MIRA
Dissolution Authority

Date Submitted: March 10, 2025

The South Meadows Redevelopment Considerations Study

Weston & Sampson℠
NAES ADMINISTRATIVE SERVICES
westonandsampson.com
712 Brook Street, Suite 103, Rocky Hill, CT 06067

ACKNOWLEDGMENTS

MIRA Dissolution Authority

Bert Hunter, Board Chairperson

William Beccaro, Board Director

Mark Daley, President

Christopher Shepard, PE, Environmental Compliance Manager

Weston & Sampson Engineers, Inc.

Robert Carr, PE, LEP, Senior Technical Leader

Malcolm Beeler, LEP, Senior Technical Leader

Paul Uzgiris, PE, Senior Team Leader

Susan Mara, Planning Team Leader

Craig Miner, Team Leader

Caleb Pettigrew, Environmental Scientist

Joanna Nadeau, Public Outreach Technical Specialist

Jeffrey Willson, LEP, Technical Leader

Paul Boison, LEP, Technical Specialist

Eagle Environmental, Inc.

Peter Folino, Principal

Led By Us & Associates, LLC

Kelvin Ayala, Principal

Natalie Pryce, Principal

Simpson, Gumpertz & Heger, Inc.

Justin Dominguez, PE, P.Eng (BC), Project Manager

Tetra Tech, Inc.

David Braungardt, Project Manager Industrial Hygiene and Safety

Raymond Leung, P.Eng., Director of Engineering Energy Transmission Group

APPENDIX A

COMMENTS AND QUESTIONS
FAQ SHEET

South Meadows Study

MIRA Dissolution Authority

Weston & Sampson℠

Site History

1920s — Originally developed and operated as a coal fired power plant in the 1920s.

1940s — Converted to petroleum fuels by the 1940s.

1970s — Oil-fired power plant retired and site mothballed in mid-1970s.

1980s — Redeveloped for waste combustion (Resource Recovery Facility) in early 1980s.

2001 — Entire 80-acre site (waste processing facility, power block and electric generating facility) acquired by CRRA in 2001 pursuant to CT Transfer Act.

2001 - 2020 — CRRA and its successors led investigation and remediation to industrial/commercial standards.

2022 — Shutdown, Eversource maintains ~14 acres of easements on the property for electricity transmission and distribution (still active – part of the regional power supply grid).

2024 — Current Redevelopment Considerations Study: evaluating potential future uses and attaching costs, per Public Act 23-170.

?

Resource Recovery Facility Shut Down and Closure

- **The Facility was shut down in July 2022** when it stopped receiving and combusting waste.
- **Waste and ash residue** was broom cleaned, equipment fluids, radioactive measuring devices and bag house filter bags removed and properly disposed off-site, and boilers explosive–blast cleaned.
- **A *Closure Plan*** for the Resource Recovery Facility was originally submitted to DEEP in May 2022.
- **The initial *Closure Plan* called for** additional removal of commercial chemical products, draining and sealing of tanks and vessels, more extensive cleaning of equipment and building surfaces and storm water drainage systems, sealing floor drains, cleaning the coal pond, cleaning and dismantling the duct work that runs from the waste processing to the power block, sealing the cooling water intake and discharge pipes, and removing lamps, batteries and smoke detectors.
- **No building demolition was proposed** in the initial Closure Plan.
- **The *Closure Plan* has been through several rounds of comments** from DEEP and responses by the Authority.
- **Final approval of the Closure Plan** will now be held, pending the findings of the ***South Meadows Redevelopment Considerations Study.***
- **In the interim,** the Authority may proceed with removal and recycling of non-structural equipment.

Ongoing Remediation to Commercial / Industrial Standard

- **Transfer act triggered environmental investigation and remediation** to commercial / industrial standards.
- **Thousands of soils samples taken** and 44 areas of concern identified.
- **Site went through 12 years of active remediation including:**
  - Removal and proper off-site disposal of 60,000 tons of impacted soil
  - Pumping and treatment of ground water
  - Installation of engineered controls
  - Imposition of deed restrictions and environmental land use restrictions
- **A *Verification Report*** (that the remediation was complete) was submitted to DEEP June 2018, but rejected by DEEP in June 2019 after additional contaminants discovered in one area of concern.
- **Additional remediation** was completed in October 2023.
- **An updated Verification Report** submission to DEEP is scheduled for the fall of 2024.
- **Once the Verification Report is accepted by DEEP** the remediation of the Site to Commercial / Industrial standards is deemed complete.

Estudio de South Meadows

MIRA Dissolution Authority

Weston & Sampson℠

Historia del Sitio

1920s — Desarrollada y explotada originalmente como central eléctrica a carbón en los años 20.

1940s — Convirtió al petróleo por los años 40.

1970s — A mitad de los años 70, retiró la central eléctrica de petróleo y dejó en suspenso su actividad.

1980s — Remodelada para la combustión de residuos (Instalación de Recuperación de Recursos) a principios de los años 80.

2001 — La totalidad del sitio de 80 acres (instalación de tratamiento de residuos, bloque de energía e instalación de generación eléctrica) fue adquirida por el CRRA en 2001 conforme a la Ley de Transferencia de CT.

2001 - 2020 — El CRRA y sus sucesores dirigieron la investigación y la descontaminación según las normas industriales/comerciales.

2022 — Cerrado, Eversource mantiene ~14 acres de servidumbres en la propiedad para la transmisión y distribución de electricidad (aún activa - parte de la red regional de suministro eléctrico).

2024 — Estudio de las Consideraciones Actuales de Renovación: evaluación de los posibles usos futuros y fijación de los costes, según la Ley Pública 23-170.

?

Cierre y clausura de la Planta de Recuperación de Recursos

- **La instalación se cerró en julio de 2022,** cuando dejó de recibir y quemar residuos.
- Se limpiaron **los residuos y cenizas** con una escoba, se sacaron los fluidos de los equipos, los dispositivos de medición radiactiva y las bolsas de filtro de la cámara de filtros de la instalación y se eliminaron adecuadamente fuera del emplazamiento, y se limpiaron las calderas con explosivos.
- En mayo de 2022 se presentó al DEEP un **Plan de Cierre** inicial para la Instalación de Recuperación de Recursos.
- **El Plan de Cierre inicial** exigía la retirada adicional de productos químicos comerciales, el vaciado y sellado de tanques y recipientes, una limpieza más exhaustiva de las superficies de los equipos y edificios y de los sistemas de drenaje de aguas pluviales, el sellado de los desagües del suelo, la limpieza del estanque de carbón, la limpieza y el desmantelamiento de los conductos que van desde el procesamiento de residuos hasta el bloque de potencia, el sellado de las tuberías de entrada y descarga de agua de refrigeración, y la extracción de lámparas, baterías y detectores de humo.
- En el Plan de Cierre inicial **no se proponía la demolición de ningún edificio.**
- **El Plan de Cierre ha pasado por varias rondas de comentarios** por parte del DEEP y de respuestas por parte de la Autoridad.
- **La aprobación definitiva del Plan de Cierre** se aplazará ahora, a la espera de las conclusiones del ***Estudio de Consideraciones sobre la Reurbanización de South Meadows.***
- **Mientras tanto,** la Autoridad podrá proceder a la extracción y reciclaje de los equipos no estructurales.

Remediación en curso para cumplir con las normas comerciales / industriales

- **El acto de transferencia desencadenó la investigación ambiental y la remediación** a las normas comerciales / industriales.
- **Se tomaron miles de muestras de suelo** y se identificaron 44 zonas preocupantes.
- **El emplazamiento pasó por 12 años de rehabilitación activa. Incluyó:**
  - Extracción y eliminación de 60.000 toneladas de tierra contaminada.
  - Bombeo y tratamiento de agua subterránea
  - Instalación de controles técnicos
  - Imposición de restricciones de escrituración y restricciones de uso de la tierra con fines medioambientales
- Se entregó un **Informe de Verificación** (que la remediación estaba completa) al DEEP en junio de 2018, pero fue rechazado por el DEEP en junio de 2019 después de que se descubrieran contaminantes adicionales en un área de preocupación.
- Se completó unas **reparaciones adicionales** en octubre de 2023.
- La entregada de un **Informe de Verificación actualizado** al DEEP está prevista para el otoño de 2024.
- **Una vez que el DEEP acepte el Informe de Verificación,** se considerará que se ha completado la rehabilitación del emplazamiento a las normas comerciales e industriales.

COMMUNITY MEETING

SOUTH MEADOWS REDEVELOPMENT STUDY

DID YOU KNOW? THE SOUTH MEADOWS TRASH TO ENERGY PLANT *CEASED OPERATIONS ON JULY 19, 2022.*

JOIN US! LEARN ABOUT THIS CRITICAL NEXT PHASE AND BE PART OF THE CONVERSATION FOR A COMMUNITY DRIVEN PLAN.

MIRA
Dissolution Authority

TAKE OUR SURVEY

TUESDAY, JULY 23, 2024

5:30PM - 7:30PM | METZNER COMMUNITY CENTER
60 FRANKLIN AVENUE, HARTFORD, CT.

zoom

OPEN TO THE PUBLIC

LITE REFRESHMENTS PROVIDED

JOIN VIRTUALLY

PUBLIC ZOOM LINK: HTTPS://BIT.LY/3XNM1FV

FOR MORE INFORMATION: WWW.CTMIRA.ORG 203-514-0856

South Meadows Redevelopment Considerations Study

Frequently Asked Questions (FAQs)

General Project Questions:

What is the South Meadows Redevelopment Considerations Study?

The South Meadows Redevelopment Considerations Study is studying the shuttered Materials Innovation and Recycling Authority (MIRA) facilities located at 300 Maxim Road in Hartford and 100 Reserve Road in Hartford, located on the west side of the Connecticut River, next to Brainard Airport. Part of the mission of the MIRA Dissolution Authority is to identify the immediate environmental needs and knowledge necessary for future redevelopment of the Authority's properties at these South Meadows sites. The Authority has hired a technical team led by Weston & Sampson Engineers, Inc. to evaluate the environmental conditions of the site.

What is the goal of this Study?

The South Meadows Redevelopment Considerations Study aims to determine the work and costs for environmental remediation necessary to arrive at a starting point for a number of potential future Site uses.

When will the study be completed?

The draft results of the study will be available for public comment in January 2025, and this Study is scheduled to be completed in February 2025.

Who is involved in this project?

- **MDA (MIRA Dissolution Authority)** - created by the State of Connecticut effective July 1, 2023. Replaces the Materials Innovation and Recycling Authority (MIRA). Responsible for submitting and implementing closure plan for the facility and winding down all of MIRA's operations.
- **Weston & Sampson** – Engineering consultant contracted by MDA to conduct South Meadows Redevelopment Considerations Study.
- **State of Connecticut** - Upon conclusion of the dissolution process, anticipated as early as July 1, 2025, but not later than July 1, 2026, any remaining rights, real or personal property of the MIRA Dissolution Authority will pass to and vest in the State of Connecticut through the Department of Administrative Services (DAS).
- **Connecticut Department of Energy and Environmental Protection (DEEP)** – responsible regulator for reviewing and approving the Closure Plan, including the issuance of related environmental permits, as well as reviewing the Verification Report that confirms the site has been remediated to industrial/commercial standards.
- **Other key stakeholders** are the U.S. Army Corps, Greater Hartford Flood Commission, City of Hartford, and Eversource.

What does the study entail?

The study will gather and evaluate site information to identify potential needs to fill in knowledge gaps required for proper redevelopment.

The study has the following tasks:

- Review existing environmental information on the site
- Perform a Hazardous Building Materials Survey – asbestos, lead based paint, PCBs, mercury
- Review and document condition of flood control system and develop site-specific operation, inspection, and maintenance plan
- Review infrastructure, permitting, easements and other physical conditions that could impact future uses

What will be the result of this study?

- Identification of gaps of knowledge about the environmental and site infrastructure (e.g. flood control, site drainage, easements) needed to inform future use scenarios
- Understanding of site constraints
- Scale of costs to prepare the Site for future redevelopment options
- Understanding of the funds needed to finish remediation and prep for future uses
- A written report to the MDA and CT Legislature

Site History

What is the history of this site?

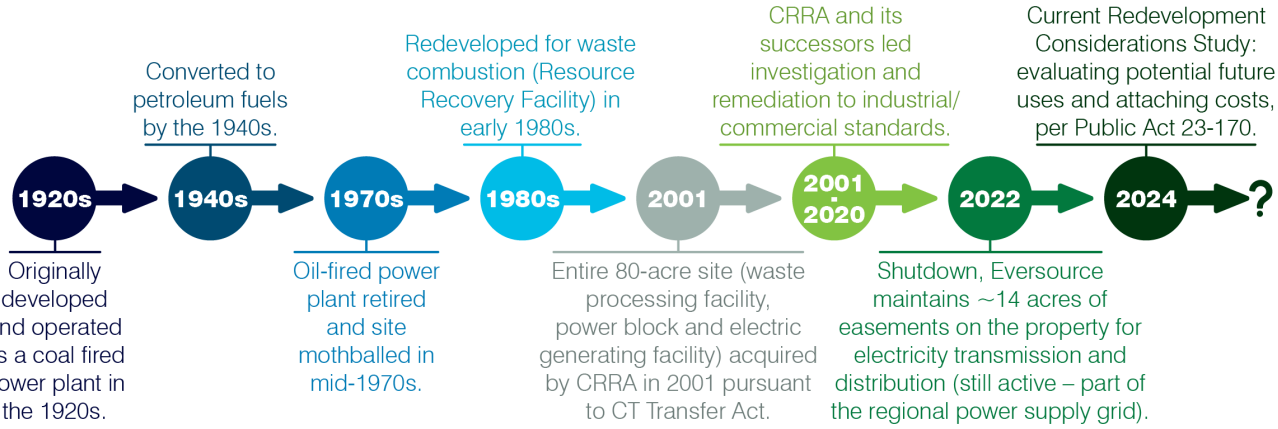

Why did the plant close?

Due to the age of the facility and repeated breakdowns of critical equipment, the decision was made to close the plant. The Resource Recovery Facility stopped receiving waste deliveries, and processing waste into “refuse derived fuel”, on July 11, 2022. Combustion of waste stopped on July 19, 2022, and the final shipment of ash left the facility on August 5, 2022. Since then, the site buildings have been “broom” cleaned. The adjacent Jet Turbine Facility was then shut down effective May 31, 2023.

How long will it take to clean up the site?

There have been many years of investigation and remediation completed between 2001 and now to achieve industrial/commercial standards. A verification report will be submitted with anticipated approval by DEEP next year.

Environmental and Health Concerns

What are the major contaminants existing on the site that needed to be cleaned up?

Contaminants in soil include PCBs, metals (primarily arsenic) and some petroleum products. These contaminants were present before the resource recovery facility was developed, and have been remediated to CT industrial/commercial standards.

Are there coal ponds on the site?

Yes, there is a lined coal storage area with a lined stormwater collection pond on the property.

Is there a risk to the neighborhood from contaminants present on site?

There is minimal risk to the adjacent properties. The contaminants of concern in soil are covered and inaccessible, preventing human exposure. The site is currently vacant, except for MDA offices and Eversource activities in its on-site substation, and access to the property is limited by fencing and locked gates. The site buildings are also secured to prevent unauthorized access.

What is being done to address environmental impacts from development of this site?

The Redevelopment Considerations Study is the first step to redevelopment of the property that will include a remediation plan for the site.

Future Development

What activities are permitted at the site now?

The site is currently zoned for industrial uses and permitted for solid waste handling and management. The site is no longer permitted as a waste-to-energy facility.

Is there an opportunity for renewable energy activities here in the future?

Possibly. Electrical infrastructure such as transformers and transmission lines are on the site and part of the regional electrical grid to support uses such as solar, wind, and water power.

Where would funding come from for redevelopment?

The MDA currently has over $50M in reserve funding that could be potentially used for site remediation and redevelopment efforts, and MDA's other wind-down activities. Other potential funding sources would include private investment and the State of Connecticut.

What uses are being evaluated for this site in the Study?

Four general types of uses are being evaluated:

- Industrial / commercial uses including any activity related to the commercial production, distribution, manufacture or sale of goods or services.
- Residential uses, including residences and outdoor recreation.
- A mix of commercial and residential uses.
- Existing permitted use as a solid waste handling/management facility.

This Study will document existing environmental conditions, conceptual site considerations, potential future uses and the environmental needs and knowledge necessary for potential future uses.

Who or what entity will make final determination of site redevelopment?

The MDA is scheduled to be dissolved by July 1, 2025. After that date, the State of CT will take over all former MDA assets, including the South Meadows property. Future site redevelopment will likely be decided by the State of CT.

Other General Questions / Public Comment Opportunities

How can the public submit their comments regarding the project?

The general public can submit their comments regarding the project by using the following comment form: Considerations Study Comment Form (https://forms.gle/gU4pSu2XtjwQFGB2A). Please be sure to give your contact information if you require a response to your comments or concerns.

Where should the public go to learn more information?

Detailed project information can be found on MDA's Website, which includes past presentations, videos, and downloads. Please visit ctmira.org/home/south-meadows-redevelopment-considerations-study

What is the planned schedule of public meetings?

There are two additional public meetings that will be advertised and held for this project. Our next public meeting will be held on *Tuesday, November 12, 2024*, at the Metzner Community Center, 680 Franklin Avenue in Hartford. The primary objectives of the November meeting are to share findings of samples collected from site buildings, and provide an overview of current site conditions, infrastructure, redevelopment opportunities and constraints. Our final public meeting will be held in early 2025 to present the findings of the full Redevelopment Considerations Study.

How will public meetings be advertised in the future?

Public meetings will be publicly noticed, and meetings will be advertised through an identified network of community stakeholders, environmental organizations, neighborhood revitalization zone (NRZ) groups, and the City's Department of Community Engagement. Flyers will be circulated within the community and posted in public locations such as libraries and civic buildings. Digital media will be shared through social media pages of environmental and sustainability groups for organic traction. We have also relied on elected officials from the City of Hartford to share with constituents and participate within the process. Finally, traditional print media such as "The Hartford News" and community radio such as "89.9 Qute FM" are also being utilized.

APPENDIX B

STAKEHOLDERS SUMMARIES

Riverfront Recapture manages, operates and maintains four connected parks encompassing 148 acres along the Connecticut River: Mortensen Riverfront Plaza, Charter Oak Landing and Riverside Park in Hartford and Great River Park in East Hartford. The Vision of Riverfront Recapture revolves around 4 themes: Recreation, Job creation, Housing, and Events/Space activation. By stitching access to the water's edge and joining continuous nodes, the spirit of bringing quality recreational activities along the waterfront for residents and visitors to enjoy is a priority. Once fully completed, Riverwalk will reconnect the local communities to the river through a continuous, accessible, multi-use path system extending from the north at Riverside Park south to Charter Oak Landing.

Current Projects:

- Feasibility study for the Hartford to Wethersfield Riverwalk
- 60 Acre Community Park with 10 acre Commercial mix use development on Hartford/Windsor line
    - Currently, plans for the property include the creation of "Garmany Cove," a nine-acre inlet where Riverfront Recapture plans to install a paddle sports and outdoor center, with rowing, kayaking, canoeing, dragon boating and stand-up paddle boarding all available.

Primary Contact: Michael Zaleski, CEO & President / MZaleski@Riverfront.org

Stakeholder Analysis:
Per our interview, the leadership is extremely vested in the future potential uses of the MIRA site. They have a stated goal to continue the connection with Charter Oak Landing park which abuts the area of study. They have shown capacity to manage improvement projects and per the leadership expressed an interest in being part of the collaborative effort to revitalize the site. They are willing to be part of any public private partnership that may arise or even have discussions with CT's DAS department on future stewardship. For obvious reasons, Riverfront Recapture envisions waterfront access through recreational activities such as biking and walking trails but is open to seeing a mix of uses with potential residential on the site.

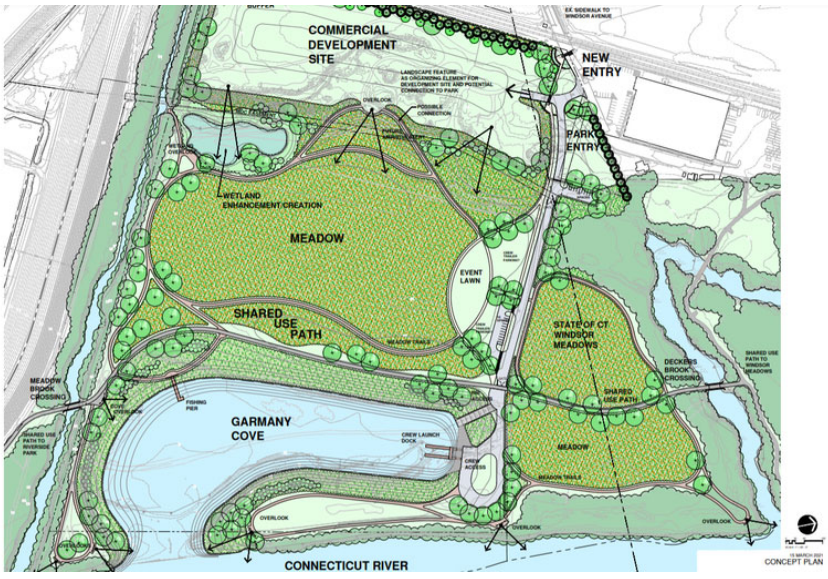

Key Takeaways:
The amount of time it will take to achieve an implementation plan for the site. What level of site remediation will be committed to and the funding sources to mitigate costs that lead to potential future reuses. Based on current work and goals, this parcel is one of the final pieces for connecting the proposed riverwalk from its original 1982 master plan. What impact does the I91/I84 realignment outlined in the "Hartford 400" plan was cited as a concern. They have a strong desire to be part of the collaborative team and stewardship of this parcel's redevelopment. Based on team capacity and experience on the river, this should be a welcomed approach.

The Capital Region Development Authority was established in 2012 with a mission to stimulate new investment, rebrand and promote the district as a multicultural destination for all ages to enjoy and as a vibrant multidimensional downtown. Other initiatives include expanding residential housing development while stimulating the tourism, art, culture, history, education,and entertainment of the downtown core. In 2019, CRDA took over ownership of the Connecticut Regional Market expanding its interest to South Meadows

.

The Market is a 33-acre facility with over 185,000 square feet of warehouse and refrigerated space located at 101 Reserve Road in Hartford. It is the largest perishable food distribution facility between New York and Boston consisting of four distribution/warehouse buildings, one free-standing restaurant, office space dedicated to real estate management, Department of Agriculture (DoAg) and related federal agricultural services, and a farmers' market pavilion. While promoting Connecticut Agriculture, the Market serves a dual customer goal by providing a facility for both retail and wholesale trade. At present, approximately 20 tenants are employing approximately 450 persons at the facility daily.

Completed Projects: Proposed Redevelopment concept of CT. Regional Market

Primary Contact: Michael Freimuth - Executive Director / mfreimuth@crdact.net

Stakeholder Analysis: CRDA has been paying attention to developments in the South Meadows area as it aligns with its work revolving around future investments and expansion of the Regional Market. About 4-5 years ago there were discussions with MIRA regarding acquisition of up to 20 acres of the MIRA prosperity for development of a distribution hub for Sysco Corporation, the Market's largest client. Renovation of existing facilities does not resolve the need for expansion and the energy production necessary for an expanded campus.

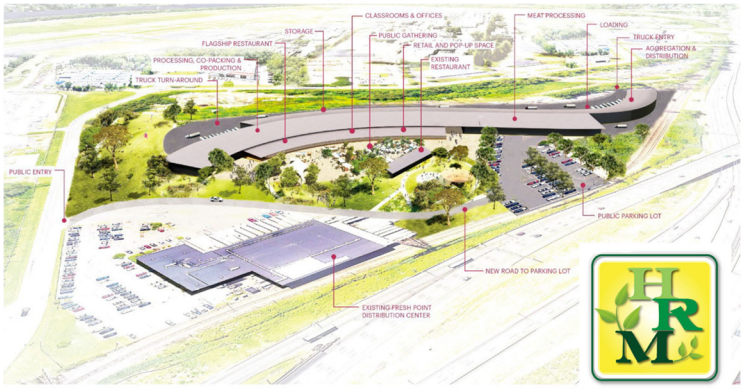

Key Takeaways: CRDA is keenly aware of the environmental concerns of redevelopment in South Meadows and the strain of prioritization of state tax dollars for this project and others in the immediate area. They suggest it needs a collaborative approach that master plans the area considering the state's position on the future of Brainard Airport, the Regional Market, and now the MIRA site. It is the opinion of CRDA that the highest and best use is an industrial/commercial use in the form of warehousing and other potential campus uses that ignite job creation and other industry sectors that can benefit from clustering in South Meadows. They also cautioned to be aware of the railroad tracks that are still being utilized in South Meadows for the movement of goods from the market. The state DOT may also need to weigh in on potential redevelopment due to the rail infrastructure. They do not oppose some recreational uses or access to the water's edge but would caution that residential use could prove costly without necessary infrastructure and amenities to accommodate a new neighborhood. CRDA feels that kind of effort would take away from the support downtown needs to maintain its residential mix and sustained growth there.

Goodwin University has proposed a master plan to expand its campus with an economic impact along the river inclusive of a hotel, marina, residential housing and other mix uses. This development is complementary to East Hartford development goals and brings amenities in closer proximity to the university's campus and regional magnet schools. They have a vested interest in what happens across the river due to environmental concerns and aesthetics. The view matters as potential redevelopment will benefit from the synergy of key developments along the river.

Current Projects:

- Proposed STEM based magnet school with focus on space exploration and astronaut training
- Hotel/Marina/Housing project - Currently put on hold due to rising costs and market demand

Primary Contact: Todd Andrews /SR Vice President / TAndrews@goodwin.edu/

Stakeholder Analysis: The facilities and development team at Goodwin University benefit externally from the potential redevelopment of the MDA site.. It would make access to capital for other projects easier to obtain, increase visibility and synergy, and bring new excitement to the waterfront. Goodwin did go through the regulatory process and federal approvals to move forward with a 32 slip marina however due to Covid and change in market forces, bid prices were simply not feasible as a stand alone project. The decision was made that any Marina project must be complemented by a variety of mixed uses. They do feel that recreational activity is a win and should be included in any redevelopment of the site. They also expressed concern about its substation in East Hartford and what connectivity it has to the Eversource assets across the water on the MDA site.

Key Takeaways: In regards to redevelopment, they shared that the FAA approval process for permits can be daunting and time consuming. If Brainard Airport will continue to serve the region or expand, potential redevelopment will have height restriction and a tedious permitting process. They also shared that the presence of eagles in the area added steps to potential redevelopment from DEEP, and the waterways are littered with fresh water mussels. Redevelopment of the site may require an action plan to deal with the ecological impact of redirecting currents in the water and natural habitats for native species of various shellfish. This information was shared just to highlight complexities of redevelopment and added expenses that could potentially be incurred beyond physical site remediation.

Eversource is responsible for providing safe, sustainable, and reliable distributed electrical power throughout the Greater Hartford Region. They are responsible for the local electric utility infrastructure and maintenance of critical infrastructure, uniquely positioning themselves as a critical partner to any large scale redevelopment projects. Their transmission and distribution network is essential to energizing any project and they have been intimately embedded into the South Meadows ecosystem overseeing 2 sub stations on the MDA site.

Current Projects:

- Underground Cable Modernization program - Replacement of 115kv transmission lines
  - Mitigates risk of lines approaching end of life reliability
  - Reduces risk of unplanned outages and emergency repairs
  - The 1704 underground transmission line runs from the Southwest Hartford substation to South Meadow substation.

Primary Contact: Patrice Tyrie - Project Services Manager / patrice.tyrie@eversource.com

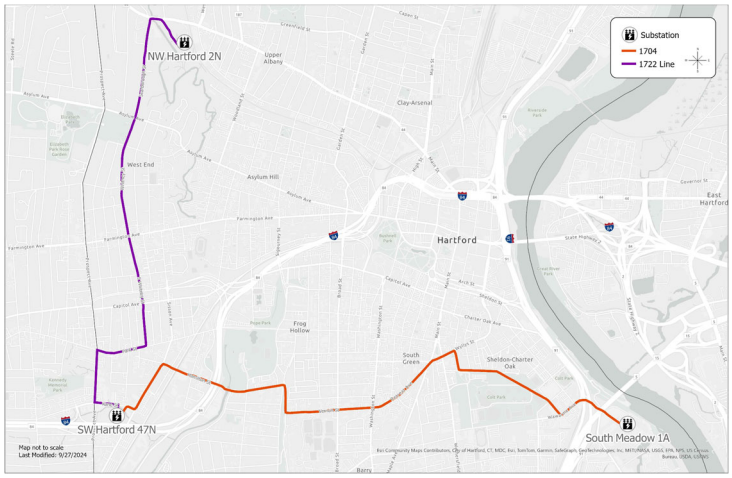

Stakeholder Analysis: Eversource currently maintains an easement on the MDA 83 acre site to maintain its substations and transmission line infrastructure critical to serving the region. One of the key points of the study was to engage Eversource on some sort of financial analysis on the potential costs to move the substation to another location and decommission from the current location in South Meadows. Understanding the importance of this transmission network and the associated costs to remove are important for future redevelopment evaluation.

Key Takeaways:

Eversource is keenly aware of its role in any potential redevelopment of the site and is looking forward to the process of engaging actual redevelopment proposals. In the meantime, they understand the level of site remediation necessary will be dependent on selected final use. They will address any obstacles that may arise over time based on their assets and rights of way currently in place. They are understanding of pursuing a collaborative approach to any future economic development based activities on the site and are positive they can assist constructively and remove any barriers of entry along the way. Their goal is to support critical utility infrastructure investment and reliable energy for the capital region. They will continue an evaluation and financial projection report on costs to remove and relocate existing substation and infrastructure. Although likely not financially feasible, it is important to understand these costs to achieve highest and best use of the property.

The Urban League of Greater Hartford (ULGH) is rooted in fighting for equal opportunities and against the injustice of discrimination. Their programs and services have helped Hartford area residents overcome barriers to achieve their life goals. They believe in promoting racial equity through economic empowerment and financial literacy. Locally the Urban League is involved in social and economic causes such as tackling food insecurity, education, social justice, adequate housing, along with health and wellness. This local branch also has a community development corporation that is involved in workforce development initiatives and real estate development.

Primary Contact: David Hopkins - President & CEO / dhopkins@ulgh.org

Stakeholder Analysis: ULGH has a long standing relationship with the communities throughout the city of Hartford and can serve as a key cog in disseminating information. They have also expressed the desire in being involved in a community benefits agreement for South Meadows that addresses serving the people of Hartford who suffered the impacts of environmental injustice from the operations of the trash to energy plant. This is an organization that has shown capacity and a desire to get involved and share its vast network to share information, obtain community buy-in, and secure opportunities for the betterment of city residents.

Key Takeaways: The Urban League's potential involvement in South Meadows site redevelopment was discussed. From a community development perspective, they want to ensure that Hartford residents are at the forefront for any job and housing opportunities. There was creative discussion revolving around potential uses and one topic that came up was disaster recovery. The city is in need of an emergency response center that provides wrap-around services for individuals dealing with life crises such as displacement due to a fire. Other thoughts that were discussed include:

- Leveraging Urban League's brand for grant applications as a non profit fiduciary
- Utilizing CDC for social enterprises and community control
- Partnering with energy companies on environmental justice initiatives
- Urban League's position to advocate for community benefits and economic empowerment
- Focus on workforce development, housing, and disaster recovery
- Importance of community involvement and information flow
- Opportunity to represent marginalized communities in decision-making process

The Center for Leadership and Justice (CLJ) was established out of concern for the plight of the poor and new immigrants in Hartford. Over the years, they have created numerous nonprofit organizations, established the first kindergarten in Hartford, started the Newington Children's Hospital, established mission centers, built a congregate home for the elderly, played a pivotal role in the effort to obtain universal healthcare in Connecticut, and created over 200 units of affordable housing. CLJ develops and organizes leaders in neighborhood-based and multi-faith alliances to build power and act collectively for systemic change toward social, racial, and economic justice. In 2016, the Greater Hartford Interfaith Alliance (GHIAA) was established with 38 faith based institutions. The goal was to build a diverse organization of lay leaders and clergy from across the bounds of race, class, gender identity, religion and geography to build relational power to address justice issues in local communities and beyond.

Primary Contact: Sarah McCoy - Lead Organizer for GHIAA /smccoy@cljct.org

Stakeholder Analysis: GHIAA has taken up environmental justice issues as a primary cause of its organization. They have been in constant contact with MIRA to address community concerns. GHIAA has organized against any potential waste handling use in the future and has been adamant that attention now needs to be turned over to the people of Hartford who have borne the negative impacts and health effects of living near the trash management station for decades. GHIAA emphasized two main points: no more trash processing on the site and using the projected $60 million for an environmental justice fund. They argued that remediation should include addressing public health harms to the community, not just cleaning up the physical site

Key Takeaways:
This Interview was well attended by over 18 members of the organization and one key theme arose. The definition of remediation should be expanded to include impacts on Hartford residents beyond just the 80-acre site. Their concern here is that all emphasis of cleanup has been on the physical site but no restorative justice campaign or separate fund to promote health and well being in Hartford neighborhoods that suffered desperate impacts of the plant. Examples could be environmental justice grants, tackling air quality and noise pollution, green spaces, health clinics for those suffering respiratory diseases. As an organization, they want to ensure community engagement and outreach remains a priority regarding any potential redevelopment. They have highlighted two absolute points in their advocacy.

- Absolutely no more trash processing as a future use on that site. Hartford has done its share for the region for decades
- Ensure funding be set aside to promote health and wellness objectives such as a study to address asthma and other pulmonary diseases for Hartford residents. This environmental justice fund should be accessible to all Hartford neighborhoods to improve quality of life and opportunities for all residents due to the environmental impacts of the MDA site.

Hartford NEXT (HNXT) is the coalition of all Hartford's Neighborhood Revitalization Zones (NRZ's) in the City of Hartford. The city of Hartford comprises thirteen (13) unique NRZ's all with local leadership and community focused on concerns that impacts everyone's prosperity. HNXT serves as the collective voice of Hartford residents and stakeholders working to strengthen and grow the Hartford community. Through the Neighborhood Training Institute (NTI), HNXT provides programs to educate and empower the community. NRZs across the State of Connecticut were created through a 1995 Act of the Connecticut State Legislature for the purpose of improving the quality of life of residents by giving the NRZs resources to address blighted properties and revitalization efforts..

Primary Contact: Marion Griffin - Technical Organizer / hnxt@hartfordNEXT.org

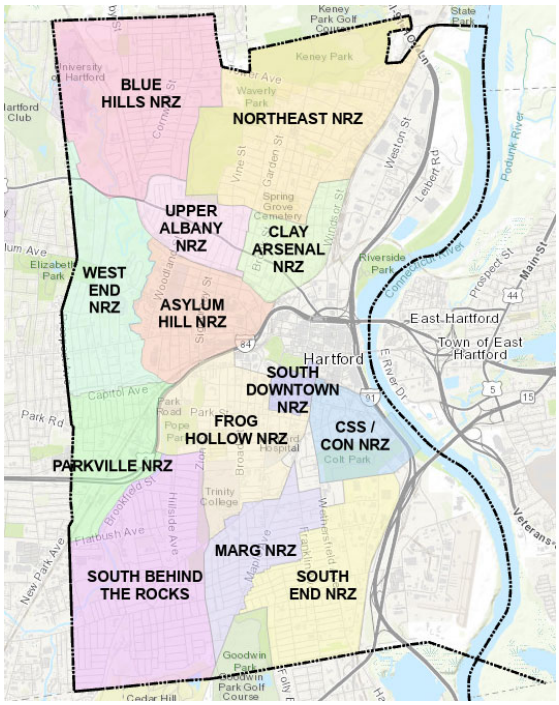

Stakeholder Analysis: NRZ have become a critical component of community engagement when it comes to economic development projects in the city. They have been a voice of advocacy to address community concerns and to ensure that development projects address community needs and not just the vision proposed by real estate developers or city planners. The South End NRZ and Sheldon/Charter Oak NRZ immediately abut South Meadows and have been very vocal throughout the engagement of the study. Now all NRZ's city wide have been noticed on the study and have taken particular interest in potential site redevelopment and opportunities it may afford for Hartford residents.

Key Takeways: Many members expressed frustration with the MDA website and found it cumbersome to find immediate information to keep up with potential site redevelopment. It was recommended that a consistent and updated timeline be managed to showcase milestones in current and future studies. Community involvement in any future site planning is a must. When asked about recommended uses, recreation opportunities scored high but also the consideration of renewable energy, an expanded regional market, and public waterfront access in future plans. Potential housing was discussed, but questions arose regarding noise pollution from nearby airport, access to amenities, isolated pocket neighborhood, and costs of development removing any affordable access to adequate housing for Hartford residents to benefit. Recommended to focus on job creation opportunities in south meadows. Finally, extreme concerns over the site remediation process and potential of airborne toxins or other impacts of cleanup once again impacting air quality at the expense of Hartford residents.

As part of the stakeholder interviews we included the economic and community development departments of the city of Hartford. It has long been documented the city has wanted to see progress on the closure plan that was presented to the state and have stayed in communication with MDA regarding wind down efforts. The Hartford flood commission has been significantly involved to ensure that the site is dealt with responsibility in regard to coastal flooding and resilience. The economic development office is responsible for improving quality of life through meaningful administration of infrastructure and real estate development projects that create value for its communities. The biggest concern for the city of Hartford has always been to seek best and highest use of Hartford properties that can increase the tax base and produce direct benefits in the city.

Primary Contact: Patrick Pentalow - Economic Development Director / Patrick.Pentalow@hartford.gov

Stakeholder Analysis: The team at the economic development office has been keeping a close out on closeout activities including this redevelopment consideration study. Completion of remediation, shutdown and closure activities enables a redevelopment of the South Meadows site for industrial / commercial uses within existing building footprints without significant additional soil or groundwater remediation. Industrial / commercial uses would include any activity related to the commercial production, distribution, manufacture or sale of goods, services, or any other activity which is not a residential activity. Redevelopment for residential uses would require additional potentially significant measures. Residential uses would include a residence, dwelling, house, apartment, condo, nursing home, dorm, school, day care, outdoor recreation or hospital. Of particular interest to the city of Hartford, is oversight and management of the potential $55 Million dollars set aside for site remediation and redevelopment activities.

Key takeaways: The City of Hartford wants to play a key role in any disposition, public private partnership, or other land management administration of the site once in receivership of the state Department of Administrative Services. They are adamant in administering the dollars of the fund towards cleanup and site remediation activities. They are primarily concerned with seeking immediate opportunities to repurpose the area complimentary to commercial activity in the area that supports highest and best use. They look forward to the next phase of visioning, design, and intentful reclamation of this significant property for revitalization. On behalf of the city of Hartford, this department is prepared to take on an administrative role to manage the complexities in the next phase and potential redevelopment phase in collaboration with all stakeholders and state/federal regulatory approvals.

APPENDIX C

HAZARDOUS BUILDING MATERIALS INSPECTION

EAGLE Environmental, Inc.

- **Industrial Hygiene / IAQ**
- **Hazardous Building Materials**
- **Environmental Assessments**
- **Laboratory Services & Training**

November 20, 2024

Mr. Robert Carr
Senior Technical Leader
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, Connecticut 06067

RE: Hazardous Building Materials Inspection Report
MIRA Resource Recovery Facility and Jet Turbine Facility
300 Maxim Road and 100 Reserve Road
Hartford, Connecticut
Eagle Project No. 24-138.10T1

Dear Mr. Carr:

Please find the report for the Hazardous Building Materials Inspection (HBMI) conducted at the Materials Innovation and Recycling Authority (MIRA) Resource Recovery Facility and Jet Turbine Facility located at 300 Maxim Road and 100 Reserve Road in Hartford, CT (the "Site"). The HBMI was performed as a component of the overall South Meadows Redevelopment Considerations Study (the "Study") for the Site. The HBMI included asbestos-containing materials, lead-based paint, universal waste materials and Other Hazardous Materials (OHMs) within the existing Site buildings. Testing for Polychlorinated Biphenyls (PCBs) in building materials was performed directly by Weston & Sampson Engineers, Inc. (W&S) and is not a component of this report. The on-Site field inspection work associated with the HBMI was performed by Eagle Environmental, Inc. (Eagle) during the months of June, July, August, and September 2024.

Please do not hesitate to contact us if you have any questions regarding the contents of this report.

Sincerely,
Eagle Environmental, Inc.

Report Prepared By:

Angelo Folino
Environmental Consultant
Asbestos Inspector/Management Planner (#000366)

Nicholas Mussen
Environmental Consultant
Lead Inspector (#002291)

Report Reviewed By:

Peter J. Folino
President
Asbestos Inspector/Management Planner (#000184)
Asbestos Project Designer (#000195)
Lead Inspector/Risk Assessor (#000102)
Lead Planner Designer (#0001047)

Z:\2024 Files\2024 Reports\Weston & Sampson\MIRA\HBMI Inspection\Report\MIRA HBMI Report.doc

TABLE OF CONTENTS

PAGE

1. EXECUTIVE SUMMARY 1-3

2. INTRODUCTION 4-5

3. REGULATORY GUIDELINES AND REQUIREMENTS 6-7

4. SCOPE OF SERVICES 8-9

5. SITE AND BUILDING DESCRIPTIONS 10-16

6. ASBESTOS CONTAINING MATERIALS 17-29

7. LEAD PAINT 30-38

8. UNIVERSAL WASTE MATERIALS AND OTHER HAZARDOUS MATERIALS 39-45

LIST OF TABLES

Table I	Asbestos-Containing Materials Summary Table
Table II	Non-Asbestos-Containing Materials Summary Table
Table III	Universal Waste and Other Hazardous Materials Summary Table

APPENDICES

Appendix A	Site Plan
Appendix B	General Layout Plans and Roof Plans
Appendix C	Asbestos Bulk Sample Laboratory Reports
Appendix D	XRF Lead Paint Inspection Reports
Appendix E	Eagle Environmental Inc. Licenses and Laboratory Certificates
Appendix F	Photo Log

1. Executive Summary

This report summarizes the study-level Hazardous Building Materials Inspection (HBMI) performed by Eagle Environmental, Inc. (Eagle) at the Materials Innovation and Recycling Authority (MIRA) Resource Recovery Facility and Jet Turbine Facility in Hartford, Connecticut (the "Site"). Conducted as part of the South Meadows Redevelopment Considerations Study, the HBMI identifies and quantifies hazardous building materials (HBMs) to support environmental compliance and future redevelopment planning.

The MIRA Site spans approximately 80 acres with over sixteen (16) buildings and structures and consists of two primary operational zones:

Waste Processing Facility (WPF):

1. Constructed in the 1980s and 1990s to convert municipal solid waste into Refuse Derived Fuel (RDF).
2. Structures include the Waste Processing Building, Administrative Building, Tool Storage Building, Transfer Building, Coal Barge Unloading Building, Scale Houses, Odor Control Equipment, and Conveyors.

Power Block Facility (PBF):

1. Originally built in 1921 for coal-fired energy production, later updated with 1980s additions to support RDF combustion and energy generation.
2. Includes the Boiler House, Turbine Hall, Northeast Utilities Building, Administration Building, Jet Shop, Wheel Wash Building, and other key facilities such as ash handling and treatment structures, screen houses, and warehouses.

The inspection focused on identifying and quantifying hazardous materials within accessible areas of the Site buildings and structures, including:

1. **Asbestos-Containing Materials (ACMs):** Identified via sampling and analysis in accordance with EPA and OSHA standards.
2. **Lead-Based Paint:** Screened using X-Ray Fluorescence (XRF) devices to detect lead in painted surface coatings.
3. **Universal Waste and Other Hazardous Materials (OHMs):** Visually inspected for regulated items such as metal halide and fluorescent lamps, mercury-containing items, lamps, batteries, PCB/DEHP electrical components (excluding transformers that were previously inventoried), stored chemicals, paints, solvents, petroleum products, and refrigerants containing Chlorofluorocarbons (CFCs) or Hydrochlorofluorocarbons (HCFCs).

Excluded areas include confined spaces, inaccessible materials or areas of the buildings/structures, and materials requiring destructive testing.

The inspection was conducted between June and September 2024 and involved the collection of one-thousand five-hundred and seven (1,507) asbestos bulk samples from seven-hundred and six (706) Homogeneous Areas (HAs) or suspect ACMs for asbestos analysis, the collection of two-thousand three-hundred eighty-three (2,383) XRF lead paint readings, and visual surveys to identify universal waste and other hazardous materials.

Asbestos-Containing Materials Results Summary

From the samples one-thousand five-hundred and seven (1,507) samples collected, one-hundred twenty-two (122) HAs were confirmed to contain asbestos at or above the State of Connecticut regulated of 1% or federal regulated level of >1%, and sixty-one (61) HAs were presumed ACMs due to inaccessibility or the presence of vermiculite.
Key asbestos quantities include:

WPF:

1. Window glazing compound: Approximately eight (8) doors and seven (7) window sashes.
2. Roof flashing cement: Approximately twenty (20) sq. ft.
3. Assumed ACMs: Gaskets, adhesives, and pin tab adhesives in ductwork.

PBF:

1. Boilers 9 & 10: Interior asbestos-containing materials including insulation, liners, gaskets and presumed refractory materials.
2. Approximately 5,152 linear feet of asbestos-containing/contaminated pipe insulation.
3. Approximately eight-hundred twenty-nine (829) ACM gaskets were identified in the boiler area with several additional gaskets in other areas of the buildings.
4. Approximately twenty-four thousand (24,000) linear feet of ACM wire coatings in boiler area, Turbine Hall, and Northeast Utilities Building.
5. Approximately two-thousand one-hundred and eight (2,108) sashes with ACM window glazing compounds.
6. Approximately two thousand (2,000) linear feet of 48" diameter process water intake/discharge piping with ACM tar and felt coatings.
7. Approximately fifteen-thousand two hundred (15,200) square feet of asphaltic tar on Terracotta and clay block.
8. Interior asbestos-containing tape on turbine stators.
9. Roofing materials (flashing, tar, felts): Found across multiple buildings.
10. Expansion joints and caulks: Significant quantities throughout walls and roof structures.

Several other ACMs were identified during the inspection which are provided in the Asbestos-Containing Materials Summary Table I, included within the report.

Lead-Based Paint Testing Results

Lead-based paint was identified on limited Site components within the WPF buildings, including:

WPF:

1. Metal handrails and metal fuel piping

Lead-based paint was identified across various site components within and on the PBF buildings, including:

PBF:

1. Metal door frames, window frames, and structural steel.
2. Masonry including brick and concrete.
3. Limited wood components.

The lead-based paint screen results are provided on thirty-six (36) individual XRF lead-based paint screen reports provided in Appendix D.

Universal Waste and Other Hazardous Materials (OHMs)

The Site contains:

1. **Universal Waste Materials:** Approximately nine-thousand eight-hundred and ninety-five (9,895) linear feet of fluorescent lights, metal halide lighting, sixty-one (61) mercury ampules in thermostatic controls, six-hundred and forty-five (645) lead acid batteries (some in operational equipment) and two-hundred eighty-vie (285) aerosol cans.
2. **PCB/DEHP in Electrical Equipment:** Potentially present in approximately five-hundred and fourteen (514) older lighting ballasts and numerous capacitors in motors and electrical components.
3. **Additional OHMs:** Refrigerants in HVAC equipment and window air conditioners, stored chemicals including paints, solvents, household chemicals, and stored petroleum products.

The summary of inventoried universal waste materials and OHMs is included in Table III contained within the report.

Recommendations

1. **Hazardous Materials Abatement:**
    - Engage a licensed asbestos project designer to create detailed abatement plans.
    - Confirm presumed ACMs in inaccessible areas through additional inspection and sampling.
2. **Regulatory Compliance:**
    - Adhere to EPA, OSHA, and state regulations during abatement and redevelopment.
    - Preparation of an ACM Operations and Maintenance (O&M) Plan to provide for ongoing management of identified ACMs.
3. **Cost and Risk Management:**
    - Utilize provided cost estimates for hazardous material removal and building demolition.
    - Implement proper handling protocols to minimize environmental and worker exposure risks.

Conclusion

This report provides a detailed inventory of hazardous materials, including asbestos quantities, lead-based paint distribution, and universal waste findings. While comprehensive, additional sampling is recommended for inaccessible areas. The findings serve as a critical resource for safe, compliant redevelopment of the MIRA site. Plans and specifications for hazardous materials removal/management should be developed to support future abatement activities at the Site.

Asbestos-containing materials identified during the inspection are recommended to be managed under an ACM O&M Plan until they are eventually removed. The O&M Plan should include provisions for repairing any damaged ACMs, labeling of ACM, training and notification at minimum. The lead-based paint testing data should be used for future planning in developing a waste characterization sampling plan to support proper disposition of lead-contaminated waste materials generated during renovation or demolition of the Site buildings. The lead-based paint testing data should also be provided to contractors who may perform maintenance, renovation or demolition activities in the building to aid in compliance with the OSHA Lead in Construction Standard 29 CFR 1926.62. The universal waste materials and OHMs will require collection and containerization for proper disposal prior to renovation or demolition activities.

2. Introduction

Eagle was retained by W&S to perform an HBMI of the MIRA Site buildings located at 300 Maxim Road and 100 Reserve Road Hartford, CT (the "Site"). The HBMI was performed in general accordance with the Request for Proposals to conduct The South Meadows Redevelopment Considerations Study (the "Study) (RFP Number 24-AUTH-004) and the associated addenda. The HBMI was performed as a component of the larger Study of the Site by W&S. The purpose of the overall Study is to identify the immediate environmental needs and knowledge necessary for potential future redevelopment of the Site. The scope of the HBMI included a study-level inspection for asbestos-containing materials, lead-based paint and universal waste materials and OHMs within the interiors and on the exteriors of the Site buildings to develop testing data and information relative to HBMs to address the purpose of the Study.

The HBMI is a study-level inspection that included a comprehensive inspection of the Site buildings including accessible interior and exterior building materials for HBMs identified within the RFP. The study-level HBMI did not include inaccessible areas of the buildings or inaccessible building materials that could not be readily identified or sampled without disassembling equipment, coring through slabs and foundations, entry into confined spaces, or other means of destructive testing to locate and identify materials for testing. Inaccessible suspect asbestos-containing materials (ACMs) were assumed to be ACM for the purpose of this study.

The asbestos-containing materials inspection was performed by a State of Connecticut licensed Asbestos Inspector who completed the 24-hour US EPA Site Inspector training course. The asbestos inspection was performed in general accordance with the US EPA Asbestos Hazard Emergency Response Act (AHERA) regulation which was promulgated under the US EPA Toxic Substances Contract Act (TSCA) (Title II). The AHERA regulation provides a framework for asbestos bulk sampling and analysis and frequency of sampling depending on the type of suspect asbestos-containing material. The asbestos-containing materials inspection was performed to develop an inventory of asbestos-containing materials and non-asbestos-containing materials in and on the Site buildings. For the purpose of this report, materials containing equal to, or greater than one percent ($\geq$1%) asbestos are classified as an Asbestos-Containing Material. Asbestos includes Chrysotile, Amosite, Crocidolite, Actinolite, Anthophyllite, and Tremolite forms of asbestos minerals. Certain materials within this report are also presumed to be asbestos-containing if the inspector believed the material to be present but could not access it for sampling or if labeling of stored materials indicated them to be an ACM. Additionally, certain materials containing vermiculite are presumed to be ACM for the purpose of this report based on current US EPA recommendations. Vermiculite originating from the Libby Mine in Libby, MT may be contaminated with Tremolite-Actinolite series asbestos, often called Libby Amphibole asbestos. The Libby Mine may have produced 80 percent of the world's supply of vermiculite while in operation. Based on the US EPA recommendation, Eagle has presumed building materials containing vermiculite to be asbestos-containing.

The lead-based paint screening was performed by a State of Connecticut licensed Lead Inspector who completed the 24-Hour US EPA Lead Inspector training course and X-Ray Fluorescence (XRF) manufacturer radiation safety training course. The lead-based paint screen was performed utilizing an X-Ray Fluorescence (XRF) Radiation Monitoring Device (RMD) Lead Paint Analyzer (LPA-1). The intent of the lead-based paint screen was to evaluate surface coatings including paint, varnish, and shellac for lead. Lead-Based Paint is defined by State and Federal regulation as a surface coating containing $\geq$1.0 mg/cm^2 of lead by XRF or .5% by laboratory analysis. This definition generally applies to residential structures but was used as a threshold value for determining "high" and "low" levels of lead. The OSHA Lead in Construction Standard 29 CFR 1926.62 regulates exposure to lead in the construction industry. The OSHA

regulation currently does not define a threshold level of lead in paint that would be applicable to their regulation. OSHA considers any amount of lead to trigger compliance with the OSHA Lead in Construction Standard.

Lead may be a potential hazardous waste when characterized for disposal utilizing the Toxicity Characteristic Leachate Procedure (TCLP) method of analysis. Materials that will be disposed of in a landfill and contain lead must be characterized prior to disposal to ensure the waste stream is disposed of in an appropriate manner. Lead on metal components such as structure steel, stair systems, metal windows, etc. may be recycled at an approved recycling facility, if the waste stream contains no other potential hazardous or regulated materials. TCLP testing for waste disposal characterization was not included in Eagle's scope of services.

Eagle performed a visual inspection for universal waste materials and OHMs, which included sodium, metal halide, and mercury lamps, batteries, mercury containing equipment and aerosol cans. The OHM inspection included lighting ballasts or capacitors that could potentially contain PCBs or Di-ethylhexlpthalate (DEHP), refrigerants, e-wastes and other stored chemicals or materials that may be regulated for disposal or recycling. The universal waste materials and OHM inspection was visual in nature and did not include any sampling.

The HBM was performed in general compliance with applicable regulations governing this type of work and with a standard of care that would be considered acceptable for the professional services provided. Certain limitations are inherent with this type of work and even the most comprehensive inspection may fail to detect all hazardous building materials that may be associated with the Site buildings.

Federal Regulation

The asbestos-containing materials inspection meets the general requirements of the United States Environmental Protection Agency (US EPA) National Emissions Standard for Hazardous Air Pollutants (NESHAP) regulation 40 CFR Part 61 for a pre-renovation or pre-demolition level asbestos-containing materials inspection. The NESHAP regulation which was promulgated under the US EPA Clean Air Act (CAA) requires a facility owner or operator to perform a thorough inspection of a facility prior to renovation or demolition activities. There are no cut-off dates on construction absolving a facility owner from this requirement since certain types of asbestos-containing materials can still legally be used.

The inspection was also performed in general accordance with the US EPA AHERA regulation, which provides a regulatory framework for performing asbestos inspections in school buildings but which are often used for asbestos-containing materials inspections in non-school facilities. The AHERA regulation includes regulatory guidance including but not limited to the identification of Homogenous Areas (HA) (an area of surfacing material, thermal system insulation material, miscellaneous material that is similar in color and texture), frequency of samples per HA depending on the type of material, and accreditation requirements for inspectors and laboratories. Although the AHERA regulation is a school-based regulation which applies to schools K-8, AHERA is regularly used in the private industry in the absence of other regulations governing asbestos inspection work. The inspector and laboratory accreditation requirements found in AHERA were reauthorized to public and commercial buildings under the Asbestos School Hazard Abatement Reauthorization Act (ASHARA). Under the ASHARA Act, inspector and laboratory accreditations cited in AHERA became the standard for asbestos inspections in public and commercial buildings. The personnel and laboratories utilized to complete the inspection meet the accreditation requirements cited in AHERA which were reauthorized through the ASHARA Act.

The United States Department of Labor's Occupational Safety and Health Administration (OSHA) Asbestos in Construction Standard 29 CFR 1926.1101 regulates asbestos exposure in construction including but not limited to demolition or salvage, removal or encapsulation of materials containing asbestos, construction, maintenance, installation of products containing asbestos, asbestos spill/emergency cleanup, and transportation, storage and disposal of products containing asbestos. The OSHA Asbestos in Construction Standard also delineates the duties of building and facility owners, which includes determining the presence, location, and quantity of ACM or Presumed Asbestos-Containing Material (PACM) at each work Site.

The US EPA regulates disposal and recycling of universal waste materials including batteries, lamps, mercury-containing equipment, pesticides (unused stored pesticides), and aerosol cans under 40 CFR Part 273 Standards for Universal Wast Management. A visual inspection for universal waste materials was performed as part of the overall inspection.

State Regulations

The State of Connecticut Department of Public Health's (CT DPH) Standards for Asbestos Abatement 19a-332-1 through 19a-332a-16 contains standards for the asbestos abatement

industry but CT DPH does not have a specific set of regulations governing inspections prior to renovation or demolition activities. However, disturbance of asbestos would be a violation under the CT DPH Standard for Asbestos Abatement, so inspections are ultimately needed prior to renovation or demolition work. The Connecticut General Statutes §20-436 requires persons who perform certain asbestos consulting services to be licensed by the State of Connecticut.

The State of Connecticut Department of Energy and Environmental Protection (CT DEEP) Hazardous Waste Management Regulations; Regulations of Connecticut State Agencies (RCSA) Sections 22a-449(c)-100 through -119, incorporating federal regulations 40 CFR 124 and 40 CFR 260 through 279 regulate the management, storage, and disposal of hazardous wastes. Lead-based paint screening performed during this inspection is the initial step in determining if any hazardous lead waste will be generated as a result of renovation or demolition activities.

Eagle performed an HBMI of the existing Site buildings within the accessible interior and exterior spaces of the structures. The inspection was limited to areas that could readily and safely be accessed for inspection. Areas that required confined space entry or were limited for access due to height or other physical constraints, or presented a potentially dangerous condition to the inspection team, were excluded from the inspection. Eagle did not disassemble any equipment for internal inspection. The fleet of front end loaders, dozers, skid steers, trucks and other fleet vehicles were auctioned off and were not included in the HBMI. Presumptions regarding the presence of HBMs within inaccessible areas were made when deemed appropriate by the inspector.

The HBMI included the structures associated with the Waste Processing Facility (WPF) including the Administration Building, the Waste Processing Facility Building (consisting of the municipal solid waste storage area and expansion area, the primary and secondary shredders and primary baghouses, the processing floor, the RDF storage and expansion area, a shop area, and the ferrous loadout), conveyors, odor control equipment, Coal Barge Unloading Building, scale houses (3), Transfer Building and Tool Storage Building. Asbestos-containing materials, lead paint, universal waste, and OHMs were included in the HBMI of the WPF.

The HBMI included the structures associated with the Power Block Facility (PBF) including the boiler house, Turbine Hall, Northeast Utilities Building, Ash Loadout Building, Coal Pond Pump House, Combustion Units 11, 12, and 13 and associated dry scrubbers, Gate 40 Warehouse Building, Jet Shop and Jet Twin-Pacs, Lime Slurry and Concrete Stack, Northwest Guard Shack, PBF Administration Building, Screen Houses #1, #2, and #3, Scrubber Control Building, Warehouse off of the Turbine Hall, Wheel Wash Building and Maintenance Garage, Demineralization Shack and Flood Wall. Asbestos-containing materials, lead paint, universal waste, and OHMs were included in the HBMI of the PBF.

Although PCBs in building materials were included in the overall Study of the Site, the PCB in building materials sampling effort was performed directly by W&S and is outside of Eagle's scope of services.

Hazardous materials abatement and demolition cost estimates were prepared by W&S's independent cost estimator. Eagle assisted with providing information necessary to complete the abatement portion of the cost estimate.

This written report includes a detailed description of the services performed by Eagle, protocols and procedures for performing the HBMI, and the summary of findings of the HBMI to satisfy the scope of work for HBMs included in the RFP, which includes the following:

1. An inspection of all buildings to inventory potential HBMS including types, locations and estimated quantities (Completed by Eagle).
2. A sampling of potential HBMs to confirm status (Completed by Eagle and W&S)
3. An estimate of costs to abate all HBMs for building renovation or demolition (Developed by W&S's independent cost estimator)
4. An estimate of the costs to demolish all buildings following HBM abatement (Developed by W&S's independent cost estimator)
5. Preparation of a draft and final report for the HBMI (Eagle)

This report contains a summary of findings of the HBMI inspection. It is not intended to serve as a bidding document to obtain pricing from contractors for hazardous building materials abatement. It is recommended that a CT DPH licensed Asbestos Project Planner/Designer

develop a scope of work and technical specifications for hazardous building materials abatement prior to any abatement activities. Although the HBMI was comprehensive nature, even the most thorough inspection cannot guarantee that all hazardous building materials will be identified.

Eagle performed a lead-based paint screening of the structure to evaluate painted, stained and varnished building surfaces for lead. Site buildings constructed after the 1978 ban on lead-based paint for residential use were included in the lead-based paint screen since commercial applications of lead in paint coatings could be present on the post 1978 construction buildings. Lead disposal waste characterization sampling was not included in Eagle's scope of services.

Eagle performed a visual inspection for the presence of universal waste materials and OHMS in the Site buildings. The universal waste and OHM inspection did not include any testing of materials. The visual inspection was non-destructive and did not include disassembling equipment for internal inspection.

Site Description

The Project Site includes the shuttered MIRA Resource Recovery Facility and Jet Turbine Facility located on the approximately 80-acre site at 300 Maxim Road and 100 Reserve Road in Hartford, CT. The Site was initially developed in 1921 with a coal-fired power plant, which is still present but is non-operational. In 1987 a trash to energy plant was constructed on the Site and included the construction of a WPF, an administration facility, conveyor systems for moving RDF to three combustion units and associated scrubbers, baghouse dust collectors and associated boiler gas exhaust stack. The three combustion boilers and associated exhaust gas treatment equipment and two 1960 Babcock and Wilcox coal fired boilers are located in the original 1921 building collectively referred to as the PBF. The 1987 combustion units are identified as units 11, 12, and 13. The Babcock and Wilcox boilers are identified as boilers 9 and 10. A mercury boiler was formerly decommissioned and removed from the PBF. Two steam turbine power generators remain in the turbine hall of the PBF. Non-contact cooling water for the turbines was pumped through cooling water intakes located in screenhouses #1 and #2 located to the east of the PBF on the western bank of the Connecticut River. A coal unloading crane and transfer building, and associated conveyor system remain on the western bank of the Connecticut River. 115kV and 23kV switchyards, which are still active components of the regional power grid, are located to the west and northwest of the PBF. Pratt & Whitney "twin-pac" backup generators provided emergency power to the switch yards in the event the regional power grid instability. The facility stopped receiving, processing, and combusting waste in July 2022. The Jet Turbine Facility was shut down effective May 31, 2023.

The City of Hartford Tax Assessor card for the Site lists sixteen structures on the Site with the PBF being the earliest construction in 1921 and the latest being the scrubber control building in 1997. Several buildings were added to the Site between the initial 1921 construction and 1997 when the most recent building was added. Additional support and process buildings include but are not limited to the PBF Administration Building, Jet Turbine Warehouse, Ash Loadout Building, Wheel Wash Building, Coal Pond Pump House and other small sheds, tanks, and storage buildings. The overall Site layout is provided on the attached Site Plan (SP-1) included in Appendix A.

Building Descriptions

For the purpose of this Report, the Site has been divided into two main areas including the WPF and the PBF. The WPF consists primarily of later vintage buildings constructed in the late 1980s and 1990's that were used to process municipal waste that would ultimately be processed as RDF at Combustion Units 11, 12, and 13. General layout plans depicting the layout of the individual buildings and roofs comprising the WPF are shown on Drawings WPF-1 through WPF-5. The PBF consists of a combination of original and early vintage buildings that were utilized during operation of the original boilers as well as buildings that were constructed in the 1980s and 1990s to support the operation of Combustion Boilers 11, 12, and 13. Floor plans depicting the general layout of the individual buildings and roofs are shown on Drawings PBF-1 through PBF-17. Individual rooms and areas of each building within the drawing set have been assigned a unique room location number that corresponds with Tables I, II, and III contained within this report.

WPF

The WPF was constructed in the 1980's with additions constructed in the 1990's to support the transition to combustible municipal waste from coal. The WPF consists of an Administrative Building, the Waste Processing Building consisting of the Municipal Solid Waste Storage and

Processing Areas, Maneuvering Hall, RDF Storage, Primary and Secondary Shredders, Shop Area, Ferris Loadout, the Tool Storage Building, Transfer Building, Coal Barge Unloading Building, Scale Houses #1, #2, and #3, Odor Control Equipment and the Elevated Conveyors.

Administrative Building

The WPF Administrative Building was constructed in 1987 and is located at the southeastern portion of the site east of the Waste Processing Building. The 5,000 square foot single story structure is constructed slab on grade with steel framework and standing seam exterior panels. The interior walls are of sheetrock construction with suspended acoustical ceiling tiles and various resilient flooring finishes including vinyl floor tile and carpet. Heating and cooling is supplied from a roof top HVAC unit and distributed in insulated ductwork above the drop ceiling. The piping is un-insulated and enclosed within the walls or above the drop ceilings. The structure has a lower-level EPDM roof with 2" of built-up foam above the breezeway and the main gravel covered EPDM roof with 4" built up foam above the main structure.

Waste Processing Building

The Waste Processing Building was constructed in 1987 with the Maneuvering Hall added in 1991. The one hundred ninety thousand (190,000) square foot structure is the primary structure of the WPF where municipal waste was received and processed for combustion. The structure consists of the Maneuvering Hall, Municipal Solid Waste Receiving and Storage Areas, Primary and Secondary Shredders, Waste Processing Area, Ferrous Loadout, A shop Area, RDF storage with an expansion and pit, stationary packer, and a second-floor mezzanine area. The structure is constructed slab on grade with the exception of the RDF pit, and the conveyor trench which is below grade. The exterior siding is corrugated aluminum mechanically fastened to steel columns at the walls and steel beams at the ceilings. The interior walls are comprised of concrete construction and sheetrock in the mezzanine area. The interior and exterior doors and door frames are metal. There is no mechanical equipment associated with heating or cooling present in the building besides the mezzanine area. The elevated RDF conveyor starts at the northeast end of the RDF pit and extends to the transfer building.

Tool Storage Building

The Tool Storage Building was constructed in 1991and is located to the northeast of the WPF Administrative Building. The fourteen thousand (14,000) square foot two-story structure is constructed slab on grade with steel framework and aluminum panel exterior siding. The interior partition walls separating the office from the main storage area are of sheetrock construction. The office floors are vinyl with acoustical drop in ceiling tiles. The main storage area has exposed unpainted concrete flooring on the first floor. The second floor is an office space with interior sheetrock walls, suspended acoustical ceiling tiles, and vinyl flooring with ceramic flooring in the bathrooms and locker rooms. The supplied cooling air is supplied from the roof top HVAC unit and distributed through an aluminum duct work system above the suspended ceiling in the second-floor office space. The unit ventilators in the stair wells are supplied water through pipes that are enclosed in risers behind sheetrock. The distribution pipes are insulated with fiberglass. The roof is pitched with metal paneling.

Transfer Building

The Transfer Building is a five-level thirteen thousand five hundred (13,500) square foot structure constructed in the 1980s. The Transfer building is located to the south of the main PBF building. The transfer building is the centralized junction for the elevated conveyors on the Site. The RDF Conveyor, Coal Conveyors #1, #2, #3, RDF Supply Conveyor 515, 517 and 519 merge at the fourth and fifth level in the interior of the building. The interior floors and ceilings are unpainted concrete, with concrete masonry units and sheetrock interior walls. The pipes are exposed within the building and are insulated with an aluminum jacket. Interior and exterior doors are metal with metal frames. The window frames located off of the control room are metal. The two roofs on the structure are flat tar and gravel roof systems.

Coal Barge Unloading Building

The Coal Barge Unloading Building is a ten-level structure constructed in the 1980s. The structure is located at the east end of the Site on the Connecticut River. The structure is built on a concrete slab and consists of a large coal grapple to feed Coal Conveyor #1 from barges below. The Structure has ten (10) levels of catwalk systems and metal grates supported by steel columns and beams. The grapple offices and other interior areas have concrete flooring with metal wall paneling. The roofs above the structure are metal pitched roofs.

Scale Houses #1, #2 and #3

Scale House #1

The three scale houses on the Site were constructed in the 1980s. Scale House #1 located to the southwest of the MSW Receiving and Storage area is a two hundred eighty (280) square foot structure-built slab on grade with steel framework and metal exterior paneling. The interior partition walls are of sheetrock construction. The interior ceiling consists of a suspended acoustical ceiling system. Heating and cooling is supplied to the structure with a single roof top HVAC Unit. The floors are finished with 12”x12” vinyl floor tiles. The doors and windows are metal with metal frames. The roof consists of an EPDM roof system with 3” polyiso insulation.

Scale House # 2

Scale House #2 is located to the southwest of the Maneuvering Hall adjacent to Maxim Road and is an approximately one hundred forty (140) square foot structure constructed with a metal framework with a metal shell. The diamond plate flooring sits on a concrete slab. Heating is supplied to the building through a wall mounted heater. Cooling is supplied through a small roof A/C unit. The doors and windows are metal with metal frames.

Scale House #3 located south of the Jet Shop on the Gate forty (40) access road is an approximately one hundred forty (140) square foot structure constructed on a concrete ramp. The structure is constructed with metal framing with metal paneling. Heating is supplied to the building through a wall mounted heater. Cooling is supplied through a small roof A/C unit. The doors and windows are metal with metal frames.

Odor Control Equipment

The Odor Control Equipment located to the northeast of the WPF was constructed in the 1990’s. The Regenerative Thermal Oxidizer (RTO) consists of a two (2)-chamber, single vessel system that eliminates volatile organic compounds (VOCs). The equipment rests on slabs of concrete abutted by the pavement. There are two metal exterior tanks with a single metal stack associated with the equipment. Large motor-powered fans distribute the air through three roof mounted cylindrical metal ducts on the Waste Processing Building, and three ducts associated with the Transfer Building and Pugmill. There are two 100 square foot adjacent offices constructed with metal framing and metal paneling. The offices have 12”x12” vinyl floor tile finishes with metal doors and door frames.

Elevated Conveyors

The six (6) Elevated Conveyors were constructed in the 1990’s. The conveyors are elevated and constructed with concrete floors, steel framework, and metal panel walls and roofs. The conveyor belts are driven by electric motors and pulleys. The Refuse Derived Conveyor is an approximately 570’ long 23’ wide conveyor that runs from the Refuse Derived Storage to the Transfer Building. Coal Conveyor #1 is an approximate 85’ long 14’ wide conveyor that runs from the Coal Barge Unloading Building to the east side of the Transfer Building. Coal Conveyor #2 is an approximately 200’ long 14’ wide conveyor that runs from the southwest side of the Transfer Building and transfers coal to the coal pile. Coal Conveyor #3 is an approximately 310’ long 14’ wide conveyor that runs from the west side of the Transfer building to the Coal Pond. The RDF Supply Conveyors 515 and 519 run from the north side of the transfer building to the southeast side of the PBF combustion unit area sharing the same

enclosure at an approximate 175' length and 23' width. The RDF Supply Conveyor 517 is an approximately 156' long 14' wide conveyor that runs from the north side of the Transfer Building to the southeast side of the PBF combustion unit area.

PBF

The PBF consists of multiple buildings including the original 1920's boiler area that currently houses two 1960s coal/oil fired boilers and combustion units 11, 12, and 13 that were installed in the late 1980s. Boiler exhaust gas treatment equipment associated with combustion units 11, 12, and 13 and the existing exhaust stack were also constructed in the 1980s. The Turbine Hall located to the west of the boiler area and the Northeast Utilities Building located to the west of the Turbine Hall each played major functions in the overall power generation at the Site. The PBF Administration Building is located to the north of the boiler area and contains former administrative office space. Three screen houses, two warehouses, a maintenance garage, four jet turbine generators and Jet Shop, scale houses, Coal Pond Pump House, guard shacks, Wheel Wash Building, Lime Slurry, and Pugmill are supporting buildings of the PBF.

Ash Alley, Boiler Area, Combustion Unit 11, 12, 13 Area, Turbine Hall, Warehouse (Boiler Rooms, Combustion units 11, 12, 13 and associated spaces, Turbine Hall, Warehouse)

The Main Power Block Structure is an approximate two hundred fifty thousand (250,000) square foot masonry and steel structure with the original building constructed in 1921. The 1921 section of the building consists of boiler house and associated areas and contains the 1960 coal fired Babcock & Wilcox Integral Furnace boilers Type PFI boilers 9 &10 present. This section of the building's lowest elevation is 11' with the highest elevation of 146'. The interior construction consists of concrete slab floors, steel framing with brick, terracotta block, and clay block walls and flat roof systems with rubber membrane EPDM roofs on concrete decks. The Mercury Boiler and Mercury Boiler House were demolished with the associated concrete slab remaining.

The 1921 section of the building also contains the two (2) level turbine halls with turbines 5 and 6 present. The turbine hall has a sub-grade first level (elevation 11') that is constructed on a concrete slab with 6"x6" quarry tile floor finish. The ground level turbine deck (elevation 36') is open to elevation 104' concrete roof deck. The Interior walls consist of 1920's glazed brick with large window openings. There is a 100-ton cable hoist on a trolly system above the turbine hall. Combustion units 11, 12, 13 and associated steel framed metal panel enclosure was added at the Southeast portion of the structure off of the boiler house in the 1980s. Combustion units 11, 12 and 13 bases sit at elevation 31' and end extend to elevation 146'. The breaching ducts associated with combustion units 11, 12, and 13 transfer combustion unit exhaust gas into the dry scrubbers and baghouses, which are set on a steel support system. The 1950's warehouse addition can be accessed from the southeast ground level turbine hall at elevation 36'. The warehouse is an approximate 1,400 square foot addition-built slab on grade. The steel framed brick structure is a single-story area with interior sheetrock partition walls, 12"x12" vinyl floor tile finishes and suspended acoustical ceilings. There are Eleven (11) roofs associated with the Boiler Room Area, Combustion Unit Area, and the Turbine Hall. The roofs consist of foam insulation on concrete decks with a rubber membrane EPDM covering as well as limited pitched roof systems. The two (2) roofs associated with the Warehouse are rubber membrane EPDM roof systems.

Northeast Utilities Building

The Northeast Utilities Building is an approximate eighty-thousand (80,000) square foot structure that was constructed in 1921 with a 1938 addition off the southwest side of the Turbine Hall. The masonry and steel framed structure houses multiple floors of bus closets, which transferred electricity from the turbines to the switchyards. The 1920s control room is located in this building. The bus closet areas consist of concrete floors and ceilings with cementitious brick stall enclosures for wire conduits. Renovation work occurred to accommodate office spaces in the Northwest corner of the structure. The office space has plaster wall and ceiling finishes, suspended acoustical ceilings and resilient flooring finishes including vinyl asbestos floor tile

and carpet. The facades consist of two courses of brick with exterior metal doors and doors frames. The windows consist of metal awning window sashes with metal frames. There are seven (7) roofs associated with the structure, with flat rubber membrane EPDM and rolled asphalt roofing systems.

Ash Loadout

The Ash loadout building is an approximate eight-thousand five-hundred (8,500) square foot structure constructed in the 1980's. The structure is built slab on grade with corrugated metal wall and ceiling panels. The structure does not have a heating or cooling system. The exterior man doors are metal with metal frames.

Coal Pond Pump House

The Coal Pond Pump House adjacent to the coal pond is an approximately three-hundred forty (340) square foot structure constructed in the 1980's. The structure is built slab-on-grade with exterior metal wall and ceiling finishes.

Gate 40 Warehouse

The Gate 40 Warehouse is located in the southwest portion of the site adjacent to Reserve Road. The approximately five-thousand (5,000) square foot structure is believed to be constructed in the 1980s. The structure is constructed slab on grade with steel framing. The interior finishes include sheetrock partition walls, suspended acoustic ceilings, and resilient flooring finishes. Heating and cooling is created from a single exterior air conditioning and heat pump which is distributed through an aluminum duct above the drop ceiling in the office spaces. The plumbing piping and duct work is uninsulated.

Jet Shop

The Jet Shop is an approximately nine-thousand two-hundred and eighty (9,280) square foot structure constructed in the 1970's. The two-story structure is constructed slab on grade. The interior office spaces consist of sheetrock walls, suspended acoustic ceilings and vinyl flooring. The domestic plumbing pipes are uninsulated. The metal exterior wall and roof panels are mechanically into the steel framing. The Windows are constructed with metal sashes and frames. Interior and exterior doors are metal with metal frames. The hot water furnace is located on the first floor and supplies hot water to the ceiling mounted space heaters.

Jet Turbine "Twin-Pacs"

The four (4) Pratt and Whitney Twin-Pac units are adjacent to the Jet Shop. The Twin-Pacs were installed in the 1970's and consist of steel housing around the units with a small control room at each unit. The units consist of air intake inlets, compressors, the combustion chamber, turbine, and exhaust.

Lime Slurry

The Lime Slurry building constructed in the 1980's consists of a suspended tank used to neutralize the exhaust from combustion units 11, 12, and 13. The associated piping in the interior of the structure is insulated with fiberglass and a paper covering. The exterior of the Lime Slurry consists of a steel framed metal lower structure with metal paneling to support the suspended metal slurry tank above.

Concrete Stack

Concrete Stack constructed in the 1980's is a two hundred eighteen (218)-foot stack used for the exhaust of the combustion units. The Stack is concrete with an interior liner. A cleanout access hatch is located at grade at the base of the stack.

Northwest Guard Shack

The Northwest Guard Shack is an approximately two-hundred eighty-five (285) square foot structure. It is uncertain of when the structure was constructed. The structure is brick with steel framing. The interior of the structure consists of single coat plaster and sheetrock wall and ceiling finishes. The flooring is comprised of 12”x12” vinyl floor tile. The Roof is pitched with a single layer of asphalt roof shingles.

PBF Administration Building

The PBF Administrative Building is an approximately eight-thousand three-hundred (8,300) square foot structure constructed in the 1950’s. The structure is constructed slab on grade with two (2)-story and three (3)-story sections The mechanical equipment consists of an oil-fired boiler located on the first floor that provides hot water to a wall mounted baseboard system with copper-fin tube radiators. The mechanical distribution system is insulated with fiberglass. The piping is exposed, and the risers are contained within the walls. The interior walls are of sheet rock and joint compound construction. The window frames and sashes are metal. The door frames are metal with metal doors. The Floors are finished with various resilient flooring finishes. The exterior facades are brick. The roof consists of a built-up roofing system with ballast.

Screen Houses #1 and #3

The Screen Houses are located on the western bank of the Connecticut river east of the PBF. Screen Houses #1 and #3 were constructed in the 1940’s. The screen houses consist of steel frame and masonry construction and house intake and discharge piping associated with turbines #5 and #6. There are no heating or cooling systems in the structures. The window frames and sashes are of metal construction. The door frames are metal with metal doors. The floors consist of un-painted concrete and or steel grating. The Exterior facades are brick. The roofs are flat and consist of rubber membrane EPDM roofing systems.

Screen House #2

Screen House #2 is located between Screen House #1 and #3. Screenhouse #2 was constructed in the 1920’s. The steel framed and masonry structure houses the indirect cooling water and discharge pipes that service the turbines. The window frames and sashes are of metal construction. The door frames are metal with metal doors. The exterior facades are brick. The roof is flat and consists of a built-up roofing system with ballast. The interior of the structure could not be accessed due to the building’s condition.

Scrubber Control Building

The Scrubber Control building located to the west of the Northeast Utilities building is an approximately one-thousand seven-hundred (1,700) square foot structure constructed in the 1990’s. The mechanical equipment consists of an exterior forced air ventilation system. The mechanical system distribution system is un-insulated. The interior partition walls are sheetrock. The window frames and sashes are of metal construction. The door frames are metal with metal doors. The floors are finished with 6”x6” quarry tile. The exterior facades and roofs consists of corrugated metal paneling.

Wheel Wash Building

The Wheel Wash building constructed in the 1980’s is a single-story steel frame building. The building is constructed slab on grade. There is no mechanical system associated with the building. The window frames and sashes are of metal construction. The door frames are metal with metal doors. The slab is exposed in the interior with no flooring finishes. The exterior facades and roof consist of metal paneling.

Maintenance Garage

The Maintenance Garage constructed in the 1980's is a single-story steel frame building. The building is constructed slab on grade. There is no mechanical equipment associated with the building. The window frames and sashes are of metal construction. The door frames are metal with metal doors. The slab is exposed in the interior with no flooring finishes. The exterior facades and roof consist of metal paneling.

Pugmill

The Pugmill building constructed in the 1980's is a multi–level steel frame structure. The structure is associated with the Ash Loadout building. The Pugmill was utilized to mix different materials into one homogeneous mixture. The roof appears to be a rubber membrane EPDM system but could not be accessed.

Introduction

The asbestos inspection was conducted in order to satisfy the United States Environmental Protection Agency (USEPA) National Emission Standard for Hazardous Air Pollutants Act (NESHAP) as amended November 20, 1990. The USEPA NESHAP final rule requires the facility owner or operator to perform a thorough inspection of the facility for asbestos prior to renovation or demolition.

The asbestos-containing materials inspection was performed by Angelo Folino, a CT DPH licensed Asbestos Inspector/Management Planner (license #000366). The inspection was managed by Peter J. Folino, a CT DPH licensed Asbestos Inspector/Management Planner (license #000184), and CT DPH licensed Asbestos project Designer (license #000195) and Chris Liberti; a CT DPH licensed Asbestos Inspector (license #000256), and CT DPH licensed Asbestos Project Designer (license #000261).

The asbestos-containing materials inspection was initiated in the WPF on July 2, 2024, and proceeded to the PBF on July 15, 2024, and was substantially completed on September 2, 2024. Prior to the inspection, Eagle reviewed existing available drawings of the Site buildings and systems that were provided by the Dissolution Authority or were available in the on-Site plan room. Eagle assembled drawings to assist in developing general layout plans for each structure and which would be utilized during the field inspection work at the Site. Building construction dates were determined for each structure, when available, by reviewing property record cards or based on existing information available to Eagle. The building construction dates are keyed onto the Site Plan (SP-1) and are color coded based on each construction date. In some instances, the exact date of construction could not be determined but the general time frame in which the building was constructed was identified and noted. The general layout plans contain unique numerical room identifiers (room numbers) which correspond to the data contained within Summary Tables included in the report. The PBF and associated buildings contain multiple elevations of construction. The elevations are generally marked on each level of the building and are also noted on the general layout plans to orientate the user when using this report. The lowest most elevation of the PBF is 11’ above sea level which is the basement of the Turbine Hall and extends to 146’ above sea level, which is the upper most level of the PBF above combustion units 11, 12, and 13. Asbestos bulk sample locations are identified on the general layout plans for each building. The Site Plan identifies Project North which is utilized throughout this report in the building description section and on Tables I and II.

Inspection Protocols

The asbestos-containing materials inspection included a systematic physical inspection of functional spaces within the Site buildings, which included locating suspect ACM for sampling, collection of bulk samples for laboratory analysis, plotting sample locations on the general layout plans, and developing an estimated quantity of each suspect ACM. Suspect ACMs are identified as Homogeneous Areas (HA) within this report. An HA is an area of surfacing material, thermal systems insulation, or miscellaneous material which is similar in color and texture. HAs are further distinguished based on their apparent date of application. It is possible to have two similar HAs that are similar in color and texture, but if installed or applied at different times, were determined to be different HAs and were sampled separately. Each HA was assigned the appropriate ACM category including surfacing ACM, thermal systems insulation ACM, or miscellaneous ACM. Surfacing ACMs are those materials that are sprayed or troweled on or otherwise applied and include materials such as spray applied fire proofing, acoustical plaster, stucco, etc. Thermal Systems Insulation ACMs are insulating materials utilized to prevent heat loss or gain or condensation build up and generally include pipe insulation, boiler and tank

insulation, and duct insulation. Miscellaneous ACMs are all remaining ACMs not categorized as Surfacing ACM or Thermal Systems Insulation ACM and includes but is not limited to flooring materials, ceiling tiles, caulk, adhesive, roofing materials, asbestos cement board. The friability of each material was determined by touching the material. Friable ACM can be reduced to a powder under normal hand pressure when dry.

Eagle developed estimated quantities of each HA by field measuring with a laser measurer. Materials were quantified in square feet, linear feet or each depending on the nature and application of the material. Estimated outside diameters of linear circular or rectangular components, such as piping and ductwork, were determined and recorded on the field inspection and are included in the ACM Summary Table. Quantities of each HA are expected to be within +/- 10% of actual quantity for each of the identified materials. Quantities are not provided for HAs that were confirmed to be non-ACM.

Eagle's inspection team utilized personal protective equipment including protective coveralls, respiratory protection, Nitrile gloves, head protection and eye protection during the inspection. Personal exposure monitoring for asbestos was performed during the inspection process.

Most of the buildings have limited to no active lighting. Head lamps, high power LED flashlights and stand lighting were used to illuminate the immediate inspection areas during the inspection process. The inspection was performed with a buddy system ensuring two people were within verbal contact distance during the work. Ladders were used where necessary to access elevated HAs for sampling. Roof systems were cored to the roof deck and individual layers of HAs were sampled accordingly. Roofs were patched with ethylene propylene diene terpolymer (EPDM) patches or non-asbestos cold patch and mesh depending on the roofing system.

Semi-destructive testing techniques were utilized during the inspection process. This included cutting through various layers of flooring and roofing materials to verify and sample individual layers of each HA. Suspect building materials that are inaccessible for inspection and sampling are assumed to be ACM for the purpose of this report. These suspect materials are generally located in operational equipment, behind rigid walls and ceilings, or otherwise concealed areas of the building, including below grade materials.

Asbestos Bulk Sampling

Eagle collected bulk samples of each identified HA identified during the inspection process. Samples were collected by misting the sample area with water and removing a dime or quarter-size piece material for placement into an individual sample bag. Samples were collected with hand tools including chisels, pliers, and razor knives. The hand tools were decontaminated with soap and water between successive samples. Samples were placed in individual 2"x3" zip-lock sample bags that were labeled with a unique sample number. The sample number assigned to each HA consists of the following:

07-02-AF-01A whereas 07 is the month, 02 is the day, AF is the inspector's initials, 01 is the homogeneous area number and A is the sample frequency in the sample group.

During the sampling process, suspect ACM was separated into one of the three (3) USEPA categories include the following:

1. Thermal Systems Insulation: TSI includes all materials used to prevent heat loss or gain or water condensation on mechanical systems. Examples of TSI are pipe covering, boiler insulation, duct wrap and mudpack fitting cement.
2. Surfacing Materials: Surfacing ACM includes all ACM that is sprayed, troweled, or otherwise applied to an existing surface. These applications are most commonly used in fireproofing and decorative and acoustical plaster applications.

3. Miscellaneous Materials: Miscellaneous materials include all ACM not listed in thermal or surfacing, such as flooring materials, asbestos cement board, ceiling tiles, roofing, glazing compound, caulk, and adhesives.

In most instances, samples were collected in general accordance with the following frequency for each homogeneous area:

1. Thermal Systems Insulation: 3 samples, 1 sample for patch up to 6 square feet
2. Surfacing Materials: 3 samples up to 1,000 square feet, 5 samples up to 5,000 square feet, 7 samples >5,000 square feet
3. Miscellaneous Materials: Minimum of 2 samples or in a manner sufficient to produce accurate results

All samples were submitted under proper chain of custody to Scientific Analytical Institute (SAI), Laboratory of Greensboro, NC for analysis.

Asbestos Bulk Sample analyses

The bulk samples were analyzed by SAI Laboratory who is accredited by the National Voluntary Laboratory Accreditation Program (NVLAP) and is a State of Connecticut Department of Public Health (DPH) approved laboratory (Registration No. PH-0336). Samples were analyzed by Polarized Light Microscopy (PLM). PLM is the USEPA accepted method of analysis for identification of asbestos in bulk matrices. All samples were analyzed by PLM EPA Method 600/R-93/116 and 40 CFR Part 763, Subpart E to Appendix E.

Sample analysis results are reported in percentage of asbestos and non-asbestos components. The USEPA defines any material that contains greater than one percent (>1%) asbestos, utilizing PLM, as being an asbestos-containing material (ACM). CT DPH regulates any material containing equal to or greater than one percent (≥1%). Suspect materials containing greater than or equal to one percent (≥1%) asbestos utilizing the PLM Point Count Method and the NOB TEM method are also considered to be asbestos-containing. Sample results indicating "no asbestos detected" (NAD) are specified as non-asbestos containing materials and are included in Table II. Samples results indicating "Did Not Analyze" (DNA) are not analyzed due to the stop on first positive request to the laboratory.

A total of one-thousand five-hundred and seven (1,507) asbestos bulk samples were submitted for laboratory analysis by PLM and one-thousand three-hundred and ninety-four (1,394) samples were analyzed based on the stop on first positive request to the laboratory.

Non-friable ACM

The USEPA recommends that Transmission Electron Microscopy (TEM) analyses be performed on certain non-friable suspect materials found to be negative by PLM. NOB TEM analysis is especially designed to identify asbestos fibers in non-friable organically bound materials such as floor tiles, roofing materials, caulk, etc. Eagle requested further analysis of certain negative PLM results by NOB - TEM analyses. A total of eighty-one (81) were further analyzed by the NOB TEM method.

Friable ACM

Certain samples of friable materials shown to contain less than 10% asbestos may be analyzed further by the "Point Count Method". This procedure is recommended by the United States Environmental Protection Agency to confirm friable bulk samples shown to have less than 10%

asbestos by PLM to be definitively negative or positive for asbestos. This method is accepted as providing statistically reliable results when analyzing bulk samples with low (<10%) asbestos concentrations. No samples were further analyzed by the PLM Point Count method.

Asbestos Inspection Results

The asbestos-containing materials inspection resulted in the identification of seven-hundred and six (706) HAs that resulted in the collection of one-thousand five-hundred and seven (1,507) asbestos bulk samples. From the one-thousand five-hundred and seven (1,507) asbestos bulk samples collected, one hundred twenty-two (122) asbestos-containing HAs were identified. The positive HAs contain asbestos at concentrations equal to or greater than one percent. In addition to the confirmed ACMs, sixty-one (61) HAs were assumed to be ACM because they could not be accessed for sampling, were previously labeled as ACM or the sample contains vermiculite and is recommended by the US EPA to be managed as an ACM.

Asbestos-containing summary tables developed for this report provide a summary of the asbestos and non-asbestos-containing materials identified during the HBMI. Table I Asbestos-Containing Materials Summary Table consists of a summary of confirmed and assumed asbestos-containing materials identified during the HBMI. These materials were either confirmed by laboratory analysis to contain ≥1% asbestos, were assumed to contain asbestos because the material was inaccessible for testing or was previously labeled as an ACM, or contains vermiculite and is recommended by the US EPA to be managed as an ACM. The HA number is a unique identifier representing each HA. Room numbers contained within the "Location" column on Table I correspond to room numbers contained on the floor plans and roof plans. The "Material Type" columns contains a description of the HA that was identified. The "Sample Number" column contains the unique asbestos bulk sample number assigned to the HA. The "Category" column identifies the US EPA category of ACM which includes Surfacing ACM (SURF), Thermal Systems Insulation ACM (TSI), or Miscellaneous ACM (MISC). The "Bulk Sample Analysis Results" column identifies the type of asbestos bulk sample analysis performed by the laboratory which includes Polarized Light Microscopy (PLM), PLM Point Count (PLM PC) or Transmission Electron Microscopy Non-Friable Organically Bound (TEM NOB). The estimated quantity of the HA is provided in the "Estimated Quantity" column and the "Friability" column indicates if the material is Friable (F) or Non-Friable (NF). The Table II Non-Asbestos-Containing Summary Table includes all materials that were confirmed by laboratory analysis to be non-ACM. Table II includes similar information to that of Table I but does not include quantities of the HAs since they are non-ACMs.

The asbestos bulk sample laboratory reports are contained in Appendix C.

WPF Results

Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, RDF Storage and Ferris Loadout

The window glazing compound (HA# 10) contained in the viewport windows within eight doors was confirmed to be an ACM. The window glazing compound holds the glazing (glass) in place and provides a seal between the glass and door. The window glazing compound (HA# 18) contained within seven (7) window sashes associated with the grapple office windows was confirmed to be an ACM. The window glazing compounds are non-friable miscellaneous ACMs. The flashing cement (HA# 185) applied to localized areas of the roof was confirmed to be an ACM. The flashing cement is a non-friable miscellaneous ACM. The beige caulk (HA# 656) around the exterior frame of one (1) louver was confirmed to be an ACM. Similar frames on the building did not exhibit the same caulk. The caulk is a non-friable miscellaneous ACM.

The window glazing compound within thirteen (13) double hung window sashes (HA# 710) was not accessible for testing without breaking the glass. The window glazing compound is an

assumed miscellaneous non-friable ACM. Multiple gaskets associated with the equipment in the building including the cylindrical trash chute (HA# 707), cyclones (HA# 708), blower units (HA# 709), cylindrical odor control duct (HA# 712) and valve houses (HA# 713) were assumed to be ACM. Testing of other limited accessible gaskets within the associated buildings confirmed the gaskets to be non-ACMs but the inspector was unable visually determine if the inaccessible gaskets were similar to those that were tested. The gaskets are assumed non-friable miscellaneous ACMs.

Tool Storage

The window glazing compound (HA# 10) contained in the viewport windows within three (3) doors was confirmed to be an ACM. The window glazing compound holds the glazing (glass) in place and provides a seal between the glass and door. The window glazing compound is a non-friable miscellaneous ACM.

The interior duct pin tab adhesive (HA# 715) was assumed to be an ACM. The inspector was unable to inspect the interior of the duct and assumed the material to be present. The pin tabs are generally glued or welded to the duct and hold the blanket duct insulation in place. The glue is sometimes an ACM. The pin tab adhesive is an assumed non-friable miscellaneous ACM. Two (2) mirrors potentially containing mirror adhesive (HA# 716) were assumed to be adhered with asbestos-containing adhesive. The mirror adhesive is an assumed miscellaneous non-friable ACM. Gaskets (HA# 717) and valve packing (HA# 718) associated with the water main piping were not accessible for sampling, are assumed to be present, and are assumed ACMs. The gaskets are assumed non-friable miscellaneous ACMs and the valve packing is an assumed friable miscellaneous ACM.

Coal Barge Unloading Building

No confirmed ACMs were identified in the Coal Barge Unloading Building. The gaskets associated with the fuel lines (HA # 719), pulley system (HA# 721), cable motors (HA# 722) and grapple pulley (HA# 725) were not accessible for testing and are assumed non-friable miscellaneous ACMs. The valve packing (HA# 720) in the fuel lines was not accessible for testing and is an assumed friable miscellaneous ACM. The cloth like filters (HA# 723) above the grapple and grapple brake pads (HA# 724) were not accessible for testing and are assumed ACMs. The filters and brake pads are classified as assumed non-friable miscellaneous ACMs.

Transfer Building

The roof flashing cement (HA# 159) was confirmed to be an ACM. There is approximately twenty (20) square feet of this miscellaneous non-friable ACM on the lower and main roofs of the building. Gaskets associated with the access hatches to the conveyors (HA# 726), the large diameter water line piping (HA# 727), conveyor motors 511 and 513 (HA# 728) and blower units (HA# 729) were not accessible for testing and are assumed non-friable miscellaneous ACMs. The brake pads associated with the pully unit (HA# 730) were also not able to be sampled and is an assumed non-friable miscellaneous ACM.

Administration Building

The window glazing compound (HA# 77) associated with the interior divider windows and doors was confirmed to be an ACM. The ACM is in good condition and is non-friable and should be managed in place until it is removed. The window glazing compound is a non-friable miscellaneous ACM.

PBF Results

Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse

Several types of homogenous areas associated with Boilers 9 and 10 and throughout the boiler room area were identified and confirmed to be ACM. Boilers 9 and 10 consist of two Babcock and Wilcox coal/oil fired boilers which contain installation plates from 1960. Site sources indicated that Boiler 9 was "abated" in the past but it appears that abatement included only accessible ACMs exterior to the boiler. Residual debris on pipes (HA# 219) was identified at varying elevations around each boiler and was confirmed to be an ACM. The residual debris is a friable thermal systems insulation. Stored gaskets (HA# 220), which were also observed on steam piping flanges at each boiler, were sampled and confirmed to be an ACM. The gaskets are non-friable miscellaneous ACMs. Rope gaskets (HA# 221) at access hatches to both boilers were sampled and confirmed to be friable miscellaneous ACMs. Miscellaneous soft packing rings (HA# 223) associated with water lines at both boilers were confirmed to be friable thermal system insulation ACM. The gasket at the igniter sight glasses (HA# 224) at both boilers (12 per boiler) was confirmed to be a non-friable miscellaneous ACM. Rope gaskets at the ignition sight glass access panel (HA# 225) and at access hatch to breeching duct (HA# 233) were confirmed to be ACMs. The rope gaskets are friable miscellaneous ACMs. The pipe wrap on the 1" line (HA# 229) at the base of Boiler 10 was confirmed to be an ACM. The pipe wrap is a friable thermal system insulation. The soft packing insulation behind the boiler steel jacket (shell) (HA# 232) was confirmed to be an ACM and was sampled at Boiler 10 but is assumed to also be present behind the steel jacket on Boiler 9. This material is a friable thermal systems insulation. The sealant between the interior boiler steel jacket (shell) junctions (HA# 227) was confirmed to be a non-friable miscellaneous ACM. Eagle did not disassemble any of the boiler components to inspect the interiors of the boilers. The interior boiler components (HA# 731), which include refractory, packing, linings, gaskets, and insulation common with these types of boilers are assumed to be ACM for the purpose of this report. Based on the findings of the sampling on the boilers, the boilers will require full demolition as an abatement activity to fully abate the two (2) boilers. Steel components may be decontaminated during the abatement process and recycled.

The sample of paper covering on the fiberglass insulation (HA# 22) was confirmed to contain >1% asbestos. Additional samples of this HA were none detected for asbestos. It is possible that cross contamination from other ACM within the area of the HA occurred over the years. For the purpose of this report, the fiberglass insulation on the <6" diameter lines is considered an ACM but additional sampling of this HA is recommended. The HA is a friable thermal systems insulation. The white endcap mastic (HA# 236) used to seal the fiberglass seams around valves and at insulation termination points was confirmed to be an ACM. The HA is a non-friable miscellaneous ACM and is located throughout portions of the PBF. Mastic observed within the abandoned breeching duct (HA# 239) was sampled and confirmed to be a non-friable miscellaneous ACM. Friable debris (HA# 241) was observed and sampled on top of the abandoned breeching duct. It is unclear where the friable ACM debris originated from. Interior window frame caulk (HA# 246) and interior window glazing compound (HA# 248) in non-reinforced window sashes were observed and sampled and confirmed to be non-friable miscellaneous ACMs. The gasket at the boiler recirculatory heat tracing circuit (HA# 251) was confirmed to be a non-friable miscellaneous ACM. There is one circuit containing multiple gaskets. The spray applied fire proofing (HA# 261 and 262) within two (2) electrical closets was confirmed to contain 20% vermiculite. Based on current US EPA recommendations to manage materials containing vermiculite as an ACM, the HA is assumed to be ACM and is recommended for abatement if it will be disturbed by renovation or demolition activities. Several non-friable miscellaneous materials present in relatively small quantities including the wall mounted circuit protection panels (HA# 264), the residual insulator in electrical box (HA# 267), the black tar coating on pipe (HA# 269), window glazing compound in Plexiglas doors (HA# 275), patch flashing cement (HA# 282), window frame caulk (HA# 292) at bricked openings, tar at column ceiling junction – black (HA# 306),residual flashing cement at cement cap (HA# 327),

tar and felt paper on column cap (HA# 332), tar coating at floor penetrations (HA# 366), expansion joint caulk (HA# 372), window glazing compound in office partition windows (HA# 374), caulk around mechanical box (HA# 467), flashing cement on brick wall (HA# 472), window glazing compound in non-reinforced window sashes (HA# 473), Galbestos™ panels (HA# 702) that form a small interior roof structure and one stored panel, gaskets at incandescent light fixtures (HA# 686), and ebonite backer board at circuit panel (HA# 700) were all confirmed to be non-friable miscellaneous ACMs and are located in various areas throughout the PBF.

Residual mudded pipe fitting insulation (HA# 272) was identified within several areas of the boiler area on <6" diameter un-insulated mechanical piping. The residual debris was confirmed through bulk sampling to be a friable thermal systems insulation. Residual debris (HA# 278) was observed and sampled within a large wall penetration. The material appears to be residual pipe insulation that was on a former pipe that penetrated the wall. Gaskets sampled from 5"-8" diameter steam lines (HA# 347) throughout the PBF were confirmed to be ACM. There are approximately eight hundred twenty-nine (829) gaskets quantified. The gaskets are non-friable miscellaneous ACM. Magnesium silicate pipe insulation (HA# 280) was observed throughout the PBF and was confirmed through bulk sampling to be a friable thermal systems insulation. The HA was found in various conditions including residual insulation on existing exposed (uninsulated) pipes, exposed on 6" to >12" diameter mechanical piping, and under fiberglass on <6" diameter pipes. The HA is a friable thermal systems insulation. Residual packing around the perimeter of pipe conduit wall penetration (HA# 283) was sampled and confirmed to be a friable thermal systems insulation. This material was observed in one location in the PBF.

Several types and diameters of electrical wire coating (HA#s 294, 295, and 303) were observed, sampled and confirmed to be ACMs within the boiler area and turbine hall. The wire coating is associated with various types and uses of wire that serviced equipment within the facility. The wire coatings were observed primarily in metal conduit, with some exposed, at six forced draft fan units and at three (3) General Electric rheo-stats. Eagle quantified over six thousand eight hundred (6,800) linear feet of wire coating in the boiler area and turbine hall.

The caulk (HA# 296) and black expansion board (HA# 297) were observed at the vertical interface of the 1930's building and 1980's addition. The caulk and expansion board are non-friable miscellaneous ACMs. The damp proofing (HA# 299) was observed in a two (2)-foot wide application the height of the interface behind HA 296 and HA 297. Although thoroughly investigated, additional destructive inspection is recommended to verify the extent of this HA.

Eagle observed and sampled a suspect fibrous wrap (HA# 455) over metal conduit that originated in the Northeast Utilities building and was found exposed with a terminated end in the turbine hall. The material is a friable miscellaneous ACM.

Asbestos cement board panels (Transite™) (HA#s 304 and 333) were observed and sampled and confirmed to be ACM. The asbestos cement board panels are non-friable miscellaneous ACMs. The asbestos cement board panels were observed as a breeching enclosure and as wall panels as well as a chemical splash guard in a fume hood.

The damp proofing (HA# 193) located in two air shafts below former turbine locations was determined to be non-asbestos by PLM analysis. The damp proofing is a waterproofing coating applied to the interior masonry walls of the air shafts. Eagle requested the laboratory to perform confirmatory analysis utilizing the NOB TEM method. The TEM result was 1% asbestos, which classifies this material as an ACM. Additional sampling of this material may be warranted to confirm the TEM result.

The exterior window glazing (HA# 457) associated with the windows on the PBF was confirmed to be an ACM. The window glazing is associated with the metal reinforced glass windows on the

building. Eagle estimates approximately two thousand one hundred eighteen (2,108) window sashes with the asbestos window glazing compound within approximately sixty (69) window openings of various sizes. The sashes are fixed metal sashes set in metal frames.

Eagle identified asbestos-containing tar/flashing cement (HA# 475) on the exterior face of the Terracotta and solid clay block on the south and east exterior building facades enclosing Boilers 9 and 10. The tar/flashing cement appears to have been applied to cover cracks and potential deterioration of the block. The tar/flashing cement is both exposed and behind standing seam metal panels that cover portions of the façades.

The building expansion joint seam caulk (HA# 477) and expansion board (HA# 478) behind the caulk were confirmed to be ACM. The caulk and expansion board run vertically up the façade of the building within an expansion joint between the brick. The caulk and expansion board are non-friable miscellaneous ACMs.

The tar coating (HA# 687) and felt paper (HA# 688) covering the tar coating on the 48"diameter process water intake and discharge pipes and the service water intake and discharge pipes were confirmed to be ACMs. The process water intake pipes originate at Screen Houses #1 and #3 and run below grade into the dirt cellar of the PBF where they are partially below grade or at grade where they enter the Turbine Hall from the Dirt Cellar. The pipes provide indirect cooling water to turbines #5 and #6. The discharge piping follows the intake piping back to the screenhouse where it is discharged. The Service water intake pipe originates from Screen House #2 and runs below grade to the Dirt Cellar where it is partially below grade. The tar and felts are classified as non-friable miscellaneous ACM. Site sources also indicated that the 48" diameter piping was known to contain an interior cementitious liner. Eagle was unable to access the interior of the piping for sampling. The interior cementitious lining (HA# 768) is assumed to be ACM for the purpose of this report.

A tar flashing cement (HA# 689) and tar moisture barrier (HA# 691) were applied to the concrete wall and portion of the concrete ceiling within the dirt cellar of the PBF. These materials were likely applied to control or repair moisture or water damage to the masonry in these areas. These materials are classified as non-friable miscellaneous ACMs.

The two (2) existing turbine units underwent previous asbestos bulk sampling prior to former repair work on one (1) of the turbine units. The fibrous tape (HA# 733) on the stators was formerly confirmed to be an ACM and is assumed to be present on the stators in each turbine unit. The tape is classified as a friable miscellaneous ACM. Additional interior components associated with the turbine units were inaccessible for sampling and are assumed to be ACM for the purpose of this report.

Eagle quantified approximately three hundred forty-four (344) valves in the PBF that are assumed to contain asbestos-containing valve packing (HA# 736). Three hundred twenty four (324) valves ranging in diameter from 4"-8" and twenty valves >36" diameter were identified. The valve packing is an assumed friable miscellaneous ACM.

Several types of exterior non-friable caulk, sealants, and tar/roof flashing cements were confirmed to be ACMs on the PBF. Roofing materials including flashing cement and roofing tar were identified on parapet walls, at roof penetrations, on certain roof decks, on roof top equipment and other miscellaneous areas of the multiple PBF roofs. Some roofs were re-roofed with the asbestos-containing material located under newer roofing systems.

The boiler exhaust stack contains several suspect ACMs that could not be accessed for sampling primarily due to height and confined space entry constraints. Eagle reviewed the as-built drawings of the boiler exhaust stack to evaluate the stack for potential suspect ACMs. The stack was constructed in the late 1980's and there is a potential for ACMs to have been included in the construction of the stack. Eagle included the stack liner that was identified on drawings as an

assumed ACM as well as the paint on the upper third of the stack. These materials should be sampled prior to stack demolition to definitively classify them as ACM or Non-ACM prior to demolition. The stack liner is estimated at approximately two hundred fifteen (215) high with a 10' diameter based on information contained on the drawings.

Northeast Utilities Building

The electrical wire coating (HA#s 295, 434, and HA #303) were confirmed to be ACMs. HA# 295 is on wiring originating within the original control room of the building. The wiring is located on the back of the analog control panel, below the raised control room floor and feeds various equipment throughout the building. The wiring is located within asbestos cement conduit, metal conduit and is exposed. The wire coating is classified as a friable miscellaneous ACM. Eagle quantified approximately three-thousand six-hundred and fourteen (3,614) linear feet of HA #295 in the Northeast Utilities Building. HA# 434 is wire coating associated with the former switchgear boxes. Eagle quantified fifty (50) switch gear boxes with approximately two hundred twenty-four (224) linear feet of wire coating each. HA# 303 consists of small diameter wiring associated with the control desk, circuit panels and circuit breakers.

The high voltage cubicles located at elevation 11' contain asbestos cement board panels (HA# 304). There are multiple cubicles with asbestos cement board backing and shelving. The asbestos cement board is a non-friable miscellaneous ACM.

The asbestos cement conduits (HA# 377) house wiring with asbestos wire coating. The asbestos cement conduit includes exposed conduits as well as conduits encased in concrete with an average concrete encasement dimension of 3'x2', but varies depending on the quantity of conduits. The asbestos cement conduit is a non-friable miscellaneous ACM.

Flooring materials including asbestos-containing floor tile mastic (HA# 390), 12"x12" white with grey streak floor tile (HA# 419), 9"x9" black floor tile (HA# 430), and 9"x9" beige floor tile (HA# 435) were confirmed to be present within office space within the building. The floor tile and mastic are non-friable miscellaneous ACM.

The capacitors located within the bus closets contain an interior insulating asbestos paper (HA# 403) which is a friable miscellaneous ACM. There are approximately ninety-seven (97) capacitors.

The expansion board (HA# 406), which is present between the 1920 original construction and 1938 addition of the building was confirmed to be an ACM. The expansion board runs both vertically and horizontally at the interface of the two (2) buildings. The expansion board is estimated to be 12" wide and is estimated at 400 linear feet.

The tar at conduit penetration (HA# 404), mastic at ductwork wall penetration (HA#405), and tar coating on metal conduits (HA# 409) were confirmed to be ACMs. These non-friable miscellaneous ACMs are located in small quantities in localized areas.

The mastic at the bus closet ceilings (HA# 425) was confirmed to be an ACM. This non-friable miscellaneous ACM was applied at most bus closet ceilings on elevation 56'.25".

Gaskets associated with the incandescent light fixtures (HA# 686) and mastic on fiberglass pipe wrap and valve endcaps (HA# 236), summarized in the PBF building, were also identified in the Northeast Utilities Building.

The window glazing compound (HA# 739) associated with the fixed second and third story windows was assumed to be an ACM. The window glazing compound is classified as a non-

friable miscellaneous ACM. The window glazing compound was inaccessible for testing without breaking the glass. The window glazing compound (HA# 604) associated with the skylight windows was confirmed to be an ACM. The skylights are located on Roof 5.

Several types of exterior non-friable caulk and roofing materials were confirmed to be ACMs on the exterior and roofs of the building. Asbestos-containing flashing cement at penetrations and perimeter (base) of the roof and at the at skylight frame were confirmed to be ACMs. Asbestos-containing felt paper over tar on the concrete roof deck and the tar and felt paper under the rubber roof membrane on the parapet walls were confirmed to be ACMs. A tar coating on the structural steel in the roof top air handling room was also confirmed to be an ACM. Asbestos-containing caulk at aluminum flashing and at louvers were confirmed to be ACMs. The exterior tar, flashing cement, and caulk are miscellaneous ACMs.

PBF Administration Building

The window glazing compound in the corridor door view port windows (HA# 490) was confirmed to be an ACM. The window glazing compound is a non-friable miscellaneous ACM.

The moisture barrier (HA# 501) on the interior face of the perimeter brick walls was confirmed to be an ACM. The moisture barrier was spray or brush applied to the brick face (facing inward and behind interior wall finishes) to the exterior perimeter walls. The moisture barrier is a non-friable miscellaneous ACM.

Roof flashing cement (HA# 520), exterior caulk at aluminum flashing (HA# 521), and caulk at glass block windows frames (HA# 523) were confirmed to be ACMs. The flashing cement and caulks are miscellaneous non-friable ACMs.

The factory-applied window glazing compound associated with the double-hung windows (HA# 742) was inaccessible for testing without breaking the glass. The window glazing compound is an assumed miscellaneous ACM.

Jet Shop and Jet "Twin-Pacs"

The sealant between the window sash and frame (HA# 546) within the Jet Shop was confirmed to be an ACM. Eagle estimated approximately two-hundred ninety-five (295) linear feet of the non-friable miscellaneous ACM sealant at the windows within the building. An unknow type of stored jet engine part was labeled as ACM and is stored within the Jet Shop within room 2-09. Additional similar parts are assumed to be present within the assembled four Jet Twin Pacs. Eagle did not disassemble any components of the Jet Twin Pacs for internal inspection.

Screen House #1

The roof flashing cement (HA# 564) was confirmed to be an ACM. Gaskets (HA#s 746 and 748) and valves (HA#s 747 and 749) associated with screen house piping and the window glazing compound associated with the double hung windows (HA# 750) were inaccessible for testing and are assumed to be ACMs for the purpose of this report.

Screen House #2

Eagle did not access Screen House #2 for inspection due to the overall condition of the building. Several materials were assumed to be ACM for the purpose of this report.

Screen House #3

No confirmed ACM was identified. Gaskets (HA#s 759 and 760) and valves (HA#s 758 and 761) associated with screen house piping and the window glazing compound associated the double hung windows (HA# 762) were inaccessible for testing and are assumed to be ACMs for the purpose of this report.

Warehouse Building

The window glazing compound (HA# X524) and the caulk at the window frame (HA# 527) were confirmed to be ACMs. The window glazing and caulk are non-friable miscellaneous ACMs.

Gate 40 Warehouse

The sealant at the rectangular duct work flanges (HA# 659) was confirmed to be an ACM. The sealant was observed at thirty-six (36) flanges at four (4) linear feet each. The sealant is a non-friable miscellaneous ACM.

Northwest Guard Shack

The flashing cement (HA# 679) on the exterior belt course of brick was confirmed to be an ACM. Eagle observed approximately fourteen (14) linear of this non-friable miscellaneous ACM.

Demineralization Schack

The gaskets (HA# 764) and valve packing (HA# 765) associated with the piping in the building were assumed to be ACMs.

Concrete Ramp Near Sea Wall

Eagle observed flashing cement (HA# 766) on the concrete ramp near the sea wall which was assumed to be an ACM. Eagle observed approximately twenty (20) square feet of this non-friable miscellaneous ACM. This material was sampled elsewhere and was confirmed to be an ACM.

Pugmill

The roof flashing cement and roof fields (HA# 767) were inaccessible for testing and are assumed to be ACM.

Conclusion and Recommendations

Eagle completed an asbestos-containing materials study of the buildings and structures at the Site between July and September 2024. The asbestos-containing materials study was a non-destructive study for accessible suspect ACMs. Each building or structure included in the scope of services was systematically inspected by performing a physical inspection of the functional spaces within the buildings. A functional space is a room or group of rooms, or area in a building with a specific use. The physical inspection included a walkthrough of each functional space to locate and identify homogeneous areas of suspect ACMs for bulk sampling. Homogeneous areas were placed into three US EPA categories including Surfacing ACM, Thermal Systems Insulation ACM, and Miscellaneous ACM. Bulk samples of each homogeneous area were collected and analyzed by an accredited laboratory. A total of one- thousand five-hundred and seven (1,507) asbestos bulk samples were submitted for laboratory analysis by PLM and one-thousand three-hundred and ninety-four (1,394) samples were analyzed based on the stop on first

positive request to the laboratory. From the one thousand three hundred ninety-four (1,394) samples analyzed, one-hundred twenty-two (122) homogeneous areas were confirmed to be ACM (≥1% asbestos).

ACM that will be potentially be disturbed by renovation or demolition activities must be removed by a State of Connecticut licensed Asbestos Contractor for disposal as regulated waste. Certain non-friable ACMs may necessitate removal concurrently with building demolition based on their location and application. These ACMs generally include mastic and tar that is applied to structural members or to components where manually removal of the material would not be feasible. This removal scenario may require an Alternative Work Practice (AWP) to be approved by CT DPH. Visual inspections and re-occupancy air monitoring must be performed within each abatement area at the completion of the abatement work. The visual inspections and re-occupancy air monitoring must be performed by a State of Connecticut licensed Asbestos Project Monitor. The abatement areas must meet final visual and re-occupancy air monitoring criteria prior to work areas being re-occupied. Re-occupancy air monitoring is required if the building will be re-entered by any person following abatement and prior to demolition. This includes but is not limited to entry for utility disconnects, salvage, equipment removal, etc.

State of Connecticut Regulatory Notification Requirements

The Asbestos Abatement Contractor must submit a notice of asbestos abatement to the CT DPH post marked or hand delivered ten (10) calendar days prior to the commencement of any asbestos abatement activities involving the abatement of greater than ten (10) linear feet or twenty-five (25) square feet of asbestos-containing materials. The asbestos abatement notification satisfies the DPH regulatory requirements for demolition notification. For asbestos abatement projects involving less than ten (10) linear feet or twenty-five (25) square feet of asbestos-containing materials or projects where no regulated asbestos-containing materials are identified, the facility owner or any person who will be conducting demolition must submit a demolition notification to the CT DPH post marked or hand delivered ten (10) days prior to the commencement of demolition activities.

United States Environmental Protection Agency Notification Requirements

The facility owner/operator must provide a notification of demolition and renovation under the USEPA NESHAP regulation 40 CFR Part 61 Subpart M. The facility owner must submit notification to the USEPA for all demolition projects ten (10) working days prior to all demolition projects, which fall under the NESHAP regulation regardless of the presence of asbestos-containing materials. The facility owner must also provide notification to the USEPA for all renovation projects involving greater than one hundred sixty (>160) square feet or greater than two hundred sixty (>260) linear feet or thirty-five (35) cubic feet of regulated asbestos-containing materials.

State and federal notifications are completely independent of one another and both regulatory agencies must be notified when applicable.

ACMs that are not immediately removed are recommended to be managed under an asbestos Operations and Maintenance (O&M) program. The primary objective of an asbestos O&M program is to clean up existing contamination and repair or remove damaged ACMs, minimize future fiber release, and properly maintain ACM until it is removed. These objectives can generally by achieved by implementing administrative controls, labeling ACM, providing training to facilities personnel, and providing notification to outside vendors who may perform routine maintenance work at the facility and utilizing trained and accredited contractors and personnel to perform asbestos related services. An Asbestos Program Manager (APM) should be assigned to oversee implementation of the O&M program.

The duties of building and facilities owners under the OSHA Asbestos in Construction Standard include determining the presence, location, and quantity of ACM and/or PACM at a facility prior to work subject to the OSHA Standard is begun. This duty has generally been accomplished through completion of this inspection. However, future targeted inspections may be necessary should specific construction activities be planned that involves activities that may impact areas or suspect materials outside the scope of this inspection.

Building and/or facility owners shall also notify the following persons of the presence, location, and quantity of ACM or PACM at the work sites in their buildings and facilities:

1. Prospective employers applying or bidding for work whose employees reasonably can be expected to work in or adjacent to areas containing ACM or PACM.
2. Employees of the owner who will work in or adjacent to areas containing ACM or PACM.
3. On multi-employer worksites, all employers of employees who will be performing work within or adjacent to areas containing ACM or PACM.
4. Tenants who will occupy areas containing ACM or PACM.

The OSHA in Construction Standard also requires that labels be affixed to all products containing asbestos and to all containers containing such products, including waste containers.

Limitations

The asbestos-containing materials inspection was a s study-level study that included accessible suspect ACMs and accessible areas of the buildings and structures only. The inspection was limited to areas that could readily and safely be accessed for inspection. Areas that required confined space entry or were limited for access due to height or other physical constraints, or presented a potentially dangerous condition to the inspection team, were excluded from the inspection. Eagle did not disassemble any equipment for internal inspection. Reasonable care was taken to identify all suspect accessible asbestos-containing materials by performing a physical inspection and bulk sampling. However, it is not always feasible to locate all suspect ACM that may exist within or on a building and there is a possibility of hidden or concealed suspect ACM within or on the buildings. Should additional suspect ACMs be discovered, they must be presumed to be asbestos-containing until sample analysis proves otherwise.

This report provides information on the presence or absence of asbestos in building materials at the Site. The report is not intended for use as a bid document or scope of work for asbestos abatement. Should asbestos abatement be required, a State of Connecticut licensed Asbestos Project Designer should be retained to develop plans and technical specifications for asbestos abatement. Unique conditions may exist that require abatement design strategies specific for the project, which must be considered during abatement scope development. An Alternative Work Practice may be required to address Site-specific conditions that would allow for an unconventional abatement approach.

Introduction

Eagle performed a lead-based paint screen of the Site buildings and structures to screen painted surface coatings for lead. The lead-based paint screen included the interior and exterior accessible painted surfaces of the Site buildings and structures. It was not the intent to test every painted surface throughout the Site buildings or structures. Rather, the lead paint screen was intended to evaluate painted surface coatings to develop data to support future waste stream disposal resulting from demolition or renovation activities and to provide data to contractors that may perform paint disturbing activities requiring compliance with the OHSA Lead in Construction Standard 29 CFR 1926.62.

Lead is a naturally occurring element in the earth's crust. Although useful in some applications, lead is a harmful toxin, and if inhaled or ingested can lead to serious health conditions. Children under the age of six (6) years old, whose brain, central nervous system, and organs are still developing, are at the greatest risk for negative health effects related to lead exposure. Children can be exposed to lead dust that is generated from renovation activities, from moveable parts of windows and doors that when operated create lead dust, soil contaminated with lead paint, and from lead piping or fixtures that provide potable water to residential buildings and schools. Health effects to children related to lead exposure can lead to damage to the brain and nervous system, decreased cognitive skills, lowered IQ and behavioral problems, organ damage, seizures, and in some circumstances, coma, and death. Lead poisoning is one of the most preventable childhood diseases but still persists today. Lead-based paint was banned for residential use in 1978, but commercial applications continued beyond the 1978 ban.

Lead is not only harmful to children but can also be harmful to adults when exposed to lead dust or lead fumes. Adults can become lead poisoned through various types of construction activities including renovation or demolition work that disturbs lead paint, paint removal from bridges and steel structures, handling of soil contaminated with lead, and even certain hobbies that utilize lead such as ammunition reloading or making lead fishing weights. Lead exposure to adults can lead to reproductive health issues including increased risk of miscarriage and birth defects, kidney damage and increased blood pressure. Lead exposure is regulated in the construction industry under the OSHA Lead in Construction Standard 29 CFR 1926.62. The OSHA Lead in Construction Standard is intended to protect employees from lead exposure during tasks that disturb lead paint or other lead-contaminated materials during construction activities. The OSHA Lead in Construction Standard has established an Action Level (AL) and Permissible Exposure Limit (PEL) that triggers regulatory compliance when these airborne exposure levels are approached or surpassed.

Lead bearing materials can be a potential hazardous waste if taken off-site for disposal. The CT DEEP regulates hazardous waste disposal on a State level which incorporates federal hazardous waste disposal regulations. Waste streams containing lead are required to be evaluated for hazardous waste through testing or knowledge of process. A waste stream is a group of waste materials that are generated during renovation or demolition activities or during soil remediation activities. Waste streams can be made up of multiple wastes or may be one single waste. Building demolition often results in multiple types of waste streams including but not limited to solid waste materials that will be disposed of in an off-site landfill, masonry or metal materials that may be recycled at an approved recycling facility, and regulated asbestos waste or other wastes requiring special disposal due to the presence of other regulated or hazardous constituents. These waste streams are generally transported to separate facilities for disposition or recycling. The solid waste waste stream may include painted building materials that contain lead which will require evaluation for hazardous lead waste. Masonry with lead paint coatings may also require a hazardous lead waste determination.

The approved testing method for determining if a waste stream is hazardous is the Toxicity Characteristic Leachate Procedure (TCLP) test. The TCLP test subjects a sample or samples collected from each waste stream to simulated landfill conditions and determines the amount of leachable lead in the sample. Samples that leach equal to or greater than 5.0 mg/L by the TCLP method are characterized as hazardous lead waste. Hazardous lead waste disposal costs are significantly higher than non-hazardous solid waste disposal costs.

The lead paint screen was performed to identify on a broad scale lead coatings on building materials that will assist contractors performing work in the building with developing a lead compliance plan for the work. The lead paint screen also provides valuable data to aid in the development of a lead disposal management plan for managing waste streams that will be generated during renovation or demolition activities. No TCLP sampling was included in Eagle's scope of services.

Lead Testing Protocols

The lead paint screen was performed utilizing an X-Ray Fluorescence (XRF) Radiation Monitoring Device (RMD) Lead Paint Analyzer (LPA 1), serial number 2753. The RMD LPA 1 utilizes a radioactive source, Cobalt 57, to "excite" the lead particles which fluoresce. The instrument measures the amount of fluorescence through the bezel of the instrument and converts the measurement into milligrams of lead per square centimeter (mg/cm^2). Lead based paint in a dried paint film as measured by an XRF instrument is defined as paint or other surface coatings containing equal to or greater than 1.0 mg/cm^2 of lead. This definition of lead-based paint generally applies to residential applications and school buildings occupied by children under the age of six years old. OSHA does not currently define a threshold level of lead in paint where OSHA Lead in Construction Standard would not apply. Any measurable amount of lead in paint by XRF triggers compliance with the OSHA Lead in Construction Standard.

For the purpose of this report, the XRF results are separated into two (2) categories; high levels of lead ($\geq$1.0 mg/cm^2) and low levels of lead (<1.0 mg/cm^2). Building materials containing surface coatings with high levels of lead may have a greater probability of creating worker exposure during construction activities. Additionally, a site-specific lead waste characterization sampling plan should be developed considering both high and low levels of lead The XRF Performance Characteristic Sheet (PCS) identifies the RMD LPA 1 as having +/- 0.3 mg/cm^2 tolerance.

The XRF is capable of measuring lead in up to, and sometimes beyond, thirty (30) layers of paint. The XRF does not indicate at which depth the layer of lead paint is at, but this is less important for construction activities and waste disposal characterization testing than it may be for designing a lead abatement project in a residential setting. The XRF screening is a non-destructive testing method that does not create damage to the surface coating.

All inspectors utilizing an XRF instrument undergo manufacturer radiation safety training and instrument operations training. Inspectors utilize dosimetry badges to monitor radiation exposure during testing. Quarterly radiation exposure monitoring reports are monitored by Eagle's Health and Safety Officer to evaluate radiation exposure rates relative to permissible exposure limits (PEL). All of Eagle's XRFs are registered with CT DEEP.

The lead paint screening included a general XRF screening of painted surface coatings within the accessible interior and exterior areas of the building. The inspector performs a visual inspection to identify painted surface coatings for testing. The component type, location, substrate, surface coating color and paint condition are recorded on a Portable Data Recorder (PDR). Once the testing information is entered into the PDR, the inspector tests the component with the XRF to obtain a lead measurement in the paint coating. The XRF measurement includes a reading number and test result. The data on the PDR and XRF are merged through the RMD report editing software which generates an electronic report for the testing.

Testing included building components with painted surface coatings. XRF Testing was performed to develop testing data of representative building components within or on each building. Building components that are generally tested for renovation or demolition purposes include but are not limited to structural steel, walls, ceilings, windows, doors, floors, steel grates, catwalks, painted piping, equipment, glazed brick and block, unique architectural features, and exterior facades. Similar components with different substrates are considered during the testing (i.e. brick walls vs. plaster walls or metal doors vs. wood doors), since each could have different painting histories or factory primer applications.

The electronic lead paint testing reports are organized into three sections consisting of the cover page, the summary report, and the detailed report. The cover page provides information specific to the project including the XRF report number, which includes the serial number of the instrument and the date and time the XRF testing was initiated, client information, Site information, inspection date, instrument type and serial number, Action Level for a positive or high result, building name and areas tested, and inspector information. The summary report provides the inspection date, report date, Action Level, report number, total number of readings collected, total number of readings exceeding the Action Level set on the instrument, and the inventory of components which contain a surface coating above the action level. If no readings exceeded the Action Level, the summary report will simply indicate "End of Readings". The detailed report provides the total inventory of tested components for the building or area. Both the summary report and detailed report include specific testing information including the XRF reading number, the room or area designation, the component type, the paint condition, the substrate, the color and the lead concentration in mg/cm^2. The room numbers contained on the electronic lead-paint inspection report correspond to the room numbers contained on the general layout plans. Side designations representing a component location within a room or on a building correspond as follows:

WPF: "A Side" is Maxin Road or Project South
"B Side" is Project West
"C Side" is Project North
"D Side" is Project East

PBF: "A Side" is Reserve Road or Project West
"B Side" is Project North
"C Side" is Project East
"D Side" is Project South

Individual lead paint inspection reports were developed for the following buildings/areas and are included in Appendix D:

WPF

1. WPF Interiors
2. WPF Exteriors
3. WPF Roofs
4. WPF Maneuvering Hall
5. WPF RDF Storage
6. Transfer Building
7. Coal Barge Unloading Building
8. Scale houses
9. Odor Control Equipment

PBF

1. Ash Alley
2. Ash Loadout
3. Bag Houses and Dry Scrubbers
4. Coal Pond Pump House
5. Boilers 9 and 10
6. Boiler Area (Building)
7. Boiler Area and Building Interiors at Combustion Units 11, 12, 13
8. Combustion Units 11, 12, 13
9. Building Interiors at Combustion Units 11, 12, 13
10. Combustion Units Building (Cont.)
11. Demineralization Shack
12. Gate 40 Warehouse
13. Exhaust Stack and Lime Silo
14. Northwest Guard Shack
15. PBF Administration Building (2 reports)
16. PBF Administration Exteriors
17. PBF Roofs
18. Dirt Cellar
19. Screen Houses
20. Scrubber Control Room
21. Warehouse Exteriors
22. Wheel Wash and Storage Garage
23. Turbine Hall (3 Reports)
24. Jet Shop and Jet Power Packs
25. Northeast Utilities Building (4 Interior Reports)
26. Northeast Utilities Building Exteriors
27. Northeast Utilities Building Roofs

Lead Paint Testing Results

A total of two-thousand three-hundred eighty-three (2,383) XRF measurements were collected with three-hundred and seventy-five (375) readings were identified as containing "High" levels of lead at or above the Action Level of 1.0 mg/cm^2. The following summarizes the results of the XRF testing:

WPF (Interior, Exterior, Roofs, Maneuvering Hall, RDF Storage, Transfer Building, Coal Barge Unloading Building, Scale Houses, Odor Control Equipment)

A total of three-hundred sixty-eight (368) XRF readings were collected throughout the WPF. From the three-hundred sixty-eight (368) XRF readings, the metal catwalk railings (black) within the Maneuvering Hall and the fuel line (blue), steel container shell (tan), electric motor framework (orange), and winch gearbox (orange) at the Coal Barge Unloading Building were confirmed to contain high levels of lead in paint. The metal handrails may be recycled as scrap metal. No other tested surfaces were found to contain lead concentrations above the 1.0 mg/cm^2 Action Level established for the project.

PBF

A total of two-thousand fifteen (2,015) XRF readings were collected throughout the PBF. From the two-thousand fifteen (2,015) XRF readings, three-hundred sixty-nine (369) readings were confirmed to contain high levels of lead in paint. The following summarizes the results of the XRF testing throughout the PBF:

Ash Alley

A total of two-hundred nineteen (219) XRF readings were collected within Ash Alley with fifty-nine (59) readings containing high levels of lead. High levels of lead were identified in surface coatings on steel piping (green), metal stair components (yellow and silver), freight doors (green and black), metal fuel lines (orange), interior of the steel breeching (black), metal door frames (various colors), metal window components (various colors), plaster walls (various colors), steel columns (white), terracotta wall (green), concrete column (black) and brick walls (black). Several solid waste materials including plaster, terracotta, wood freight doors, concrete, and brick contain high levels of lead in paint coatings. These waste streams will require TCLP sampling to characterize the materials for disposal. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Dirt Cellar

A total of thirteen (13) XRF readings were collected in the Dirt Cellar with one (1) reading containing a high level of lead, which included the stored wood cabinet (grey). The wood cabinet should be characterized for proper disposal by TCLP sampling.

Boilers 9 and 10

A total of forty-eight (48) XRF readings were collected from Boilers 9 and 10 with nineteen (19) XRF readings containing high levels of lead. High levels of lead were identified in surface coatings on the boiler shell to Boiler 9 (silver), fuel supply piping (orange), structural steel (green), catwalk supports (green), and boiler opening framing on Boiler 10 (silver). The metal components associated with the boilers may be recycled as scrap metal following decontamination from asbestos abatement activities and if no other regulated or hazardous constituents are present. Certain structural steel also contains paint containing greater than 50 parts per million PCB. TCLP sampling of the steel will be necessary to characterize the steel for proper disposal since PCBs in the paint will likely preclude it from being recycled.

Boiler Area (Building)

A total of thirty-five (35) XRF readings were collected within the Boiler Area with ten (10) XRF readings containing high levels of lead. High levels of lead were identified in surface coatings on the steel framework (green), tank (silver), tank supports (green), railings (yellow), coal hopper casings (silver), structural steel (silver), and plaster on columns (green). The plaster containing high levels of lead in the associated paint coating will require TCLP sampling to characterize the material for disposal. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present. Certain structural steel also contains paint containing greater than 50 parts per million PCB. TCLP sampling of the steel will be necessary to characterize the steel for proper disposal since PCBs in the paint will likely preclude it from being recycled.

Boiler Area and Building Interiors at Combustion Units 11, 12, 13

A total of eighty-eight (88) XRF readings were collected within the Boiler Area and Building Interiors housing Combustion Units 11, 12, and 13 with twenty-five (25) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings on metal door frames (grey), brick walls (silver and green), steel columns (silver and green), metal window frames (green), a wood freight door (green), terracotta walls (green), plaster walls (green), and metal wall panels (silver and green). Several solid waste materials including plaster, terracotta, wood freight doors and brick contain high levels of lead in paint coatings. These waste streams will require TCLP sampling to characterize the materials for disposal. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Building Interiors (Cont.) at Combustion Units 11, 12, 13

A total of fifty-nine (59) XRF readings were collected within the interior of the Building Interiors housing Combustion Units 11, 12, and 13 with six (6) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings on metal door frames (green), steel columns (green), and metal window frames (green). The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Combustion Units 11, 12, 13

A total of fifty-one (51) XRF readings were collected from Combustion Units 11, 12, and 13 with two (2) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings on equipment MCC-421 housing (yellow), and electric scale motor case (orange) on the combustion units. The metal components may be recycled as scrap metal.

PBF Exteriors

A total of thirty-seven (37) XRF readings were collected from the exterior of the PBF with seven (7) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings on the metal stair stringers (yellow), overhead door frame (grey), freight door (blue), steel window sash (grey), pipes (yellow), window frames (red) and steel door (green). The metal components may be recycled as scrap metal excluding window sashes. The Window sashes will require TCLP sampling since the sashes contain asbestos-containing glazing compound and will be disposed of within an asbestos landfill.

PBF Roofs

A total of twenty-two (22) XRF readings were collected from the roof areas of the PBF with one (1) XRF reading containing a high level of lead. High levels of lead were identified on surface coatings associated with a blue steel vent on Roof 4. The metal component may be recycled as scrap metal.

Turbine Hall

A total of one-hundred fifty-two (152) XRF readings were collected from Turbine Hall with twenty-eight (28) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with the steel I-beams (green), concrete ceilings (silver), metal stair systems (blue and green), concrete columns (black), Turbine 6 casing (black), metal door frames (grey), railing balusters (black), and brick walls (cream and blue). The brick and concrete containing high levels of lead will require TCLP sampling to characterize the waste streams for disposal. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Northeast Utilities Building

A total of five-hundred fifty-four (554) XRF readings were collected from the Northeast Utilities Building with one-hundred fifty-nine (159) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with the metal stair systems (green and white), steel columns (green), concrete walls (green), wood walls (yellow), metal door systems (grey), plaster (white), pipes (various colors), ceramic wall tiles (white), HVAC ducts (various colors), brick walls (green), metal window sashes (black), and control panel frame (black). Several solid waste materials including plaster, brick, concrete, and limited wood components contain high levels of lead in paint coatings. These waste streams will require TCLP sampling to characterize the materials for disposal. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present

Bag Houses and Dry Scrubbers

A total of twenty-two (22) XRF readings were collected from the Bag Houses and Dry Scrubbers with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Scrubber Control Room

A total of thirty-three (33) XRF readings were collected from the Scrubber Control Room with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Main Boiler Exhaust Stack and Lime Silo

A total of twenty (20) XRF readings were collected from the Boiler Exhaust Stack and Lime Silo with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Demineralization Schack

A total of fourteen (14) XRF readings were collected from the Demineralization Shack with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Ash Loadout Building

A total of nineteen (19) XRF readings were collected from the Ash Loadout Building with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

PBF Administration Building

A total of two-hundred thirty-seven (237) XRF readings were collected from the PBF Administration Building with thirty-three (53) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with ceramic wall tiles and ceramic windowsills, exterior steel window frames, and steel stair components (cream). The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present. The ceramic tiles will require TCLP sampling to characterize the waste stream for disposal.

Wheel Wash Building and Storage Garage

A total of thirty-five (35) XRF readings were collected from the wheel Wash Building and Storage Garage with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Screen Houses 1 and 3

A total of seventy-nine (79) XRF readings were collected from Screen Houses 1 and 3 with eight (8) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with the metal stair railings (grey) on Screen House 1 and the metal stair stringers and railings (grey), metal ladder (grey), and metal door frames (grey) at Screen House 3. Screen House 2 was not accessible for testing based on its condition. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Coal Pond Pump House

A total of twenty (20) XRF readings were collected from the Coal Pond Pump House with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Gate 40 Warehouse

A total of fifty (50) XRF readings were collected from the Gate 40 Warehouse with no XRF readings containing high levels of lead. No further action is required regarding lead-based paint disposal.

Northwest Guard Shack

A total of thirty-three (33) XRF readings were collected from the Northwest Guard Shack with one (1) XRF reading containing a high level of lead. High levels of lead were identified on surface coatings associated with the metal door frame (cream). The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Warehouse

A total of eighteen (18) XRF readings were collected from the Warehouse with two (2) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with the overhead metal door frames (grey and orange). The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Jet Shop and Jet "Twin-Pacs"

A total of one-hundred fifty-seven (157) XRF readings were collected from the Jet Shop and Jet "Twin-Pacs" with eight (8) XRF readings containing high levels of lead. High levels of lead were identified on surface coatings associated with the exterior metal doors and door frames (blue) and ceramic floor tile (grey) at the Jet Shop, and on Power Pac (JTC-12) shell (façade). All power pac shells are presumed to contain high levels of lead in the paint surface coating. The metal components may be recycled as scrap metal if no other regulated or hazardous constituents are present.

Conclusion and Recommendations

Eagle performed a lead paint screen of the Site buildings and structures between July and September 2024. The lead-based paint screen included surface coating testing utilizing an XRF lead paint analyzer. Representative interior and exterior painted surfaces were screened for lead and not all surfaces were tested. The intent of the lead paint testing was to screen building materials with painted surface coatings for lead to develop data that can be used to support future renovation or demolition activities at the Site.

A total of two-thousand three-hundred eighty-three (2,383) XRF measurements were collected with three-hundred seventy-five (375) readings containing "high" levels of lead or above the Action Level of 1.0 mg/cm^2. Six XRF readings recorded within the WPF and two-hundred sixty-nine XRF readings recorded within the PBF were at or above the Action Level of 1.0 mg/cm^2. The six XRF readings at or above 1.0 mg/cm^2 at the WPF were obtained from surface coatings on metal components that can be recycled as scrap metal. Within Ash Alley, the Boiler Area, and Interior Building Area around Combustion Units 11, 12, 13, XRF readings collected from brick, plaster, and concrete were at or above 1.0 mg/cm2 and will require waste characterization sampling prior to disposal. The CT DEEP guidance allows for whole building composite samples for buildings undergoing mass demolition. The whole building composite sample includes the

lead-contaminated materials and non-lead materials representative of the entire demolition waste stream. The whole building composite samples often test out as non-hazardous solid waste due to amount of non-lead materials in the sample.

The steel window sashes associated with the PBF Boiler Area contain asbestos-glazing compound and also contain lead in the paint surface coating on the sashes. A TCLP of the window sashes will be required since the sashes will be disposed of in an asbestos landfill and cannot be recycled as a result of the asbestos-containing glazing compound.

Ceramic tile glazing in the PBF Administration Building was confirmed to contain lead in the glazing and will require waste characterization prior to disposal.

Multiple components in the Turbine Hall and Northeast Utilities Building contain high levels of lead in paint coatings on solid waste materials and will require TCLP sampling for waste disposal characterization. Whole building composite samples can be collected if the buildings undergo mass demolition. Composite samples can be calculated to include the lead-contaminated and non-lead-contaminated building materials. Metal components may be recycled if no other regulated or hazardous constituents are present.

The lead paint testing data can be used by contractors to assist them in developing a site-specific lead paint compliance plan for renovation or demolition activities. Contractors performing work at the Site will be required to maintain compliance with the OHSA Lead in Construction Standard when performing work activities that disturb lead. A limited quantity of tested components contain lead at detectable levels on the XRF but below the 1.0 mg/cm2 Action Level (low levels) established for the project. Contractors who will perform work that disturbs the painted surfaces with detectable levels of lead must perform an initial exposure assessment to determine if lead exposures are at or above the Action Level of 30 $\mu g/m^3$ of airborne lead. The initial exposure assessment must be performed on employees who have had lead awareness training and who are capable of utilizing personal protective equipment during the exposure assessment.

The lead-based paint testing data can also be used to develop a lead disposal sampling plan once the final scope of renovation or demolition is determined. Lead is a potential hazardous waste and testing by the TCLP method will be required to characterize the renovation or demolition of waste streams for disposal. Solid waste materials that contain lead in the paint surface coating and which will be disposed of in a landfill will require waste disposal characterization testing. The CT DEEP *Guidance for the Management and Disposal of Lead-Contaminated Materials Generated in the Lead Abatement, Renovation, and Demolition Industries* outlines strategies for managing lead-contaminated materials for disposal. The document provides regulatory guidance for the waste management aspects of lead abatement, renovation, demolition, and soil remediation projects. The guidance includes general protocols for waste characterization, handling, storage, transportation, and off-site disposal of lead-contaminated waste streams. Specific strategies for managing the lead-contaminated materials identified during the lead paint screening will be necessary during planning phases of any future projects which affect the buildings at the Site.

8. Universal Waste Materials And Other Hazardous Materials

Introduction

Eagle performed a visual inspection for universal waste materials and other hazardous materials (OHMs) including lighting ballasts, capacitors, or switches that could contain Polychlorinated Biphenyls (PCBs) or Di-ethylhexlpthalate (DEHP) within the dielectric fluid associated with the component, electronic wastes (e-waste), refrigerants including Chlorofluorocarbons (CFCs) and Hydrochlorofluorocarbons (HCFCs). Stored chemicals, containerized paints and solvents, household cleaning chemicals and stored containerized petroleum products were also inventoried where observed. The visual inspection included a walkthrough of the Site buildings to visually identify potential universal waste materials or OHMs. The visual inspection did not include any material sampling. The inspector located and identified each type of universal waste material or OHM and developed an estimated quantity of each material within the room or area being inspected. Eagle did not disassemble equipment or fixtures for internal inspection. Assumptions were made as to the presence of certain materials within equipment and fixtures when deemed appropriate by the inspector. Components within buildings constructed after the ban on certain types of OHMs were not included in the inventory. An inventory of universal waste materials and OHM is provided in Table III.

Universal Waste Materials

Universal waste materials are a group of wastes that are commonly generated by a wide variety of establishments, and which are regulated by the US EPA under 40 CFR Part 273 Standards for Universal Wast Management. The Universal waste materials regulated under the US EPA include the following materials:

Batteries

A device consisting of one or more electrically connected electrochemical cells which is designed to receive, store, and deliver electric energy. Batteries including lead-acid batteries and lithium batteries can contribute to environmental contamination. Batteries can release chemicals into soil and water as they corrode and breakdown impacting ecosystems. Lithium batteries can be volatile and result in fires which release harmful gases into the atmosphere.

Pesticides

A pesticide is any substance or mixture of substances intended for preventing, destroying, repelling, or mitigating any pest, or intended for use as a plant regulator, defoliant, or desiccant. Stored unused pesticides are a universal waste material while applied pesticides are not.

Mercury-Containing Equipment

A device or part of a device (including thermostats but excluding batteries and lamps) that contains elemental mercury integral to its function. Thermostatic controls with mercury ampules, mercury switches, manometers, natural gas meters and other items can contain enough mercury to be classified as a special waste, and therefore require special disposal or recycling. The mercury associated with these products must be reclaimed prior to renovation or demolition activities that could potentially disturb the materials creating a release.

Lamp

A lamp is the bulb or tube portion of an electric lighting device. A lamp is specifically designed to produce radiant energy most often in the ultraviolet, visible, and infra-red regions of the

electromagnetic spectrum. Examples of common universal waste electric lamps include, but are not limited to, fluorescent, high intensity discharge, neon, mercury vapor, high pressure sodium, and metal halide lamps. Lamps must be removed for reclamation prior to renovation or demolition activities that could disturb the materials creating a release.

Aerosol Cans

An aerosol can is a non-refillable receptacle containing a gas compressed, liquefied, or dissolved under pressure, the sole purpose of which is to expel a liquid, paste, or powder and fitted with a self-closing release device allowing the contents to be ejected by the gas. Propellants in the aerosol can release CFCs into the air which damage the ozone layer. Other chemicals within the aerosol can may also be harmful to the environment and to people when exposed to them.

OHMs

OHMs included within the scope of this inspection include PCBs or DEHP in electrical equipment, excluding transformers that were previously inventoried under past investigations, refrigerants that may contain CFCs or HFCs, and e-wastes. Certain types of exit signs may contain Tritium which is a naturally occurring radioactive isotope that can light an exit sign without the use of batteries or electricity.

PCB and DEHP Containing Equipment

PCB and DEHP lighting ballasts and electrical equipment, including capacitors and switches that contain PCBs, are regulated under the Toxic Substances Control Act of 1976 (TSCA) which bans the manufacturing and distribution of PCBs and regulates their storage and disposal.

PCBs and DEHP can be found in a number of items, including lighting ballast and electrical equipment, including capacitors and switches. DEHP and PCB-containing items such as these must be managed and disposed of in accordance with special requirements. A visual inspection for the presence of lighting ballasts and electrical equipment potentially containing PCB's or DEHP was performed within the Site buildings. Lighting ballasts and oil-filled capacitor manufactured after 1979 may have "NO PCB's" stamped on its casing. These are filled with oil which does not contain PCB's but may contain DEHP. Lighting ballasts and Capacitors with date stamps prior to 1979 or no date stamps are assumed to contain PCB's. Lighting ballasts and capacitors labeled as "No PCB's" are assumed to contain DEHP if the date stamp is illegible or non-existent. Electronic ballasts are not assumed to contain PCB's or DEHP and may be recycled.

Refrigerants

Freon gas includes a number of gaseous, colorless chlorofluorocarbons (CFCs) that are commonly used as refrigerants. Freon is listed as a controlled substance by governments around the world. In the United States, the USEPA regulates the emission of Freon gas into the atmosphere due to its ozone depleting capabilities. Through Title VI, Stratospheric Ozone Protection, of the Clean Air Act Amendments of 1990, the USEPA regulates Freon gas and requires mandatory recycling and a ban on the intentional venting or releasing of refrigerants during maintenance, service and or repair. Hydrochlorofluorocarbons (HCFC) were used as substitutes for CFC applications such as refrigerants and aerosol propellants but is also considered an ozone-depleting substance.

Electronic Wastes (E-Waste)

Electronic Waste (e-waste) includes anything with plugs, cords and electronic components and includes but is not limited to televisions, computers and monitors, mobile phones, appliances and air conditioners. Most e-wastes contain toxic metals that can lead to environmental

contamination if not properly recycled. E-waste is the fastest growing portion of disposal waste streams. Proper recycling of e-waste is important to ensure the hazardous components associated with the products are not released into the environment from improper disposal or recycling. Computer monitors and televisions can contain leaded glass and printed circuit boards can contain a variety of metals including beryllium, mercury, cadmium, nickel, zinc, silver, and gold. Connecticut enacted an e-waste recycling law in July 2007 which allows Connecticut residents to properly recycle certain covered electronics such as computers, monitors, printers, and televisions at no cost.

Miscellaneous Stored Chemical and Products

Stored chemicals, containerized paints and solvents, household cleaning chemicals and stored containerized petroleum products were inventoried throughout the buildings and where observed. These types of products may require special disposal and should not be disposed of in solid waste landfills.

Inspection Protocols

Eagle performed a visual inspection for universal waste materials and OHMs throughout the Site buildings. The inspection included a room-by-room inventory for potential universal waste materials and OHMs. The visual inspection was limited to the universal waste materials and OHMs described within this report. Only accessible areas of the buildings were inspected. Inaccessible areas include areas requiring confined space entry, internal parts of equipment or building systems, areas not accessible due to height constraints, or other areas of the buildings that could not be safely accessed.

The inspection was initiated in the WPF buildings and proceeded to the PBF buildings. The inspector inventoried and recorded each potential universal waste material or OHM on a field inspection log. Room or area numbers were recorded on the field inspection log with the type of universal waste material or OHM and an estimated quantity was developed. Representative lamps were disassembled on a case-by-case basis to determine types and quantities of lighting ballasts within each lamp type. Lighting ballasts were inspected for date stamps, labels indicating "No PCBs" or an identification that the ballast is electronic. Lighting ballasts were quantified per unit. Fluorescent light tubes are assumed to contain mercury vapors and are quantified in linear feet. Covers to thermostatic controls were removed to determine the presence or absence of a mercury ampule. Electric motors, where observed, were assumed to contain a running capacitor with PCB or DEHP dielectric fluid. Capacitors were not dismantled to determine the presence or absence of dielectric fluid. There is a potential for some capacitors listed on the inventory to be a dry-type capacitor. E-wastes were quantified by unit.

Results and Conclusions

Eagle completed a visual inspection for universal waste materials and OHMs within and on the exteriors of the Site buildings. The inventory of universal waste materials and OHMs is provided in Table III Universal Waste Materials and OHM Summary Table. The room numbers identified on Table III correspond with the room numbers contained on the general layout plans of the buildings.

Universal Waste Materials

Batteries, Lamps, Mercury Equipment, Aerosols, Pesticides

Several types of universal waste materials were identified throughout the Site buildings including mercury vapor light tubes, compact fluorescent lights (CFLs), sodium or metal halide lights, thermostatic controls with mercury ampules, batteries associated with fire alarms, exit signs, emergency light systems, emergency circuit units, fire alarm panels, electric motors, projector

and projector screen motor, computer server banks, and miscellaneous battery operated equipment. Eagle observed no pesticides but did observe herbicides including two (2) quarts of weed killer in the Jet Shop.

Eagle quantified nine-thousand eight-hundred and ninety-five (9,895) linear feet of fluorescent lights throughout the WPF and PBF. Mercury vapor light tubes may be recycled by at an appropriate recycling facility while mercury ampules will require disposal has hazardous waste. Eagle observed sixty-one (61) thermostatic controls with mercury ampules. The quantity and locations of the specific items containing fluorescent lamps and thermostatic controls are provided in Table III.

Six-hundred and forty-five (645) lead acid batteries associated with emergency light systems, exit signs, fire alarm systems and miscellaneous equipment were identified. Several small dry cell batteries were also observed throughout the facility and were quantified and are included in the universal waste and OHM inventory. Eagle did not observe any radioactive markings on the exit signs that would indicate them to contain Tritium. The quantity and locations of the specific items containing batteries are provided in Table III.

Eagle identified approximately two-hundred and eighty-five (285) aerosol cans containing different types of products. The volume of product within the aerosol cans varied. The aerosol cans must be collected for proper recycling prior to renovation or demolition activities. The quantity and locations of the aerosol cans are provided in Table III.

The universal waste materials must be removed for proper recycling or disposal if they become a waste product as a result of renovation or demolition activities. Universal waste materials may legally be stored on site while awaiting disposal for up to one year. Maintenance activities that result in the removal or replacement of universal waste materials, such as changing out mercury vapor lights, should include proper waste packaging of the material, labeling, and proper recycling or disposal. Recycling and disposal records should be maintained for any universal waste material taken off site for recycling or disposal.

OHMs

The inspection for OHMs identified a myriad of different types of materials and products that will require removal from the buildings and special disposal prior to renovation or demolition activities. The following summarizes the findings of the OHM inspection:

CFCs and HCFCs

Window air conditioners and mini-split units potentially containing CFCs or HCFS were identified in the WPF in Rooms 1,02, 1-05, 1-15, 1-20, Fuel House, WPF roof top units, and at the Re-Therm Systems RTO #1 and RTO #2. Window unit air conditioners were also observed in the Tool Shop, and at Scale Houses #1, #2, and #3.

Within the PBF buildings CFCs or HCFCs were identified in window air conditioning units in Ash Alley, mini-split units in the PBF Boiler Area in room 0-23, refrigerator units in Room 0-56, Elevation 11 of the Turbine Hall, mini-split and window air conditioners in the Northeast Utilities Building, a commercial refrigerator, window air conditioners and an air conditioner condenser in the PBF Administration Building, window air conditioners and min-splits in the Jet Shop, a window air conditioner in the Pump Room of the Wheel Wash Building, in window air conditioner and mini-fridge in the Gate 20 Guard Shack.

The CFCs and HCFCs must be reclaimed prior to disposition of the associated equipment. The equipment may be salvaged and reused elsewhere but venting of the refrigerants during salvage operations is unlawful. The quantity and locations of the specific items containing CFCs or HCFCs are provided in Table III.

Ballasts and Capacitors

Capacitors associated with electrical motors and equipment and lighting ballasts associated with Site lighting were identified throughout the buildings. The capacitors are assumed to contain PCB dielectric fluid. The majority of lighting ballasts in the WPF buildings were identified as electronic with the exception of a limited quantity of unmarked lighting ballasts. The electronic ballasts may be recycled, and the unmarked ballasts are assumed to contain DEHP. Lighting ballasts within the PBF buildings generally were not marked as electronic and did not contain labels indicating "No PCBs." The lighting ballasts throughout the PBF buildings are assumed to contain PCB dielectric oil and must be removed for proper disposal or incineration prior to renovation or demolition activities. Leaking ballasts must be separated from non-leaking ballasts for disposal. Lamp covers or reflectors with oil staining from leaking ballasts must also be properly disposed of. Eagle quantified approximately 123 PCB ballasts and 391 DEHP ballasts. The quantity and locations of the capacitors and ballasts are provided in Table III.

Petroleum Products

Twenty-five (25) 55-gallon drums, five (5) 10-gallon drums, and fifteen (15) 5-gallon containers of petroleum products were observed in Room 1-17 of the WPF. The volume of petroleum product in the drums and containers is unknown. A 10,000-gallon above ground diesel tank was observed on the west side of the WPF. Although out of scope, this tank is referenced for informational purposes. The elevator located in the Tool Shop contains a hydraulic oil reservoir in the elevator rooms which is accessed from the exterior of the building. It is uncertain if the hydraulic oil has previously been tested for PCBs but is assumed to contain PCBs for the purpose of this report.

One (1) hydraulic oil tank was observed on Level 02 and one (1) 55-gallon grease drum was observed on Level 05 of the Coal Barge Unloading Building. One (1) hydraulic oil tank each was observed at Elevation 45 at Combustion Units 11, 12, and 13. One (1) gallon of "Saw Fluid" which appears to be a petroleum based cutting oil was identified in Room 0-01, one (1) oil tank associated with electrical equipment in Room 0-01, two (2) Ingersol-Rand air compressors with lubrication oil were observed in Room 0-11, stored oils were observed in the flammable cabinet in Room 0-15 of Ash Alley.

Four (4) 5-gallon oil buckets, two (2) shelves of grease containers and one (1) large oil-cooled radiator associated with electrical equipment were identified in Room 0-22 of the Warehouse Building. One (1) 55-gallon drum of "Mobile Fluid" was stored in Room 1-26, Elevation 45 of the Boiler Area. One (1) 5-gallon fuel can and three (3) 1-gallon oil cans were observed in Room 2-36, Elevation 55 of the Boiler Area at the combustion units. Three hydraulic oil tanks and twelve (12) hydraulic motors were identified in Room 6-44 of the Boiler Area.

Two (2) 5-gallon gas cans, one (1) 275-gallon lubricating oil tank with residual oil, and one (1) ~1,000-gallon gear oil tank were observed in Room 0-56, Elevation 11, one (1) ~30-gallon tank with residual oil was observed in Room 00-59 of the Turbine Hall. Seven (7) gallons of stored oil were observed in Room 1-63 of the Turbine Hall.

Eagle observed one (1) abandoned oil bath at the electrical panel in Room 00-02, four (4) tubes of grease, five (5) 5-gallon cans of lubricant, two (2) 5-gallon gasoline cans, twelve (12) 60-gallon tanks of grease/oil, two (2) 800-gallon tanks of oil, three (3) 500-gallon tanks of oil and one (1) 2.5 gallon grease container in Room 00-03 of the Northeast Utilities Building. Eagle observed three (3) grease tubes, two (2) 5-gallon gasoline cans, one (1) 2-gallon oil container within Room 1-24, Northeast Utilities Building.

Eagle observed several containers of stored petroleum products throughout the Jet Shop including one (1) gallon of compressor oil, ¼ gallon of Sta-Bil, one (1) gallon of silicone carbide grease, thirty-nine (39) tubes of grease, six (6) quarts of air compressor oil, one (1) gallon of

chain lube, one (1) bottle of turbine oil, two (2) quarts of cutting oil, one (1) quart of motor oil, one (1) gallon of gasoline, and four (4) quarts of lubricating oil. Eagle observed two (2) 5-gallon fuel cans in Room 1-01 of the Scrubber Control Building. Within the Wheel Wash Building, Eagle observed two (5) 5-gallon gasoline cans, one (1) 2-gallon gasoline can, five (5) gallons of hydraulic oil, two (2) quarts of engine oil, one (1) 800-gallon tank with unknown substance, one (1) 20-gallon drum of grease. Within the Storage Garage, Eagle observed eight (8) 1-gallon paint cans, two (2) 5-gallon paint buckets, and ~10 gallons of stored oil. Within the Gate 40 Warehouse, Eagle observed one (1) 5-gallon bucket of petroleum oil, eight (8) oil-filled surge arrestors, one (1) 55-gallon drum of turbine oil, and one (1) 5-gallon bucket of lubricating oil.

The quantity and locations of the petroleum product identified during the inspection are provided in Table III. The petroleum products consist of a combination of stored products and products associated with equipment. Transformers, although included on the inventory for informational purposes, were not included in Eagle's scope of inspection services as the transformers are understood to have been evaluated through previous studies. The stored petroleum products will require collection for proper disposal prior to renovation work. The petroleum products associated with the equipment may require testing prior to disposal. Equipment will need to be cleaned of residual petroleum product prior to disposal or recycling.

Paint, Solvents, and Chemicals

An empty Hypochlorite Tank with residue was observed in Room 0-12 of Ash Alley. A 55-gallon drum of "Aqua-Sol" solvent was observed in Room 0-11, paint and solvent containers were observed within the flammable cabinet in Room 0-15, two 5,000-gallon caustic materials tanks for sulfuric acid and caustic soda were observed in Room 0-19 of Ash Alley.

One (1) approximately 500-gallon chemical tank with unknown chemicals, two (2) shelves of cleaning products, five (5) 55-gallon drums of boiler chemicals, ten (10) 21-gallon fiber drums of unknown chemicals, and ten (10) 1-gallon containers of ammonia were identified in Room 0-22 of the Warehouse Building. Pressurized Halon fire extinguisher tanks containing Fluorine, Chlorine, Bromine, or Iodine were observed in Room 1-26, Elevation 45 of the Boiler Area around the combustion units. Three pressurized flammable containers, two spray bottles with unknown content, three (3) 55-gallon drums of boiler treatment chemicals, two (2) 55-gallon drums of Methoxy propylamine, one (1) 100-gallon sulfite solution drum, one (1) 100-gallon amine solution drum, two (2) 50-gallon and one (1) 100-gallon drums containing "chemical treatment", three (3) fiber drums with unknown boiler water treatment chemicals were identified in Room 2-36, Elevation 55 in the Boiler Area around the combustion units. Twenty-five (25) containers of water testing solution, one (1) 5-gallon container of floor finish and one (1) 1-gallon container of Acetone were observed in Room 2-37 of the Boiler Area.

Eight (8) 55-gallon empty drums potentially containing residual chemicals, one (1) 55-gallon drum of Activated Alumina, four (4) 55-gallon drums with unknown content and one (1) 55-gallon drum of Sodium Molybdate, Nitrous Acid was observed in Room 0-56, Elevation 11 of the Turbine Hall. Five (5) gallons of resin were observed containerized in Room 1-63 of the Turbine Hall. Two (2) 1-gallon paint cans and four (4) 5-gallon paint buckets were observed in Room 1-19, forty-one (41) 1-gallon paint cans, and two (2) 5-gallon paint cans in Room 1-28 of the Northeast Utilities Building.

Six (6) gallons of floor stripper was identified in Room 1-08, six (6) gallons of chemical cleaner in Room 2-11 of the PBF Administration Building. Eagle observed seven (7) gallons of denatured alcohol in Room, one (1) gallon of contact cement, one (1) pint of industrial adhesive in Room 1-01, five (5) gallons of buffer solution in Room 1-02, and one (1) gallon of copper sulfate solution in Room 2-08 in the Jet Shop. Eagle observed three (3) 1-gallon paint cans, two (2) sprayers with unknown chemicals, and two (5) 5-gallon containers of coolant in Room 1-01 of the Scrubber Control Building. Within the Storage Garage, Eagle observed two (2) 55-gallon drums of anti-freeze, two (2) 55-gallon drums of compound cleaner, one (1) 55-gallon drum of

Acetic Acid, and ~10 gallons of various types of solvents. Eagle observed two (2) Acetylene canisters, five (5) 5-gallon buckets of filter spray, and one (1) 1-gallon can of paint within the Gate 40 Warehouse Building.

The quantity and locations of the specific types of paints, solvents and chemicals identified during the inspection are provided in Table III. The paints, chemicals and solvents will require collection for proper disposal prior to renovation or demolition activities. Small containers of similar types of products may require lab packing which includes on site sorting of materials by hazardous waste classification and packaging the materials into 55-gallon or 1-cubic yard containers for off-site disposal. The lab packs will require hazardous waste manifests.

Pressurized Tanks

Eagle observed three (3) small propane tanks and three forty (43)-pound propane cylinders in Room 1-01 of the Jet Shop. Five (5) small propane tanks were identified in Room 1-01 of the Scrubber Control Building. The quantity and locations of the pressurized tanks identified during the inspection are provided in Table III. The pressurized tanks should be removed as part of the renovation or demolition process for proper recycling.

Electronic Waste

Spent and in-use electronics were identified during the inspection throughout the facility. The e-wastes observed during the inspection includes stored computers and electrical components, CRTV monitors, battery chargers, speakers, projectors, server equipment, phone systems, and other miscellaneous electrical devices. Some of the equipment is believed to still be in use or necessary to maintain the currently limited on-Site operations. The quantity and locations of the electronic waste identified during the inspection are provided in Table III. The e-wastes must be recycled at an approved recycling facility prior to renovation for demolition activities.

.

TABLE I

ASBESTOS CONTAINING MATERIALS SUMMARY TABLE

KEY FOR TABLES I and II

*** Please utilize the following key for abbreviations used in Tables I and II**

KEY		ANALYTICAL METHODS
DNA = DID NOT ANALYZE	SF = SQUARE FEET	PLM PC = EPA 600/R-93/116 QUANTITATION 400 POINT COUNT
NAD = NO ASBESTOS DETECTED	LF = LINEAR FEET	TEM NOB = NEW YORK ELAP 198.4 METHOD
F = FRIABLE	Chrys = Chrysotile	PLM = EPA 600/R-93/116
NF = NON-FRIABLE	Amos = Amosite	PS = Previously Sampled
TSI = THERMAL SYSTEMS INSULATION	Anth = Anthophylite	EA = Each
SURF = SURFACING MATERIAL	Trem = Tremolite	IM = Insufficient Material
MISC = MISCELLANEOUS MATERIAL	Croc = Crocidolite	NQ = Not Quantifiable
HA = HOMOGENOUS AREAS	Verm = Vermiculite	
BOLD TEXT IN "LOCATION" COLUMN INDICATES SAMPLE LOCATION		

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
WASTE PROCESSING FACILITY										
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferrous Loadout										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #10	**Rm 1-04, Rm 1-10,** Rm 1-12, **Rm 1-14**	Window glazing compound in interior doors - black	7-2-AF-10A	MISC	2% Chrys			YES	8 Doors with 1 sash each at 1'x1'	NF
			7-2-AF-10B		DNA					
			7-2-AF-10C		DNA					
HA #18	**Rm 1-05**	Window glazing compound in grapple office windows - brown	7-2-AF-18A	MISC	5% Chrys			YES	2 Sashes at 4'x4' EA; 5 Sashes at 2'x4' EA	NF
			7-2-AF-18B		DNA					
HA #185	**WPF Roof (Localized Areas)**	Flashing cement black	7-10-AF-185A	MISC	5% Chrys			YES	50 SF	NF
			7-10-AF-185B		DNA					
HA #656	**South Façade**	Caulk at louver - beige	7-10-AF-656A	MISC	5% Chrys			YES	1 At 20 LF	NF
			8-30-AF-656B		4% Chrys					
HA #707	Rm 1-07, Rm 1-09	Gaskets associated with cylindrical trash chute	Assumed	MISC	Assumed			YES	24"-36" Diameter - 8 EA	NF
HA #708	Rm 1-20	Large gaskets associated with cyclones	Assumed	MISC	Assumed			YES	24"-36" Diameter - 20 EA	NF
HA #709	Rm 1-20	Gaskets at blower units	Assumed	MISC	Assumed			YES	40 EA	NF
HA #710	Rm 2-29, Rm 2-30	Window glazing compound in double hung window pain	Assumed	MISC	Assumed			YES	13 Sashes at 4'x4' EA	NF
HA #711	Rm 1-10	Large valve packings	Assumed	MISC	Assumed			YES	24"-36" Diamter - 12 EA	NF
HA #712	Rm 1-53	Gaskets associated with cylindrical odor control duct	Assumed	MISC	Assumed			YES	9 EA	NF
HA #713	Valve Houses 1, 2, 3, 5, 6	Gaskets	Assumed	MISC	Assumed			YES	6"-8" Diameter - 36 EA	NF
HA #714	Valve Houses 1, 2, 3, 5, 6	Valve packings	Assumed	MISC	Assumed			YES	6"-8" EA	F
Tool Storage										
	Color Key On Drawing:	**1990'S Construction**								
HA #10	Rm 1-01, Rm 2-03	Window glazing compound in interior doors-black	7-2-AF-10A	MISC	2% Chrys			YES	3 doors with 1 sash at 2'x3' EA	NF
			7-2-AF-10B		DNA					
			7-2-AF-10C		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Tool Storage (continued)										
	Color Key On Drawing:	**1990'S Construction**								
HA #715	Rm 2-09	Interior duct pin tab adhesive at exterior duct	Assumed	MISC	Assumed			YES	50 Linear feet of a 2'x2' rectangular duct.	NF
HA #716	Rm 2-06, 2-07	Mirror adhesive	Assumed	MISC	Assumed			YES	2 mirrors at 8'x4' EA	NF
HA #717	Rm 2-11	Gaskets associated with water main piping	Assumed	MISC	Assumed			YES	5 EA	NF
HA #718	Rm 2-11	Valve packings associated with water main piping	Assumed	MISC	Assumed			YES	1 EA	F
Coal Barge Unloading Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #719	Level 1	Gasket on fuel lines	Assumed	MISC	Assumed			YES	14 EA	NF
HA #720	Level 1	Valve packings in fuel lines	Assumed	MISC	Assumed			YES	3 EA	F
HA #721	Level 2	Gaskets at pulley system	Assumed	MISC	Assumed			YES	2 Motors- 4 EA	NF
HA #722	Level 5	Gaskets at cable motors	Assumed	MISC	Assumed			YES	3 Motors- 4 EA	NF
HA #723	Level 8	Cloth like filter above grapple	Assumed	MISC	Assumed			YES	50 EA	NF
HA #724	Level 9	Grapple brake pads	Assumed	MISC	Assumed			YES	1 Brake system	NF
HA #725	Level 9	Gaskets at grapple pulley	Assumed	MISC	Assumed			YES	4 EA	NF
Transfer Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #159	**Lower Level Roof,** Main Roof	Flashing cement - black	7-9-AF-159A 7-9-AF-159B	MISC	15% Chrys DNA			YES	20 SF	NF
HA #726	Rm 3-09	Gaskets at access hatch to conveyors	Assumed	MISC	Assumed			YES	12" Diamater - 4 EA	NF
HA #727	Rm 4-10	Gaskets on large diameter red water lines	Assumed	MISC	Assumed			YES	40 EA	NF
HA #728	Rm 4-10	Gaskets on conveyor 511 and 513 motor	Assumed	MISC	Assumed			YES	4 EA	NF
HA #729	Rm 5-11	Gaskets associated with blower fan units	Assumed	MISC	Assumed			YES	3 Fans, 8 gaskets	NF

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
HA #730	Rm 5-11	Brake pads associated with pulley cable unit	Assumed	MISC	Assumed			YES	1 EA	NF
Waste Processing Facility Administration Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #77	**Rm 1-06**	Window glazing compound in interior divider windows - grey	7-5-AF-77A	MISC	8% Chrys			YES	8 Doors with 8 sashes at 2'x3.5' & 8 sashes at 2'x2' EA; 2 doors with 2 sashes at 1'x3.5' EA; 2 sashes at 1'x4' EA; 2 sashes at 1'x2' EA; 2 sashes at 2'x4' EA; 2 sashes at 2'x2' EA; 6 sashes at 3'x4' EA	NF
			7-5-AF-77B		DNA					
POWER BLOCK FACILITY										
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #219	Boiler Unit 9 Base level, **Boiler unit 10 second level,** Boiler unit 10 fourth level	Residual debris on pipes - white (adjacent pipes to boilers)	7-17-AF-219A	TSI	NAD			YES	>6" diameter pipe 100 LF (uninsulated); <6" diameter pipe 160 LF (insulated)	F
			7-17-AF-219B		30% Chrys					
			7-17-AF-219C		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #220	**Boiler unit 9 base level,** Boiler unit second level, Boiler unit 9 third level, Boiler unit 9 fourth level, Boiler unit 10 base level, Boiler unit 10 fourth level	Gaskets on steam piping adjacent to boilers	7-17-AF-220A	MISC	15% Chrys			YES	6" Diameter - 23 EA	NF
			7-17-AF-220B		DNA					
HA #221	Boiler Unit 9 base level, Boiler Unit 9 second level, **Boiler unit 10 base level**	Rope gasket at access hatch to boiler	7-17-AF-221A	MISC	60% Chrys			YES	3 Linear feet - 4 EA	F
			7-17-AF-221B		DNA					
HA #223	**Boiler unit 9 base level,** Boiler Unit 10 base level	Miscellaneous soft pack ring at water lines - white/ fibrous	7-17-AF-223A	TSI	15% Amos			YES	4 EA	F
			7-17-AF-223B		DNA					
HA #224	**Boiler unit 9 second level, Boiler unit 10 second level**	Gasket at igniter sight glass	7-17-AF-224A	MISC	70% Chrys			YES	24 EA (12 per boiler)	NF
			7-17-AF-224B		DNA					
HA #225	**Boiler unit 9 second level, Boiler unit 10 second level**	Rope gasket at ignition sight glass access panel	7-17-AF-225A	MISC	70% Chrys			YES	6 EA	F
			7-17-AF-225B		DNA					
HA #229	**Boiler unit 10 base level**	Pipe wrap on 1" line - white / fibrous	7-17-AF-229A	TSI	70% Chrys			YES	12 LF	F
			7-17-AF-229B		DNA					
			7-17-AF-229C		DNA					
HA #233	**Boiler unit 10 fourth level**	Rope gasket to access hatch to breeching duct	7-17-AF-233A	MISC	70% Chrys			YES	1 At 4 LF	NF
			7-17-AF-233B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #232	**Boiler unit 10 second level,** Boiler unit 9 second level	Soft fibrous packing behind upper steel jacket at boiler	7-17-AF-232A	TSI	40% Chrys			YES	2 Boilers at 37' height X 37' length X 22' width	F
			7-17-AF-232B		DNA					
			7-17-AF-232C		DNA					
HA #227	**Boiler unit 10 third level,** Boiler unit 9 third level	Sealant between interior boiler steel jacket junctions	7-17-AF-227A	MISC	40% Chrys					NF
			7-17-AF-227B		DNA					
HA #731	Boiler Unit 9, Boiler Unit 10	Interior Boiler components	Assumed	TSI	Assumed					F
HA #732	Boiler Unit 10	Interior breeching packing/insulation in ribs - white	Assumed	MISC	Assumed			YES	1 Duct a 42' height X 10' width	F
HA #578	**Rm 00-56 Elevation 11', Rm 0-01 Elevation 31',** Rm 2-36 Elevation 55', Rm 6-44 Elevation 104', Rm 7-53 Elevation 106', Rm 6-54 Elevation 84', Rm 1-63 Elevation 63', Rm 1-63, Rm 1-66, Rm 1-67, Rm 1-68, Rm 1-69, Rm 1-70**, Rm 2-29 Elevation 57'**	Paper cover on fiberglass on <6" pipes.	7-29-AF-578A	TSI	5% Chrys			YES	1,800 LF	F
			8-15-AF-578B		NAD					
			8-15-AF-578C		NAD					
			8-15-AF-578D		NAD					
HA #236	**Rm 0-01 Elevation 31', Rm 2-27 Elevation 57', Rm 00-56 Elevation 11'**	Mastic on fiberglass pipe wrap endcaps-white	7-18-AF-236A	MISC	8% Chrys			YES	80 End caps at 2 SF each.	NF
			7-23-AF-236B		DNA					
			7-29-AF-236C		DNA					
HA #239	**Rm 0-01 Elevation 31'**	Mastic in interior breeching duct seams-black (abandoned - from former boilers)	7-18-AF-239A	MISC	10% Chrys			YES	40 LF	NF
			7-18-AF-239B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #241	**Rm 0-01 Elevation 31'**	Debris on top of breeching duct-white(abandoned - from former boilers)	7-18-AF-241A	MISC	15% Ams 3% Croc			YES	300 SF	F
			7-18-AF-241B		DNA					
HA #246	**Rm 0-02 Elevation 31',** Rm 00-03 Elevation 31', Rm 00-04 Elevation 31'	Window frame caulk - brown	7-18-AF-246A	MISC	8% Chrys			YES	64 LF	NF
			7-18-AF-246B		DNA					NF
HA #248	**Rm 0-04 Elevation 31', Rm 1-09 Elevation 45'**	Window glazing compound in metal (non-reinforced) window sashes-white	7-19-AF-248A	MISC	10% Chrys			YES	24 Sashes at 2.5'x3' EA	NF
			7-19-AF-248B		DNA					
HA #251	**Rm 0-07 Elevation 31'**	Gasket at boiler recirculator heat tracing circuit - white	7-19-AF-251A	MISC	60% Chrys			YES	5" Diameter - 8 EA	NF
			7-19-AF-251B		DNA					
HA #261	**Room 1-09 Elevation 45', Room 1-10 Elevation 45'**	Spray applied fire proofing - thin / soft (type 1) (2" thickness)	7-19-AF-261A	SURF	20% Verm			YES	4,000 SF	F
			7-19-AF-261B		20% Verm					
			7-19-AF-261C		20% Verm					
			7-19-AF-261D		20% Verm					
			7-19-AF-261E		20% Verm					
HA #262	**Room 1-09 Elevation 45', Room 1-10 Elevation 45'**	Spray applied fire proofing - thick / hard (type 2) (2" thickness)	7-19-AF-262A	SURF	20% Verm					
			7-19-AF-262B		20% Verm					
			7-19-AF-262C		20% Verm					
			7-19-AF-262D		20% Verm					
			7-19-AF-262E		20% Verm					
HA #264	**Rm 0-11 Elevation 31'**	Wall mounted circuit protection panels	7-19-AF-264A	MISC	20% Chrys			YES	8 panels at 1.5' x 1.5' 1" thick EA	NF
			7-19-AF-264B		DNA					
HA #267	**Rm 0-12 Elevation 35'**	Residual insulator in electrical box-gray/hard	7-19-AF-267A	MISC	20% Chrys			YES	1 SF	NF
			7-19-AF-267B		DNA					
HA #269	**Rm 0-12 Elevation 35',** Rm 00-01 Elevation 31', Rm 02-27 Elevation 57'	Tar coating on pipe - black	7-19-AF-269A	MISC	10% Chrys			YES	5" Diameter pipe - 300 LF	NF
			7-19-AF-269B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #272	**Rm 0-13 Elevation 35',** Rm 0-14 Elevation 35' **Rm 0-15 Elevation 35', Rm 2-27 Elevation 57', Rm 7-46 Elevation 114', Rm 00-58 Elevation 25'**	Residual mudded pipe fitting insulation-gray	7-22-AF-272A	TSI	40% Chrys			YES	<6" Diameter - 54 Fittings	F
			7-22-AF-272B		DNA					
			7-22-AF-272C		DNA					
			7-22-AF-272D		DNA					
			7-25-AF-272E		DNA					
			7-31-AF-272F		DNA					
HA #275	**Rm 0-16 Elevation 35'**	Window glazing compound in Plexiglas doors - gray	7-22-AF-275A	MISC	NAD				2 Sashes at 2' x3' EA	NF
			7-22-AF-275B		4% Chrys			YES		
HA #278	**Rm 0-17 Elevation~21',**	Residual debris in large pipe conduit through wall - white	7-22-AF-278A	TSI	30% Chrys			YES	20 SF	F
			7-22-AF-278B		DNA					
HA #347	Rm 0-01 Elevation 31', Rm 0-02 Elevation 31', Rm 0-05 Elevation 31' Rm 0-06A Elevation 31', Rm 0-07, Rm 0-11 Elevation 31', Rm 0-12 Elevation 35', Rm 0-13 Elevation 35', Rm 0-14 Elevation 35', ST-1, **Rm 0-17 Elevation ~21,** Rm 0-18 Elevation 31', Rm 0-19, Rm 2-27 Elevation 57, Rm 8-55, **Rm 00-56 Elevation 11',** Rm 6-54 Elevation 85', Rm 7-45 Elevation 114', Rm 7-53 Elevation 106'	Typical gasket for area on steam/water lines - black	7-30-AF-347A	MISC	60% Chrys			YES	5"-8" Diameter - 829 EA	NF
			7-30-AF-347B		DNA					
HA #279			7-22-AF-279A		60% Chrys					
			7-22-AF-279B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #280	**Rm 0-17 Elevation~21', Rm 0-01 Elevation 31', Rm 2-27 Elevation 57', Rm 8-55, Rm 00-059 Elevation 25',** Rm 0-18, Rm 7-53 Elevation 106', Rm 6-54 Elevation 84', **Rm 8-55**	Magnesium silicate insulation on pipes (residual) (Exposed on >6" diameter pipes and under fiberglass on <6" diameter pipes)	7-22-AF-280A	TSI	30% Chrys			YES	<6" diameter pipe (under fiberglass) 1,640 LF >6" diameter pipe 1,304 LF >12" diameter pipe 136 LF	F
			7-22-AF-280B		DNA					
			7-23-AF-280C		DNA					
			7-23-AF-280D		DNA					
			7-23-AF-280E		DNA					
			7-29-AF-280F		DNA					
			7-31-AF-280G		DNA					
HA #282	**Rm 0-17 Elevation~21', Rm 7-47**	Tar on brick masonry (patch) - black	7-22-AF-282A	MISC	10% Chrys			YES	16 LF Strip @ 2" wide and 2 SF Patch	NF
			7-22-AF-282B		DNA					
HA #283	**Rm 0-17 Elevation~21'**	Residual packing around perimeter of pipe conduit through wall - white	7-22-AF-283A	TSI	20% Chrys			YES	20 SF	NF
			7-22-AF-283B		DNA					
HA #292	**Rm 0-22**	Caulk at bricked openings - gray	7-22-AF-292A	MISC	5% Chrys			YES	200 LF	NF
			7-22-AF-292B		DNA					
HA #294	**Rm 0-17, Rm 2-19, Rm 00-56 Elevation 25',** Rm 0-15, Rm 0-14, Rm 0-01 Elevation 31', Rm 0-07 Rm 2-27 Elevation 57'	Woven electrical wire coating on >.25" lines - yellow	7-23-AF-294A	MISC	10% Chrys			YES	5,400 LF	F
			7-31-AF-294B		DNA					
		Woven electrical wire coating on >.25" lines - yellow	7-23-AF-295A	MISC	30% Chrys					
			7-31-AF-295B		DNA					
HA #296	**Rm 1-26 Elevation 45'** Rm 0-18 Elevation 31', Rm 2-36, Rm 3-39	Caulk at 1930s / 1980's construction junction - beige	7-23-AF-296A	MISC	6% Chrys			YES	64 LF	NF
			7-23-AF-296B		DNA					
HA #297	**Rm 1-26 Elevation 45' Rm 0-18 Elevation 31', Rm 2-36, Rm 3-39**	Tar like vertical expansion board at 1930s / 1980s construction junction - black	7-23-AF-297A	MISC	3% Chrys			YES	64 LF	NF
			7-23-AF-297B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #299	**Rm 1-26 Elevation 45',** Rm 0-18 Elevation 31', Rm 2-36, Rm 3-39	Damp proofing at 1930s / 1980s construction junction (behind brick) - black (interior)	7-23-AF-299A	MISC	5% Chrys			YES	128 SF	NF
			7-23-AF-299B		DNA					
HA #303	**Rm 2-27,** Rm 2-29, Rm 00-58 Elevation 25', **Rm 00-59 Elevation 25',** Rm 00-60 Elevation 25', **Rm 00-56 Elevation 25'**	Woven electrical wire coating on <.25" lines - white	7-23-AF-303A	MISC	70% Chrys			YES	At conduits - 550 LF; At force draft fan unit - 6 at 100 LF EA; At G.E. Rheo Stat - 1 at 160 LF, 1 at 100 LF, 1 at 50 LF	F
			7-31-AF-303B		DNA					
			7-31-AF-303C		DNA					
HA #304	**Rm 2-29 Elevation 57', Rm 2-37 Elevation 55' Rm 2-38 Elevation 55' Rm 7-47 Elevation 114'**	Asbestos cement board (Transite) panel	7-23-AF-304A	MISC	15% Chrys			YES	Panels - 27 panels at 4'x3' .25" thick EA ; Fume hood - 52 SF	NF
			7-23-AF-304B		DNA					
HA #306	**Rm 2-29 Elevation 57'**	Tar at column ceiling junction - black	7-23-AF-306A	MISC	15% Chrys			YES	6 SF	NF
			7-23-AF-306B		DNA					
HA #327	**Rm 3-39 Elevation 64'**	Residual flashing cement at cement cap - black	7-25-AF-327A	MISC	5% Chrys			YES	15 SF	NF
			7-25-AF-327B		DNA					
HA #332	**Rm 7-45 Elevation 114'**	Tar felt paper on column cap - black	7-25-AF-332A	MISC	50% Chrys			YES	120 SF	NF
			7-25-AF-332B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #333	**Rm 7-47 Elevation 114'**	Asbestos cement board (Transite) breaching enclosure	7-25-AF-333A	MISC	20% Chrys			YES	8 Panels at 3'x2' .25" thick EA	NF
			7-25-AF-333B		DNA					
HA #366	**Rm 00-56 Elevation 11'**	Tar coating at floor penetrations - black	7-31-AF-366A	MISC	3% Chrys			YES	26 at 2 SF EA	NF
			7-31-AF-366B		DNA					
HA #372	**Rm 1-64**	Expansion joint caulk at 20's/50's construction junction -off white	7-31-AF-372A	MISC	4% Chrys			YES	30 LF	NF
			7-31-AF-372B		DNA					
HA #374	**Rm 1-66,** Rm 1-68, Rm 1-69	Window glazing compound in office partition windows-light gray	8-1-AF-374A	MISC	3% Chrys			YES	3 Sashes at 4'x5' EA	NF
			8-1-AF-374B		DNA					
HA #193	**Rm 00-56 Elevation 11'**	Damp proofing in interior shafts below turbines - black	7-15-AF-193A	MISC	NAD			YES	2,500 SF	NF
			7-30-AF-193B		NAD		1% Chrys			

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #457	North Façade, East Façade, South Façade, **West Façade**	Exterior window glazing compound in reinforced glass windows - white	8-8-AF-457B	MISC	3% Chrys			YES	6 Openings at 14'x4' EA; 40 Openings at 8'x3' EA; 2 Openings at 22'x8' EA; 4 Openings at 10'x10' EA; 2 Openings at 4'x2' EA; 3 Openings at 40'x10' EA; 5 Openings at 10'x4' EA; 4 Openings at 3'x7' EA; 1 Openings at 4'x2' EA; 2 Openings at 6'x3' EA; 1 Openings at 40'x12' EA	NF
HA #467	**West Facade**	Caulk around mechanical box - hard / brittle / gray	8-8-AF-467A	MISC	8% Chrys			YES	8 LF	NF
			8-8-AF-467B		DNA					
HA #472	**North Facade Elevation 135'**	Flashing cement on brick wall (residual)	8-8-AF-472A	MISC	10% Chrys			YES	30 SF	NF
			8-8-AF-472B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #473	**East Facade**	Window glazing compound in non-reinforced window sashes -white	8-8-AF-473A	MISC	3% Chrys			YES	48 Sashes at 2.5'x3' EA	NF
			8-8-AF-473B		DNA					
HA #475	**East Facade , South Facade**	Flashing cement over terracotta block and 1'x1' clay tile - black (exterior building walls - Some under standing seam metal wall panels)	8-8-AF-475A	MISC	10% Chrys			YES	15,200 SF	NF
			8-8-AF-475B		DNA					
HA #477	**East Facade**	Building expansion joint seam caulk between brick - gray (vertical)	8-8-AF-477A	MISC	3% Chrys			YES	45 LF	NF
			8-8-AF-477B		DNA					
HA #478	**East Facade**	Vertical expansion board - black	8-8-AF-478A	MISC	8% Chrys			YES	45 SF	NF
			8-8-AF-478B		DNA					
HA #702	**Rm 0-06B,** Rm 8-55	Albestos panel	10-2-AF-702A	MISC	20% Chrys			YES	5 Panel at 3'x8' EA	NF
			10-2-AF-702B		DNA					
HA #455	**Rm 1-63 Elevation 63'**	Wrap over electrical conduit in chase - white	8-7-AF-455A	MISC	70% Chrys			YES	40 LF	F
			8-7-AF-455B		DNA					
HA #686	**Rm 00-71 Elevation 22' (Dirt Cellar)**	Gasket at incandescent light fixtures - gray	10-1-AF-686A	MISC	10% Chrys			YES	60 at 1 LF EA	NF

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #687	**Below grade from screen house to building, Rm 00-71 Elevation 22' (Dirt Cellar), Rm 00-56' Elevation 11' (lower level turbine hall)**	Tar coating on 48" process/service and discharge water pipes - black	10-1-AF-687A	MISC	50% Chrys			YES	Exposed - 5 48" diameter pipes at 700 LF; Assumed below grade 48" process water intake and discharge pipes. - 2 48" Diameter pipes at 200 LF EA (from screen house #3 to turbine #6); 2 48" Diameter pipes at 250 LF EA (from screen house #1 to turbine unit 5); Assumed below grade 2 48" service water intake and discharge pipes 200 LF EA	NF
			10-1-AF-687B		DNA					
			10-1-AF-687C		DNA					
HA #688		Paper over tar coating on 48" diameter process/services and discharge water pipes - brown	10-1-AF-688A	MISC	40% Chrys			YES		NF
			10-1-AF-688B		DNA					
			10-1-AF-688C		DNA					
HA #768		Cementitious interior pipe lining	Assumed		Assumed					NF
HA #689	**Rm 00-71 Elevation 22' (Dirt Cellar)**	Flashing cement at concrete wall junction - black	10-1-AF-689A	MISC	10% Chrys			YES	40 SF	NF
			10-1-AF-689B		DNA					
HA #691	**Rm 00-71 Elevation 22' (Dirt Cellar)**	Tar moisture barrier at soft concrete ceiling - black	10-1-AF-691A	MISC	10% Chrys			YES	1,210 SF	NF
			10-1-AF-691B		DNA					
HA #700	**Rm 7-53 Elevation 106'**	Ebonite backer board at circuit panel - black	10-2-AF-700A	MISC	10% Chrys			YES	2 At 6 SF each	NF
			10-2-AF-700B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Area, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #733	Rm 1-63 Elevation 63'	Light blue / gray fibrous tape at interior turbine stator of turbines	(PS) (WSP) 112818-1	MISC	60% Chrys			YES	2 Turbines at 2,000 SF EA	F
			(PS) (WSP) 112818-2	MISC	45% Chrys					
HA #734	Rm 00-056 Elevation 11', Rm 1-63 Elevation 63'	Interior turbine components	Assumed	MISC	Assumed			YES		F
HA #735	East Facade	Flashing cement at original boiler exhausts	Assumed	MISC	Assumed			YES	600 SF	NF
HA #736	Rm 0-01 Elevation 31', Rm 0-05 Elevation 31', Rm 0-07 Elevation 31', Rm 0-12 Elevation 35', Rm 0-13 Elevation 35', Rm 0-14, Elevation 35', ST-1, Rm 0-17, Rm 0-18 Elevation 31', Rm 0-19 Elevation 31', Rm 2-27, Rm 7-45, Rm 7-53, Rm 6-54, Rm 8-55, Rm 00-56 Elevation 11', Rm 00-71 Elevation 22'	Valve packings	Assumed	MISC	Assumed			YES	324 Medium-Sized Valves (4"-8" diameter) and 20 Large valves (>36" diameter)	F

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Power Block Facility Roofs (Over Boiler Room, Combustion Units and Turbine Hall)										
	Color Key On Drawing:	**1920'S Construction**								
		1980'S Construction								
		1930'S Construction								
HA #623	**Roof #1**	Tar coating on small, medium and large vent stacks - black	8-28-AF-623A	MISC	3% Chrys			YES	Small - 18 at 70 SF EA; Medium - 8 at 282 SF EA; Large - 14 at 410 SF EA	NF
			8-28-AF-623B		DNA					
HA #625	**Roof #1**	Newer caulk over perimeter flashing - white	8-28-AF-625A	MISC	2% Chrys			YES	266 LF	NF
			8-28-AF-625B		DNA					
HA #628	**Roof #1**	Caulk at access hatch to large vents - brown	8-28-AF-628A	MISC	2% Chrys			YES	100 LF	NF
			8-28-AF-628B		DNA					
HA #629	**Roof #2**	Mop down tar on concrete roof deck-black (under 1" of foam)	8-28-AF-629A	MISC	4% Chrys			YES	10,270 SF	NF
			8-28-AF-629B		DNA					
HA #630	**Roof #2, Roof #3, Roof #4**	Perimeter flashing cement on parapet walls - black	8-28-AF-630A	MISC	4% Chrys			YES	1,404 SF	NF
			8-28-AF-630B		DNA					
HA #632	**Roof #1, Roof #2**	Tar on pitched metal corrugated roof deck -black	8-28-AF-632A	MISC	5% Chrys			YES	9,300 SF	NF
			8-28-AF-632B		DNA					
HA #603	Roof #1 Roof #2, Roof #3, Roof #4, **Roof #5**	Original caulk at base of coping on parapet wall - gray / hard	8-27-AF-603A	MISC	NAD			YES	720 LF	NF
			8-27-AF-603B		NAD					
			8-28-AF-603C		NAD					
			8-28-AF-603D		NAD					
			8-28-AF-603E		2% Chrys					
HA #638	**Roof #6**	Tar like caulk at aluminum flashing on tar coating-black	8-28-AF-638A	MISC	10% Chrys			YES	100 LF	NF
			8-28-AF-638B		DNA					
HA #639	**Roof #6, Roof #8**	Caulk at aluminum flashing below black caulk-grey	8-28-AF-639A	MISC	3% Chrys			YES	100 LF	NF
			8-28-AF-639B		DNA					
HA #643	**Roof #9, Roof #10**	Thick tar at curb-black	8-28-AF-643A	MISC	5% Chrys			YES	704 SF	NF
			8-28-AF-643B		DNA					
HA #644	**Roof #9**	Sealant at bolted flanges on ductwork - gray	8-28-AF-644A	MISC	2% Chrys			YES	81 Flanges at 5 LF EA	NF
			8-28-AF-644B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Power Block Facility Roofs (Over Boiler Room, Combustion Units and Turbine Hall)										
	Color Key On Drawing:	**1920'S Construction**								
		1980'S Construction								
		1930'S Construction								
HA #645	**Roof #9, Roof #10**	Flashing cement-black	8-28-AF-645A	MISC	5% Chrys			YES	110 SF	NF
			8-28-AF-645B		DNA					
Ware House Exteriors										
	Color Key On Drawing:	**1950'S Construction**								
HA #X524	**West Facade , East Facade , South Facade**	Window glazing compound - white	8-13-AF-X524A	MISC	5% Chrys			YES	8 Sashes at 4'x3' EA	NF
			8-13-AF-X524B		DNA					
HA #527	**South Facade**	Caulk at window sash frame junction - gray / hard / brittle	8-13-AF-527A	MISC	8% Chrys			YES	8 LF	NF
			8-13-AF-527B		DNA					
Concrete Stack										
	Color Key On Drawing:	**1980'S Construction**								
HA #737	Concrete Stack	Interior stack liner	Assumed	MISC	Assumed			YES	215' Height X 10' Width	NF
HA #738		Exterior paint on concrete - white (at top of stack)	Assumed	MISC	Assumed			YES	~1,800 SF	NF
Northeast Utilities Building										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #295	**Rm 00-02 Elevation 11',** Rm 0-05, Rm 1-19 Elevation 37', Rm 1-20 Rm 3-36 Elevation 56.25', Rm 3-38, Rm 4-47, Rm 5-57, ST-3	Woven electrical wire coating on >.25" lines-white	8-1-AF-295C	MISC	25% Chrys			YES	3,614 LF	F
HA #377	**Rm 00-02 Elevation 11',** Rm 00-04 Elevation 11', Rm 0-06, Rm 1-23, **Rm 1-25 Elevation 37',** Rm 1-26, Rm 1-28, Rm 1-29, Rm 1-30, Roof 3	6" Transite electrical conduit (asbestos cement)	8-1-AF-377A	MISC	10% Chrys 5% Croc			YES	50 LF in brick walls; 1,560 LF in concrete encasement (average concrete encasement 3'x2'); 80 LF exposed (suspended)	NF
			8-5-AF-377B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #304	**Rm 00-02 Elevation 11'**	Transite panel (asbestos cement board) at high voltage cubicles	8-1-AF-304C	MISC	15% Chrys			YES	44 panels at 1'x2' .25" thick EA	NF
HA #390	**Rm 1-15 Elevation 37',** Rm 1-17 Elevation 37', **Rm 3-34 Elevation 56'.25",** Rm 3-38 Elevation 56'.25" Rm 4-40, Rm 4-43 **Rm 5-50 Elevation 83'.75"**	Floor tile mastic - black	8-1-AF-390A	MISC	2% Chrys			YES	844 SF	NF
			8-6-AF-390B		DNA					
			8-7-AF-390C		DNA					
HA #403	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Interior paper in capacitor - white	8-5-AF-403A	MISC	70% Chrys			YES	97 Capacitors	F
			8-6-AF-403B		DNA					
HA #404	**Rm 1-22 (Tunnel)**	Tar at conduit penetration - black	8-5-AF-404A	MISC	5% Chrys			YES	11 SF	NF
			8-5-AF-404B		DNA					
HA #405	**Rm 1-22 (Tunnel)**	Mastic at duct work penetration through wall - black	8-5-AF-405A	MISC	5% Chrys			YES	4 LF	NF
			8-5-AF-405B		DNA					
HA #406	**Rm 1-24, Rm 1-25, Rm 3-36 Elevation 56.25',** Rm 4-47 Elevation 67.25', Rm 5-58, Rm 5-59 Elevation 83.53', West Facade	Expansion board between 1920's construction and 1938 additions (vertical & horizontal between concrete and brick)	8-5-AF-406A	MISC	4% Chrys			YES	400 LF (Estimate 12" wide joint)	NF
			8-5-AF-406B		DNA					
			8-6-AF-406C		DNA					
HA #409	**Rm 1-25 Elevation 37'**	Tar coating on metal conduits-brown	8-5-AF-409A	MISC	2% Chrys 2% Croc				36 LF	NF
			8-5-AF-409B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #419	**Rm 3-34 Elevation 56'.25",** Rm 3-38 Elevation 56'.25", **Rm 4-40 Elevation 67'.25",** Rm 4-43 Elevation 67'.25"	12"x12" vinyl floor tile-white with grey streaks	8-6-AF-419A	MISC	2% Chrys			YES	610 SF	NF
			8-6-AF-419B		DNA					
HA #425	**Rm 3-36 Elevation 56'.25"**	Mastic at bus closet ceilings - brown	8-6-AF-425A	MISC	5% Chrys			YES	380 SF	NF
			8-6-AF-425B		DNA					
HA #426	**Rm 3-36 Elevation 56.25',** Rm 4-47 Elevation 67.25', Rm 5-58, West Facade	Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	8-6-AF-426A	MISC	5% Chrys			YES	170 LF	NF
			8-6-AF-426B		DNA					
HA #456		Expansion joint caulk at A-wall 1938 addition junction over expansion board - gray	8-8-AF-456A	MISC	5% Chrys			YES		NF
			8-8-AF-456B		DNA					
HA #427	**Rm 3-36 Elevation 56'.25"**	Rope gasket between concrete stall junction at the 1938 addition junction - white / fibrous	8-6-AF-427A	MISC	60% Chrys			YES	10 LF	F
			8-6-AF-427B		DNA					
HA #430	**Rm 4-40 Elevation 67'.25",** Rm 4-43 Elevation 67'.25"	9"x9" vinyl floor tile - black	8-6-AF-430A	MISC	8% Chrys			YES	230 SF	NF
			8-6-AF-430B		DNA					
HA #432	**Rm 4-42 Elevation 67'.25"**	Cloth wrap over hard pack pipe insulation - white (residual)	8-6-AF-432A	MISC	5% Chrys			YES	3 LF	F
			8-6-AF-432B		DNA					
HA #434	**Rm 4-44 Elevation 67'.25"**	<.25" Woven wire coating in switch gear boxes - white	8-6-AF-434A	MISC	30% Chrys			YES	50 Switch boxes with 224 LF of wire each (11,200 LF)	F
			8-6-AF-434B		DNA					
HA #435	**Rm 5-50 Elevation 83'.75"**	9"x9" vinyl floor tile - beige	8-7-AF-435A	MISC	6% Chrys			YES	520 SF	NF
			8-7-AF-435B		DNA					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #442	**Rm 5-52 Elevation 83'.75"**	Caulk at soap stone panel seams - black	8-7-AF-442A	MISC	10% Chrys			YES	40 LF	NF
			8-7-AF-442B		DNA					
HA #303	**Rm 5-57 Elevation 83'.75"**	Woven electrical wire coating on <.25" lines - white	8-7-AF-303D	MISC	50% Chrys			YES	At control desk 9,360 LF; At circuit panels 3,500 LF; At circuit breakers 800 LF	F
HA #686	**Rm 1-23, 1-27**	Gasket at incandescent light fixtures - gray	10-1-AF-686A	MISC	10% Chrys			YES	8 At 1 LF EA	NF
HA #236	Rm 1-15 Elevation 37', Rm 1-17 Elevation 37', Rm 3-34 Elevation 56'.25", Rm 3-38 Elevation 56'.25" Rm 4-40, Rm 4-43 Rm 5-50 Elevation 83'.75, **Rm 5-53 Elevation 83'.75"**	Mastic on fiberglass pipe wrap endcaps-white	8-30-AF-236D	MISC	5% Chrys			YES	100 End caps at 2 SF EA	NF
HA #457	**West Façade, Elevator Pent House**	Exterior window glazing compound in reinforced chicken wire windows - white	8-8-AF-457A	MISC	NAD			YES	8 Sashes at 3'x4' EA;	NF
			8-8-AF-457B		3% Chrys					
			8-27-AF-457C		NAD		NAD			
HA #455	**St-2**	Wrap over electrical conduit in chase - white	8-7-AF-455A	MISC	70% Chrys			YES	20 LF	F
			8-7-AF-455B		DNA					
HA #739	West Facade	Window glazing compound in second and third story plain sash windows	Assumed	MISC	Assumed			YES	63 Sashes at 2.5'x3' EA	NF
HA #740	Rm 00-01, 00-02, 00-04, 1-26, 5-54, 5-55	Gaskets	Assumed	MISC	Assumed			YES	6"-8" Diameter - 61 Gaskets	NF
HA #741	Rm 00-01, 00-02, 1-26	Valve packing	Assumed	MISC	Assumed			YES	6"-8" Diameter - 21 Valves	F

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building Roofs										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #585	**Lower level roof #1**	Caulk at aluminum flashing brick façade junction - gray	8-27-AF-585A	MISC	5% Chrys			YES	160 LF	NF
			8-27-AF-587B		5% Chrys					
HA #590	**Lower level roof #2**	Flashing cement - black	8-27-AF-590A	MISC	6% Chrys			YES	1,368 SF	NF
			8-27-AF-590B		6% Chrys					
			8-27-AF-590C		6% Chrys					
HA #597	**Upper level roof #5**	Felt paper over tar on concrete deck - black (layer 3)	8-27-AF-597A	MISC	3% Chrys			YES	6,800 SF	NF
			8-27-AF-597B		NAD					
HA #610	**Upper level roof #5**	Caulk at louvers - grey	8-27-AF-610A		NAD		2.8% Chrys	YES	2 At 6 LF EA	NF
			8-27-AF-610B		NAD					
HA #604	**Upper level roof #5**	Original window glazing compound at skylights - grey / brittle / hard	8-27-AF-604A	MISC	3% Chrys			YES	100 LF	NF
			8-27-AF-604B		3% Chrys					
HA #605	**Upper level roof #5**	Flashing cement at skylight casing/frame junction - black	8-27-AF-605A	MISC	5% Chrys			YES	100 SF	NF
			8-27-AF-605B		5% Chrys					
HA #607	**Upper level roof #5 (pitched roof above air handler)**	Mastic in metal pitched roof panel seams at air handler room-black	8-27-AF-607A	MISC	6% Chrys			YES	1,600 SF	NF
			8-27-AF-607B		6% Chrys					
HA #608	**Upper level roof #5 (pitched roof above air handler)**	Tar coating on structural steel in air handler room - black	8-27-AF-608A	MISC	2% Chrys			YES	60 SF	NF
			8-27-AF-608B		NAD					
HA #613	**Upper level roof #7**	Tar and felt paper at parapet under rubber membrane - black	8-27-AF-613A	MISC	5% Chrys			YES	105 SF	NF
			8-27-AF-613B		5% Chrys					
HA #615	**Elevator pent house roof**	Tar behind rolled asphalt roofing at skylight curb - black	8-27-AF-615A	MISC	4% Chrys			YES	20 SF	NF
			8-27-AF-615B		4% Chrys					

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
PBF Administration Building										
	Color Key On Drawing:	**1950'S Construction**								
HA #490	**St-1, Rm 1-03,** Rm 2-09, Rm 2-15, Rm 3-21	Window glazing compound in hallway doors - black	8-12-AF-490A	MISC	6% Chrys			YES	11 doors with 1 sash at 3'x.5' EA	NF
			8-12-AF-490B		DNA					
HA #501	West Facade, **North Facade ,** East Facade , South Facade	Moisture barrier on interior face of second course of exterior brick-black	8-12-AF-501A	MISC	5% Chrys			YES	8,760 SF	NF
			8-12-AF-501B		DNA					
HA #520	**Roof #1, Roof #3**	Flashing cement-black (at coping/building junction)	8-13-AF-520A	MISC	8% Chrys			YES	14 SF	NF
			8-13-AF-520B		DNA					
HA #521	**Roof #1, Roof #3, Roof #4**	Caulk at aluminum flashing/ building junction - light grey	8-13-AF-521A	MISC	3% Chrys			YES	38 LF	NF
			8-13-AF-521B		DNA					
HA #523	**West Facade**	Caulk at cube glass block windows - grey/hard/brittle	8-13-AF-523A	MISC	5% Chrys			YES	240 LF	NF
			8-13-AF-523B		DNA					
HA #742	Rm 1-02, St-1, Rm 1-05, Rm 1-06, Rm 1-07, Rm 1-08, Rm 2-12, Rm 2-13, Rm 2-14, Rm 2-16, Rm 2-17, Rm 2-18, Rm 2-19, Rm 2-20, Rm 3-21, Rm 3-22, Rm 3-23, Rm 3-25, Rm 3-26, Rm 3-28, Rm 3-29	Inaccessible window glazing compound in double hung sashes - black	Assumed	MISC	Assumed			YES	86 Sashes at 4'x3' EA; 2 Sashes at 3'x.5' EA	NF
HA #743	Rm 1-08	Gaskets	Assumed	MISC	Assumed			YES	<6" Diameter - 4 EA	NF
Jet Shop & Turbo Jet Power Packs										
	Color Key On Drawing:	**1970'S Construction**								
HA #546	Rm 1-01, 1-02, Rm 1-03, Rm 1-04, Rm 2-06, Rm 2-07, Rm 2-08, **Rm 2-10,** Rm 2-11, Rm 2-12, ST-1, ST2	Sealant between window sash and frame-black	8-14-AF-546A	MISC	8% Chrys			YES	295 LF	NF
			8-14-AF-546B		DNA					
HA #744	Rm 2-09	Stored jet engine part	Labeled asbestos	MISC	Labeled asbestos			YES	1 Part at 10 SF	NF

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Jet Shop & Turbo Jet Power Packs (continued)										
	Color Key On Drawing:	**1970'S Construction**								
HA #745	Jet Power Packs	Interior components	Assumed	MISC	Assumed			YES	4 Power packs at 1,200 SF EA	NF
Screen House #1										
	Color Key On Drawing:	**1940'S Construction**								
HA #564	**Screen House #1 Roof**	Flashing Cement - Black	8-15-AF-564A 8-15-AF-564B	MISC	8% Chrys			YES	144 SF	NF
HA #746	Rm 0-01	Large Gaskets	Assumed	MISC	Assumed			YES	>38" Diameter - 16 EA	NF
HA #747	Rm 0-01	Large valves	Assumed	MISC	Assumed			YES	>38" Diameter - 2 EA	NF
HA #748	Rm 0-01, Rm 1-02, Rm 3-04	Medium gaskets	Assumed	MISC	Assumed			YES	6"-8" Diameter - 26 EA	NF
HA #749	Rm 0-01, Rm 1-02, Rm 3-04	Medium valves	Assumed	MISC	Assumed			YES	6"-8" Diameter - 8 EA	NF
HA #750	Rm 3-04	Double Hung window window glazing compound-black	Assumed	MISC	Assumed			YES	13 Sashes at 4'x4' EA; 1 sash at 4 x .5	NF
Screen House #2 (Inaccessible)										
	Color Key On Drawing:	**1920'S Construction**								
HA #751	Interior	Gaskets	Assumed	MISC	Assumed			YES	~24 EA	NF
HA #752	Interior	Valves	Assumed	MISC	Assumed			YES	~16 EA	NF
HA #753	Interior	Pipe insulation	Assumed	TSI	Assumed			YES	~300 LF	F
HA #754	Roofs	Roof fields and flashing cements	Assumed	MISC	Assumed			YES	~980 SF	NF
HA #755	Exterior	Interior window glazing compound	Assumed	MISC	Assumed			YES	~ 20 Sashes at 1'x3' EA	NF
HA #756		Exterior window glazing compound	Assumed	MISC	Assumed			YES	~ 20 Sashes at 1'x3' EA	NF
HA #757	Exterior	Exterior window glazing compound	Assumed	MISC	Assumed			YES	NQ	NF

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Screen House #3										
	Color Key On Drawing:	**1940'S Construction**								
HA #758	Rm 0-01, Rm 1-03, Rm 1-04,	Valves	Assumed	MISC	Assumed			YES	6"-8" Diameter - 6 EA	NF
HA #759	Rm 0-01, Rm 1-03, Rm 1-04, Rm 3-08	Gaskets	Assumed	MISC	Assumed			YES	12 EA	NF
HA #760	Rm 0-02	Large Gaskets	Assumed	MISC	Assumed			YES	>38" Diameter - 16 EA	NF
HA #761	Rm 0-02	Large valves	Assumed	MISC	Assumed			YES	> 38" Diameter - 2 EA	NF
HA #762	Rm 2-07, Rm 3-08	2X Hung window window glazing compound - black	Assumed	MISC	Assumed			YES	32 Sashes at 3' x 2'	NF
Gate 40 Warehouse										
	Color Key On Drawing:	**1980'S Construction**								
HA #659	**Rm 1-06, Rm 1-07, Rm 1-08, Rm 1-09**	Sealant at rectangular duct work flanges - gray	10-1-AF-659A	MISC	3% Chrys			YES	36 Flanges at 4 LF each	NF
			10-1-AF-659B		DNA					
HA #763	Rm 1-02	Large (>4' diameter) valve packing (stored)	Assumed	MISC	Assumed			YES	2 Each	F
Northwest Guard Shack										
	Color Key On Drawing:	**Not Applicable Construction Date Unkown**								
HA #679	**East Facade**	Flashing cement at concrete belt course - black	10-1-AF-679A	MISC	5% Chrys			YES	14 LF	NF
			10-1-AF-679B		DNA					
Demineralization Shack										
	Color Key On Drawing:	**1980'S Construction**								
HA #764	Rm 1-01	Gaskets	Assumed	MISC	Assumed			YES	6"-8" Diameter -12 Each	NF
HA #765	Rm 1-01	Valve packings	Assumed	MISC	Assumed			YES	6"-8" Diameter - 4 Each	F
Concrete Ramp Near Flood Wall										
HA #766	Concrete Ramp Near Flood Wall	Flashing cement	Assumed	MISC	Assumed			YES	20 SF	NF

TABLE I
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Pug Mill										
	Color Key On Drawing:	**1980'S Construction**								
HA #767	Roof (inaccessible)	Flashing Cement	Assumed	MISC	Assumed			YES	40 SF	NF
		Roof fields	Assumed	MISC	Assumed			YES	1,100 SF	NF

TABLE II

NON-ASBESTOS-CONTAINING MATERIALS SUMMARY TABLE

KEY FOR TABLES I and II

*** Please utilize the following key for abbreviations used in Tables I and II**

KEY		ANALYTICAL METHODS
DNA = DID NOT ANALYZE	SF = SQUARE FEET	PLM PC = EPA 600/R-93/116 QUANTITATION 400 POINT COUNT
NAD = NO ASBESTOS DETECTED	LF = LINEAR FEET	TEM NOB = NEW YORK ELAP 198.4 METHOD
F = FRIABLE	Chrys = Chrysotile	PLM = EPA 600/R-93/116
NF = NON-FRIABLE	Amos = Amosite	PS = Previously Sampled
TSI = THERMAL SYSTEMS INSULATION	Anth = Anthophylite	EA = Each
SURF = SURFACING MATERIAL	Trem = Tremolite	IM = Insufficient Material
MISC = MISCELLANEOUS MATERIAL	Croc = Crocidolite	NQ = Not Quantifiable
HA = HOMOGENOUS AREAS	Verm = Vermiculite	
BOLD TEXT IN "LOCATION" COLUMN INDICATES SAMPLE LOCATION		

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
WASTE PROCESSING FACILITY										
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #1	**Rm 1-01, Rm 1-17, Rm 1-32**	Concrete slab	7-2-AF-01A	MISC	NAD			NO	NQ	NF
			7-3-AF-01B		NAD				NQ	
			7-5-AF-01C		NAD				NQ	
HA #2	**Rm 1-01, Rm 1-17, Rm 1-53**	Roll up door membrane-black	7-2-AF-02A	MISC	NAD			NO	NQ	NF
			7-3-AF-02B		NAD				NQ	
			7-5-AF-02C		NAD				NQ	
HA #3	**Rm 1-01, Rm 1-10**	Interior door frame caulk-white	7-2-AF-03A	MISC	NAD			NO	NQ	NF
			7-2-AF-03B		NAD				NQ	
			7-2-AF-03C		NAD				NQ	
HA #4	**Rm 1-01, Rm-1-10, Rm 1-17**	Paint on metal paneling - metallic	7-2-AF-04A	MISC	NAD			NO	NQ	NF
			7-2-AF-04B		NAD				NQ	
			7-3-AF-04C		NAD				NQ	
HA #5	**Rm 1-02**	Window glazing compound-black	7-2-AF-05A	MISC	NAD			NO	NQ	NF
			7-2-AF-05B		NAD				NQ	
HA #6	**Rm 1-02**	Woven window curtain-white	7-2-AF-06A	MISC	NAD			NO	NQ	NF
			7-2-AF-06B		NAD				NQ	
HA #7	**Rm 1-01**	High visibility paint - yellow	7-2-AF-07A	MISC	NAD			NO	NQ	NF
			7-2-AF-07B		NAD				NQ	
			7-2-AF-07C		NAD				NQ	
HA #8	**Rm 1-01**	Pin tab adhesive on columns - maroon	7-2-AF-08A	MISC	NAD		NAD	NO	NQ	NF
			7-2-AF-08B		NAD				NQ	
HA #9	**Rm 1-01**	Door frame caulk - brown	7-2-AF-09A	MISC	NAD			NO	NQ	NF
			7-2-AF-09B		NAD				NQ	
HA #11	**Rm 1-04**	Flex connector at duct-black	7-2-AF-11A	MISC	NAD			NO	NQ	NF
HA #12	**Rm 1-04**	Sealant at duct slips at smaller diameter duct - brown	7-2-AF-12A	MISC	NAD			NO	NQ	NF
			7-2-AF-12B		NAD				NQ	
HA #13	**Rm 1-04**	Bottom layer felt paper on concrete roof deck (layer 1)	7-2-AF-13A	MISC	NAD			NO	NQ	NF
			7-2-AF-13B		NAD				NQ	
HA #14	**Rm 1-04**	Middle layer felt paper - black (layer 2)	7-2-AF-14A	MISC	NAD			NO	NQ	NF
			7-2-AF-14B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #15	**Rm 1-04**	Top layer felt paper-black (layer 3)	7-2-AF-15A	MISC	NAD			NO	NQ	NF
			7-2-AF-15B		NAD				NQ	
HA #16	**Rm 1-04**	Sealant at roof membrane/metal wall panel junction - black	7-2-AF-16A	MISC	NAD			NO	NQ	NF
			7-2-AF-16B		NAD				NQ	
HA #17	**Rm 1-05**	Fire hose-white	7-2-AF-17A	MISC	NAD			NO	NQ	F
			7-2-AF-17B		NAD				NQ	
HA #19	**Rm 1-07, Rm 1-17, Rm 1-20**	Conveyor belt (non-processible waste conveyor)	7-2-AF-19A	MISC	NAD			NO	NQ	NF
		Conveyor belt (secondary shredder)	7-3-AF-19B	MISC	NAD			NO	NQ	NF
		Conveyor belt (ferrous shuttle conveyor)	7-3-AF-19C	MISC	NAD			NO	NQ	NF
HA #21	**Rm 1-07, Rm 1-17, Rm 1-20**	Shrapnel guard above conveyor - black / rubbery (non-processible waste conveyor)	7-2-AF-21A	MISC	NAD			NO	NQ	NF
		Shrapnel guard above conveyor - black / rubbery (secondary shredder)	7-3-AF-21B	MISC	NAD			NO	NQ	NF
		Shrapnel guard above conveyor - black / rubbery (ferrous shuttle conveyor)	7-3-AF-21C	MISC	NAD			NO	NQ	NF
HA #22	**Rm 1-10**	Paper insulation over fiberglass on water lines	7-2-AF-22A	TSI	NAD			NO	NQ	NF
			7-2-AF-22B		NAD				NQ	
			7-2-AF-22C		NAD				NQ	
HA #23	**Rm 1-10**	Woven gasket at burner gun - white	7-2-AF-23A	MISC	NAD			NO	NQ	F
			7-2-AF-23B		NAD				NQ	
HA #24	**Rm 1-10**	Sealant from boiler base to concrete pad - black	7-2-AF-24A	MISC	NAD			NO	NQ	NF
			7-2-AF-24B		NAD				NQ	
HA #25	**Rm 1-10**	Pipe dope - white	7-2-AF-25A	MISC	NAD			NO	NQ	F
			7-2-AF-25B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #26	**Rm 1-10**	Rope gasket at boiler ribs - gold	7-2-AF-26A	MISC	NAD			NO	NQ	NF
			7-2-AF-26B		NAD				NQ	
HA #27	**Rm 1-10**	Sealant over rope gasket - red	7-2-AF-27A	MISC	NAD			NO	NQ	NF
			7-2-AF-27B		NAD				NQ	
HA #28	**Rm 1-10**	Mastic at water supply line/boiler junction - white	7-2-AF-28A	MISC	NAD			NO	NQ	NF
			7-2-AF-28B		NAD				NQ	
HA #29	**Rm 1-10**	Foil insulation	7-2-AF-29A	TSI	NAD			NO	NQ	NF
			7-2-AF-29B		NAD				NQ	
			7-2-AF-29C		NAD				NQ	
HA #30	**Rm 1-10, Rm 1-12**	Sheetrock	7-2-AF-30A	MISC	NAD			NO	NQ	NF
			7-3-AF-30B		NAD				NQ	
HA #31	**Rm 1-10, Rm 1-12**	Joint compound - white	7-2-AF-31A	MISC	NAD			NO	NQ	F
			7-3-AF-31B		NAD				NQ	
HA #32	**Rm 1-10**	Spacer board between column and CMU - black	7-2-AF-32A	MISC	NAD			NO	NQ	NF
			7-2-AF-32B		NAD				NQ	
HA #33	**Rm 1-12**	Thinset associated with 6" x 6" quarry tile - white	7-3-AF-33A	MISC	NAD			NO	NQ	NF
			7-3-AF-33B		NAD				NQ	
HA #34	**Rm 1-12**	Grout associated with 6" x 6" quarry tile - black	7-3-AF-34A	MISC	NAD			NO	NQ	NF
			7-3-AF-34B		NAD				NQ	
HA #35	**Rm 1-12**	Thinset associated with 2" x 2" ceramic wall tile - beige	7-3-AF-35A	MISC	NAD			NO	NQ	NF
			7-3-AF-35B		NAD				NQ	
HA #36	**Rm 1-12**	Grout associated with 2" x 2" ceramic wall tile - grey	7-3-AF-36A	MISC	NAD			NO	NQ	NF
			7-3-AF-36B		NAD				NQ	
HA #37	**Rm 1-12**	Appliance caulk-transparent	7-3-AF-37A	MISC	NAD			NO	NQ	NF
			7-3-AF-37B		NAD				NQ	
HA #38	**Rm 1-13**	2' x 2' Acoustic ceiling tile - pin hole and crater	7-3-AF-38A	MISC	NAD			NO	NQ	F
			7-3-AF-38B		NAD				NQ	
HA #39	**Rm 1-12**	Panel adhesive under fiberglass in unit ventilator - black	7-3-AF-39A	MISC	NAD			NO	NQ	NF
			7-3-AF-39B		NAD				NQ	
HA #40	**Rm 1-13**	Poured epoxy flooring - grey with blue accents	7-3-AF-40A	MISC	NAD			NO	NQ	NF
			7-3-AF-40B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #41	**Rm 1-13**	4" Vinyl cove base adhesive - cream	7-3-AF-41A	MISC	NAD			NO	NQ	NF
			7-3-AF-41B		NAD				NQ	
HA #42	**Rm 1-13**	4" Vinyl cove base - grey	7-3-AF-42A	MISC	NAD			NO	NQ	NF
			7-3-AF-42B		NAD				NQ	
HA #43	**Rm 1-13, Rm 1-17**	Sealant between slab relief cuts - white	7-3-AF-43A	MISC	NAD			NO	NQ	NF
			7-3-AF-43B		NAD				NQ	
HA #44	**Rm 1-13**	Expansion seam caulk between concrete walls - white	7-3-AF-44A	MISC	NAD			NO	NQ	NF
			7-3-AF-44B		NAD				NQ	
HA #45	**Rm 1-15**	Flooring leveler - gray (first layer)	7-3-AF-45A	MISC	NAD			NO	NQ	NF
			7-3-AF-45B		NAD				NQ	
HA #46	**Rm 1-15**	Flooring mastic - yellow (second layer)	7-3-AF-46A	MISC	NAD			NO	NQ	NF
HA #47	**Rm 1-15**	12" x 12" vinyl floor tile-beige with grey specs (third layer)	7-3-AF-47A	MISC	NAD			NO	NQ	NF
HA #48	**Rm 1-15**	4" Vinyl cove base - cream	7-3-AF-48A	MISC	NAD			NO	NQ	NF
			7-3-AF-48B		NAD				NQ	
HA #49	**Rm 1-15, Rm 1-16**	Original sheet rock behind newer sheet rock	7-3-AF-49A	MISC	NAD			NO	NQ	NF
			7-3-AF-49B		NAD				NQ	
HA #50	**Rm 1-15, Rm 1-16**	Original joint compound behind newer joint compound-white	7-3-AF-50A	MISC	NAD			NO	NQ	F
		Original joint compound behind newer joint compound-white-at columns	7-3-AF-50B	MISC	NAD			NO	NQ	F
HA #51	**Rm 1-17**	Gasket at compressed air receiver tank - grey	7-3-AF-51A	MISC	NAD			NO	NQ	NF
			7-3-AF-51B		NAD				NQ	
HA #52	**Rm 1-17**	Adhesive under rubber roof membrane on concrete - yellow	7-3-AF-52A	MISC	NAD			NO	NQ	NF
			7-3-AF-52B		NAD				NQ	
HA #53	**Rm 1-17**	Tar under rubber membrane on steel walls and beams - black	7-3-AF-53A	MISC	NAD			NO	NQ	NF
			7-3-AF-53B		NAD				NQ	
HA #54	**Rm 1-17**	Reglet caulk - black	7-3-AF-54A	MISC	NAD			NO	NQ	NF
			7-3-AF-54B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #55	**Rm 1-17**	Felt paper at access hatch to ferris conveyor junction - black	7-3-AF-55A	MISC	NAD			NO	NQ	F
			7-3-AF-55B		NAD				NQ	
HA #56	**Rm 1-17**	Caulk at interior access hatch to ferris conveyor - black	7-3-AF-56A	MISC	NAD		NAD	NO	NQ	NF
			7-3-AF-56B		NAD				NQ	
HA #57	**Rm 1-18**	Poured epoxy flooring - white	7-3-AF-57A	MISC	NAD			NO	NQ	NF
			7-3-AF-57B		NAD				NQ	
HA #58	**Rm 1-18**	Sealant at air compressor ductwork - grey	7-3-AF-58A	MISC	NAD			NO	NQ	NF
			7-3-AF-58B		NAD				NQ	
HA #59	**Rm 1-18**	Fire stop caulk - red	7-3-AF-59A	MISC	NAD			NO	NQ	NF
			7-3-AF-59B		NAD				NQ	
HA #60	**Rm 1-20**	Gasket at cylindrical cyclone access hatch - black	7-3-AF-60A	MISC	NAD			NO	NQ	NF
			7-3-AF-60B		NAD				NQ	
HA #61	**Rm 1-20**	Gasket at electrical conduit at fan unit between small and large duct	7-3-AF-61A	MISC	NAD			NO	NQ	NF
			7-3-AF-61B		NAD				NQ	
HA #62	**Rm 1-20**	Gasket at smaller diameter chute off large fan unit to cyclone -	7-3-AF-62A	MISC	NAD			NO	NQ	NF
			7-3-AF-62B		NAD				NQ	
HA #63	**Rm 2-22**	Vinyl stair tread adhesive - brown	7-3-AF-63A	MISC	NAD			NO	NQ	NF
			7-3-AF-63B		NAD				NQ	
HA #64	**Rm 2-22**	Vinyl stair tread - brown	7-3-AF-64A	MISC	NAD			NO	NQ	NF
			7-3-AF-64B		NAD				NQ	
HA #65	**Rm 1-26, Rm 2-23, Rm 2-29**	Flooring mastic on concrete - black	7-3-AF-65A	MISC	NAD			NO	NQ	NF
			7-3-AF-65B		NAD		NAD		NQ	
			7-3-AF-65C		NAD				NQ	
HA #66	**Rm 1-26, Rm 2-23**	12" x 12" vinyl floor tile - blue	7-3-AF-66A	MISC	NAD			NO	NQ	NF
			7-3-AF-66B		NAD				NQ	
HA #67	**Rm 2-23**	4" vinyl cove base - black	7-3-AF-67A	MISC	NAD			NO	NQ	NF
			7-3-AF-67B		NAD				NQ	
HA #68	**Rm 2-23**	Sealant at sheetrock/metal wall panel junction - transparent	7-3-AF-68A	MISC	NAD			NO	NQ	NF
			7-3-AF-68B		NAD				NQ	
HA #69	**Rm 2-24**	12" x 12" vinyl floor tile - white	7-3-AF-69A	MISC	NAD			NO	NQ	NF
			7-3-AF-69B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #70	**Rm 2-24**	Cellulose insolation in wall cavity	7-3-AF-70A	MISC	NAD			NO	NQ	F
			7-3-AF-70B		NAD				NQ	
HA #67X	**Rm 2-28**	Mastic on fiberglass end caps - white	7-3-AF-67Ax	MISC	NAD			NO	NQ	NF
			7-3-AF-67Bx		NAD				NQ	
HA #90	**Rm 2-28**	Mastic at cylindrical duct work - grey	7-5-AF-90A	MISC	NAD			NO	NQ	NF
			7-5-AF-90B		NAD				NQ	
HA #91	**Rm 2-28**	Vinyl flex connector - black	7-5-AF-91A	MISC	NAD			NO	NQ	NF
			7-5-AF-91B		NAD				NQ	
HA #92	**Rm 2-29**	Sealant at window surround - white	7-5-AF-92A	MISC	NAD			NO	NQ	NF
			7-5-AF-92B		NAD				NQ	
HA #93	**Rm 1-53**	Caulk at concrete slab/perimeter wall junction - black	7-5-AF-93A	MISC	NAD			NO	NQ	NF
			7-5-AF-93B		NAD				NQ	
HA #94	**Rm 1-53**	Skim coat at columns - brown	7-5-AF-94A	MISC	NAD			NO	NQ	NF
			7-5-AF-94B		NAD				NQ	
			7-5-AF-94C		NAD				NQ	
HA #95	**Rm 1-53**	Caulk at column/metal wall panel junction - white	7-5-AF-95A	MISC	NAD			NO	NQ	NF
			7-5-AF-95B		NAD				NQ	
HA #164	**South Facade, North Facade**	Door frame caulk - grey	7-10-AF-164A	MISC	NAD			NO	NQ	NF
			7-10-AF-164B		NAD				NQ	
HA #165	**South Facade, North Facade**	Sealant between metal wall panels - white	7-10-AF-165A	MISC	NAD			NO	NQ	NF
			7-10-AF-165B		NAD				NQ	
HA #166	**South Facade, North Facade**	Skim coat on foundation	7-10-AF-166A	SURF	NAD			NO	NQ	NF
			7-10-AF-166B		NAD				NQ	
			7-10-AF-166C		NAD				NQ	
HA #167	**West Facade, East Facade**	Mastic at metal covered downspout - clear	7-10-AF-167A	MISC	NAD			NO	NQ	NF
			7-10-AF-167B		NAD				NQ	
HA #168	**West Facade, North Facade**	Caulk at louvers - beige	7-10-AF-168A	MISC	NAD			NO	NQ	NF
			7-10-AF-168B		NAD				NQ	
HA #169	**North Facade**	Gaskets at natural gas main	7-10-AF-169A	MISC	NAD			NO	NQ	NF
			7-10-AF-169A		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout (continued)										
	Color Key On Drawing:	**1980'S Construction**								
		1990'S Construction								
HA #170	**West Facade**	Putty at electrical conduits - grey	7-10-AF-170A	MISC	NAD			NO	NQ	NF
			7-10-AF-170B		NAD				NQ	
HA #171	**South Facade**	Caulk at window base junction - white	7-10-AF-171A	MISC	NAD			NO	NQ	NF
			7-10-AF-171B		NAD				NQ	
HA #172	**South Facade**	Membrane at façade junction - black	7-10-AF-172A	MISC	NAD			NO	NQ	NF
			7-10-AF-172B		NAD				NQ	
HA #173	**East Facade**	Caulk at duct work seam - grey	7-10-AF-173A	MISC	NAD			NO	NQ	NF
			7-10-AF-173B		NAD				NQ	
HA #183	**Roof**	Caulk at structural beam under odor control duct - grey	7-10-AF-183A	MISC	NAD			NO	NQ	NF
			7-10-AF-183B		NAD				NQ	
HA #184	**Roof**	Caulk at cylindrical duct work penetration through roof - grey	7-10-AF-184A	MISC	NAD			NO	NQ	NF
			7-10-AF-184B		NAD				NQ	
HA #186	**Roof**	Cementitious skim coat on stack above bag house and shredders	7-10-AF-186A	SURF	NAD			NO	NQ	NF
			7-10-AF-186B		NAD				NQ	
			7-10-AF-186C		NAD				NQ	
HA #187	**Roof**	Blow-off roof canvas	7-10-AF-187A	MISC	NAD			NO	NQ	NF
			7-10-AF-187B		NAD				NQ	
Odor Control Equipment Building										
	Color Key On Drawing:	**1990'S Construction**								
HA #96	**RTO #1, RTO #2**	Flooring mastic - yellow	7-8-AF-96A	MISC	NAD			NO	NQ	NF
			7-8-AF-96B		NAD				NQ	
HA #97	**RTO #1, RTO #2**	12"x12" vinyl floor tile - gray	7-8-AF-97A	MISC	NAD			NO	NQ	NF
			7-8-AF-97B		NAD				NQ	
HA #98	**RTO #2**	Stored cell like cement	7-8-AF-98A	MISC	NAD			NO	NQ	NF
			7-8-AF-98B		NAD				NQ	
HA #101	**Re-therm system**	Gasket at electrical box - black	7-8-AF-101A	MISC	NAD			NO	NQ	NF
			7-8-AF-101B		NAD				NQ	
HA #102	**Re-therm system**	Gasket at re-therm blower - gray	7-8-AF-102A	MISC	NAD			NO	NQ	NF
			7-8-AF-102B		NAD				NQ	
HA #103	**Re-therm system**	Pipe dope at yellow natural gas lines - gray	7-8-AF-103A	MISC	<1% Chrys		NAD	NO	NQ	NF
			7-8-AF-103B		<1% Chrys				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Odor Control Equipment Building (continued)										
	Color Key On Drawing:	**1990'S Construction**								
HA #104	**Re-therm system**	Flex connector at compressed air line - pink	7-8-AF-104A	MISC	NAD			NO	NQ	NF
			7-8-AF-104B		NAD				NQ	
HA #105	**Re-therm system**	Gasket at water line tank junction - black	7-8-AF-105A	MISC	NAD			NO	NQ	NF
			7-8-AF-105B		NAD				NQ	
HA #106	**Re-therm system**	Gasket at tank inlet	7-8-AF-106A	MISC	NAD			NO	NQ	NF
			7-8-AF-106B		NAD				NQ	
HA #107	**Re-therm unit**	Flex connector between damper and stack	7-8-AF-107A	MISC	NAD			NO	NQ	NF
			7-8-AF-107B		NAD				NQ	
HA #108	**Re-therm unit**	Rope gasket at flex connector - tan	7-8-AF-108A	MISC	NAD			NO	NQ	F
			7-8-AF-108B		NAD				NQ	
HA #109	**Re-therm unit**	Rope gasket at flex connector - black	7-8-AF-109A	MISC	NAD			NO	NQ	F
			7-8-AF-109B		NAD				NQ	
HA #110	**Odor control system**	Caulk at 4160 volt odor control system main circuit braker - grey	7-8-AF-110A	MISC	NAD			NO	NQ	NF
			7-8-AF-110B		NAD				NQ	
HA #111	**Odor control duct work**	Flex connector at cylindrical duct - red	7-8-AF-111A	MISC	NAD			NO	NQ	NF
			7-8-AF-111B		NAD				NQ	
HA #112	**Ram clean unit**	Door packing material - black	7-8-AF-112A	MISC	NAD			NO	NQ	F
			7-8-AF-112B		NAD				NQ	
HA #99	**RTO #1 - South Facade, RTO #2 - South Facade**	Window glazing compound in entry door - gray	7-8-AF-99A	MISC	NAD			NO	NQ	NF
			7-8-AF-99B		NAD				NQ	
HA #100	**RTO #1 - South Facade, RTO #2 - South Facade**	Door frame caulk - off white	7-8-AF-100A	MISC	NAD			NO	NQ	NF
			7-8-AF-100B		NAD				NQ	
Elevated Conveyors										
	Color Key On Drawing:	**1980'S Construction**								
HA #113	**Refuse derived fuel conveyor**	Exterior caulk at flex connector - white	7-8-AF-113A	MISC	NAD			NO	NQ	NF
			7-8-AF-113B		NAD				NQ	
HA #114	**Refuse derived fuel conveyor**	Flex connector at building / conveyor junction - black	7-8-AF-114A	MISC	NAD			NO	NQ	NF
			7-8-AF-114B		NAD				NQ	
HA #115	**Refuse derived fuel conveyor**	Foam like caulk at metal wall panel base in corrugated valleys -	7-8-AF-115A	MISC	NAD			NO	NQ	NF
			7-8-AF-115B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Elevated Conveyors (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #155	**Refuse derived fuel conveyor, Coal supply conveyor**	Caulk at steel frame beam junctions above conveyor belt - black	7-9-AF-155A	MISC	NAD			NO	NQ	NF
			7-9-AF-155B		NAD				NQ	
			7-9-AF-155C		NAD				NQ	
HA #156	**Coal return conveyor**	Spray foam at ceiling ridge between metal panels - yellow	7-9-AF-156A	MISC	NAD			NO	NQ	NF
			7-9-AF-156B		NAD				NQ	
Transfer Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #148	**Rm 1-01, Rm 2-05**	Fire stop caulk - beige	7-9-AF-148A	MISC	NAD			NO	NQ	NF
			7-9-AF-148B		NAD				NQ	
HA #149	**Rm 1-02**	Skim coat at electrical conduits-metallic	7-9-AF-149A	SURF	NAD			NO	NQ	NF
			7-9-AF-149B		NAD				NQ	
			7-9-AF-149C		NAD				NQ	
HA #30	**Rm 1-02**	Sheetrock	7-9-AF-30D	MISC	NAD			NO	NQ	NF
HA #31	**Rm 1-02**	Joint compound associated with sheet rock - white	7-9-AF-31D	MISC	NAD			NO	NQ	F
HA #150	**Rm 1-04**	Pre-cast calcium silicate insulation pipe wrap - white	7-9-AF-150A	TSI	NAD			NO	NQ	F
			7-9-AF-150B		NAD				NQ	
HA #151	**Rm 1-04**	Pre-cast calcium silicate insulation block - white	7-9-AF-151A	TSI	NAD			NO	NQ	F
			7-9-AF-151B		NAD				NQ	
HA #152	**Rm 2-05**	Gasket at roof drain - orange	7-9-AF-152A	MISC	NAD			NO	NQ	NF
			7-9-AF-152B		NAD				NQ	
HA #153	**Rm 3-09**	Silicone caulk over aluminum jacket on pipes - transparent	7-9-AF-153A	MISC	NAD			NO	NQ	F
			7-9-AF-153B		NAD				NQ	
HA #154	**Rm 4-10**	Woven gasket at belt cleaner unit access door - white	7-9-AF-154A	MISC	NAD			NO	NQ	F
			7-9-AF-154B		NAD				NQ	
HA #157	**Rm 5-11**	Bottom layer tar paper at roof deck - corrugated	7-9-AF-157A	MISC	NAD			NO	NQ	NF
			7-9-AF-157B		NAD				NQ	
HA #158	**Lower Level Roof**	Roof tar and felts - black	7-9-AF-158A	MISC	NAD			NO	NQ	NF
			7-9-AF-158B		NAD				NQ	
HA #160	**Lower Level Roof**	Louver caulk-cream	7-9-AF-160A	MISC	NAD			NO	NQ	NF
			7-9-AF-160B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Transfer Building (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #161	**West Facade**	Door frame caulk-grey	7-9-AF-161A	MISC	NAD			NO	NQ	NF
			7-9-AF-161B		NAD				NQ	
Coal Barge Unloading Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #162	**Level 4**	Gasket at motor for hopper - red	7-10-AF-162A	MISC	NAD			NO	NQ	NF
			7-10-AF-162B		NAD				NQ	
HA #163	**Level 9**	Caulk at hatch door - gray	7-10-AF-163A	MISC	NAD			NO	NQ	NF
			7-10-AF-163B		NAD				NQ	
Waste Processing Facility Administration Building										
	Color Key On Drawing:	**1980'S Construction**								
HA #38	**Rm 1-01**	Paper insulation over fiberglass on water lines	7-5-AF-38C	TSI	NAD			NO	NQ	F
HA #71	**Rm 1-01**	Carpet square adhesive-yellow	7-5-AF-71A	MISC	NAD			NO	NQ	NF
HA #72	**Rm 1-01**	4" vinyl cove base adhesive-grey	7-5-AF-72A	MISC	NAD			NO	NQ	NF
HA #73	**Rm 1-01**	4" vinyl cove base - grey	7-5-AF-73A	MISC	NAD			NO	NQ	NF
			7-5-AF-73B		NAD				NQ	
HA #74	**Rm 1-01, Rm 1-06**	Sheetrock-wall	7-5-AF-74A	MISC	NAD			NO	NQ	NF
			7-5-AF-74B		NAD				NQ	
HA #75	**Rm 1-01, Rm 1-06**	Joint compound associated with sheetrock-white	7-5-AF-75A	MISC	NAD			NO	NQ	F
			7-5-AF-75B		NAD				NQ	
HA #76	**Rm 1-01**	Window glazing compound to exterior windows-black	7-5-AF-76A	MISC	NAD			NO	NQ	NF
HA #78	**Rm 1-02**	Carpet adhesive-yellow	7-5-AF-78A	MISC	NAD			NO	NQ	NF
HA #79	**Rm 1-02**	2' x 2' smooth face acoustic ceiling tile	7-5-AF-79A	MISC	NAD			NO	NQ	F
			7-5-AF-79B		NAD				NQ	
HA #80	**Rm 1-02**	2' x 2' Rough face acoustic ceiling tile	7-5-AF-80A	MISC	NAD			NO	NQ	F
			7-5-AF-80B		NAD				NQ	
HA #81	**Rm 1-03**	Floor tile mastic associated with white vinyl floor tile- transparent	7-5-AF-81A	MISC	NAD			NO	NQ	NF
			7-5-AF-81B		NAD				NQ	
HA #82	**Rm 1-03**	12" x 12" vinyl floor tile - white with grey specs	7-5-AF-82A	MISC	NAD			NO	NQ	NF
			7-5-AF-82B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Waste Processing Facility Administration Building (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #47	**Rm 1-04**	12" x 12" vinyl floor tile-beige with grey specs	7-5-AF-47C	MISC	NAD			NO	NQ	NF
HA #65	**Rm 1-04**	Flooring mastic on concrete-black	7-5-AF-65B	MISC	NAD			NO	NQ	NF
HA #39	**Rm 1-06**	Panel adhesive under fiberglass in unit ventilator-black	7-5-AF-39C	MISC	NAD			NO	NQ	NF
HA #83	**Rm 1-06**	Mastic on foil wrap over duct work - yellow	7-5-AF-83A	TSI	NAD			NO	NQ	NF
			7-5-AF-83B		NAD				NQ	
HA #84	**Rm 1-07**	Thinset associated with ceramic wall tile - white	7-5-AF-84A	MISC	NAD			NO	NQ	NF
			7-5-AF-84B		NAD				NQ	
HA #85	**Rm 1-07**	Grout associated with wall tile - grey	7-5-AF-85A	MISC	NAD			NO	NQ	NF
			7-5-AF-85B		NAD				NQ	
HA #86	**Rm 1-11**	Backer to bat insulation	7-5-AF-86A	MISC	NAD			NO	NQ	NF
			7-5-AF-86B		NAD				NQ	
HA #87	**Rm 1-16**	Thinset associated with ceramic floor tile - grey	7-5-AF-87A	MISC	NAD			NO	NQ	NF
			7-5-AF-87B		NAD				NQ	
HA #88	**Rm 1-18**	Sink undercoating - white	7-5-AF-88A	MISC	NAD			NO	NQ	NF
			7-5-AF-88B		NAD				NQ	
HA #89	**Rm 1-18**	Caulk at sink spout - white	7-5-AF-89A	MISC	NAD			NO	NQ	NF
			7-5-AF-89B		NAD				NQ	
HA #164	**South Facade**	Door frame caulk-grey	7-10-AF-164C	MISC	NAD			NO	NQ	NF
HA #173	**West Facade**	Window glazing at entry doors - black	7-10-AF-173A	MISC	NAD			NO	NQ	NF
			7-10-AF-173B		NAD				NQ	
HA #174	**North Facade**	Expansion board at concrete wall junction - brown	5-10-AF-174A	MISC	NAD			NO	NQ	NF
			5-10-AF-174B		NAD				NQ	
HA #175	**Roof 1**	Felt paper - black	5-10-AF-175A	MISC	NAD			NO	NQ	F
			5-10-AF-175B		NAD				NQ	
HA #176	**Roof 1**	Reglet caulk - black	5-10-AF-176A	MISC	NAD			NO	NQ	NF
			5-10-AF-176B		NAD				NQ	
HA #177	**Roof 2**	Gypsum roof deck	5-10-AF-177A	MISC	NAD			NO	NQ	NF
			5-10-AF-177B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Waste Processing Facility Administration Building (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #178	**Roof 2**	Joint compound associated with gypsum roof deck - white	5-10-AF-178A	MISC	NAD			NO	NQ	F
			5-10-AF-178B		NAD				NQ	
HA #179	**Roof 2**	Reglet caulk - black	5-10-AF-179A	MISC	NAD			NO	NQ	NF
			5-10-AF-179B		NAD				NQ	
Tool Storage										
	Color Key On Drawing:	**1990'S Construction**								
HA #116	**Rm 1-01**	Spray applied fire proofing	7-8-AF-116A	SURF	NAD			NO	NQ	F
			7-8-AF-116B		NAD				NQ	
			7-8-AF-116C		NAD				NQ	
			7-8-AF-116D		NAD				NQ	
			7-8-AF-116E		NAD				NQ	
HA #117	**Rm 1-01**	Soft fitting cement at roof drains and penetrations	7-8-AF-117A	TSI	NAD			NO	NQ	F
			7-8-AF-117B		NAD				NQ	
			7-8-AF-117C		NAD				NQ	
HA #118	**Rm 1-01**	Sealant between duct frame and wall - black	7-8-AF-118A	MISC	NAD			NO	NQ	NF
			7-8-AF-118B		NAD				NQ	
HA #119	**Rm 1-01**	Caulk at CMU / metal wall panel junction - gray	7-8-AF-119A	MISC	NAD			NO	NQ	NF
			7-8-AF-119B		NAD				NQ	
HA #120	**Rm 1-02**	Window glazing compound in partition windows - off white	7-8-AF-120A	MISC	NAD			NO	NQ	NF
			7-8-AF-120B		NAD				NQ	
HA #121	**Rm 1-02**	Rubber square adhesive - yellow	7-8-AF-121A	MISC	NAD			NO	NQ	NF
			7-8-AF-121B		NAD				NQ	
HA #122	**Rm 1-02**	4" vinyl cove base - gray	7-8-AF-122A	MISC	NAD			NO	NQ	NF
			7-8-AF-122B		NAD				NQ	
HA #123	**Rm 1-02**	Gypsum ceiling backer	7-8-AF-123A	MISC	NAD			NO	NQ	NF
			7-8-AF-123B		NAD				NQ	
HA #124	**Rm 1-02**	Pin tab adhesive on gypsum ceiling - olive	7-8-AF-124A	MISC	NAD			NO	NQ	NF
			7-8-AF-124B		NAD				NQ	
HA #125	**Rm 1-02**	2'x4' acoustical ceiling tile - pinhole & fissure	7-8-AF-125A	MISC	NAD			NO	NQ	F
			7-8-AF-125B		NAD				NQ	
HA #126	**Rm 2-03**	Panel adhesive on unit ventilator - red	7-8-AF-126A	MISC	NAD			NO	NQ	NF
			7-8-AF-126B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Tool Storage (continued)										
	Color Key On Drawing:	**1990'S Construction**								
HA #127	**Rm 2-03**	Caulk at metal cove base / wall panel junction - white	7-8-AF-127A	MISC	NAD			NO	NQ	NF
			7-8-AF-127B		NAD				NQ	
HA #128	**Rm 2-05**	Fire door core insulation - white	7-8-AF-128A	MISC	NAD			NO	NQ	F
			7-8-AF-128B		NAD				NQ	
HA #46	**Rm 2-05**	Flooring mastic - yellow	7-8-AF-46D	MISC	NAD			NO	NQ	NF
HA #47	**Rm 2-05**	12" x 12" vinyl floor tile-beige with grey specs	7-8-AF-47D	MISC	NAD			NO	NQ	NF
HA #29	**Rm 2-05**	Foil insulation	7-8-AF-29D	TSI	NAD			NO	NQ	NF
HA #30	**Rm 2-05**	Sheetrock	7-8-AF-30C	MISC	NAD			NO	NQ	NF
HA #31	**Rm 2-05**	Joint compound-white	7-8-AF-31C	MISC	NAD			NO	NQ	F
HA #25	**Rm 2-05**	Pipe dope- white	7-8-AF-25C	MISC	NAD			NO	NQ	NF
HA #129	**Rm 2-06**	Mud base associated with gray ceramic floor tile	7-8-AF-129A	MISC	NAD			NO	NQ	NF
			7-8-AF-129B		NAD				NQ	
HA #130	**Rm 2-06**	Grout associated with gray ceramic floor tile - gray	7-8-AF-130A	MISC	NAD			NO	NQ	NF
			7-8-AF-130B		NAD				NQ	
HA #131	**Rm 2-06**	Adhesive associated with gray Ceramic floor tile over mud base - yellow	7-8-AF-131A	MISC	NAD			NO	NQ	NF
			7-8-AF-131B		NAD				NQ	
HA #132	**Rm 2-06**	Adhesive associated with ceramic wall tile - yellow	7-8-AF-132A	MISC	NAD			NO	NQ	NF
			7-8-AF-132B		NAD				NQ	
HA #133	**Rm 2-06**	Grout associated with ceramic wall tile - gray	7-8-AF-133A	MISC	NAD			NO	NQ	NF
			7-8-AF-133B		NAD				NQ	
HA #134	**Rm 2-10**	12"x12" vinyl floor tile - black	7-8-AF-134A	MISC	NAD			NO	NQ	NF
			7-8-AF-134B		NAD				NQ	
HA #135	**Rm 2-11**	Canvas wrap on sheetrock	7-8-AF-135A	MISC	NAD			NO	NQ	NF
			7-8-AF-135B		NAD				NQ	
HA #136	**Rm 2-11**	Sink undercoating - blue	7-8-AF-136A	MISC	NAD			NO	NQ	NF
			7-8-AF-136B		NAD				NQ	
HA #137	**Rm 2-11**	Caulk at sink surround - white	7-8-AF-137A	MISC	NAD			NO	NQ	NF
			7-8-AF-137B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Tool Storage (continued)										
	Color Key On Drawing:	**1990'S Construction**								
HA #180	**Roof**	Caulk at roof top unit - gray	7-10-AF-180A	MISC	NAD		NAD	NO	NQ	NF
			7-10-AF-180B		NAD				NQ	
HA #181	**Roof**	Caulking at roof penetrations - black	7-10-AF-181A	MISC	NAD			NO	NQ	NF
			7-10-AF-181B		NAD				NQ	
HA #182	**Roof**	Flashing cement - black	7-10-AF-182A	MISC	NAD		NAD	NO	NQ	NF
			7-10-AF-182B		NAD				NQ	
Scales House										
	Color Key On Drawing:	**1980'S Construction**								
HA #139	**Scale house #1 interior**	2'x4' imitation ceiling tile	7-9-AF-139A	MISC	NAD			NO	NQ	F
			7-9-AF-139B		NAD				NQ	
HA #146	**Scale house #2 interior**	Caulk at window sash and frame - gray	7-9-AF-146A	MISC	NAD			NO	NQ	NF
			7-9-AF-146B		NAD				NQ	
HA #140	**Scale house #1 exterior - West Facade, Scale house #1 exterior - North Facade**	Caulk at window / door surrounds - gray	7-9-AF-140A	MISC	NAD			NO	NQ	NF
			7-9-AF-140B		NAD				NQ	
HA #141	**Scale house #1 roof**	Bottom layer roofing felt paper - black (layer 1)	7-9-AF-141A	MISC	NAD			NO	NQ	NF
			7-9-AF-141B		NAD				NQ	
HA #142	**Scale house #1 roof**	Toper layer roofing felt paper - black (layer 2)	7-9-AF-142A	MISC	NAD			NO	NQ	NF
			7-9-AF-142B		NAD				NQ	
HA #143	**Scale house #1 roof**	Reglet caulk - black	7-9-AF-143A	MISC	NAD			NO	NQ	NF
			7-9-AF-143B		NAD				NQ	
HA #144	**Scale house #1 roof**	Caulking on duct work to roof top unit - gray	7-9-AF-144A	MISC	NAD			NO	NQ	NF
			7-9-AF-144B		NAD				NQ	
HA #145	**Scale house #1 roof**	Caulking on duct work to roof top unit - vibrant white	7-9-AF-145A	MISC	NAD			NO	NQ	NF
			7-9-AF-145B		NAD				NQ	
POWER BLOCK FACILITY										
Combustion Units 11, 12, 13, Dry Scrubbers and Bag Houses										
	Color Key On Drawing:	**1980'S Construction**								
HA #199	**Electrical Room under Dry Scrubber #2**	Felt paper - brown	7-15-AF-199A	MISC	NAD			NO	NQ	NF
			7-15-AF-199B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Combustion Units 11, 12, 13, Dry Scrubbers and Bag Houses (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #200	**Electrical Room under Dry Scrubber #2**	Caulk at roof vent - black	7-15-AF-200A	MISC	NAD			NO	NQ	NF
			7-15-AF-200B		NAD				NQ	
HA #201	**Electrical Room under Dry Scrubber #2**	Expansion board at concrete bisque of columns - black	7-15-AF-201A	MISC	NAD			NO	NQ	NF
			7-15-AF-201B		NAD				NQ	
HA #213	**Tank under scrubber 1 and 2**	Packing at tank under aluminum jacket - beige	7-16-AF-213A	TSI	NAD			NO	NQ	F
			7-16-AF-213B		NAD				NQ	
			7-16-AF-213C		NAD				NQ	
HA #202	**Combustion unit 11, elevation 31'**	Rubber gasket at hot water/trash zone access hatch	7-15-AF-202A	MISC	NAD			NO	NQ	NF
			7-15-AF-202B		NAD				NQ	
HA #203	**Combustion unit 11, elevation 31', Combustion unit 12, elevation 31'**	Gasket at supply lines between valves - orange	7-15-AF-203A	MISC	NAD			NO	NQ	NF
			7-15-AF-203B		NAD				NQ	
HA #204	**Combustion unit 11, elevation 31', Combustion unit 12, elevation 31'**	Rope gasket at hopper funnel - white	7-15-AF-204A	MISC	NAD			NO	NQ	NF
			7-15-AF-204B		NAD				NQ	
HA #205	**Combustion unit 11, elevation 31', Combustion unit 12, elevation 31'**	Packing behind aluminum jacket at water tank - gray	7-15-AF-205A	TSI	NAD			NO	NQ	F
			7-15-AF-205B		NAD				NQ	
			7-15-AF-205C		NAD				NQ	
HA #206	**Combustion unit 11, elevation 36', Combustion unit 11, elevation 55', Combustion unit 12, elevation 36'**	Packing under aluminum jacket around steam tank - white	7-15-AF-206A	TSI	NAD			NO	NQ	F
			7-15-AF-206B		NAD				NQ	
			7-15-AF-206C		NAD				NQ	
HA #207	**Combustion unit 11, elevation 36', Combustion unit 12, elevation 36'**	Sealant at aluminum jackets at pipes - metallic	7-15-AF-207A	MISC	NAD			NO	NQ	NF
			7-15-AF-207B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Combustion Units 11, 12, 13, Dry Scrubbers and Bag Houses (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #208	**Combustion unit 11, elevation 36'**	Pipe insulation - soft/white	7-15-AF-208A	TSI	NAD			NO	NQ	F
			7-15-AF-208B		NAD				NQ	
			7-15-AF-208C		NAD				NQ	
HA #209	**Combustion unit 11, elevation 45', Combustion unit 12, elevation 45'**	Large flex connector around entire boiler - black	7-15-AF-209A	MISC	NAD			NO	NQ	NF
			7-15-AF-209B		NAD				NQ	
HA #210	**Combustion unit 11, elevation 45', Combustion unit 12, elevation 45'**	Rope gasket around flex connector	7-15-AF-210A	MISC	NAD			NO	NQ	NF
			7-15-AF-210B		NAD				NQ	
HA #211	**Combustion unit 11, elevation 45', Combustion unit 12, elevation 45', Combustion unit 13, elevation 45'**	Refractory packing at interior boiler access door - gray	7-15-AF-211A	MISC	NAD			NO	NQ	NF
			7-15-AF-211B		NAD				NQ	
			7-15-AF-211C		NAD				NQ	
HA #212	**Combustion unit 11, elevation 45'**	Residual material on pipe - white	7-15-AF-212A	TSI	NAD			NO	NQ	F
HA #214	**Combustion unit 11, elevation 89', Combustion unit 12, elevation 89'**	Gasket at electrical scale funnel - blue	7-16-AF-214A	MISC	NAD			NO	NQ	NF
			7-16-AF-214B		NAD				NQ	
HA #215	**Combustion unit 11, elevation 89', Combustion unit 12, elevation 89'**	Sealant at rope gasket - black	7-16-AF-215A	MISC	NAD			NO	NQ	NF
			7-16-AF-215B		NAD				NQ	
HA #216	**Combustion unit 11, elevation 104'**	Patching component at boiler access hatch - gray	7-16-AF-216A	MISC	NAD			NO	NQ	NF
			7-16-AF-216B		NAD				NQ	
HA #217	**Combustion unit 11, elevation 116'**	Cylindrical flex connector at hopper - black	7-16-AF-217A	MISC	NAD			NO	NQ	NF
			7-16-AF-217B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Combustion Units 11, 12, 13, Dry Scrubbers and Bag Houses (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #218	**Combustion unit 12, elevation 36'**	Diplag wrap over fiberglass	7-16-AF-218A	TSI	NAD			NO	NQ	NF
HA #219	**Combustion unit 12, elevation 36'**	Coating on pipe - white at steam system	7-16-AF-219A	MISC	NAD			NO	NQ	F
			7-16-AF-219B		NAD				NQ	
HA #216	**Combustion Unit 13, elevation 89'**	Mineral wool behind corrugated metal paneling	7-17-AF-X216B	MISC	NAD			NO	NQ	F
HA #194	**Bag House #1 - North Facade, Bag House #2 - South Facade**	Large flex connector - black	7-15-AF-194A	MISC	NAD			NO	NQ	NF
			7-15-AF-194B		NAD				NQ	
HA #195	**Bag House #1 - North Facade, Bag House #2 - South Facade**	Gasket at air lock base motor switch	7-15-AF-195A	MISC	NAD			NO	NQ	NF
			7-15-AF-195B		NAD				NQ	
HA #196	**Bag House #1 - North Facade**	Sealant at aluminum fiberglass insulation covers at pipe - transparent	7-15-AF-196A	MISC	NAD			NO	NQ	NF
			7-15-AF-196B		NAD				NQ	
HA #197	**Dry Scrubber #1 - West Facade**	Window glazing compound in hoist room doors - black	7-15-AF-197A	MISC	NAD			NO	NQ	NF
			7-15-AF-197B		NAD				NQ	
HA #198	**Dry Scrubber #1 - South Facade**	Insulator material between interior and exterior paneling - white	7-15-AF-198A	MISC	NAD			NO	NQ	NF
			7-15-AF-198B		NAD				NQ	
HA #216	**Bag House #1, South Facade**	Mineral wool behind corrugated metal paneling	7-17-AF-X216A	MISC	NAD			NO	NQ	F
HA #217	**Combustion unit 9 base level, Combustion unit 10 base level**	Soft pack pipe insulation - gray	7-17-AF-217A	TSI	NAD			NO	NQ	F
			7-17-AF-217B		NAD				NQ	
		Soft pack pipe insulation - gray (elbow)	7-17-AF-217C	TSI	NAD			NO	NQ	F
HA #218	**Combustion unit 9 base level, Combustion unit 10 base level**	Woven wrap over soft pack pipe insulation - white	7-17-AF-218A	TSI	NAD			NO	NQ	F
			7-17-AF-218B		NAD				NQ	
			7-17-AF-218C		NAD				NQ	
HA #219	**Combustion unit 9 base level**	Debris in interior boiler fire tube - white	7-17-AF-X219A	TSI	NAD			NO	NQ	F
			7-17-AF-X219B		NAD				NQ	
			7-17-AF-X219C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Combustion Units 11, 12, 13, Dry Scrubbers and Bag Houses (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #222	**Combustion unit 9 base level, Combustion unit 10 base level**	Refractory packing at access hatch - gray	7-17-AF-222A	MISC	NAD			NO	NQ	F
			7-17-AF-222B		NAD				NQ	
HA #226	**Combustion unit 10 third level**	Stored refractory brick	7-17-AF-226A	MISC	NAD			NO	NQ	NF
			7-17-AF-226B		NAD				NQ	
HA #228	**Combustion unit 10 base level**	Interior refractory packing on wire mesh	7-17-AF-228A	MISC	NAD			NO	NQ	F
			7-17-AF-228B		NAD				NQ	
HA #230	**Combustion unit 10 second level**	Electrical wire coating behind chemelex - white / woven	7-17-AF-230A	MISC	NAD			NO	NQ	NF
			7-17-AF-230B		NAD				NQ	
HA #231	**Combustion unit 10 second level**	Taping compound around electrical wires	7-17-AF-231A	MISC	NAD			NO	NQ	NF
			7-17-AF-231B		NAD				NQ	
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #234	**Rm 0-01 Elevation 31', Rm 2-27 Elevation 57'**	Concrete floor - gray	7-18-AF-234A	MISC	NAD			NO	NQ	NF
			7-23-AF-234B		NAD				NQ	
HA #235	**Rm 0-01 Elevation 31', Rm 2-27 Elevation 57'**	Terracotta block mortar - brown	7-18-AF-235A	MISC	NAD			NO	NQ	NF
			7-22-AF-235B		NAD				NQ	
HA #192	**Rm 0-01 Elevation 31', Rm 0-07 Elevation 31', Rm 0-14 Elevation 35', Rm 7-45 Elevation 114', Rm 00-56 Elevation 11', Rm 00-59 Elevation 25'**	2" concrete fire proofing	7-15-AF-192A	SURF	NAD			NO	NQ	NF
			7-18-AF-192B		NAD				NQ	NF
			7-19-AF-192C		NAD				NQ	
			7-22-AF-192XC		NAD				NQ	
			7-25-AF-192D		NAD				NQ	
			7-25-AF-192E		NAD				NQ	
			7-30-AF-192F		NAD				NQ	
			7-31-AF-192G		NAD				NQ	
HA #237	**Rm 0-01 Elevation 31', Rm 2-27 Elevation 57', Rm 00-56 Elevation 11'**	Pipe dope on 2" water lines - white	7-18-AF-237A	MISC	NAD			NO	NQ	NF
			7-23-AF-237B		NAD				NQ	
			7-29-AF-237C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #238	**Rm 0-01 Elevation 31', Rm 8-55**	Pipe dope on 3" lines - orange	7-18-AF-238A	MISC	NAD			NO	NQ	NF
			7-29-AF-238B		NAD				NQ	
HA #240	**Rm 0-01 Elevation 31'**	Felt paper at interior boiler breaching behind angle iron -	7-18-AF-240A	MISC	NAD			NO	NQ	F
			7-18-AF-240B		NAD				NQ	
HA #X241	**Rm 0-01 Elevation 31', Rm 2-27 Elevation 57'**	Window glazing compound in reinforced chicken wire windows - white	7-18-AF-X241A	MISC	NAD		NAD	NO	NQ	NF
			7-23-AF-X241B		NAD				NQ	
HA #242	**Rm 0-01 Elevation 31'**	Insol block-19 at tanks - white	7-18-AF-242A	TSI	NAD			NO	NQ	F
			7-18-AF-242B		NAD				NQ	
			7-18-AF-242C		NAD				NQ	
HA #243	**Rm 0-01 Elevation 31', Rm 0-06B Elevation 31', Rm 00-56 Elevation 11'**	Protective cloth wrap over soft pack insulation	7-18-AF-243A	TSI	NAD			NO	NQ	NF
			7-18-AF-243B		NAD				NQ	
			7-30-AF-243C		NAD				NQ	
HA #244	**Rm 0-02 Elevation 31', Rm 0-04 Elevation 31', Rm 2-28 Elevation 57'**	Plaster rough coat - brown	7-18-AF-244A	SURF	NAD			NO	NQ	F
			7-18-AF-244B		NAD				NQ	
			7-23-AF-244C		NAD				NQ	
HA #245	**Rm 0-02 Elevation 31', Rm 0-04 Elevation 31', Rm 2-28 Elevation 57'**	Plaster skim coat - white	7-18-AF-245A	SURF	NAD			NO	NQ	F
			7-18-AF-245B		NAD				NQ	
			7-23-AF-245C		NAD				NQ	
HA #247	**Rm 0-04 Elevation 31'**	Stored gasket - gray	7-18-AF-247A	MISC	NAD			NO	NQ	NF
			7-18-AF-247B		NAD				NQ	
HA #249	**Rm 0-13 Elevation 35', Rm 2-27 Elevation 57', Rm 00-56 Elevation 11'**	Calcium silicate insulation	7-22-AF-249A	TSI	NAD			NO	NQ	F
			7-23-AF-249B		NAD				NQ	
			7-30-AF-249C		NAD				NQ	
HA #250	**Rm 0-07 Elevation 31', Rm 0-11 Elevation 31', Rm 2-27 Elevation 57', Rm 7-45 Elevation 114'**	Paint on structural components and pipes - metallic	7-19-AF-250A	MISC	NAD			NO	NQ	NF
			7-19-AF-250B		NAD				NQ	
			7-23-AF-250C		NAD				NQ	
			7-25-AF-250D		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #252	**Rm 0-07 Elevation 31'**	Caulk between slabs - white	7-19-AF-252A	MISC	NAD			NO	NQ	NF
			7-19-AF-252B		NAD				NQ	
HA #253	**Rm 0-07 Elevation 31'**	Window glazing compound in sliding door windows - white	7-19-AF-253A	MISC	NAD			NO	NQ	NF
			7-19-AF-253B		NAD				NQ	
HA #254	**Rm 0-07 Elevation 31'**	Expansion board between slabs - black	7-19-AF-254A	MISC	NAD			NO	NQ	NF
			7-19-AF-254B		NAD				NQ	
HA #255	**Rm 0-08A Elevation 31'**	Floor tile mastic - yellow	7-19-AF-255A	MISC	NAD			NO	NQ	NF
			7-19-AF-255B		NAD				NQ	
HA #256	**Rm 0-08A Elevation 31'**	12"x12" vinyl floor tile - white	7-19-AF-256A	MISC	NAD			NO	NQ	NF
			7-19-AF-256B		NAD				NQ	
HA #257	**Rm 0-08A Elevation 31'**	4" vinyl cove base adhesive - dark yellow	7-19-AF-257A	MISC	NAD			NO	NQ	NF
			7-19-AF-257B		NAD				NQ	
HA #258	**Rm 0-08A Elevation 31'**	4" vinyl cove base - black	7-19-AF-258A	MISC	NAD			NO	NQ	NF
			7-19-AF-258B		NAD				NQ	
HA #259	**Rm 0-08B Elevation 31', Rm 1-66**	Sheetrock (wall)	7-19-AF-259A	MISC	NAD			NO	NQ	NF
			8-1-AF-259B		NAD				NQ	
HA #260	**Rm 0-08B Elevation 31', Rm 1-66**	Joint compound associated with sheetrock - white	7-19-AF-260A	MISC	NAD			NO	NQ	F
			8-1-AF-260B		NAD				NQ	
HA #263	**Rm 1-09 Elevation 45', Rm 1-10 Elevation 45'**	Sealant at duct work seams - orange	7-19-AF-263A	MISC	NAD			NO	NQ	NF
			7-19-AF-263B		NAD				NQ	
HA #265	**Rm 0-11 Elevation 31'**	Gasket at air compressor unit - brown	7-19-AF-265A	MISC	NAD			NO	NQ	NF
			7-19-AF-265B		NAD				NQ	
HA #266	**Rm 0-12 Elevation 35'**	Stored pipe insulation - white	7-19-AF-266A	TSI	NAD			NO	NQ	F
			7-19-AF-266B		NAD				NQ	
			7-19-AF-266C		NAD				NQ	
HA #268	**Rm 0-12 Elevation 35', Rm 2-27 Elevation 57'**	Brick mortar - gray	7-19-AF-268A	MISC	NAD			NO	NQ	NF
			7-23-AF-268B		NAD				NQ	
HA #270	**Rm 0-13 Elevation 35', Rm 00-56 Elevation 11'**	Red 6"x6" quarry tile setting cement	7-19-AF-270A	MISC	NAD			NO	NQ	NF
			7-30-AF-270B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #271	**Rm 0-13 Elevation 35', Rm 00-56 Elevation 11'**	Grout associated with red 6"x6" quarry tile - gray	7-19-AF-271A	MISC	NAD			NO	NQ	NF
			7-30-AF-271B		NAD				NQ	
HA #218	**Rm 0-13 Elevation 35'**	Diplag wrap over calcium silicate	7-22-AF-218B	TSI	NAD			NO	NQ	NF
HA #273	**Rm 0-13 Elevation 35'**	Cement like sleeve in pipe conduit through floor - gray	7-22-AF-273A	MISC	NAD			NO	NQ	NF
			7-22-AF-273B		NAD				NQ	
HA #274	**Rm 0-16 Elevation 35'**	Sink undercoating - cream	7-22-AF-274A	MISC	NAD			NO	NQ	NF
			7-22-AF-274B		NAD				NQ	
HA #276	**ST-1**	Ice and water shield over sprinkler room	7-22-AF-276A	MISC	NAD			NO	NQ	NF
			7-22-AF-276B		NAD				NQ	
HA #277	**Rm 0-17 Elevation ~21'**	Tar paper in pipe penetration conduit through floor - black	7-22-AF-277A	MISC	NAD			NO	NQ	NF
			7-22-AF-277B		NAD				NQ	
HA #281	**Rm 0-17 Elevation ~21'**	Brushed on paint on structural steel beam - black	7-22-AF-281A	MISC	NAD			NO	NQ	NF
			7-22-AF-281B		NAD				NQ	
			7-22-AF-281C		NAD				NQ	
HA #284	**Rm 0-18 Elevation 31'**	Spray applied cementitious coating on foundation	7-22-AF-284A	SURF	NAD			NO	NQ	F
			7-22-AF-284B		NAD				NQ	
			7-22-AF-284C		NAD				NQ	
HA #285	**Rm 0-18 Elevation 31', Rm 2-30 Elevation 57'**	Window glazing compound in door window - black	7-22-AF-285A	MISC	NAD			NO	NQ	NF
			7-23-AF-285B		NAD				NQ	
HA #286	**Rm 0-18 Elevation 31', Rm 2-30 Elevation 57'**	Door frame caulk - beige	7-22-AF-286A	MISC	NAD			NO	NQ	NF
			7-23-AF-286B		NAD				NQ	
HA #287	**Rm 0-18 Elevation 31'**	Styrofoam between interior and exterior paneling	7-22-AF-287A	MISC	NAD			NO	NQ	NF
			7-22-AF-287B		NAD				NQ	
HA #288	**Rm 0-19 Elevation 31'**	Sealant around rubber gasket - red	7-22-AF-288A	MISC	NAD			NO	NQ	NF
			7-22-AF-288B		NAD				NQ	
HA #289	**Rm 0-19 Elevation 31'**	Expansion seam caulk at CMU / brick junction - white	7-22-AF-289A	MISC	NAD			NO	NQ	NF
			7-22-AF-289B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #290	**Rm 0-18 Elevation 31'**	Refractory block at 6 H.P. heater - white	7-22-AF-290A	TSI	NAD			NO	NQ	NF
			7-22-AF-290B		NAD				NQ	
			7-22-AF-290C		NAD				NQ	
HA #291	**Rm 0-20**	Caulk at foundation floor junction - white	7-22-AF-291A	MISC	NAD			NO	NQ	NF
			7-22-AF-291A		NAD				NQ	
HA #293	**Rm 0-23**	Window glazing compound in office partition windows - white	7-22-AF-293A	MISC	NAD			NO	NQ	NF
			7-22-AF-293B		NAD				NQ	
HA #298	**Rm 1-26 Elevation 45'**	Vapor paper behind brick - black	7-23-AF-298A	MISC	NAD			NO	NQ	NF
			7-23-AF-298B		NAD				NQ	
HA #300	**Rm 1-26 Elevation 45'**	Tar at original brick at "D" wall floor junction - black	7-23-AF-300A	MISC	NAD			NO	NQ	NF
			7-23-AF-300B		NAD				NQ	
HA #301	**Rm 2-27 Elevation 57'**	Mortar over lintel at window - gray	7-23-AF-301A	MISC	NAD			NO	NQ	NF
			7-23-AF-301B		NAD				NQ	
HA #302	**Rm 2-27 Elevation 57'**	Tar on lintel under windows - black	7-23-AF-302A	MISC	NAD		NAD	NO	NQ	NF
			7-23-AF-302B		NAD				NQ	
HA #305	**Rm 2-29 Elevation 57'**	Window glazing compound in office windows - beige	7-23-AF-305A	MISC	NAD			NO	NQ	NF
			7-23-AF-305B		NAD				NQ	
HA #307	**Rm 2-30 Elevation 57'**	Expansion board between slabs - black	7-23-AF-307A	MISC	NAD			NO	NQ	NF
			7-23-AF-307B		NAD				NQ	
HA #308	**Rm 2-30 Elevation 57'**	Flooring leveler - white	7-23-AF-308A	MISC	NAD			NO	NQ	NF
			7-23-AF-308B		NAD				NQ	
HA #309	**Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	Floor tile mastic - yellow	7-23-AF-309A	MISC	NAD			NO	NQ	NF
			7-23-AF-309B		NAD				NQ	
HA #310	**Rm 1-66, Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	12"x12" vinyl floor tile - blue gray specs	7-23-AF-310A	MISC	NAD			NO	NQ	NF
			7-23-AF-310B		NAD				NQ	
			7-31-AF-310C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #311	**Rm 1-66, Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	4" vinyl cove base adhesive - yellow	7-23-AF-311A	MISC	NAD			NO	NQ	NF
			7-23-AF-311B		NAD				NQ	
			8-1-AF-311C		NAD				NQ	
HA #312	**Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	4" vinyl cove base - brown	7-23-AF-312A	MISC	NAD			NO	NQ	NF
			7-23-AF-312B		NAD				NQ	
HA #313	**Rm 2-30 Elevation 57'**	Gypsum board (wall)	7-23-AF-313A	MISC	NAD			NO	NQ	NF
			7-23-AF-313B		NAD				NQ	
HA #314	**Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	Joint compound associated with gypsum - white	7-23-AF-314A	MISC	NAD			NO	NQ	F
			7-23-AF-314B		NAD				NQ	
HA #315	**Rm 2-30 Elevation 57', Rm 2-33 Elevation 57'**	Laminate 2'x4' ceiling tile - white	7-23-AF-315A	MISC	NAD			NO	NQ	F
			7-23-AF-315B		NAD				NQ	
HA #316	**Rm 2-32 Elevation 57'**	Glue daubs on brick behind foam - white	7-23-AF-316A	MISC	NAD			NO	NQ	NF
			7-23-AF-316B		NAD				NQ	
HA #317	**Rm 1-66, Rm 2-31 Elevation 57', Rm 2-33 Elevation 57'**	Floor tile mastic - black	7-23-AF-317A	MISC	NAD		NAD	NO	NQ	NF
			7-23-AF-317B		NAD				NQ	
			7-31-AF-317C		NAD				NQ	
HA #318	**Rm 2-33 Elevation 57'**	12"x12" vinyl floor tile - gray	7-23-AF-318A	MISC	NAD			NO	NQ	NF
			7-23-AF-318B		NAD				NQ	
HA #319	**Rm 2-33 Elevation 57'**	Sealant at duct seams - gray	7-23-AF-319A	MISC	NAD			NO	NQ	NF
			7-23-AF-319B		NAD				NQ	
HA #322	**Rm 2-37 Elevation 55', Rm 2-38 Elevation 55'**	12"x12" vinyl floor tile - white	7-25-AF-322A	MISC	NAD			NO	NQ	NF
			7-25-AF-322B		NAD				NQ	
HA #323	**Rm 2-38 Elevation 55'**	Ebony lab table tops	7-25-AF-323A	MISC	NAD			NO	NQ	NF
			7-25-AF-323B		NAD				NQ	
HA #324	**Rm 2-38 Elevation 55'**	Adhesive at counter mounted sinks - black	7-25-AF-324A	MISC	NAD			NO	NQ	NF
			7-25-AF-324B		NAD				NQ	
HA #325	**Rm 2-38 Elevation 55'**	2'x4' acoustical ceiling tile - worm hole pattern	7-25-AF-325A	MISC	NAD			NO	NQ	F
			7-25-AF-325B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #326	**Rm 3-39 Elevation 64'**	Stored fire hose	7-25-AF-326A	MISC	NAD			NO	NQ	F
			7-25-AF-326B		NAD				NQ	
HA #328	**Rm 3-39 Elevation 64'**	8"x8" Glass block mortar - gray	7-25-AF-328A	MISC	NAD			NO	NQ	NF
			7-25-AF-328B		NAD				NQ	
HA #329	**Rm 5-42 Elevation 89'**	1'x1' Acoustical ceiling tile - ridge pattern	7-25-AF-329A	MISC	NAD			NO	NQ	F
			7-25-AF-329B		NAD				NQ	
HA #330	**Rm 5-42 Elevation 89'**	Adhesive under rubber roof membrane over CEM shack -	7-25-AF-330A	MISC	NAD			NO	NQ	NF
			7-25-AF-330B		NAD				NQ	
HA #331	**Rm 7-45 Elevation 114'**	Coating on column caps - black	7-25-AF-331A	MISC	NAD			NO	NQ	NF
			7-25-AF-331B		NAD				NQ	
HA #217	**Rm 6-54 Elevation 84', Rm 00-56 Elevation 11', Rm 00-62 Elevation 31'**	Soft pack pipe insulation - gray	7-29-AF-217D	TSI	NAD			NO	NQ	F
		Soft pack pipe insulation - gray (at tank)	7-29-AF-217E	TSI	NAD			NO	NQ	F
		Soft pack pipe insulation - gray	7-29-AF-217F	TSI	NAD			NO	NQ	F
			7-30-AF-217G		NAD				NQ	
			7-30-AF-217H		NAD				NQ	
			7-30-AF-217I		NAD				NQ	
			7-30-AF-217J		NAD				NQ	
HA #334	**Rm 6-54 Elevation 84'**	Packing at fiberglass end caps - gray	7-29-AF-334A	MISC	NAD			NO	NQ	NF
			7-29-AF-334B		NAD				NQ	
HA #335	**Rm 8-55**	1'x1' Fire block - white (above coal hopper)	7-29-AF-335A	MISC	NAD			NO	NQ	F
			7-29-AF-335B		NAD				NQ	
HA #336	**Rm 8-55**	1'x1' Fire block mortar - gray	7-29-AF-336A	MISC	NAD			NO	NQ	F
			7-29-AF-336B		NAD				NQ	
HA #337	**Rm 8-55**	Window glazing compound associated with windows above coal hopper - white	7-29-AF-337A	MISC	NAD			NO	NQ	F
			7-29-AF-337B		NAD				NQ	
HA #338	**Rm 00-56 Elevation 11'**	Skim coat at abandoned pipe conduit through wall - white	7-29-AF-338A	MISC	NAD			NO	NQ	NF
			7-29-AF-338B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #339	**Rm 00-56 Elevation 11'**	Mudset associated with 6" ceramic boarder tile - light gray	7-29-AF-339A	MISC	NAD			NO	NQ	NF
			7-31-AF-339B		NAD				NQ	
HA #340	**Rm 00-56 Elevation 11'**	Grout associated with 6" ceramic boarder tile - gray	7-29-AF-340A	MISC	NAD			NO	NQ	NF
			7-31-AF-340B		NAD				NQ	
HA #341	**Rm 00-56 Elevation 11'**	Tar wire coating - black	7-29-AF-341A	MISC	NAD		NAD	NO	NQ	NF
			7-29-AF-341B		NAD				NQ	
HA #342	**Rm 00-56 Elevation 11'**	Tar Like pipe wrap - thin/bumpy/brown	7-29-AF-342A	MISC	NAD			NO	NQ	NF
			7-30-AF-342B		NAD				NQ	
			7-30-AF-342C		NAD				NQ	
HA #343	**Rm 00-56 Elevation 11'**	Window glazing compound in turbine shaft window - white	7-30-AF-343A	MISC	NAD			NO	NQ	F
			7-31-AF-343B		NAD				NQ	
HA #344	**Rm 00-56 Elevation 11'**	Sealant between turbine shaft window frame access panel - gray	7-30-AF-344A	MISC	NAD			NO	NQ	F
			7-31-AF-344B		NAD				NQ	
HA #345	**Rm 00-56 Elevation 11'**	Glazed 1920's brick	7-30-AF-345A	MISC	NAD		NAD	NO	NQ	NF
			7-31-AF-345B		NAD				NQ	
HA #346	**Rm 00-56 Elevation 11'**	Glazed 1920's brick mortar	7-30-AF-346A	MISC	NAD			NO	NQ	NF
			7-31-AF-346B		NAD				NQ	
HA #349	**Rm 00-56 Elevation 11'**	Mineral wool jacket on stored turbine part	7-30-AF-349A	MISC	NAD			NO	NQ	F
			7-30-AF-349B		NAD				NQ	
HA #350	**Rm 00-56 Elevation 11'**	Hard caulk at brick column junction - black	7-30-AF-350A	MISC	NAD			NO	NQ	NF
			7-30-AF-350B		NAD				NQ	
HA #351	**Rm 00-56 Elevation 11'**	Tar felt paper at column behind brick - black	7-30-AF-351A	MISC	NAD			NO	NQ	NF
			7-30-AF-351B		NAD				NQ	
HA #352	**Rm 00-56 Elevation 11'**	Pipe insulation at saddles - white	7-30-AF-352A	TSI	NAD			NO	NQ	F
			7-30-AF-352B		NAD				NQ	
			7-30-AF-352C		NAD				NQ	
HA #353	**Rm 00-56 Elevation 11'**	Tar in large pipe conduit through wall - black	7-30-AF-353A	MISC	NAD			NO	NQ	NF
			7-30-AF-353B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #354	**Rm 00-56 Elevation 11'**	Tar coating on turbine #5 - black	7-30-AF-354A	MISC	NAD			NO	NQ	NF
			7-30-AF-354B		NAD				NQ	
		Tar coating on turbine #5 - black (valve)	7-30-AF-354C	MISC	NAD			NO	NQ	NF
HA #355	**Rm 00-56 Elevation 11'**	Debris under turbine #5 - white	7-30-AF-355A	MISC	NAD			NO	NQ	F
			7-30-AF-355B		NAD				NQ	
HA #356	**Rm 00-56 Elevation 11'**	Coating on large cooling lines to turbines - gray	7-30-AF-356A	MISC	NAD			NO	NQ	NF
			7-30-AF-356B		NAD				NQ	
HA #357	**Rm 00-56 Elevation 11'**	Pipe Wrap insulation on large cooling lines to turbines	7-30-AF-357A	TSI	NAD			NO	NQ	F
			7-30-AF-357B		NAD				NQ	
HA #358	**Rm 00-56 Elevation 11'**	Debris on pipe under fiber glass - white	7-30-AF-358A	MISC	NAD			NO	NQ	F
			7-30-AF-358B		NAD				NQ	
			7-30-AF-358C		NAD				NQ	
			7-30-AF-358D		NAD				NQ	
HA #359	**Rm 00-56 Elevation 11'**	Sealant at large cooling line / turbine junction - beige	7-30-AF-359A	MISC	NAD			NO	NQ	NF
			7-30-AF-359B		NAD				NQ	
HA #360	**Rm 00-56 Elevation 11'**	Cloth wrap at large cooling line / turbine junction under sealant -	7-30-AF-360A	TSI	NAD			NO	NQ	NF
			7-30-AF-360B		NAD				NQ	
HA #361	**Rm 00-56 Elevation 11'**	Hard pack pipe insulation under cloth wrap - white	7-31-AF-361A	TSI	NAD			NO	NQ	F
			7-31-AF-361B		NAD				NQ	
			7-31-AF-361C		NAD				NQ	
			7-31-AF-361D		NAD				NQ	
			7-31-AF-361E		NAD				NQ	
HA #362	**Rm 00-56 Elevation 11'**	Mudded fitting insulation associated with hard pack pipe insulation - gray	7-31-AF-362A	TSI	NAD			NO	NQ	F
			7-31-AF-362B		NAD				NQ	
			7-31-AF-362C		NAD				NQ	
HA #363	**Rm 00-56 Elevation 11'**	Spacer on ceramic insulator studs - black	7-31-AF-363A	MISC	NAD			NO	NQ	NF
			7-31-AF-363B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #364	**Rm 00-56 Elevation 11'**	Ebonite backer board for electrical monitors - black	7-31-AF-364A	MISC	NAD			NO	NQ	NF
			7-31-AF-364B		NAD				NQ	
HA #365	**Rm 00-58 Elevation 25'**	Hard conduit insulator through concrete - black	7-31-AF-365A	MISC	NAD			NO	NQ	NF
			7-31-AF-365B		NAD				NQ	
HA #367	**Rm 00-6- Elevation 25'**	Mud set associated with glazed 1920's brick	7-31-AF-367A	MISC	NAD			NO	NQ	NF
			7-31-AF-367B		NAD				NQ	
HA #368	**Rm 1-63 Elevation 63'**	Door frame caulk to stairwell - white	7-31-AF-368A	MISC	NAD			NO	NQ	NF
			7-31-AF-368B		NAD				NQ	
HA #369	**Rm 1-63 Elevation 63'**	Cloth jacket around pipes inside turbine shell	7-31-AF-369A	MISC	NAD			NO	NQ	NF
			7-31-AF-369B		NAD				NQ	
HA #370	**Rm 1-63 Elevation 63'**	Gasket at turbine access hatch - black	7-31-AF-370A	MISC	NAD			NO	NQ	NF
			7-31-AF-370B		NAD				NQ	
HA #371	**Rm 1-64**	Door frame caulk - off white	7-31-AF-371A	MISC	NAD			NO	NQ	NF
			7-31-AF-371B		NAD				NQ	
HA #373	**Rm 1-65**	Vinyl flex connector - black	7-31-AF-373A	MISC	NAD			NO	NQ	NF
			7-31-AF-373B		NAD				NQ	
HA #375	**Rm 1-67, Rm 1-70**	2'x4' acoustical ceiling tile - pin hole & fissure pattern	8-1-AF-375A	MISC	NAD			NO	NQ	F
			8-1-AF-375B		NAD				NQ	
HA #376	**Rm 1-68**	Tar at roof drain - black	8-1-AF-376A	MISC	NAD			NO	NQ	NF
			8-1-AF-376B		NAD				NQ	
HA #X376	**Rm 0-01 Elevation 31', Rm 00-56 Elevation 11'**	Building dust on floor	8-1-AF-X376A	MISC	NAD			NO	NQ	NF
			8-1-AF-X376B		NAD				NQ	
HA #685	**Rm 00-71**	Parge coating over concrete walls - gray	10-1-AF-685A	MISC	NAD			NO	NQ	NF
			10-1-AF-685B		NAD			NO	NQ	
HA #690	**Rm 00-71**	Tar coating on 14" diameter pipes - black	10-1-AF-690A	MISC	NAD			NO	NQ	NF
			10-1-AF-690B		NAD					
			10-1-AF-690C		NAD					
HA #692	**Rm 00-71**	Soft concrete at walls and ceiling - gray	10-1-AF-692A	MISC	NAD			NO	NQ	F
			10-1-AF-692B							

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #693	**Rm 00-71**	Debris on ground - black / compact	10-1-AF-693A	MISC	NAD			NO	NQ	NF
			10-1-AF-693B							
HA #694	**Rm 00-71**	Stored composite brick	10-1-AF-694A	MISC	NAD			NO	NQ	NF
			10-1-AF-694B							
HA #695	**Rm 00-71**	Concrete coal hopper - gray / hard	10-2-AF-695A	MISC	NAD			NO	NQ	NF
			10-2-AF-695B							
HA #696	**Rm 8-55**	Coating over concrete in coal hopper - gray	10-2-AF-696A	MISC	NAD					NF
			10-2-AF-696B							
			10-2-AF-696C							
HA # 697	**Rm 7-53 elevation 106'**	Adhesive behind fiberglass at fan room doors - black	10-2-AF-697A	MISC	NAD			NO	NQ	NF
			10-2-AF-697B							
HA # 698	**Rm 7-53 elevation 106'**	Tar board between steel deck and concrete floor at fan rooms - black	10-2-AF-698A	MISC	NAD			NO	NQ	NF
			10-2-AF-698B							
HA #699	**Rm 7-53 elevation 106'**	Light weight concrete at original stairs	10-2-AF-699A	MISC	NAD			NO	NQ	NF
HA #701	**Rm 0-15**	Electrical conduit - black	10-2-AF-701A	MISC	NAD			NO	NQ	NF
			10-2-AF-701B					NO		
HA #703	**Rm 00-56 elevation 11'**	Parge coating over concrete walls - gray	10-2-AF-703A	MISC	NAD			NO	NQ	NF
			10-2-AF-703B							
HA #704	**Rm 5-57**	Small insulator board mounted onto main panel board - black	10-2-AF-704A	MISC	NAD			NO	NQ	NF
			10-2-AF-704B							
HA #458	**West Facade**	Exterior window frame caulk - gray	8-8-AF-458B	MISC	NAD		NAD	NO	NQ	NF
HA #459	**West Facade**	Exterior door frame caulk - cream	8-8-AF-459B		NAD			NO	NQ	NF
HA #467	**West Facade**	Caulk around mechanical box - hard / brittle / gray	8-8-AF-467B	MISC	NAD			NO	NQ	NF
HA #468	**West Facade**	Vertical expansion joint seam caulk between brick - beige / soft	8-8-AF-468A	MISC	NAD		NAD	NO	NQ	NF
			8-8-AF-468B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ash Alley, Boiler Room, Combustion Unit Area, Turbine Hall, Warehouse (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1930'S Construction								
		1950'S Construction								
		1980'S Construction								
HA #469	**West Facade**	Vertical caulk at metal panel / brick façade junction - pink / hard	8-8-AF-469A	MISC	NAD			NO	NQ	NF
			8-8-AF-469B		NAD				NQ	
HA #470	**West Facade**	Vertical caulk at metal panel / brick façade junction over pink	8-8-AF-470A	MISC	NAD			NO	NQ	NF
			8-8-AF-470B		NAD				NQ	
HA #471	**West Facade**	Horizontal caulk at base of wall panels - black / rubbery	8-8-AF-471A	MISC	NAD			NO	NQ	NF
			8-8-AF-471B		NAD				NQ	
HA #460	**North Facade ground level**	Caulk at concrete foundation brick wall junction - white	8-8-AF-460B	MISC	NAD			NO	NQ	NF
HA #474	**East Facade, South Facade**	Caulk at lintel terracotta block junction - red	8-8-AF-474A	MISC	NAD		NAD	NO	NQ	NF
			8-8-AF-474B		NAD				NQ	
			8-8-AF-474C		NAD				NQ	
Power Block Facility Roofs (Over Boiler Room, Combustion Units and Turbine Hall)										
	Color Key On Drawing:	**1920'S Construction**								
		1980'S Construction								
		1930'S Construction								
HA #621	**Roof #1**	Mop down tar on concrete roof deck - black	8-28-AF-621A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-621B		NAD				NQ	
			8-28-AF-621C		NAD				NQ	
HA #622	**Roof #1**	Tar paper on metal skylights - black	8-28-AF-622A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-622B		NAD				NQ	
HA #602	**Roof #1**	Skim coat/over coat on coping	8-28-AF-602E	SURF	NAD			NO	NQ	NF
HA #601	**Roof #1**	Caulk in coping seams - grey/rubbery	8-28-AF-601C	MISC	NAD			NO	NQ	NF
HA #626	**Roof #1**	Reglet caulk - black	8-28-AF-626A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-626B		NAD				NQ	
HA #627	**Roof #1**	Caulk in coping seams at south end parapet - black	8-28-AF-627A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-627B		NAD				NQ	
HA #631	**Roof #2**	Reglet caulk - black	8-28-AF-631A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-631B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Power Block Facility Roofs (Over Boiler Room, Combustion Units and Turbine Hall) (continued)										
	Color Key On Drawing:	**1920'S Construction**								
		1980'S Construction								
		1930'S Construction								
HA #602	**Roof #2**	Skim coat/over coat on coping	8-28-AF-602F	SURF	NAD			NO	NQ	NF
HA #633	**Roof #2**	Caulk at breathing vents - white	8-28-AF-633A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-633B		NAD				NQ	
HA #634	**Roof #2**	Tar coating over vent caps - black	8-28-AF-634A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-634B		NAD				NQ	
HA #635	**Roof #3, Roof #4, Roof #5**	Thin tar on concrete roof deck - black	8-28-AF-635A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-635B		NAD				NQ	
			8-28-AF-635C		NAD				NQ	
HA #X636	**Roof #6, Roof #7, Roof #8**	Thin tar on concrete roof deck - black	8-28-AF-X636A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-X636B		NAD				NQ	
			8-28-AF-X636C		NAD				NQ	
HA #637	**Roof #6, Roof #7**	Felt paper over foam under membrane - brown	8-28-AF-637A	MISC	NAD			NO	NQ	F
			8-28-AF-637B		NAD				NQ	
HA #638	**Roof #6**	Tar like caulk at aluminum flashing on tar coating - black	8-28-AF-638A	MISC	NAD			NO	NQ	NF
			8-28-AF-638B		NAD				NQ	
HA #639	**Roof #6**	Caulk at aluminum flashing below black caulk - grey	8-28-AF-639A	MISC	NAD			NO	NQ	NF
HA #640	**Roof #7**	Adhesive under membrane on parapet - yellow	8-28-AF-640A	MISC	NAD			NO	NQ	NF
			8-28-AF-640B		NAD				NQ	
HA #641	**Roof #9, Roof #10**	Bottom layer felt paper	8-28-AF-641A	MISC	NAD			NO	NQ	F
			8-28-AF-641B		NAD				NQ	
HA #642	**Roof #9, Roof #10**	Tar and felt paper roofing - black	8-28-AF-642A	MISC	NAD			NO	NQ	NF
			8-28-AF-642B		NAD				NQ	
HA #647	**Roof #11**	Reglet caulk - black	8-28-AF-647A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-647B		NAD				NQ	
HA #648	**Roof #11**	Caulk at breathing vents-white/rubbery	8-28-AF-648A	MISC	NAD		NAD	NO	NQ	NF
			8-28-AF-648B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Ware House Exteriors										
	Color Key On Drawing:	**1950'S Construction**								
HA #525	**West Facade, South Facade**	Window frame caulk - gray	8-13-AF-525A	MISC	NAD			NO	NQ	NF
			8-13-AF-525B		NAD				NQ	
HA #526	**South Facade**	Caulk at brick corner junction - white	8-13-AF-526A	MISC	NAD			NO	NQ	NF
			8-13-AF-526B		NAD				NQ	
HA #649	**Roof #1, Roof #2**	Felt paper over tar on roof deck - brown	8-28-AF-649A	MISC	NAD			NO	NQ	F
			8-28-AF-649B		NAD				NQ	
HA #650	**Roof #1, Roof #2**	Tar on metal corrugated roof deck - black	8-28-AF-650A	MISC	NAD			NO	NQ	NF
			8-28-AF-650B		NAD				NQ	
HA #651	**Roof #1, Roof #2**	Reglet caulk-black	8-28-AF-651A	MISC	NAD			NO	NQ	NF
			8-28-AF-651B		NAD				NQ	
HA #652	**Roof #3**	Vertical caulk at metal/brick junction - beige	8-28-AF-652A	MISC	NAD			NO	NQ	NF
			8-28-AF-652B		NAD				NQ	
Northeast Utilities Building										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #378	**Rm 00-02 Elevation 11'**	Sealant in interior duct work seams - red	8-1-AF-378A	MISC	NAD			NO	NQ	NF
			8-1-AF-378B		NAD				NQ	
HA #379	**Rm 0-05**	Tar like flooring - black	8-1-AF-379A	MISC	NAD			NO	NQ	NF
			8-1-AF-379B		NAD				NQ	
HA #380	**Rm 0-07, Rm 1-17 Elevation 37', Rm 2-33, Rm 3-34 Elevation 56'.25", Rm 5-50 Elevation 83".75"**	Plaster rough coat wall - gray	8-1-AF-380A	SURF	NAD			NO	NQ	F
			8-5-AF-380B		NAD				NQ	
			8-6-AF-380C		NAD				NQ	
			8-6-AF-380D		NAD				NQ	
			8-7-AF-380E		NAD				NQ	
HA #381	**Rm 0-07, Rm 1-17 Elevation 37', Rm 2-33, Rm 3-34 Elevation 56'.25", Rm 5-50 Elevation 83".75"**	Plaster skim coat wall - white	8-1-AF-381A	SURF	NAD			NO	NQ	F
			8-5-AF-381B		NAD				NQ	
			8-6-AF-381C		NAD				NQ	
			8-6-AF-381D		NAD				NQ	
			8-7-AF-381E		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #382	**Rm 0-09**	Patching cement at conduit penetrations - gray	8-1-AF-382A	MISC	NAD			NO	NQ	NF
			8-1-AF-382B		NAD				NQ	
HA #383	**Rm 0-10**	Poured composite flooring - speckled / blue	8-1-AF-383A	MISC	NAD			NO	NQ	NF
			8-1-AF-383B		NAD				NQ	
HA #384	**Rm 0-11**	Window frame caulk - white	8-1-AF-384A	MISC	NAD			NO	NQ	NF
			8-1-AF-384B		NAD				NQ	
HA #585	**Rm 0-12, Rm 1-17 Elevation 37', Rm 2-33**	Tar moisture barrier on interior facing exterior brick - black (at north end of building)	8-1-AF-385A	MISC	NAD		NAD	NO	NQ	NF
			8-1-AF-385B		NAD				NQ	
			8-5-AF-385C		NAD				NQ	
			8-6-AF-385D		NAD				NQ	
HA #586	**Rm 1-13 Elevation 37'**	Window glazing compound in partition windows - black	8-1-AF-386A	MISC	NAD			NO	NQ	NF
			8-1-AF-386B		NAD				NQ	
HA #587	**Rm 1-13 Elevation 37'**	Thinset associated with 6"x6" wall tile - gray	8-1-AF-387A	MISC	NAD			NO	NQ	NF
			8-1-AF-387B		NAD				NQ	
HA #588	**Rm 1-13 Elevation 37'**	Grout associated with 6"x6" wall tile - gray	8-1-AF-388A	MISC	NAD			NO	NQ	NF
			8-1-AF-388B		NAD				NQ	
HA #589	**Rm 1-15 Elevation 37'**	Flooring leveler - white	8-1-AF-389A	MISC	NAD			NO	NQ	NF
			8-1-AF-389B		NAD				NQ	
HA #591	**Rm 1-15 Elevation 37', Rm 3-34 Elevation 56'.25"**	Floor tile mastic - yellow	8-1-AF-391A	MISC	NAD			NO	NQ	NF
			8-6-AF-391B		NAD				NQ	
HA #592	**Rm 1-16 Elevation 37', Rm 5-58 Elevation 83'.75"**	Gypsum board (wall)	8-1-AF-392A	MISC	NAD			NO	NQ	NF
		Gypsum board (ceiling backer)	8-7-AF-392B	MISC	NAD			NO	NQ	NF
HA #593	**Rm 1-16 Elevation 37'**	Joint compound associated with gypsum wall board - white	8-1-AF-393A	MISC	NAD			NO	NQ	F
			8-1-AF-393B		NAD				NQ	
HA #594	**Rm 1-17 Elevation 37'**	12"x12" vinyl floor tile - maroon with beige specs	8-5-AF-394A	MISC	NAD			NO	NQ	NF
			8-5-AF-394B		NAD				NQ	
HA #595	**Rm 1-17 Elevation 37'**	Skim coat on lath behind chair rail - white	8-5-AF-395A	SURF	NAD			NO	NQ	NF
			8-5-AF-395B		NAD				NQ	
			8-5-AF-395C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #191	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Black ceramic Insulator	7-15-AF-191A	MISC	NAD			NO	NQ	NF
			8-5-AF-191B		NAD				NQ	
			8-6-AF-191C		NAD				NQ	
HA #190	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Stall conduit backer plate	7-15-AF-190A	MISC	NAD			NO	NQ	NF
			8-5-AF-190B		NAD			NO	NQ	
			8-6-AF-190C		NAD			NO	NQ	
HA #189	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Cementitious stall wall	7-15-AF-189	MISC					NQ	NF
			8-5-AF-189B		NAD			NO	NQ	
			8-6-AF-189C		NAD				NQ	
HA #396	**Rm 1-19 Elevation 37', Rm 3-36 Elevation 56'.25"**	Grout associated with stall conduit backer plate - gray	8-5-AF-396A	MISC	NAD			NO	NQ	NF
			8-6-AF-396B		NAD				NQ	
HA #397	**Rm 1-19 Elevation 37', Rm 3-36 Elevation 56'.25"**	Ceramic conduit through stall backer plate - white	8-5-AF-397A	MISC	NAD			NO	NQ	NF
			8-6-AF-397B		NAD				NQ	
HA #398	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25", Rm 4-44 Elevation 67'.25"**	Skim coat over concrete stalls - gray	8-5-AF-398A	SURF	NAD			NO	NQ	NF
			8-6-AF-398B		NAD				NQ	
			8-6-AF-398C		NAD				NQ	
HA #399	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Mortar associated with cementitious block behind skim coat - gray	8-5-AF-399A	MISC	NAD			NO	NQ	NF
			8-6-AF-399B		NAD				NQ	
HA #400	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Cementitious block at stall walls behind skim coat - gray	8-5-AF-400A	MISC	NAD			NO	NQ	NF
			8-6-AF-400B		NAD				NQ	
HA #401	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Felt paper between ceramic insulator and capacitor - black	8-5-AF-401A	MISC	NAD			NO	NQ	F
			8-6-AF-401B		NAD				NQ	
HA #402	**Rm 1-19 Elevation 37', Rm 3-34 Elevation 56'.25"**	Protective paper over capacitor - black	8-5-AF-402A	MISC	NAD			NO	NQ	F
			8-6-AF-402B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #407	**Rm 1-25 Elevation 37'**	Foam at conduit penetrations through exterior walls - black	8-5-AF-407A	MISC	NAD			NO	NQ	NF
			8-5-AF-407B		NAD				NQ	
HA #408	**Rm 1-25 Elevation 37'**	Cementitious conduit backer plate at exterior wall - gray	8-5-AF-408A	MISC	NAD			NO	NQ	NF
			8-5-AF-408B		NAD				NQ	
HA #217	**Rm 1-26 (tunnel)**	Soft pack pipe insulation - gray	8-5-AF-217K	TSI	NAD		NAD	NO	NQ	F
HA #410	**Rm 1-26 (tunnel)**	Mastic at fiberglass end caps - white	8-5-AF-410A	MISC	NAD			NO	NQ	NF
			8-5-AF-410B		NAD				NQ	
HA #411	**Rm 1-26 (tunnel)**	Pipe dope on 3" diameter pipes - white	8-5-AF-411A	MISC	NAD		NAD	NO	NQ	NF
			8-5-AF-411B		NAD				NQ	
HA #412	**Rm 1-27 Elevation 37'**	Cloth flex connector - white	8-5-AF-412A	MISC	NAD			NO	NQ	F
			8-5-AF-412B		NAD				NQ	
HA #413	**Rm 1-27 Elevation 37'**	Door frame caulk - white	8-5-AF-413A	MISC	NAD			NO	NQ	NF
			8-5-AF-413B		NAD				NQ	
HA #414	**Rm 1-28 Elevation 37'**	Debris on stored pipe - gray / soft	8-5-AF-414A	MISC	NAD			NO	NQ	F
			8-5-AF-414B		NAD				NQ	
HA #415	**Rm 1-30 Elevation 37'**	12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	8-5-AF-415A	MISC	NAD			NO	NQ	NF
			8-5-AF-415B		NAD				NQ	
HA #X416	**Rm 2-32, St-1**	Terracotta block mortar - gray	8-6-AF-X416A	MISC	NAD			NO	NQ	NF
			8-7-AF-X416B		NAD				NQ	
HA #417	**Rm 2-33**	Joint compound on brick behind plaster rough coat - cream	8-6-AF-417A	MISC	NAD			NO	NQ	F
			8-6-AF-417B		NAD				NQ	
HA #418	**Rm 3-34 Elevation 56'.25", Rm 4-40 Elevation 67'.25"**	9"x9" vinyl floor tile - maroon with checker board pattern	8-6-AF-418A	MISC	NAD			NO	NQ	NF
			8-6-AF-418B		NAD				NQ	
HA #420	**Rm 3-34 Elevation 56'.25"**	4" vinyl cove base adhesive - yellow	8-6-AF-420A	MISC	NAD			NO	NQ	NF
HA #421	**Rm 3-34 Elevation 56'.25"**	4" vinyl cove base - gray	8-6-AF-421A	MISC	NAD			NO	NQ	NF
			8-6-AF-421B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #422	**Rm 3-34 Elevation 56'.25", Rm 4-40 Elevation 67'.25"**	Gypsum wall board over plaster	8-6-AF-422A	MISC	NAD			NO	NQ	NF
			8-6-AF-422B		NAD				NQ	
HA #423	**Rm 3-34 Elevation 56'.25", Rm 4-40 Elevation 67'.25"**	Joint compound associated with gypsum wall board over plaster - white	8-6-AF-423A	MISC	NAD			NO	NQ	F
			8-6-AF-423B		NAD				NQ	
HA #424	**Rm 3-34 Elevation 56'.25", Rm 4-40 Elevation 67'.25"**	2'x4' acoustical ceiling tile - pin hole & fissure pattern	8-6-AF-424A	MISC	NAD			NO	NQ	F
			8-6-AF-424B		NAD				NQ	
HA #429	**Rm 2-39 Elevation 48'**	Sealant in interior duct seams - yellow	8-6-AF-429A	MISC	NAD			NO	NQ	NF
			8-6-AF-429B		NAD				NQ	
HA #431	**Rm 4-40 Elevation 67'.25"**	Adhesive behind gypsum board on plaster - black	8-6-AF-431A	MISC	NAD		NAD	NO	NQ	NF
			8-6-AF-431B		NAD				NQ	
HA #433	**Rm 4-42 Elevation 67'.25"**	Hard pack pipe insulation on water line to radiator - white (residual)	8-6-AF-433A	TSI	NAD			NO	NQ	F
			8-6-AF-433B		NAD				NQ	
HA #188	**Rm 4-44 Elevation 67'.25"**	Stall shelf - blue	8-6-AF-188B	MISC	NAD			NO	NQ	NF
HA #X241	**Rm 4-44 Elevation 67'.25"**	Window glazing compound in reinforced chicken wire windows - white	8-6-AF-X241C	MISC	NAD			NO	NQ	NF
HA #436	**Rm 5-50 Elevation 83'.75"**	Mud base associated with 6"x6" ceramic tile at window sills - gray	8-7-AF-436A	MISC	NAD			NO	NQ	NF
			8-7-AF-436B		NAD				NQ	
HA #437	**Rm 5-50 Elevation 83'.75"**	Grout associated with 6"x6" ceramic tile at window sills - gray	8-7-AF-437A	MISC	NAD			NO	NQ	NF
			8-7-AF-437B		NAD				NQ	
HA #438	**Rm 5-50 Elevation 83'.75"**	Thinset associated with 6" ceramic cove base - white	8-7-AF-438A	MISC	NAD			NO	NQ	NF
			8-7-AF-438B		NAD				NQ	
HA #439	**Rm 5-50 Elevation 83'.75"**	Sheetrock at windows	8-7-AF-439A	MISC	NAD			NO	NQ	NF
			8-7-AF-439B		NAD				NQ	
HA #440	**Rm 5-50 Elevation 83'.75"**	Joint compound associated with sheetrock at windows - white	8-7-AF-440A	MISC	NAD			NO	NQ	F
			8-7-AF-440B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #441	**Rm 5-52 Elevation 83'.75"**	Soap stone shower surround - black	8-7-AF-441A	MISC	NAD			NO	NQ	NF
			8-7-AF-441B		NAD				NQ	
HA #248	**Rm 5-53 Elevation 83'.75"**	Window glazing compound in plain sash windows - white	8-7-AF-248C	MISC	NAD			NO	NQ	NF
HA #444	**Rm 5-57 Elevation 83'.75"**	Cork floor tile mastic - white	8-7-AF-444A	MISC	NAD			NO	NQ	NF
			8-7-AF-444B		NAD				NQ	
HA #445	**Rm 5-57 Elevation 83'.75"**	Mud set associated with 6"x4" blue composite glazed wall tile - gray	8-7-AF-445A	MISC	NAD			NO	NQ	NF
			8-7-AF-445B		NAD				NQ	
HA #446	**Rm 5-57 Elevation 83'.75"**	Grout associated with 6"x4" blue composite glazed wall tile - gray	8-7-AF-446A	MISC	NAD			NO	NQ	NF
			8-7-AF-446B		NAD				NQ	
HA #447	**Rm 5-57 Elevation 83'.75"**	6"x4" blue painted red composite material glazed wall tile	8-7-AF-447A	MISC	NAD			NO	NQ	NF
			8-7-AF-447B		NAD				NQ	
HA #448	**Rm 5-57 Elevation 83'.75"**	Resin on secondary current transformers - black	8-7-AF-448A	MISC	NAD		NAD	NO	NQ	NF
			8-7-AF-448B		NAD				NQ	
HA #449	**Rm 5-57 Elevation 83'.75"**	Non-conductive backer panel board for electric circuits - blue	8-7-AF-449A	MISC	NAD			NO	NQ	NF
			8-7-AF-449B		NAD				NQ	
HA #450	**Rm 5-58 Elevation 83'.75"**	Residual flooring mastic on wood planking - yellow	8-7-AF-450A	MISC	NAD			NO	NQ	NF
			8-7-AF-450B		NAD				NQ	
HA #452	**Rm 5-58 Elevation 83'.75"**	Glue daubs associated with 1'x1' acoustical ceiling tile - brown	8-7-AF-452A	MISC	NAD		NAD	NO	NQ	NF
			8-7-AF-452B		NAD				NQ	
HA #453	**Rm 5-58 Elevation 83'.75"**	1'x1' acoustical ceiling tile - worm hole pattern	8-7-AF-453A	MISC	NAD			NO	NQ	F
			8-7-AF-453B		NAD				NQ	
HA #454	**Rm 5-58 Elevation 83'.75"**	2'x2' acoustical ceiling tile - rough face	8-7-AF-454A	MISC	NAD			NO	NQ	F
			8-7-AF-454B		NAD				NQ	
HA #458	**West Facade**	Exterior window frame caulk - gray	8-8-AF-458A	MISC	NAD		NAD	NO	NQ	NF
HA #459	**West Facade**	Exterior door frame caulk - cream	8-8-AF-459A	MISC	NAD		NAD	NO	NQ	NF

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #460	**West Facade**	Caulk at concrete foundation brick wall junction - white	8-8-AF-460A	MISC	NAD		NAD	NO	NQ	NF
			8-8-AF-460B		NAD				NQ	
HA #461	**West Facade**	Exterior door frame caulk associated with newer door systems - beige	8-8-AF-461A	MISC	NAD			NO	NQ	NF
			8-8-AF-461B		NAD				NQ	
HA #462	**West Facade**	Horizontal expansion board at concrete foundation CMU junction	8-8-AF-462A	MISC	NAD		NAD	NO	NQ	NF
			8-8-AF-462B		NAD				NQ	
HA #463	**North Facade**	Door frame caulk associated with office entry door - dark gray	8-8-AF-463A	MISC	NAD			NO	NQ	NF
			8-8-AF-463B		NAD				NQ	
HA #464	**North Facade**	Window frame caulk associated with office windows - light gray	8-8-AF-464A	MISC	NAD			NO	NQ	NF
			8-8-AF-464B		NAD				NQ	
HA #465	**North Facade**	Caulk at pre-cast concrete belt course - gray	8-8-AF-465A	MISC	NAD		NAD	NO	NQ	NF
			8-8-AF-465B		NAD				NQ	
Northeast Utilities Building Roofs										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #582	**Lower level roof #1**	Mop down tar on concrete roof deck - black	8-27-AF-582A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-582B		NAD				NQ	
HA #584	**Lower level roof #1**	Flashing cement - black	8-27-AF-584A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-584B		NAD				NQ	
HA #583	**Lower level roof #1**	Felt paper over foam under top layer membrane - black	8-27-AF-583A	MISC	NAD			NO	NQ	NF
			8-27-AF-583B		NAD				NQ	
HA #586	**Lower level roof #1**	Reglet caulk-black	8-27-AF-586A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-586B		NAD				NQ	
HA #587	**Lower level roof #1**	Soft cement roof deck	8-27-AF-587A	MISC	NAD			NO	NQ	NF
			8-27-AF-587B		NAD				NQ	
HA #588	**Lower level roof #2, Lower level roof #3**	Rolled asphalt roofing	8-27-AF-588A	MISC	NAD			NO	NQ	NF
			8-27-AF-588B		NAD				NQ	
			8-27-AF-588C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building Roofs (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #589	**Lower level roof #2**	Tar felt paper under rolled roofing on concrete deck	8-27-AF-589A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-589B		NAD				NQ	
HA #591	**Lower level roof #3**	Soft concrete roof deck	8-27-AF-591A	MISC	NAD			NO	NQ	F
			8-27-AF-591B		NAD				NQ	
HA #592	**Lower level roof #4**	Mop down tar under gravel -black	8-27-AF-592A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-592B		NAD				NQ	
HA #593	**Lower level roof #4**	Felt paper at perimeter-black	8-27-AF-593A	MISC	NAD			NO	NQ	NF
			8-27-AF-593B		NAD				NQ	
HA #594	**Lower level roof #4**	Caulk at mechanical box-grey	8-27-AF-594A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-594B		NAD				NQ	
HA #595	**Upper level roof #5**	Bottom layer tar on corrugated metal roof deck-black (bottom layer)	8-27-AF-595A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-595B		NAD				NQ	
HA #596	**Upper level roof #5**	Tar on cement-black (layer 2)	8-27-AF-596A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-596B		NAD				NQ	
HA #598	**Upper level roof #5**	Adhesive under EPDM membrane over foam-yellow (top layer)	8-27-AF-598A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-598B		NAD				NQ	
HA #599	**Upper level roof #5**	Felt paper under coping above top layer brick on parapet - black	8-27-AF-599A	MISC	NAD			NO	NQ	F
HA #600	**Upper level roof #5**	Adhesive under rubber membrane under wood parapet - yellow	8-27-AF-600A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-600B		NAD				NQ	
HA #601	**Upper level roof #5, Upper level roof #6**	Caulk in coping seams - grey/rubbery	8-27-AF-601A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-601B		NAD				NQ	
			8-27-AF-601C		NAD				NQ	
HA #602	**Upper level roof #5, Upper level roof #6**	Skim coat/over coat on coping	8-27-AF-602A	SURF	NAD			NO	NQ	NF
			8-27-AF-602B		NAD				NQ	
			8-27-AF-602C		NAD				NQ	
			8-27-AF-602D		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northeast Utilities Building Roofs (continued)										
	Color Key On Drawing:	**1930'S Construction**								
		1920'S Construction								
HA #606	**Upper level roof #5**	Newer window glazing compound over original-brown/rubbery	8-27-AF-606A	MISC	NAD			NO	NQ	NF
			8-27-AF-606B		NAD				NQ	
HA #335	**Upper level roof #5 (pitched roof above air handler)**	1'x1' Fire block - white	8-27-AF-335C	MISC	NAD			NO	NQ	F
HA #336	**Upper level roof #5 (pitched roof above air handler)**	1'x1' Fire block mortar - gray	8-27-AF-336C	MISC	NAD			NO	NQ	F
HA #609	**Upper level roof #5, Upper level roof #6**	Reglet caulk - black	8-27-AF-609A	MISC	NAD		NAD	NO	NQ	M
			8-27-AF-609B		NAD				NQ	
			8-27-AF-609C		NAD				NQ	
HA #611	**Upper level roof #5**	Perimeter flashing cement at parapet	8-27-AF-611A	MISC	NAD		0.64% Chrys	NO	NQ	NF
			8-27-AF-611B		NAD				NQ	
HA #612	**Upper level roof #6, Upper level roof #7**	Mop down tar on concrete roof deck - black	8-27-AF-612A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-612B		NAD				NQ	
HA #614	**Elevator pent house roof**	Tar on concrete roof deck-black	8-27-AF-614A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-614B		NAD				NQ	
HA #616	**Elevator pent house roof**	Felt paper over tar under asphalt roofing at skylight curb	8-27-AF-616A	MISC	NAD			NO	NQ	F
			8-27-AF-616B		NAD				NQ	
HA #617	**Elevator pent house roof**	Rolled asphalt at skylight curb	8-27-AF-617A	MISC	NAD			NO	NQ	NF
			8-27-AF-617B		NAD				NQ	
HA #618	**Elevator pent house roof**	Flashing cement at base of skylight black	8-27-AF-618A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-618B		NAD				NQ	
HA #619	**Elevator pent house Exterior South Facade**	Caulk at louver and window frame - white	8-27-AF-619A	MISC	NAD		NAD	NO	NQ	NF
			8-27-AF-619B		NAD				NQ	
HA #620	**Elevator pent house Exterior South Facade**	Skim coat over concrete façade - white	8-27-AF-620A	SURF	NAD			NO	NQ	NF
			8-27-AF-620B		NAD				NQ	
			8-27-AF-620C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
PBF Administration Building										
	Color Key On Drawing:	**1950'S Construction**								
HA #479	**Rm 1-01, ST-1**	Floor tile mastic - black	8-12-AF-479A	MISC	NAD			NO	NQ	NF
			8-12-AF-479B		NAD		NAD		NQ	
HA #480	**Rm 1-01**	Residual floor tile mastic - yellow	8-12-AF-480A	MISC	NAD		NAD	NO	NQ	NF
			8-12-AF-480B		NAD				NQ	
HA #481	**Rm 1-01**	Thinset associated with 7"x7" gray quarry tile - gray	8-12-AF-481A	MISC	NAD			NO	NQ	NF
			8-12-AF-481B		NAD				NQ	
HA #482	**Rm 1-01**	Grout associated with 7"x7" gray quarry tile - gray	8-12-AF-482A	MISC	NAD			NO	NQ	NF
			8-12-AF-482B		NAD				NQ	
HA #483	**Rm 1-01, ST-1**	Sheetrock (wall)	8-12-AF-483A	MISC	NAD			NO	NQ	NF
			8-12-AF-483B		NAD				NQ	
HA #484	**Rm 1-01, ST-1**	Joint compound associated with sheetrock wall - white	8-12-AF-484A	MISC	NAD			NO	NQ	F
			8-12-AF-484B		NAD				NQ	
HA #485	**Rm 1-01**	2'x2' acoustical ceiling tile - pin hole and fissure	8-12-AF-485A	MISC	NAD			NO	NQ	F
			8-12-AF-485B		NAD				NQ	
HA #486	**Rm 1-01, Rm 1-08, ST-2**	Paper insulation over fiberglass on pipes	8-12-AF-486A	TSI	NAD			NO	NQ	F
			8-12-AF-486B		NAD				NQ	
			8-13-AF-486C		NAD				NQ	
HA #487	**ST-1, Rm 3-25**	12"x12" vinyl floor tile - beige with gray specs and streaks	8-12-AF-487A	MISC	NAD			NO	NQ	NF
			8-13-AF-487B		NAD				NQ	
HA #488	**ST-1, ST-2**	4" vinyl cove base adhesive - yellow	8-12-AF-488A	MISC	NAD			NO	NQ	NF
			8-13-AF-488B		NAD				NQ	
HA #489	**ST-1, ST-2**	4" vinyl cove base - brown	8-12-AF-489A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-489B		NAD				NQ	
HA #491	**ST-1, ST-2**	Vinyl stair tread adhesive - gray	8-12-AF-491A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-491B		NAD				NQ	
HA #492	**ST-1, ST-2**	Mortar associated with cube glass block windows - gray	8-12-AF-492A	MISC	NAD			NO	NQ	NF
			8-13-AF-492B		NAD				NQ	
HA #493	**ST-1**	Mortar associated with 2'x3' glazed wall tile - gray	8-12-AF-493A	MISC	NAD			NO	NQ	NF
HA #494	**Rm 1-03, Rm 2-16**	2"x2' acoustical ceiling tile - rough face	8-12-AF-494A	MISC	NAD			NO	NQ	NF
			8-12-AF-494B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
PBF Administration Building (continued)										
	Color Key On Drawing:	**1950'S Construction**								
HA #495	**Rm 1-03**	Interior duct adhesive behind fiberglass - yellow	8-12-AF-495A	MISC	NAD			NO	NQ	NF
HA #496	**Rm 1-04, Rm 1-05**	Thinset associated with 1"x1" ceramic floor tile - gray	8-12-AF-496A	MISC	NAD			NO	NQ	NF
			8-12-AF-496B		NAD				NQ	
HA #497	**Rm 1-04, Rm 1-05**	Grout associated with 1"x1" ceramic floor tile - gray	8-12-AF-497A	MISC	NAD			NO	NQ	NF
			8-12-AF-497B		NAD				NQ	
HA #498	**Rm 1-04, Rm 1-05**	Adhesive associated with 1"x1" ceramic cream wall tile - yellow	8-12-AF-498A	MISC	NAD			NO	NQ	NF
			8-12-AF-498B		NAD				NQ	
HA #499	**Rm 1-04, Rm 1-05**	Grout associated with 1"x1" ceramic wall tile - gray	8-12-AF-499A	MISC	NAD			NO	NQ	NF
			8-12-AF-499B		NAD				NQ	
HA #500	**Rm 1-04, Rm 1-05**	Sealant at outer ductwork seams - red	8-12-AF-500A	MISC	NAD		NAD	NO	NQ	NF
			8-12-AF-500B		NAD				NQ	
HA #502	**Rm 1-04**	Interlocking adhesive under ceramic floor tile - yellow	8-12-AF-502A	MISC	NAD			NO	NQ	NF
			8-12-AF-502B		NAD				NQ	
HA #503	**Rm 1-05, Rm 2-11**	Plaster skim coat - white (wall)	8-12-AF-503A	SURF	NAD			NO	NQ	F
			8-12-AF-503B		NAD				NQ	
			8-12-AF-503C		NAD				NQ	
HA #504	**Rm 1-05, Rm 2-11**	Plaster rough coat - gray (wall)	8-12-AF-504A	SURF	NAD			NO	NQ	F
			8-12-AF-504B		NAD				NQ	
			8-12-AF-504C		NAD				NQ	
HA #505	**Rm 1-05, Rm 2-13**	Terrazzo shower basin mudset - gray	8-12-AF-505A	MISC	NAD			NO	NQ	NF
			8-12-AF-505B		NAD				NQ	
HA #506	**Rm 1-07, Rm 1-08, Rm 2-16, Rm 3-21**	Skim coat on concrete ceiling deck - white	8-12-AF-506A	SURF	NAD			NO	NQ	NF
			8-12-AF-506B		NAD				NQ	
			8-12-AF-506C		NAD				NQ	
			8-13-AF-506D		NAD				NQ	
HA #507	**Rm 1-08**	Sealant in air handler seams - black	8-12-AF-507A	MISC	NAD			NO	NQ	NF
			8-12-AF-507B		NAD				NQ	
HA #508	**Rm 1-08**	Vinyl flex connector - white	8-12-AF-508A	MISC	NAD			NO	NQ	NF
			8-12-AF-508B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
PBF Administration Building (continued)										
	Color Key On Drawing:	**1950'S Construction**								
HA #509	**Rm 1-08**	Pipe dope on steam lines - white	8-12-AF-509A	MISC	NAD		NAD	NO	NQ	NF
			8-12-AF-509B		NAD				NQ	
HA #510	**Rm 2-12**	Tar at radiator penetrations through floor - black	8-12-AF-510A	MISC	NAD			NO	NQ	NF
			8-12-AF-510B		NAD				NQ	
HA #511	**Rm 2-14**	Flooring leveler under 2'x2' rubber square tread - gray	8-12-AF-511A	MISC	NAD			NO	NQ	NF
			8-12-AF-511B		NAD				NQ	
HA #512	**Rm 2-16, Rm 2-18**	Carpet adhesive - yellow	8-12-AF-512A	MISC	NAD		NAD	NO	NQ	NF
			8-12-AF-512B		NAD				NQ	
HA #513	**Rm 2-16, Rm 2-18**	4" vinyl cove base - blue	8-12-AF-513A	MISC	NAD			NO	NQ	NF
			8-12-AF-513B		NAD				NQ	
HA #514	**Rm 3-21**	Tar coating on 3" roof drain pipe - black	8-13-AF-514A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-514B		NAD				NQ	
HA #515	**Roof #1 (lower level roof), Roof #2 (top roof)**	Mopped down tar on concrete roof deck - black	8-13-AF-515A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-515B		NAD				NQ	
HA #516	**Roof #1 (lower level roof), Roof #2 (top roof)**	Adhesive behind rubber membrane on parapet wall - yellow	8-13-AF-516A	MISC	NAD			NO	NQ	NF
			8-13-AF-516B		NAD				NQ	
HA #517	**Roof #1 (lower level roof)**	Felt paper between built up foam under rubber membrane at pitched	8-13-AF-517A	MISC	NAD			NO	NQ	NF
			8-13-AF-517B		NAD				NQ	
HA #518	**Roof #1 (lower level roof), Roof #2 (top roof)**	Caulk - gray (at coping seams above parapet)	8-13-AF-518A	MISC	NAD			NO	NQ	NF
		Caulk - gray (at hand railings)	8-13-AF-518B	MISC	NAD			NO	NQ	NF
HA #519	**Roof #1 (lower level roof), Roof #2 (top roof)**	Reglet caulk - black	8-13-AF-519A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-519B		NAD				NQ	
HA #522	**West Facade, East Facade**	Window frame caulk - gray	8-13-AF-522A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-522B		NAD				NQ	
HA #524	**East Facade**	Caulk at louver - gray / hard / brittle	8-13-AF-524A	MISC	NAD		NAD	NO	NQ	NF
			8-13-AF-524B		NAD				NQ	
Jet Shop & Turbo Jet Power Packs										
	Color Key On Drawing:	**1970'S Construction**								
HA #528	**Rm 1-01, Rm 2-11**	Sheetrock (wall)	8-13-AF-528A	MISC	NAD			NO	NQ	NF
			8-14-AF-528B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Jet Shop & Turbo Jet Power Packs (continued)										
	Color Key On Drawing:	**1970'S Construction**								
HA #529	**Rm 1-01, Rm 2-11**	Joint compound associated with sheetrock wall - white	8-13-AF-529A	MISC	NAD			NO	NQ	NF
			8-14-AF-529B		NAD				NQ	
HA #530	**Rm 1-01, Rm 2-11**	4" vinyl cove base adhesive - yellow	8-13-AF-530A	MISC	NAD			NO	NQ	NF
			8-14-AF-530B		NAD				NQ	
HA #531	**Rm 1-01**	4" vinyl cove base - gray	8-13-AF-531A	MISC	NAD			NO	NQ	NF
HA #532	**Rm 1-01, ST-1**	4" vinyl cove base - white	8-13-AF-532A	MISC	NAD			NO	NQ	NF
			8-13-AF-532B		NAD				NQ	
HA #533	**Rm 1-01**	1/8" gasket material - green (stored)	8-13-AF-533A	MISC	NAD			NO	NQ	NF
			8-13-AF-533B		NAD				NQ	
HA #534	**Rm 1-01**	1/32" gasket material - black (stored)	8-13-AF-534A	MISC	NAD			NO	NQ	NF
			8-13-AF-534A		NAD				NQ	
HA #535	**Rm 1-02, Rm 2-11**	Floor tile mastic - white	8-14-AF-535A	MISC	NAD			NO	NQ	NF
			8-14-AF-535B		NAD				NQ	
HA #536	**Rm 1-02, Rm 2-11**	12"x12" vinyl floor tile - light blue	8-14-AF-536A	MISC	NAD			NO	NQ	NF
			8-14-AF-536B		NAD				NQ	
HA #537	**Rm 1-02, Rm 2-11**	2'x4' acoustical ceiling tile - pin hole & fissure	8-14-AF-537A	MISC	NAD			NO	NQ	F
			8-14-AF-537B		NAD				NQ	
HA #538	**Rm 1-03**	12"x12" vinyl floor tile - white with gray specs	8-14-AF-538A	MISC	NAD			NO	NQ	NF
			8-14-AF-538B		NAD				NQ	
HA #539	**Rm 1-03, Rm 1-05**	2'x4' acoustical ceiling tile - pin hole & crater	8-14-AF-539A	MISC	NAD			NO	NQ	F
			8-14-AF-539B		NAD				NQ	
HA #540	**Rm 1-05, Rm 2-06**	Mud base associated with 6"x6" gray quarry tile - gray	8-14-AF-540A	MISC	NAD			NO	NQ	NF
			8-14-AF-540B		NAD				NQ	
HA #541	**Rm 1-05, Rm 2-06**	Grout associated with 6"x6" gray quarry tile - gray	8-14-AF-541A	MISC	NAD			NO	NQ	NF
			8-14-AF-541B		NAD				NQ	
HA #542	**Rm 2-06**	2'x4' acoustical ceiling tile - plain face	8-14-AF-542A	MISC	NAD			NO	NQ	F
			8-14-AF-542B		NAD				NQ	
HA #543	**Rm 2-07**	Caulk at window surround - black	8-14-AF-543A	MISC	NAD			NO	NQ	NF
			8-14-AF-543B		NAD				NQ	
HA #544	**Rm 2-10**	Carpet adhesive - yellow	8-14-AF-544A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-544B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Jet Shop & Turbo Jet Power Packs (continued)										
	Color Key On Drawing:	**1970'S Construction**								
HA #545	**Rm 2-11**	Sink under coating - cream	8-14-AF-545A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-545B		NAD				NQ	
HA #548	**East Facade**	Caulk at window frame / wall panel junction - brown	8-14-AF-548A	MISC	NAD			NO	NQ	NF
			8-14-AF-548B		NAD				NQ	
HA #549	**Turbo jet 13, Turbo jet 14**	Window glazing compound in viewing window - black (D-side)	8-14-AF-549A	MISC	NAD			NO	NQ	NF
			8-14-AF-549B		NAD				NQ	
HA #550	**Turbo jet 12, Turbo jet 14**	Caulk at angle iron seams - brown	8-14-AF-550A	MISC	NAD			NO	NQ	NF
			8-14-AF-550B		NAD				NQ	
HA #551	**Turbo jet 12, Turbo jet 14**	Wool packing around jet exhaust - white	8-14-AF-551A	MISC	NAD			NO	NQ	NF
			8-14-AF-551B		NAD				NQ	
HA #522	**Turbo jet 12, Turbo jet 14**	Nylon jacket over wool packing around jet exhaust - gray	8-14-AF-552A	MISC	NAD			NO	NQ	NF
			8-14-AF-552B		NAD				NQ	
HA #523	**Turbo jet 12, Turbo jet 14**	Tar on metal roof deck - black	8-14-AF-553A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-553B		NAD				NQ	
HA #524	**Turbo jet 12, Turbo jet 14**	Top layer roofing canvas over tar - metallic	8-14-AF-554A	MISC	NAD			NO	NQ	NF
			8-14-AF-554B		NAD				NQ	
HA #525	**Turbo jet 12, Turbo jet 14**	Caulk at metal wall panel / grate junction at stack - white / hard	8-14-AF-555A	MISC	NAD			NO	NQ	NF
			8-14-AF-555B		NAD				NQ	
HA #526	**Turbo jet 14**	Gasket behind screws through metal wall panels - black	8-14-AF-556A	MISC	NAD			NO	NQ	NF
			8-14-AF-556B		NAD				NQ	
HA #527	**Tubro jet 14 control rm roof**	Tar paper on metal rood deck - black	8-14-AF-557A	MISC	NAD			NO	NQ	NF
			8-14-AF-557B		NAD				NQ	
HA #528	**Tubro jet 14 control rm roof**	Reglet caulk - black	8-14-AF-558A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-558B		NAD				NQ	
HA #529	**Turbo jet 14 control rm**	Window glazing compound in control gauge window under tank -	8-14-AF-559A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-559B		NAD				NQ	
HA #530	**Turbo jet 12 control rm roof**	Coating on power output box - white	8-14-AF-560A	MISC	NAD		NAD	NO	NQ	NF
			8-14-AF-560B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Screen Houses #1 and #2										
	Color Key On Drawing:	**1940'S Construction**								
HA #561	**Screen house #1 rm 0-01**	Tar coating on large diameter pipe - black	8-15-AF-561A	MISC	NAD		NAD	NO	NQ	NF
			8-15-AF-561B		NAD				NQ	
HA #562	**Screen house #1 roof, Screen house #3 LL roof**	Mop down tar on wood roof deck - black	8-15-AF-562A	MISC	NAD		0.64% Chrys	NO	NQ	NF
			8-15-AF-562B		NAD				NQ	
HA #563	**Screen house #1 roof, Screen house #3 LL roof**	Reglet caulk - black	8-15-AF-563A	MISC	NAD		NAD	NO	NQ	NF
			8-15-AF-563B		NAD				NQ	
HA #565	**Screen house #1 roof, Screen house #3 LL roof**	Adhesive under top layer rubber membrane on parapet - yellow	8-15-AF-565A	MISC	NAD			NO	NQ	NF
			8-15-AF-565B		NAD				NQ	
HA #566	**Screen house #1 West Facade, Screen house #3 East Facade**	Sealant between window frame and casing - gray	8-15-AF-566A	MISC	NAD			NO	NQ	NF
			8-15-AF-566B		NAD				NQ	
HA #567	**Screen house #3 rm 0-01**	Paper insulation over fiberglass on pipes - white / silver	8-15-AF-567A	TSI	NAD			NO	NQ	F
			8-15-AF-567B		NAD				NQ	
			8-15-AF-567C		NAD				NQ	
HA #568	**Screen house #3 rm 0-01**	Mastic under paper insulation on plastic elbow covering - brown	8-15-AF-568A	MISC	NAD		NAD	NO	NQ	NF
			8-15-AF-568B		NAD				NQ	
Ash Loadout										
	Color Key On Drawing:	**1980'S Construction**								
HA #569	**South Facade**	Door frame caulk - gray	8-15-AF-569A	MISC	NAD			NO	NQ	NF
			8-15-AF-569B		NAD				NQ	
Scrubber Control Building										
	Color Key On Drawing:	**1990'S Construction**								
HA #570	**Rm 1-01**	Thinset associated with 6"x6" red quarry tile - white	8-15-AF-570A	MISC	NAD			NO	NQ	NF
			8-15-AF-570B		NAD				NQ	
HA #571	**Rm 1-01**	Grout associated with 6"x6" red quarry tile - gray	8-15-AF-571A	MISC	NAD			NO	NQ	NF
			8-15-AF-571A		NAD				NQ	
HA #572	**Rm 1-01**	Sheetrock (wall)	8-15-AF-572A	MISC	NAD			NO	NQ	F
			8-15-AF-572B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Scrubber Control Building (continued)										
	Color Key On Drawing:	**1990'S Construction**								
HA #573	**Rm 1-01**	Joint compound associated with sheetrock wall - white	8-15-AF-573A	MISC	NAD			NO	NQ	NF
			8-15-AF-573B		NAD				NQ	
HA #574	**Rm 1-01**	4" vinyl cove base adhesive - white	8-15-AF-574A	MISC	NAD			NO	NQ	NF
			8-15-AF-574B		NAD				NQ	
HA #575	**Rm 1-01**	4" vinyl cove base - gray	8-15-AF-575A	MISC	NAD			NO	NQ	NF
			8-15-AF-575B		NAD				NQ	
HA #576	**Rm 1-01**	Window frame caulk - black	8-15-AF-576A	MISC	NAD			NO	NQ	NF
			8-15-AF-576B		NAD				NQ	
HA #X575	**Rm 1-03**	Adhesive associated with 4"x4" wall tile - yellow	8-15-AF-X575A	MISC	NAD			NO	NQ	NF
			8-15-AF-X575B		NAD				NQ	
HA #X576	**West Facade**	Caulk at base of wall panels - white	8-15-AF-X576A	MISC	NAD			NO	NQ	NF
			8-15-AF-X576B		NAD				NQ	
HA #577	**North Facade**	Sealant at duct seams - white	8-15-AF-577A	MISC	NAD			NO	NQ	NF
			8-15-AF-577B		NAD				NQ	
Wheel Wash Building & Maintenance Garage										
	Color Key On Drawing:	**1980'S Construction**								
HA #579	**Facade B**	Caulk under wall panel at base - white	8-15-AF-579A	MISC	NAD			NO	NQ	NF
			8-15-AF-579A		NAD				NQ	
HA #580	**Rm 1-01**	Caulk at concrete floor / wall junction - white	8-15-AF-580A	MISC	NAD			NO	NQ	NF
			8-15-AF-580B		NAD				NQ	
HA #581	**Adjacent garage to wheel wash Rm 1-03**	Window glazing compound - black	8-15-AF-581A	MISC	NAD			NO	NQ	NF
			8-15-AF-581B		NAD				NQ	
Gate 40 Warehouse										
	Color Key On Drawing:	**1980'S Construction**								
HA #653	**Rm 1-01, Rm 1-04**	Sheet rock (wall)	10-1-AF-653A	MISC	NAD			NO	NQ	NF
			10-1-AF-653B		NAD				NQ	
HA #654	**Rm 1-01, Rm 1-04**	Joint compound associated with sheet rock wall - white	10-1-AF-654A	MISC	NAD			NO	NQ	NF
			10-1-AF-654B		NAD				NQ	
HA #655	**Rm 1-01, Rm 1-03**	Vapor barrier facing over fiberglass wall panels - white	10-1-AF-655A	MISC	NAD			NO	NQ	NF
			10-1-AF-655B		NAD				NQ	
HA #656	**Rm 1-02**	Sealant at stack seams - gray (stored stacks)	10-1-AF-656A	MISC	NAD			NO	NQ	NF
			10-1-AF-656B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Gate 40 Warehouse (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #657	**Rm 1-05. Rm 1-06**	Yellow adhesive associated with brown 4" vinyl cove base	10-1-AF-657A	MISC	NAD			NO	NQ	NF
			10-1-AF-657B		NAD				NQ	
HA #658	**Rm 1-05, Rm 1-06**	4" Vinyl cove base - brown	10-1-AF-658A	MISC	NAD			NO	NQ	NF
			10-1-AF-658A		NAD				NQ	
HA #660	**Rm 1-08**	Vapor barrier facing over fiberglass ceiling insulation -	10-1-AF-660A	MISC	NAD			NO	NQ	NF
			10-1-AF-660B		NAD				NQ	
HA #661	**West Facade, South Facade**	Sealant at wall panel door frame junction - transparent	10-1-AF-661A	MISC	NAD			NO	NQ	NF
			10-1-AF-661B		NAD				NQ	
HA #662	**West Facade, South Facade**	Gasket at screws to metal wall panels - black	10-1-AF-662A	MISC	NAD			NO	NQ	NF
			10-1-AF-662B		NAD				NQ	
HA #663	**North Facade**	Window frame caulk - gray	10-1-AF-663A	MISC	NAD			NO	NQ	NF
			10-1-AF-663B		NAD				NQ	
HA #664	**Roof**	Sealant around metal roof panel screws - transparent	10-1-AF-664A	MISC	NAD			NO	NQ	NF
			10-1-AF-664B		NAD				NQ	
HA #665	**North Facade**	Exterior window glazing compound - gray	10-1-AF-665A	MISC	NAD			NO	NQ	NF
			10-1-AF-665B		NAD				NQ	
Northwest Guard Shack										
	Color Key On Drawing:	**Not Applicable Construction Date Unkown**								
HA #666	**Rm 1-01, Rm 1-02**	Brown floor tile mastic associated with white 12"x12" vinyl floor tile	10-1-AF-666A	MISC	NAD			NO	NQ	NF
			10-1-AF-666B		NAD				NQ	
HA #667	**Rm 1-01, Rm 1-03**	12"x12" Vinyl floor tile - white with gray specs	10-1-AF-667A	MISC	NAD			NO	NQ	NF
			10-1-AF-667B		NAD				NQ	
HA #668	**Rm 1-01, Rm 1-04**	Yellow vinyl cove base adhesive associated with white 4" vinyl cove base	10-1-AF-668A	MISC	NAD			NO	NQ	NF
			10-1-AF-668B		NAD				NQ	
HA #669	**Rm 1-01, Rm 1-05**	4" Vinyl cove base - white	10-1-AF-669A	MISC	NAD			NO	NQ	NF
			10-1-AF-669B		NAD				NQ	
HA #670	**Rm 1-01, Rm 1-05**	Single coat plaster skim coat on brick - white	10-1-AF-670A	SURF	NAD			NO	NQ	F
			10-1-AF-670B		NAD				NQ	
			10-1-AF-670C		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Northwest Guard Shack (continued)										
	Color Key On Drawing:	**Not Applicable Construction Date Unkown**								
HA #671	**Rm 1-01**	Sheet rock (ceiling)	10-1-AF-671A	MISC	NAD			NO	NQ	NF
			10-1-AF-671B		NAD				NQ	
HA #672	**Rm 1-01**	Joint compound associated with sheet rock ceiling - white	10-1-AF-672A	MISC	NAD			NO	NQ	F
			10-1-AF-672B		NAD				NQ	
HA #673	**Rm 1-02**	Thinset associated with 4"x4" ceramic wall tile - white	10-1-AF-673A	MISC	NAD			NO	NQ	NF
			10-1-AF-673B		NAD				NQ	
HA #674	**Rm 1-02**	Grout associated with 4"x4" ceramic wall tile - gray	10-1-AF-674A	MISC	NAD			NO	NQ	NF
			10-1-AF-674B		NAD				NQ	
HA #675	**Rm 1-02**	Caulk at sink - white	10-1-AF-675A	MISC	NAD			NO	NQ	NF
			10-1-AF-675B		NAD				NQ	
HA #676	**North Facade**	Caulk at concrete window sill seam - gray	10-1-AF-676A	MISC	NAD			NO	NQ	NF
			10-1-AF-676B		NAD				NQ	
HA #677	**North Facade**	Window frame caulk - gray	10-1-AF-677A	MISC	NAD			NO	NQ	NF
			10-1-AF-677B		NAD				NQ	
HA #678	**North Facade**	Door frame caulk - light gray	10-1-AF-678A	MISC	NAD			NO	NQ	NF
			10-1-AF-678B		NAD				NQ	
HA #680	**Roof**	Ice and water shield - black	10-1-AF-680A	MISC	NAD			NO	NQ	NF
			10-1-AF-680B		NAD				NQ	
HA #681	**Roof**	Architectural asphalt roof shingle - black	10-1-AF-681A	MISC	NAD			NO	NQ	NF
			10-1-AF-681B		NAD				NQ	
Flood Wall										
HA #705	**Flood Wall**	Caulk in vertical concrete seams - gray	10-2-AF-705A	MISC	NAD			NO	NQ	NF
			10-2-AF-705B		NAD				NQ	
HA #706	**Flood Wall**	Moisture barrier coating on concrete	10-2-AF-706A	MISC	NAD			NO	NQ	NF
			10-2-AF-706B		NAD				NQ	
Coal Pond Pump House										
	Color Key On Drawing:	**1980'S Construction**								
HA #682	**Rm 1-01**	Gasket on water lines - gray	10-1-AF-682A	MISC	NAD			NO	NQ	NF
			10-1-AF-682B		NAD				NQ	
HA #683	**Rm 1-01**	Sealant at metal frame / panel junction - white	10-1-AF-683A	MISC	NAD			NO	NQ	NF
			10-1-AF-683B		NAD				NQ	

TABLE II
ASBESTOS CONTAINING MATERIALS
SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

HA#	LOCATION(S)	MATERIAL TYPE	SAMPLE NUMBER	CATEGORY	BULK SAMPLE ANALYSIS RESULTS				ESTIMATED QUANTITY	F/NF
					PLM	PLM PC	TEM NOB	ACM		
Coal Pond Pump House (continued)										
	Color Key On Drawing:	**1980'S Construction**								
HA #684	**Rm 1-01**	Soft liner in pipe - gray	10-1-AF-684A	MISC	NAD			NO	NQ	NF
			10-1-AF-684B		NAD				NQ	
Lime Slurry and Concrete Stack										
	Color Key On Drawing:	**1980'S Construction**								
HA #653	**Lime Slurry interior**	Paper covering on fiberglass insulated pipes - white	8-29-AF-653A	TSI	NAD			NO	NQ	NF
			8-29-AF-653B		NAD				NQ	
			8-29-AF-653C		NAD				NQ	
HA #654	**Concrete Stack**	Residual door frame caulk	8-29-AF-654A	MISC	NAD			NO	NQ	NF
			8-29-AF-654B		NAD				NQ	

TABLE III

UNIVERSAL WASTE MATERIALS AND OHM SUMMARY TABLE

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility			
Maneuvering Hall, MSW Receiving/Storage, Waste Processing and Mezzanine, Refuse Derived Fuel (RDF) Storage, Ferris Loadout			
Color Key on Drawing:	**1980'S Construction**		
	1990'S Construction		
Maneuvering Hall			
Color Key on Drawing:	**1990'S Construction**		
1-01	48	Sodium or Metal Halide Light	Mercury Vapor
	5	Overhead Door Motor	Capacitors
	3	Fire Alarm	Batteries
	4	Exit Sign	Batteries
1-02	16 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Thermostat	Mercury
MSW Receiving/Storage			
Color Key on Drawing:	**1980'S Construction**		
1-03	28	Sodium or Metal Halide Light	Mercury Vapor
	28		DEHP Ballast
	5	Fire Alarm	Batteries
	2	Exit Sign	Batteries
	1	Overhead Door Motor	Capacitors
1-04	10	Sodium or Metal Halide Light	Mercury Vapor
	10		DEHP Ballast
	1	Electric Motor	Capacitors
	2	Overhead Door Motor	Capacitors
	3	HVAC Fan Motor	Capacitors
1-05	9	Sodium or Metal Halide Light	Mercury Vapor
	9		DEHP Ballast
	3	Large Circulation Fans	Capacitors
	4	Conveyor System	Capacitors and Electronic Components
	3	Electric Motor	Capacitors
	3	Wall-Mounted Fluorescent Light	Mercury Vapor
	6	Halogen Spotlight	Bromine Gas
	6		DEHP Ballast
	3	Conveyor “Manipulator System”	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
MSW Receiving/Storage (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-05 (Manipulator Operator Room)	2 LF	Two 1' Fluorescent Lightbulb	Mercury Vapor
	2		DEHP Ballast
	1	CRT Television	Electronic Waste
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
1-06	1	Wall-Mounted Fluorescent Light	Mercury Vapor
	2	Blast Proof Fluorescent Light	Mercury Vapor
1-07	5	Blast Proof Fluorescent Light	Mercury Vapor
	1	Wall-Mounted Fluorescent Light	Mercury Vapor
	1	Very-Large Electric Motor	Capacitors
	1	Medium Electric Motor	Capacitors
	1	Spotlight	Mercury Vapor
1-08	1	Wall-Mounted Fluorescent Light	Mercury Vapor
	2	Blast Proof Fluorescent Light	Mercury Vapor
1-09	5	Blast Proof Fluorescent Light	Mercury Vapor
	1	Wall-Mounted Fluorescent Light	Mercury Vapor
	1	Large Electric Motor	Capacitors
	1	Medium Electric Motor	Capacitors
	1	Halogen Spotlight	Bromine Gas
	1		DEHP Ballast
1-10	40 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	3	Fire Control Panel	Capacitors and Electronic Components
	2	Unit Heater	Capacitors
	2	Natural Gas Boilers	Capacitors and Electronic Components
	1	Oil Lubrication System	Petroleum and Capacitors and Electronic Components
	2	Electric Motor	Capacitors
1-11	8	Large Switchboards	Capacitors and Electronic Components
	1	Unit Heater	Capacitors
	96 LF	Three 8' Long Fluorescent Lightbulb	Mercury Vapor
	4	Rectifier Panels	Capacitors and Electronic Components
	2	Thermostat	Mercury
	1	Wall-Mounted Fan	Capacitors

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
MSW Receiving/Storage (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-12	8 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	2	U-Shaped Fluorescent Lightbulb	Mercury Vapor
	1	Unit Ventilator	Capacitors and Electronic Components
	1	Thermostat	Mercury
1-13	8 LF	One 2' Fluorescent Bulb	Mercury Vapor
	1	Unit Ventilator	Capacitors and Electronic Components
	1	Thermostat	Mercury
1-14	32 LF	Four 4' Long Fluorescent Lightbulb	Mercury Vapor
	1	Defibrillator	Electronic Components and Batteries
1-15	48 LF	Four 4' Long Fluorescent Lightbulb	Mercury Vapor
	2 LF	Vector Pest Control System - Two 1' Fluorescent Bulb	Electronic Components, and Mercury Vapor
	2	Air Conditioners	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Thermostat	Mercury
1-16	9	Sodium or Metal Halide Light	Mercury Vapor
	9		DEHP Ballast
	32 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	1	Odor Mitigation Unit	Capacitors and Electronic Components
	1	Electric Motor	Capacitors
	1	Overhead Door Motor	Capacitors
	6	55-Gallon Drums of Petroleum Based Products	Petroleum
	1	Wall Mounted Compact Fluorescent Lightbulb	Mercury Vapor
1-17	14	Sodium or Metal Halide Light	Mercury Vapor
	14		DEHP Ballast
	11	Wall-Mounted Fluorescent Light	Mercury Vapor
	25	55-Gallon Drums of Petroleum Based Products	Petroleum
	5	10-Gallon Drums of Petroleum Based Products	Petroleum
	15	5-Gallon Containers of Petroleum Based Products	Petroleum
	2	Ferrous Material Conveyor/Loader Units	Capacitors and Electronic Components
	2	Emergency Light System	Batteries
	2	Exit Signs	Batteries
	1	Fire Alarm	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
MSW Receiving/Storage (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-18	96 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	2	Ingersoll Rand HVAC Units	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Overhead Door Motor	Capacitors
	1	Small Electric Motor	Capacitors
	1	Unit Heater	Capacitors
	1	Thermostat	Mercury
	1	Exit Sign	Batteries
1-19	4	Switchboard Banks	Electronic Components
	1	Unit Heater	Capacitors
	40 LF	Ten 4' Fluorescent Lightbulb	Mercury Vapor
1-20	24	Sodium or Metal Halide Light	Mercury Vapor
	24		DEHP Ballast
	3	Wall-Mounted Fluorescent Light	Mercury Vapor
	1	Fluorescent Flood Light	Mercury Vapor
	22	Fire Alarm	Batteries
	6	Emergency Light System	Batteries
	5	Exit Sign	Batteries
	3	Overhead Door Motor	Capacitors
	8	Large Electric Motors	Capacitors
	16	Medium Electric Motor	Capacitors
	28	Electric Motors Associated With Conveyor Systems	Capacitors
Waste Processing Facility Mezzanine			
Color Key on Drawing:	**1980'S Construction**		
2-22	12 LF	One 4' Fluorescent Lightbulb	Mercury Vapor
	16 LF	Four 4' Long Fluorescent Lightbulb	Mercury Vapor
	2	Emergency Light System	Batteries
2-23	24 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	1	Fire Alarm	Batteries
	1	Emergency Light System	Batteries
	4 LF	One 4' Fluorescent Lightbulb	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility Mezzanine (continued)			
Color Key on Drawing:	**1980'S Construction**		
2-24	24 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	4 LF	One 4' Fluorescent Lightbulb	Mercury Vapor
	4 LF	Two 2' Fluorescent Lightbulb	Mercury Vapor
2-25	4 LF	Two 2' Fluorescent Lightbulb	Mercury Vapor
2-26	64 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
	2	Exit Sign	Batteries
	24	Fire Alarm	Batteries
	1	Computer System	Electronic Waste
	2 LF	Vector Pest Control System - Two 1' Fluorescent Bulb	Mercury Vapor, Capacitors
	7	Control Panels	Electronic Components
2-27	16 LF	Two 4' Fluorescent Lightbulb	Mercury Vapor
	3	Emergency Circuit Units	Batteries
2-28	16 LF	Two 4' Long Fluorescent Lightbulb	Mercury Vapor
2-29	64 LF	Eight 4' Long Fluorescent Lightbulb	Mercury Vapor
	1	Fire Alarm	Batteries
	2	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	1	Thermostat	Mercury
2-30	24 LF	Three 4' Long Ceiling Mounted Fluorescent Lightbulbs	Mercury Vapor
	32 LF	Four 4' Long Wall-Mounted Fluorescent Lightbulbs	Mercury Vapor
	16 LF	Two 4" Long Fluorescent Lightbulbs	Mercury Vapor
	1	Thermostat	Mercury
Waste Processing Facility Administration Building			
Color Key on Drawing:	**1980'S Construction**		
1-01	48 LF	Six 4' Long Ceiling Fluorescent Lightbulbs	Mercury Vapor
	1	Thermostat	Mercury
	4	Flush Mount Ceiling Speakers	Electronic Waste
	1	Projector- Ceiling Mounted	Electronic Waste
	1	Projector Screen Motor	Electronic Waste

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility Administration Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-02	16 LF	Two 4' Long Ceiling-Mounted Fluorescent Light	Mercury Vapor
	20	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	4	Electric Panels	Electrical Components
	2	Server Banks	Batteries
	1	Miscellaneous Server Equipment	Batteries
1-03	16 LF	Two 4' Long Ceiling Fluorescent Light	Mercury Vapor
	2	Exit Sign	Batteries
	2	Fire Alarm	Batteries
1-04	8 LF	One 4' Fluorescent Light	Mercury Vapor
1-05	8 LF	One 4' Fluorescent Light	Mercury Vapor
	8LF	One 4' Fluorescent Light	Mercury Vapor
1-06	112 LF	Fourteen 4' Fluorescent Light	Mercury Vapor
	3	(2-U Shaped) Recessed Ceiling Fixtures	Mercury Vapor
	6	U-Shaped Fluorescent Lightbulb	Mercury Vapor
	3	Exit Sign	Batteries
	2	Emergency Light System	Batteries
	2	Fire Alarm	Batteries
	3	Thermostat	Mercury
	1	Unit Ventilator-Motor	Capacitors
	1	Fire Alarm Panel	Batteries
1-09	2	Recessed CF Bulbs	Mercury Vapor
	1	Ceiling Mounted Unit Ventilator- Motor	Capacitors
	1	Door Motion Detector	Batteries
	2	Fire Alarm Panel	Batteries
1-07	3	(2 U-Shaped) Ceiling Fixture	Mercury Vapor
	6	U-Shaped Fluorescent Lightbulb	Mercury Vapor
	1	Thermostat	Mercury
	1	Urinal Cleaner Dispenser	Batteries
1-08	3	(2 U-Shaped) Ceiling Fixture	Mercury Vapor
	6	U-Shaped Fluorescent Lightbulb	Mercury Vapor
	1	Thermostat	Mercury

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility Administration Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-10	24 LF	Three 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-11	32 LF	Four 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-12	16 LF	Two 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-13	32 LF	Four 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-14	32 LF	Four 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-15	16 LF	Two 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-16	16 LF	Two 4' Fluorescent Light	Mercury Vapor
	1	Thermostat	Mercury
1-17	32 LF	Four 4' Fluorescent Light	Mercury Vapor
	2	Thermostat	Mercury
	1	Fire Alarm	Batteries
1-18	8 LF	One 4' Fluorescent Light	Mercury Vapor
	1	Emergency Light System	Batteries
	1	Fire Alarm	Batteries
1-19	32 LF	Four 4' Fluorescent Light	Mercury Vapor
	1	Emergency Light System	Batteries
	3	Thermostat	Mercury
1-20	16 LF	One 4' x 4' Fluorescent Light	Mercury Vapor
	2	Thermostat	Mercury
	1	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Server Banks	Electrical Waste
1-21	32 LF	Four 2' x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility Administration Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-52	32 LF	Four 2' x 4' Fluorescent Lights	Mercury Vapor
	3	Emergency Light System	Batteries
	1	Thermostat	Mercury
	2	Exit Sign	Batteries
	1	Fire Alarm	Batteries
1-53	34	Sodium or Metal Halide Light	Mercury Vapor
	34		DEHP Ballast
	4	Large Electric Motors	Capacitors
	2	Overhead Door Motor	Capacitors
	12	Wall Mounted Sodium or Metal Halide Lights	Mercury Vapor
	12		DEHP Ballast
	2	Exit Signs	Batteries
	6	Fire Alarms	Batteries
Waste Processing Facility Exterior			
Color Key on Drawing:	**1980'S Construction**		
Sprinkler House	2	Large Sprinkler Controllers	Electronic Components
	1	Fan	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
Sprinkler House- Façade C	7	Fluorescent Flood Light	Mercury Vapor
	8	Sodium or Metal Halide Lights	Mercury Vapor
	8		DEHP Ballast
Sprinkler House- Façade B	9	Fluorescent Flood Light	Mercury Vapor
	9		DEHP Ballast
	2	Sodium or Metal Halide Lights	Mercury Vapor
	2		DEHP Ballast
	1	10,000 Gallon Diesel Tank	Diesel Fuel
Fuel House	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	8 LF	One 2 x 4' Fluorescent Light Bulbs	Mercury Vapor
Fuel House Façade A	9	Fluorescent Flood Light	Mercury Vapor
	9		DEHP Ballast
	2	Electrical Vaults	Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Waste Processing Facility Exterior (continued)			
Color Key on Drawing:	**1980'S Construction**		
Valve House 6	20 LF	Five 1 x 4' Fluorescent Bulbs	Mercury Vapor
	2	Large Electric Motors	Capacitors
	1	Unit Heater	Capacitors and Electronic Components
Valve House 6 Façade D	2	Fluorescent Flood Light	Mercury Vapor
	2		DEHP Ballast
WPF Roof	16	Roof Top Electric Vent Fans	Capacitors and Electronic Components
	3	Rooftop HVAC Units	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Ram Clean Unit			
Color Key on Drawing:	**1980'S Construction**		
Ram Clean Unit	4	Large Electric Motors	Capacitors
	2	Small Electric Motor	Capacitors
Odor Control Unit			
Color Key on Drawing:	**1980'S Construction**		
Odor Control Unit	1	Large GE Prolec 4160/480 Volt transformer/ Circuit Breaker	Electronic Components
	4	Large Electric Motors	Capacitors
Re-Therm System (RTO #2)			
Color Key on Drawing:	**1980'S Construction**		
Re-Therm System (RTO #2)	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	8LF	One 2 x 4' Fluorescent Light	Mercury Vapor
Re-Therm System (RTO #1)			
Color Key on Drawing:	**1980'S Construction**		
Re-Therm System (RTO #1)	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	8LF	One 2 x 4' Fluorescent Light	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
RDF Conveyor			
Color Key on Drawing:	**1980'S Construction**		
RDF Conveyor	24	Ceiling Mounted Blast Proof Sodium or Metal Halide Lights	Mercury Vapor
	24		DEHP Ballast
	4	Large Electric Motors	Capacitors
Tool Storage			
Color Key on Drawing:	**1990'S Construction**		
1-01	272 LF	Seventeen 4 x 4' Fluorescent Lights	Mercury Vapor
	72 LF	Eighteen 1 x 4' Fluorescent Lights	Mercury Vapor
	2	Overhead Door Motor	Capacitors
	2	Exit Signs	Batteries
	2	Fire Alarms	Batteries
	2	Emergency Light System	Batteries
1-02	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Thermostat	Mercury
2-03	4 LF	One 1 x 4' Fluorescent Light	Mercury Vapor
	12 LF	Three 1 x 4' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
2-05	3	Fixtures with two U-Shaped Recessed Ceiling Lights	Mercury Vapor
2-06	1	Fixtures with two U-Shaped Recessed Ceiling Lights	Mercury Vapor
	1	CF Fixture	Mercury Vapor
	128 LF	Sixteen 2 x 4' Fluorescent Lights	Mercury Vapor
	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
	1	Fire Alarm	Batteries
	2	Emergency Light System	Batteries
2-07	2	Compact Fluorescent Bulbs	Mercury Vapor
	6	U-Shaped Fluorescent Lightbulb Fixtures	Mercury Vapor
	1	Emergency Light System	Batteries
2-08	48 LF	Six 2 x 4' Recessed Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Tool Storage (continued)			
Color Key on Drawing:	**1990'S Construction**		
2-09	48 LF	Six 2 x 4' Recessed Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
	2	Unit Heater	Capacitors
	2	Electric Motors	Capacitors
	2	Thermostat	Mercury
2-10	96 LF	Twelve 2 x 4' Recessed Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
	2	Emergency Light System	Batteries
	2	Fire Alarms	Batteries
2-11	64 LF	Eight 2 x 4' Recessed Fluorescent Lights	Mercury Vapor
	5	U-Shaped Fluorescent Lightbulb Fixtures	Mercury Vapor
	3	Emergency Light System	Batteries
	3	Fire Alarms	Batteries
	3	Exit Signs	Batteries
	1	Alarmed Door - D Façade	Batteries
Tool Shop Exterior	12	Fluorescent Flood Light	Mercury Vapor
	12		DEHP Ballast
	1	Electric Fan Vent	Capacitors and Electronic Components
	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Exterior Elevator Room	8 LF	One 2 x 4' Fluorescent Light Bulbs	Mercury Vapor
	1	Hydraulic Oil Tank	Hydraulic Oil
	1	Unit Heater	Capacitors and Electronic Components
	1	Wall Mounted Fan/Vent	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Scale House 1, 2, & 3			
Color Key on Drawing:	**1980'S Construction**		
Scale House 1	36 LF	Three 3 x 4' Recessed Fluorescent Lights	Mercury Vapor
	1	Fire Alarm	Batteries
	1	Emergency Light System	Batteries
	1	Thermostat	Mercury
	2	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	2	U- Shaped Bulbs	Mercury Vapor
Scale House 2	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Scale House 3	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	3	Exterior Sodium or Metal Halide Lights	Mercury Vapor
	3		DEHP Ballast
Transfer Building			
Color Key on Drawing:	**1980'S Construction**		
1-01	32 LF	Four 2 x 4' Hanging Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
1-02	72 LF	Nine Hanging Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
	3	Large Power Switchboards	Capacitors and Electronic Components
1-03	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	1	Medium Sized Electric Motor	Capacitors
	1	Thermostat	Mercury

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Transfer Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-04	8	Blast Proof Compact Fluorescent Light	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
	1	Unit Heater	Capacitors and Electronic Components
2-05	9	Blast Proof Compact Fluorescent Light	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
2-06	72 LF	Nine Hanging Fluorescent Lights	Mercury Vapor
	1	Operator Panel	Electronic Components
	4	Unidentified Panels	Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
2-07	4 LF	One 1 x 4' Fluorescent Light	Mercury Vapor
2-08	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
3-09	14	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	4	Electric Motors	Capacitors
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
4-10	16	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Large Electric Motors	Capacitors
RDF Conveyor	~30	Blast Proof Compact Fluorescent Lights	Mercury Vapor
Conveyor to PBF	~30	Blast Proof Compact Fluorescent Lights	Mercury Vapor
5-11	15	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	5	Electric Motors	Capacitors
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
6-12	9	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Medium Electric Motors	Capacitors
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Transfer Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
Lower Level Roof	1	Small Electric Motor	Batteries
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	1	Wall Mounted Compact Fluorescent Lightbulb	Mercury Vapor
Upper Conveyor Above Pond	12	Blast Proof Compact Fluorescent Lights	Mercury Vapor
Upper Conveyor to PBF	~30	Blast Proof Compact Fluorescent Lights	Mercury Vapor
Coal Barge Unloading Building			
Color Key on Drawing:	**1980'S Construction**		
LVL-01	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Sodium or Metal Halide Lights	Mercury Vapor
	2		DEHP Ballast
LVL-02	3	Large Electric Motors	Capacitors
	1	Small Electric Motor	Capacitors
	1	Hydraulic Tank	Hydraulic Oil
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
LVL-03	2	Sodium or Metal Halide Lights	Mercury Vapor
	2		DEHP Ballast
	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor
LVL-04	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Electric Motor	Capacitors
LVL-05	3	Large Electric Motors	Capacitors
	1	Medium Electric Motor	Batteries
	3	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Emergency Light System	Batteries
	4	55 Gallon Grease Drum	Petroleum Products
LVL-06	1	Control Room Electronics	Elctronic Waste
	8 LF	2 x 4' Fluorescent Light Bulbs	Mercury Vapor
	1		PCB Ballast
	1	Emergency Light System	Batteries
	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
LVL-07	4	Medium Electric Motors	Batteries
	6	Blast Proof Compact Fluorescent Lights	Mercury Vapor
LVL-08	6	Medium Electric Motors	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Coal Barge Unloading Building (continued)			
Color Key on Drawing:	**1980'S Construction**		
LVL-09	2	Sodium or Metal Halide Lights	Mercury Vapor
	2		DEHP Ballast
Power Block Facility			
Color Key on Drawing:	**1980'S Construction**		
Bag House 1	1	Small Electric Motor	Capacitors and Electronic Components
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	4	Electric Motors	Capacitors and Electronic Components
Bag House 2	1	Small Electric Motor	Capacitors and Electronic Components
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	4	Electric Motors	Capacitors and Electronic Components
Bag House 3	1	Small Electric Motor	Capacitors and Electronic Components
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	4	Electric Motors	Capacitors and Electronic Components
Scrubber 1	2	Small Electric Motor	Capacitors and Electronic Components
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	2	Unit Heater	Capacitors
	4	Electric Motors	Capacitors and Electronic Components
Scrubber 2	2	Small Electric Motor	Capacitors and Electronic Components
	13	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	2	Unit Heater	Capacitors and Electronic Components
	4	Electric Motors	Capacitors and Electronic Components
Scrubber 3	2	Small Electric Motor	Capacitors and Electronic Components
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	2	Unit Heater	Capacitors and Electronic Components
	4	Electric Motors	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Combustion Unit 11			
Color Key on Drawing:	**1980'S Construction**		
EL 31	4	Electric Motors	Capacitors and Electronic Components
	10	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 36	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 45	18	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8 LF	Four 1 x 4' Fluorescent Bulbs	Mercury Vapor
	4	Medium Sized Electric Motor	Capacitors and Electronic Components
	10	Small Electric Motor	Capacitors and Electronic Components
	3	Electric Panels	Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	1	Hydraulic Tank	Petroleum Products
	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
EL 55	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Medium Electric Motors	Capacitors and Electronic Components
	7	Electric Panels	Electronic Components
EL 64	6	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Panel	Electronic Components
	2	Electric Motors	Capacitors and Electronic Components
	4	Medium Electric Motors	Capacitors and Electronic Components
	5	Medium Electric Panels	Electronic Components
EL 73	72 LF	Nine 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	2	Electronic Scales (Motorized)	Capacitors and Electronic Components
EL 89	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	2	Medium Electric Panels	Electronic Components
EL 104	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Small Electric Motors	Capacitors and Electronic Components
EL 116	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Electric Panels	Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Combustion Unit 11 (continued)			
Color Key on Drawing:	**1980'S Construction**		
EL 125	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8	Electric Panels	Electronic Components
EL 146	20	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Electric Motors	Capacitors and Electronic Components
Combustion Unit 12			
Color Key on Drawing:	**1980'S Construction**		
EL 31	4	Electric Motors	Capacitors and Electronic Components
	10	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 36	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 45	18	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8 LF	Four 1 x 4' Fluorescent Bulbs	Mercury Vapor
	4	Medium Sized Electric Motor	Capacitors and Electronic Components
	10	Small Electric Motor	Capacitors and Electronic Components
	3	Electric Panels	Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	1	Hydraulic Tank	Petroleum Products
	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
EL 55	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Medium Electric Motors	Capacitors and Electronic Components
	7	Electric Panels	Capacitors and Electronic Components
EL 64	6	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Panel	Electronic Components
	2	Electric Motors	Capacitors and Electronic Components
	4	Medium Electric Motors	Capacitors and Electronic Components
	5	Medium Electric Panels	Electronic Components
EL 73	72 LF	Nine 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	2	Electronic Scales (Motorized)	Capacitors and Electronic Components
EL 89	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	2	Medium Electric Panels	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Combustion Unit 12 (continued)			
Color Key on Drawing:	**1980'S Construction**		
EL 104	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Small Electric Motors	Capacitors and Electronic Components
EL 116	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Electric Panels	Capacitors and Electronic Components
EL 125	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8	Electric Panels	Capacitors and Electronic Components
EL 146	20	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Electric Motors	Capacitors and Electronic Components
Combustion Unit 13			
Color Key on Drawing:	**1980'S Construction**		
EL 31	4	Electric Motors	Capacitors and Electronic Components
	10	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 36	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
EL 45	38	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8 LF	Four 1 x 4' Fluorescent Bulbs	Mercury Vapor
	4	Medium Sized Electric Motor	Capacitors and Electronic Components
	10	Small Electric Motor	Capacitors and Electronic Components
	3	Electric Panels	Electronic Components
	1	Large Electric Motors	Capacitors and Electronic Components
	1	HydraulicTank	Petroleum Products
	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
EL 55	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	136 LF	Seventeen 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Medium Electric Motors	Capacitors and Electronic Components
	7	Electric Panels	Electronic Components
EL 64	6	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Medium Electric Panel	Electronic Components
	2	Electric Motors	Capacitors and Electronic Components
	4	Medium Electric Motors	Capacitors and Electronic Components
	5	Medium Electric Panels	Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Combustion Unit 13 (continued)			
Color Key on Drawing:	**1980'S Construction**		
EL 73	72 LF	Nine 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	2	Electronic Scales (Motorized)	Capacitors and Electronic Components
EL 89	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Medium Electric Motors	Capacitors and Electronic Components
	2	Medium Electric Panels	Electronic Components
EL 104	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Small Electric Motors	Capacitors and Electronic Components
EL 116	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Electric Panels	Electronic Components
EL 125	5	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	8	Electric Panels	Electronic Components
EL 146	20	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Electric Motors	Capacitors and Electronic Components
Boiler 9			
Color Key on Drawing:	**1950'S Construction**		
Level 1	15	Sodium or Metal Halide Spot lights	Mercury Vapor
	15		DEHP Ballasts
	4	Emergency Light System	Batteries
	1	Gauge Cluster / Control Panel	Capacitors and Electronic Components
Level 2	4	Sodium or Metal Halide Lights	Mercury Vapor
	4		DEHP Ballasts
	6	Oil Fired Nozzle / Burner Modules	Capacitors and Electronic Components
Level 3	4	Sodium or Metal Halide Spot Lights	Mercury Vapor
	4		DEHP Ballasts
Level 4	4	Sodium or Metal Halide Spot Lights	Mercury Vapor
	4		DEHP Ballasts
Level 5	6	Sodium or Metal Halide Spot Lights	Mercury Vapor
	6		DEHP Ballasts
	1	Large Electric Motor	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Boiler 10			
Color Key on Drawing:	**1950'S Construction**		
Level 1	19	Sodium or Metal Halide Spot lights	Mercury Vapor
	19		DEHP Ballasts
	2	Emergency Light System	Batteries
Level 2	7	Sodium or Metal Halide Spot lights	Mercury Vapor
	7		DEHP Ballasts
	6	Oil Fired Nozzle/ Burner Modules	Capacitors and Electronic Components
Level 3	4	Sodium or Metal Halide Spot lights	Mercury Vapor
	4		DEHP Ballasts
Level 4	4	Sodium or Metal Halide Spot lights	Mercury Vapor
	4		DEHP Ballasts
Level 5	6	Sodium or Metal Halide Spot lights	Mercury Vapor
	6		DEHP Ballasts
PBF Ash Alley			
Color Key on Drawing:	**1920'S Construction**		
00-71 El-22	5	Sodium or Metal Halide Lights	Mercury Vapor
	5		DEHP Ballasts
	5	5 Gallon Buckets of Chemicals (Unknown Content)	Chemical Waste
0-01	6	Emergency Light System	Batteries
	3	Exit Signs	Batteries
	24	Sodium or Metal Halide Lights	Mercury Vapor
	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	~1	One Gallon of "Saw Fluid"	Petroleum Products
0-02	32 LF	Two 2 x 8' Fluorescent Lights	Mercury Vapor
	4		PCB Ballasts
0-03	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
	2		PCB Ballasts
0-04	24 LF	Six 2 x 2' Fluorescent Lights	Mercury Vapor
	6		PCB Ballasts
	4	Unit Heater	Capacitors and Electronic Components
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2		PCB Ballasts

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Ash Alley (continued)			
Color Key on Drawing:	**1920'S Construction**		
0-05	5	Sodium or Metal Halide Lights	Mercury Vapor
	5		DEHP Ballasts
	1	Emergency Light System	Batteries
0-06A	1	Sodium or Metal Halide Lights	Mercury Vapor
	1		DEHP Ballasts
	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
0-06B	16 LF	One 2 x 8' Fluorescent Lights	Mercury Vapor
	7	Sodium or Metal Halide Lights	Mercury Vapor
	7		DEHP Ballasts
0-07	18 LF	Three 3 x 2' Fluorescent Lights	Mercury Vapor
	3		PCB Ballasts
	3	Emergency Light Systems	Batteries
	1	Exit Sign	Batteries
0-08	108 LF	Twenty-Seven 2 x 2' Fluorescent Lights	Mercury Vapor
	27		PCB Ballasts
	2	Emergency Light Systems	Batteries
	2	Exit Signs	Batteries
	1	5 Gallon Bucket of Batteries	Batteries
	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	3	Unit Heater	Capacitors and Electronic Components
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	5	Thermostats	Mercury
	2	Electric Motors	Capacitors and Electronic Components
0-08B	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
0-08A	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
1-09	64 LF	Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Fire Alarm	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Ash Alley (continued)			
Color Key on Drawing:	**1920'S Construction**		
1-10	56 LF	Fourteen 1 x 4' Fluorescent Lights	Mercury Vapor
0-11	12 LF	Three 2 x 2' Fluorescent Lights	Mercury Vapor
	3		PCB Ballasts
	16 LF	One 2 x 8' Fluorescent Lights	Mercury Vapor
	2		PCB Ballasts
	1	Large Switchboard	Capacitors and Electronic Components
	1	Oil Tank for Electrical	Petroleum Products
	2	Ingersol- Rand Air Compressors	Petroleum and Electrical Components
	1	55 Gallon Drum of Aqua- Sol	Chemical Products
0-12	16 LF	Four 2 x 2' Fluorescent Lights	Mercury Vapor
	4		PCB Ballasts
	Residual	Hypochloride Tank (Empty)	Chemical Products
	1	Abandoned Gauge Cluster	Capacitors and Electronic Components
	2 LF	One 1 x 2' Fluorescent Lights	Mercury Vapor
	1		PCB Ballasts
0-13	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
	2		PCB Ballasts
	2	Large Electrical Switchboxes	Capacitors and Electronic Components
	2	Electric Motors	Capacitors and Electronic Components
0-14	1	Electric motor	Capacitors and Electronic Components
0-15	16 LF	One 2 x 8' Fluorescent Lights	Mercury Vapor
	1		PCB Ballasts
	8 LF	Two 2 x 2' Fluorescent lights	Mercury Vapor
	2		PCB Ballasts
	1	Electric Water heater	Capacitors and Electronic Components
	1	Flammables Cabinet	Paints, Petroleum Products, Chemical Products
0-16	48 LF	Six 2 x 8' Fluorescent Lights	Mercury Vapor
	6		PCB Ballasts
	1	Unit Heater	Capacitors and Electronic Components
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Thermostat	Mercury

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Ash Alley (continued)			
Color Key on Drawing:	**1920'S Construction**		
ST-01	12	Emergency Light Systems	Batteries
	120 LF	Twenty 2 x 3' Fluorescent Lights	Mercury Vapor
	4	Exit Signs	Batteries
0-18 (EL 31)	32	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Electric Motors	Capacitors and Electronic Components
	3	Large Switchboards	Capacitors and Electronic Components
	16 LF	Four 2 x 2' Fluorescent Lights	Mercury Vapor
	2	Overhead Door Motors	Capacitors and Electronic Components
	1	Elevator Control System	Electronic Waste
0-18 (EL 31/ Elevator Room)	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Electrical Breaker Boxes	Capacitors and Electronic Components
	1	Large Elevator Electrical Panel	Capacitors and Electronic Components
	1	Medium Electric Motors	Capacitors and Electronic Components
0-19	56 LF	Seven 2 x 4' Fluorescent Lights	Mercury Vapor
	7		DEHP Ballasts
	2	5,000 Gallon Caustic Material Tanks	Chemical Products
	7	Electric Motors	Capacitors and Electronic Components
	16 LF	Four 2 x 2' Fluorescent Lights	Mercury Vapor
	4		DEHP Ballasts
	4	~300 Gallon Tanks of Water Treatments Chemicals	Chemical Products
PBF Combustion Units 11, 12, and 13 Building			
Color Key on Drawing:	**1980'S Construction**		
0-18 (EL 36)	1	Emergency Light System	Batteries
	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
Warehouse Building			
Color Key on Drawing:	**1950'S Construction**		
0-20	16 LF	Four 2 x 2' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Warehouse Building (continued)			
Color Key on Drawing:	**1950'S Construction**		
0-21	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	1	Thermostat	Mercury
0-22	160 LF	Forty 2 x 2' Fluorescent Lights	Mercury Vapor
	1	500-Gallon Chemical Tank	Unknown Residual Chemical Products
	5	Emergency Light Systems	Batteries
	2	Exit Signs	Batteries
	1	Overhead Door Motors	Capacitors and Electronic Components
	2	Electric Motors	Capacitors and Electronic Components
	1	Large Electric Switchboard	Capacitors and Electronic Components
	2	Shelves of Grease	Petroleum Products
	4	5-Gallon Oil Buckets	Petroleum Products
	2	Shelves of Cleaning Products	Chemical Products
	5	55-Gallon Drums of Boiler Chemicals	Chemical Products
	5	21-Gallon Fiber Drums	Unknown Chemical Products
	2	55-Gallon Drums of Unknown Chemicals	Unknown Chemical Products
	22	Boxes of Metal or Sodium Halide Lamps (12 EA)	Mercury Vapor
	7	Sodium or Metal Halide Lamps	Mercury Vapor
	15	Boxes of Fluorescent Lights (24 EA)	Mercury Vapor
	30	D and C Batteries (stored)	Batteries
	10	One Gallon Jugs of Ammonia	Chemical Products
	1	Large Oil Cooled Radiator for Electrical	Petroleum Products
	1	5-Gallon Bucket of Spent Batteries	Batteries
0-23	1	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Thermostat	Mercury
	1	Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Façade A	3	Wall Mounted Compact Fluorescent Lightbulb	Mercury Vapor
Façade B	1	Wall Mounted Compact Fluorescent Lightbulb	Mercury Vapor
	2	Sodium or Metal Halide Flood Lights	Mercury Vapor
	2		DEHP Ballasts

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Warehouse Building Exterior			
Color Key on Drawing:	**1950'S Construction**		
Façade C	2	Wall Mounted Compact Fluorescent Lightbulb	Mercury Vapor
PBF Combustion Units 11, 12, and 13			
Color Key on Drawing:	**1980'S Construction**		
1-26 (EL 45)	2	Halon Fire Extinguisher Tanks- Pressurized	Chemical Products
	2	Medium Electrical Safety Switches	Capacitors and Electronic Components
	8	Sodium or Metal Halide Lights	Mercury Vapor
	8		DEHP Ballasts
	1	55 Gallon Drum of "Mobil Fluid"	Petroleum Products
	3	Large Switchboards for Combustion Units	Capacitors and Electronic Components
Boilers 9 & 10 Building			
Color Key on Drawing:	**1920'S Construction**		
2-27	29	Sodium or Metal Halide Lights	Mercury Vapor
	29		DEHP Ballasts
	12 LF	Three 3 x 2' Fluorescent Lights	Mercury Vapor
	3		PCB Ballasts
	4	Medium Electrical Switchboards	Capacitors and Electronic Components
	17	Emergency Light Systems	Batteries
	3	Thermostats	Mercury
	4	Unit Heater	Capacitors and Electronic Components
	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	2	Large Abandoned Boiler Control Systems	Capacitors and Electronic Components
2-29	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2		PCB Ballasts
	4	50 Gallon Tanks Labeled Chemical Tanks	Unknown Chemical Products

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Combustion Units Control Room			
Color Key on Drawing:	**1980'S Construction**		
2-30	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
2-31	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
2-32	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
2-33	1	HVAC Motor	Capacitors and Electronic Components
	15	Large Control Panels	Capacitors and Electronic Components
	100 LF	Twenty Five 4' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light Systems	Batteries
	1	Thermostat	Mercury
2-34	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
2-35	16 LF	One 2 x 8' Fluorescent Lights	Mercury Vapor
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	1	Medium Electric Motor	Capacitors and Electronic Components
	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Combustion Units 11, 12, and 13			
Color Key on Drawing:	**1980'S Construction**		
2-36 (EL 55)	6	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	3	Large Electric Motors	Capacitors and Electronic Components
	17	Small Electric Motors	Capacitors and Electronic Components
	152 LF	Nineteen 2 x 4' Fluorescent Lights	Mercury Vapor
	6	Medium Breaker Boxes	Capacitors and Electronic Components
	1	5 Gallon Fuel Can	Petroleum Products
	3	1 Gallon Oil Cans	Petroleum Products
	3	Pressurized Flammable Containers	Unknown Chemical Products
	2	Aerosol Paint Cans	Aerosol
	2	Unknown Spray Bottles	Unknown Chemical Products
	3	55 Gallon Boiler Treatment Chemical Drums	Unknown Chemical Products
	2	55 Gallon Methoxypropylamine Drums	Chemical Products
	1	100 Gallon Sulfite Solution Drum	Chemical Products
	1	100 Gallon Amine Solution	Chemical Products
	2	50 Gallon Chemical Treatment	Chemical Products
	1	100 Gallon Chemical Treatment	Chemical Products
	1	Large Water Sampling Station	Chemical Products
	1	Large Switchboard	Capacitors and Electronic Components
	3	Fiber Drums Boiler Water Treatment	Unknown Chemical Products
	1	Overhead Door Motors	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
2-37	8 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Small Voltage Regulator	Capacitors and Electronic Components
	1	Cabinet Containing ~25 Containers of Water Testing Solution	Chemical Products
	1	5 Gallon Container of Floor Finish	Chemical Products
	1	One Gallon Container of Acetone	Chemical Products
2-38	144 LF	Nine 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Fume Hood	Capacitors and Electronic Components Associated with Vent Fan
	28	Containers of Water Testing Solutions	Chemical Products
2-39 (EL 64)	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Blast Proof Compact Fluorescent Lights	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Combustion Units 11, 12, and 13 (continued)			
Color Key on Drawing:	**1980'S Construction**		
4-40 (EL 77)	12	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	4	Metering Module Panels	Capacitors and Electronic Components
	2	"Skid Disconnect" Panels	Capacitors and Electronic Components
	8	Small Electric Motors	Capacitors and Electronic Components
5-41	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Small Electric Motor	Capacitors and Electronic Components
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	1	Large Switchboard	Capacitors and Electronic Components
	1	Fire Alarm	Batteries
	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
5-42	3	HVAC Control Systems	Capacitors and Electronic Components
	2	Air Conditioners	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
6-43 (EL 104)	88 LF	Eleven 2 x 4' Fluorescent Lights	Mercury Vapor
	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
6-44	9	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	64 LF	Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	3	Hydraulic Tank	Petroleum Products
	3	Medium Electric Panels	Capacitors and Electronic Components
	12	Medium Electric Motors	Capacitors and Electronic Components
	12	Hydraulically Powered Motors	Petroleum Products
	12	Medium Electric Motors	Capacitors and Electronic Components
	12	Hydraulic Motors	Petroleum Products
7-45	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	1	Exit Sign	Batteries
7-46	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Combustion Units 11, 12, and 13 (continued)			
Color Key on Drawing:	**1980'S Construction**		
7-48	192 LF	Twenty Four 2 x 4' Fluorescent Lights	Mercury Vapor
	3	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Wall Mounted Spot Light	Mercury Vapor
	1	Fire System Electrical Control Panel	Capacitors and Electronic Components
	1	Overhead Door Motors	Capacitors and Electronic Components
8-49	56 LF	Seven 2 x 4' Fluorescent Lights	Mercury Vapor
	13	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	2	Wall Mounted Spot Lights	Mercury Vapor
8-50	17	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Large Electric Motor	Capacitors and Electronic Components
8-51	10	Large Electric Motors	Capacitors and Electronic Components
	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
9-52	64 LF	Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	14	Blast Proof Compact Fluorescent Lights	Mercury Vapor
Electrical Room	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
7-53 (EL 106)	24	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
6-54 (EL 85)	8	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	1	Electric Motor	Capacitors and Electronic Components
8-35	3	Large Electric Motors	Capacitors and Electronic Components
	3	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Turbine Hall			
Color Key on Drawing:	**1920'S Construction**		
0-56 (EL 11)	4	Blast Proof Compact Fluorescent Lights	Mercury Vapor
	11	Large Electric Motors	Capacitors and Electronic Components
	18	Small Electric Motors	Capacitors and Electronic Components
	3	Extra Large Motors	Capacitors and Electronic Components
	30	Emergency Light System	Batteries
	6	Exit Signs	Batteries
	12	Medium Electric Motors	Capacitors and Electronic Components
	6	Sump Pumps	Capacitors and Electronic Components
	2	5 Gallon Gear Oil Containers	Petroleum Products
	~8	Aerosol Paint Cans	Aerosol
	2	5 Gallon Gas Cans	Petroleum
	275	Lube Oil Tank	Residual Petroleum Products
	8	55 Gallon Empty Drum	Residual Chemical Products
	2	5 Gallon Containers of Air Compressor Coolant	Petroleum Products
	1	55 Gallon Drum of Activated Alumina	Heavy Metals
	4	55 Gallon Drums of Unknown Substance	Chemical Products
	1	55 Gallon Drum of Sodium Molybdate, Nitrous Acid, Sodium	Chemical Products
	2	Manometers	Mercury
	2	Refrigerators	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	~1000 Gallon Gear Oil Tank	Petroleum Products
	6	Stored Electric Motors	Capacitors and Electronic Components
Northeast Utilities Building			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
00-01	80 LF	Ten 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Large Electric Switchboards	Capacitors and Electronic Components
	1	Fire Control System	Batteries
	4	Sump Pump Breaker Panels	Capacitors and Electronic Components
00-02	1	Abandoned Electrical Switchboard	Capacitors and Electronic Components
	1	Abandoned Oil Bath Electrical Panel	Petroleum Products
	1	Electric Motor	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
00-03	21	Cans of Aerosol Chemicals	Aerosol
	4	Tubes of Grease	Petroleum Products
	5	5 Gallon Lubricant Cans	Petroleum Products
	2	5 Gallon Containers of Gasoline	Petroleum Products
	12	60 Gallon Tanks of Grease/Oil	Petroleum Products
	2	800 Gallon Tanks of Oil	Petroleum Products
	1	Small Electric Motor	Capacitors and Electronic Components
	3	500 Gallon Tanks of Oil	Petroleum Products
	1	2.5 Gallon Container of Grease	Petroleum Products
Turbine Hall			
Color Key on Drawing:	**1920'S Construction**		
00-59	1	~30 Gallon Tank With Residual Oil	Petroleum Products
	2	Small Electric Motors	Capacitors and Electronic Components
	8	Old Style Transistors/Capacitors	Capacitors and Electronic Components
	1	GE Rheostat	Capacitors and Electronic Components
00-60	2	GE Rheostat	Capacitors and Electronic Components
	1	Blast Proof Fluorescent Light	Mercury Vapor
00-61	1	GE Turbine Control System	Capacitors and Electronic Components
	4	Blast Proof Fluorescent Lights	Mercury Vapor
00-62	1	GE Turbine Control System	Capacitors and Electronic Components
	1	Excitation Control Panel	Capacitors and Electronic Components
	5	Blast Proof Fluorescent Lights	Mercury Vapor
1-63	20	Sodium or Metal Halide Lights	Mercury Vapor
	20		DEHP Ballasts
	6	Exit Signs	Batteries
	11	Emergency Light System	Batteries
	1	Fire Control System	Capacitors and Electronic Components
	2	Slurry Injector Motors	Capacitors and Electronic Components
	5	Large Electric Motors	Capacitors and Electronic Components
	7 Gallons	Stored Oil	Petroleum Products
	5 Gallons	Resin	Chemical Products
	2	Manometers	Mercury

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Turbine Hall (continued)			
Color Key on Drawing:	**1920'S Construction**		
1-64	24 LF	Six 2 x 2' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
	1	Unit Heater	Capacitors and Electronic Components
1-65	400 LF	Twenty Five 4 x 4' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Emergency Light System	Batteries
	4	Breaker Boxes	Capacitors and Electronic Components
1-66	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
1-67	16 LF	One 4 x 4' Fluorescent Lights	Mercury Vapor
1-68	36 LF	Three 3 x 4' Fluorescent Lights	Mercury Vapor
1-69	24 LF	Two 3 x 4' Fluorescent lights	Mercury Vapor
1-70	24 LF	Two 3 x 4' Fluorescent lights	Mercury Vapor
	1	Server Equipment	Electronic Waste
Northeast Utilities Building			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
0-07	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	1	Emergency Light System	Batteries
0-08	64 LF	Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	8		PCB Ballasts
	1	Unit Heater	Capacitors and Electronic Components
0-09	4 LF	One 2 x 2' Fluorescent Lights	Mercury Vapor
0-10	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
0-11	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
0-12	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Phone Control System	Electronic Waste
1-17	36 LF	Two 4 x 4' Fluorescent Lights	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
1-13	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	1	Emergency Light System	Batteries
1-16	16 LF	One 4 x 4' Fluorescent Lights	Mercury Vapor
	2 LF	One 1 x 2' Fluorescent Lights	Mercury Vapor
1-15 (Elevator)	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
1-19	2	One Gallon Paint Cans	Chemical Products
	87	Old Style Capacitors	Capacitors and Electronic Components
	4	5 Gallon Paint Buckets	Chemical Products
	1	Emergency Light System	Batteries
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	4	One Old Style Switch Box	Capacitors and Electronic Components
1-24	24 LF	Six 2 x 2' Fluorescent Lights	Mercury Vapor
	4	Emergency Light Systems	Batteries
	1	Breaker Boxes	Capacitors and Electronic Components
	40 LF	Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	5	Fire Alarms	Batteries
	7	One Gallon Paint Cans	Petroleum Products
	3	Grease Tubes	Petroleum Products
	14	Aerosol Paint Cans	Aerosol
	2	5 Gallon Gasoline Cans	Petroleum Products
	1	Two Gallon Oil Container	Petroleum Products
	9	Capacitors	Capacitors and Electronic Components
	~12	Boxes of Electronic Components	Capacitors and Electronic Components
1-25	4 LF	One 2 x 2' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
1-27	5	Switchboxes	Capacitors and Electronic Components
	1	Medium Electric Motor	Capacitors and Electronic Components
	4 LF	One 2 x 2' Fluorescent Light	Mercury Vapor
	8 LF	One 4 x 2' Fluorescent Light	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
1-28	240 LF	Thirty 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Blast Proof Compact Fluorescent Light	Mercury Vapor
	1	Exit Sign	Batteries
	2	Unit Heaters	Capacitors and Electronic Components
	12	Electric Motors	Capacitors and Electronic Components
	6	Shelves of Electrical Components	Capacitors and Electronic Components
	30	Gas Monitor Panels	Capacitors and Electronic Components
	1	CRTV	Electronic Waste
	3	Industrial Terminal Monitors	Capacitors and Electronic Components
	6	Sodium or Metal Halide Lights	Mercury Vapor
	6		DEHP Ballasts
	41	One Gallon Paint Cans	Chemical Products
	2	5 Gallon Paint Cans	Chemical Products
	1	5 Gallon Petroleum Containers	Petroleum Products
	12	Aerosol Paint Cans	Aerosol
2-31	40 LF	Five 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
2-33	8LF	One 2 x 4' Fluorescent Light	Mercury Vapor
3-34	96 LF	Eight 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
3-35	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
	2	Emergency Light System	Batteries
	1	Fire Alarm	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
3-37	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
	1	Wall Mounted Electric Heater	Capacitors and Electronic Components
3-38	96 LF	Six 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
3-38	2	CRTV	Electronic Waste
	120 LF	Fifteen 2 x 4' Fluorescent Lights	Mercury Vapor
	3	Exit Signs	Batteries
	4	Emergency Light Systems	Batteries
	224 LF	Twenty Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Unit Heaters	Capacitors and Electronic Components
	3	Electric motors	Capacitors and Electronic Components
	9	Large Power Switch Gears	Capacitors and Electronic Components
	4	High Voltage Circuit Breakers	Capacitors and Electronic Components
4-40	96 LF	Six 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
4-41	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	4 LF	One 2 x 2' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
4-43	96 LF	Six 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
	50	Switch Gears	Capacitors and Electronic Components
ST-02 (Top)	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Breaker Box	Capacitors and Electronic Components
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
4-48	224 LF	Twenty Eight 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Electric Motor	Capacitors and Electronic Components
	2	Exit Signs	Batteries
	5	Emergency Light Systems	Batteries
	2	Unit Heaters	Capacitors and Electronic Components
	1	Large Switchboard	Capacitors and Electronic Components
	1	Battery Charging Station/Room	Capacitors and Electronic Components
4-49	56	Batteries	Batteries
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	4		PCB Ballasts
5-50	96 LF	Twelve 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
5-51	64 LF	Four 4 x 4' Fluorescent Lights	Mercury Vapor
5-52	2	Unit Heaters	Capacitors and Electronic Components
5-53	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Thermostats	Mercury
5-54	36 LF	Two 2 x 8' Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
5-55	64 LF	Four 4 x 4' Fluorescent Lights	Mercury Vapor
5-56	80 LF	Ten 2 x 4' Fluorescent Lights	Mercury Vapor
	4	Exit Signs	Batteries
	5	Emergency Light Systems	Batteries
	1	Electric Motors	Capacitors and Electronic Components
	5	Electronic Panels	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northeast Utilities Building (continued)			
Color Key on Drawing:	**1920'S Construction**		
	1930'S Construction		
5-57	576 LF	Three 28 x 8' Fluorescent Lights	Mercury Vapor
	18		PCB Ballasts
	30	Capacitors	Capacitors and Electronic Components
	13	Station Monitoring Panels (50 Capacitor Box, 28 EA)	Capacitors and Electronic Components
	7	Turbine Control Panels (60 Capacitors)	Capacitors and Electronic Components
	1	Main Panel (Back)	Capacitors and Electronic Components
	2	Main Panels (Front)	Capacitors and Electronic Components
	1	CRTV	Electronic Waste
	1	Thermostat	Mercury
	1	Stored Mercury Ampule	Mercury
	2.5 LF	Five 6" Fluorescent Lights	Mercury Vapor
5-58	48 LF	Twelve 2 x 2' Fluorescent Lights	Mercury Vapor
	12		PCB Ballasts
	2	Window Air Conditioners	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
5-59	48 LF	Three 2 x 8' Fluorescent Lights	Mercury Vapor
	6		PCB Ballasts
	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	3		PCB Ballasts
	1	Medium Electric Motor	Capacitors and Electronic Components
ST-01	88 LF	Eleven 2 x 4' Fluorescent Lights	Mercury Vapor
	8 LF	Two 2 x 2' Fluorescent Lights	Mercury Vapor
	8	Emergency Light Systems	Batteries
ST-02	40 LF	Five 2 x 4' Fluorescent Lights	Mercury Vapor
ST-03	80 LF	Ten 2 x 4' Fluorescent Lights	Mercury Vapor
	4	Emergency Light Systems	Batteries
	1	Fire Alarm	Batteries
PBF Administration Builidng			
Color Key on Drawing:	**1950'S Construction**		
1-01	4	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Administration Builidng (continued)			
Color Key on Drawing:	**1950'S Construction**		
1-02	10	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
	1	Exit Sign	Batteries
	1	Fire Alarm	Batteries
1-03	16	U- Shaped Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	2	Fire Alarms	Batteries
	1	Emergency Light System	Batteries
ST-01	16	U- Shaped Fluorescent Lights	Mercury Vapor
	3	Emergency Light System	Batteries
	1	Exit Signs	Batteries
	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
	12 LF	One 3 x 4' Fluorescent Light	Mercury Vapor
1-05	3	Emergency Light System	Batteries
1-04	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
ST-02	18	U- Shaped Fluorescent Lights	Mercury Vapor
	3	Emergency Light System	Batteries
	36 LF	Three 3 x 4' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
1-06	2	Emergency Light Systems	Batteries
	24	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	CRTV	Electronic Waste
1-07	20	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Thermostat	Mercury
	2	Exit Signs	Batteries
	1	Emergency Light System	Batteries
	1	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	Commercial Refrigerator	CFC Gas/HCFC Gas, Capacitors, and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Administration Building (continued)			
Color Key on Drawing:	**1950'S Construction**		
1-08	16 LF	One 4 x 4' Fluorescent Lights	Mercury Vapor
	2	U- Shaped Fluorescent Lights	Mercury Vapor
	5	Small Electric Motors	Capacitors and Electronic Components
	6 Gallons	Floor Stripper	Chemical Products
2-09	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
	1	Exit Sign	Batteries
2-11	~6 Gallons	Cleaner	Chemical Products
2-14	2	Exit Signs	Batteries
	1	Fire Alarm	Batteries
2-15	8 LF	One 2 x 4' Fluorescent light	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	1	Defibrillator	Batteries
2-16	6	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	1	Thermostat	Mercury
2-17	4	U- Shaped Fluorescent Lights	Mercury Vapor
2-18	16	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	2	Emergency Light Systems	Batteries
2-19	8	U- Shaped Fluorescent Lights	Mercury Vapor
2-20	8	U- Shaped Fluorescent Lights	Mercury Vapor
3-21	22	U- Shaped Fluorescent Lights	Mercury Vapor
	2	Exit Signs	Batteries
	3	Emergency Light Systems	Batteries
	1	Fire Alarm	Batteries
3-22	20	U- Shaped Fluorescent Lights	Mercury Vapor
3-23	16	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
3-24	8	U- Shaped Fluorescent Lights	Mercury Vapor
3-25	6	U- Shaped Fluorescent Lights	Mercury Vapor
3-26	8	U- Shaped Fluorescent Lights	Mercury Vapor

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
PBF Administration Building (continued)			
Color Key on Drawing:	**1950'S Construction**		
3-27	8	U- Shaped Fluorescent Lights	Mercury Vapor
3-28	4	U- Shaped Fluorescent Lights	Mercury Vapor
3-29	4	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
Façade A	4	Fluorescent Lights	Mercury Vapor
	1	Sodium or Metal Halide Lights	Mercury Vapor
	1		DEHP Ballasts
Façade C	2	Air Conditioners	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	2	Sodium or Metal Halide Flood Lights	Mercury Vapor
	2		DEHP Ballasts
Façade B (lower) Roof	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Jet Shop			
Color Key on Drawing:	**1970'S Construction**		
1-01	1	Large Electric Motor	Capacitors and Electronic Components
	4	Exit Signs	Batteries
	5	Spray Cans of Chain Lube	Aerosol
	1 Gallon	Compressor Oil	Petroleum Products
	1 Gallon	Contact Cement	Chemical Products
	12	Aerosol Paint Cans	Aerosol
	7 Cans	Spray Silicone	Aerosol
	13	Small Batteries	Batteries
	1/4 Gallon	Sta-Bil	Petroleum Products
	~1 Gallon	Silicone Carbide Grease	Petroleum Products
	1 Pint	Industrial Adhesive	Petroleum Products
	1	Magnahelic Pressure Gauge	Mercury
	1	Drill Press Motor	Capacitors and Electronic Components
	1	Band Saw Motor	Capacitors and Electronic Components
	2	Bench Grinder Motors	Capacitors and Electronic Components
	1	Miller Welder	Capacitors and Electronic Components
	4	U- Shaped Fluorescent Lights	Mercury Vapor
	1	Monarch Lathe Motor	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Jet Shop (continued)			
Color Key on Drawing:	**1970'S Construction**		
1-01 (continued)	1	Bridgeport Milling Machine Motor	Capacitors and Electronic Components
	1	Landis Grinder Motor	Capacitors and Electronic Components
	3	Unit Heaters	Capacitors and Electronic Components
	7 Gallons	Denatured Alcohol	Chemical Products
	3 Cans	Propane	Pressurized Container
	5 Tubes	Grease Tubes	Petroleum Products
	4 Cans	Sprayable Insulator Varnish	Aerosol
	2 Cans	Contact Cleaner	Aerosol
	6 Quarts	Air Compressor Oil	Petroleum Products
	1 Gallon	Chain Oil	Petroleum Products
	4 Cans	Brake Cleaner	Aerosol
	1 Bottle	Turbine Oil	Petroleum Products
	1	Paint Can	Chemical Products
	1	Medium Switchboard	Capacitors and Electronic Components
	2 Quarts	Cutting Oil	Petroleum Products
	1 Quart	Motor Oil	Petroleum Products
	2 Gallons	Oil	Petroleum Products
	2 Quarts	Weed Killer	Herbicide
	1 Gallon	Gasoline	Petroleum
	3	40lbs Propane Cylinders	Pressurized Container
	1	Snow Blower	Petroleum, Electronic Components
	4	Metal Halide Lights - Stored	Mercury Vapor
	7	Metal Halide Lights	Mercury Vapor
	7		DEHP Ballasts
	3	Emergency Light System	Batteries
	6	One Gallon RV Anti Freeze	Chemical Products
	2	Overhead Cranes	Capacitors and Electronic Components
	1	Overhead Door Motors	Capacitors and Electronic Components
1-02	5 Gallons	Buffer Solution	Chemical Products
	1	Window Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Jet Shop (continued)			
Color Key on Drawing:	**1970'S Construction**		
1-03	2	Aerosol Paint Cans	Aerosol
	3	Cans of Contact Cleaner	Aerosol
	1	Mini Split Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
1-04	12	Large Electrical Insulators (Wet Insulators)	Petroleum Products
	1	Air Compressor	Capacitors, Electrical Components, and Petroleum Products
	2	Exit Signs	Batteries
	1	Electric Water heater	Capacitors and Electronic Components
	1	Overhead Door Motors	Capacitors and Electronic Components
	1	Electric Motor	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
ST-01	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
ST-02	2	Exit Signs	Batteries
	1	Emergency Light System	Batteries
1-05	1	Fire Alarm	Batteries
2-07	1	Server Equipment	Electronic Waste
2-08	3	Small Halogen Bulbs	Mercury Vapor
	1	Tube of RTV	Chemical Products
	1 Gallon	Copper Sulfate Solution	Chemical Products
	~200	Stored, Non Energized Capacitors	Capacitors
	1	Drill Press Motor	Capacitors and Electronic Components
	1	Stored Computer and Electrical Components	Electronic Waste

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Jet Shop (continued)			
Color Key on Drawing:	**1970'S Construction**		
2-09	16	Stored, Non Energized Capacitors	Capacitors and Electronic Components
	4	Resistors	Capacitors and Electronic Components
	7	Small Electric Motors	Capacitors and Electronic Components
	1	Battery Charger	Electronic Waste
	2	Electrical Transfer Pumps	Capacitors and Electronic Components
	34	Tubes of Grease	Petroleum Products
	1 Box	Silica Gel	Chemical Products
	1	Large Circuit Board	Capacitors and Electronic Components
	3	Medium Electric Motors	Capacitors and Electronic Components
	1 Box	Battery parts	Capacitors and Electronic Components
	4 Quarts	Lubricant Oil	Petroleum Products
	1	Stored Lighting Ballast	PCB Ballast
2-10	1	Fire Alarm	Batteries
	2	CRTV	Electronic Waste
Façade A	1	Fluorescent Bulb Spotlight	Mercury Vapor
	1	Sodium or Metal Halide Spot lights	Mercury Vapor
	1		DEHP Ballasts
Façade B	1	Fluorescent Bulb Spotlight	Mercury Vapor
	1	Electrical Meter Box	Capacitors and Electronic Components
JTC-14	1	Large Battery Charger	Electronic Waste
	8	Large Electrical Switchboards	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
	60	Lead/Acid Batteries	Batteries
JT-14/13 Compressor	2	Medium Electric Motors	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
Screen Houses			
Screen House 1			
Color Key on Drawing:	**1940'S Construction**		
0-01	2	Large Electric Motors	Capacitors and Electronic Components
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Screen House 1 (continued)			
Color Key on Drawing:	**1940'S Construction**		
1-02	1	Unit Heater	Capacitors and Electronic Components
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Small Electric Motor	Capacitors and Electronic Components
2-03	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	4 LF	One 2 x 2' Fluorescent Light	Mercury Vapor
3-04	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Medium Switchboard	Capacitors and Electronic Components
	2	Medium Control Panels	Capacitors and Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
	2	Medium Electric Motors	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
Screen House 3			
Color Key on Drawing:	**1940'S Construction**		
0-01	2	Large Electric Motors	Capacitors and Electronic Components
	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
1-03	1	Unit Heater	Capacitors and Electronic Components
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
2-05	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	1	Large Switchboard	Capacitors and Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Screen House 3 (continued)			
Color Key on Drawing:	**1940'S Construction**		
2-06	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	1	Large Switchboard	Capacitors and Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
1-04	1	Unit Heater	Capacitors and Electronic Components
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Emergency Light System	Batteries
2-07	36 LF	Eight 3 x 4' Fluorescent Lights	Mercury Vapor
	2	Unit Heaters	Capacitors and Electronic Components
3-08	60 LF	Five 3 x 4' Fluorescent Lights	Mercury Vapor
	4	Medium Electric Motors	Capacitors and Electronic Components
	1	Exit Sign	Batteries
	1	Emergency Light System	Batteries
Ash Loadout			
Color Key on Drawing:	**1980'S Construction**		
1-01	7	Sodium or Metal Halide Lights	Mercury Vapor
	7		DEHP Ballasts
Façade A	1	Fluorescent Bulb Spotlight	Mercury Vapor
	1	Medium Electric Motor	Capacitors and Electronic Components
	1	Small Electric Motor	Capacitors and Electronic Components
Façade D	2	Fluorescent Bulb Spotlight	Mercury Vapor
Façade C	1	Fluorescent Bulb Spotlight	Mercury Vapor
Façade B	1	Medium Electric Panel	Capacitors and Electronic Components
Pug Mill Building	3	Sodium or Metal Halide Lights	Mercury Vapor
	3		DEHP Ballasts
	3	Fluorescent Bulb Spotlight	Mercury Vapor
	2	Large Electric Motors	Capacitors and Electronic Components
Ash Conveyor	26	Sodium or Metal Halide Flood Lights	Mercury Vapor
	26		DEHP Ballasts
Upper Area	2	Large Electric Motors	Capacitors and Electronic Components
	1	Wall Mounted Fluorescent Bulb Spotlight	Mercury Vapor
	1	Small Electric Motor	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Scrubber Control			
Color Key on Drawing:	**1990'S Construction**		
1-01	152 LF	Nineteen 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Control Panels	Capacitors and Electronic Components
	2	Exit Signs	Batteries
	1	Large Switchboard	Capacitors and Electronic Components
	1	Electric Water Heater	Capacitors and Electronic Components
	3	One Gallon Paint Cans	Chemical Products
	2	5 Gallon Fuel Cans	Petroleum Products
	5	Small Propane Cans	Pressurized Container
	1	Aerosol Paint Cans	Aerosol
	2	5 Gallon Coolant Cans	Chemical Products
	2	Sprayers With Unknown Liquid	Unknown Chemicals
	2	Emergency Light Systems	Batteries
1-02	72 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	3	Emissions Monitoring Systems	Capacitors and Electronic Components
	2	Exit Signs	Batteries
	1	Emergency Light Systems	Batteries
	1	Fire Alarm	Batteries
1-03	4 LF	One 2 x 2' Fluorescent Light	Mercury Vapor
	8 LF	One 2 x 4' Fluorescent Light	Mercury Vapor
Exterior	4	Wall Mounted Fluorescent Bulb Spotlight	Mercury Vapor
	1	Fire Alarm	Batteries
	1	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Wheel Wash & Storage Garage			
Color Key on Drawing:	**1980'S Construction**		
Wheel Wash	5	Wall Mounted Fluorescent Bulb Spotlight	Mercury Vapor
	2	Overhead Door Motors	Capacitors and Electronic Components
	1	Exit Sign	Batteries

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Wheel Wash & Storage Garage (continued)			
Color Key on Drawing:	**1980'S Construction**		
Pump Room	1	Medium Electric Motor	Capacitors and Electronic Components
	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	2	5 Gallon Gasoline Cans	Petroleum Products
	1	2 Gallon Gasoline Cans	Petroleum Products
	7	1 Gallon Gasoline Cans	Petroleum Products
	1	2 Gallon Coolant Can	Chemical Products
	5 Gallons	Hydraulic Oil	Petroleum Products
	4	Cans of Spray Lube	Aerosol
	2 Quarts	Engine Oil	Petroleum Products
	1	800 Gallon Tank of Unknown Substance	Unknown Chemicals
	1	20 Gallon Drum of Grease	Petroleum Products
	1	Unit Heater	Capacitors and Electronic Components
	1	Window Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
Facades	3	Wall Mounted Fluorescent Bulb Spotlight	Mercury Vapor
Storage Garage Exterior	3	Wall Mounted Fluorescent Bulb Spotlight	Mercury Vapor
Storage Garage	2	Unit Heaters	Capacitors and Electronic Components
	1	Overhead Door Motors	Capacitors and Electronic Components
	4	Sodium or Metal Halide Lights	Mercury Vapor
	4		DEHP Ballasts
	1	55 Gallon Drum of Anti Freeze	Chemical Products
	2	55 Gallon Drum of Compound Cleaner	Chemical Products
	1	55 Gallon Drum of Acetic Acid	Chemical Products
	8	1 Gallon Paint Cans	Chemical Products
	2	5 Gallon Paint Cans	Chemical Products
	~10.5 Gallons	Oil	Petroleum Products
	~60	Cans of Spray Lube	Aerosol
	~100	Aerosol Paint Cans	Aerosol
	~10 Gallons	Solvents	Chemical Products
	6	Cans of Sprayable Gasket Remover	Aerosol
	3	Cans of Paint Primer	Chemical Products

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Wheel Wash & Storage Garage (continued)			
Color Key on Drawing:	**1980'S Construction**		
Storage Garage (continued)	15	Cans of Brake Cleaner	Aerosol
	2	Lead/Acid Batteries	Batteries
	7	Small Lead/Acid Batteries	Batteries
Main Stack	1	Medium Electric Motor	Capacitors and Electronic Components
	5	Strobe Control Boxes	Capacitors and Electronic Components
	3	Strobe Lights	Capacitors and Electronic Components
Lime Silo	6	Wall Mounted Fluorescent Spotlight	Mercury Vapor
	4	Sodium or Metal Halide Lights	Mercury Vapor
	4		DEHP Ballasts
	1	Medium Electric Motor	Capacitors and Electronic Components
	2	Small Electric Motors	Capacitors and Electronic Components
	2	Control Panels	Capacitors and Electronic Components
NU Roof 5	1	High Voltage Penthouse	Capacitors and Electronic Components
	1	Medium Electric Motor	Capacitors and Electronic Components
	3	HVAC Unit	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
PBF Roof 2	4	Vent Stack Electric Motors	Capacitors and Electronic Components
	3	Strobe Lights	Capacitors and Electronic Components
	4	Strobe Light Control Boxes	Capacitors and Electronic Components
Gate 40 Warehouse			
Color Key on Drawing:	**1980'S Construction**		
1-01	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	55 Gallon Drums of Broken Panel Alarms	Capacitors and Electronic Components
	2	55 Gallon Drums of Broken Electrical Breakers	Capacitors and Electronic Components
	2	Band Saw Motors	Capacitors and Electronic Components
	1	Lathe Motor	Capacitors and Electronic Components
	3	Electric Motors	Capacitors and Electronic Components
	3	Large Blowers	Capacitors and Electronic Components
	1	Gas Motor	Capacitors and Electronic Components
	1	Unit Heater	Capacitors and Electronic Components
	1	Small Hydraulic Pump	Capacitors and Electronic Components / Petroleum
	2 Canisters	Welding Gas or Acetylene	Chemical Products
	1	5 Gallon Bucket of Petroleum Oil	Petroleum Products

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Gate 40 Warehouse (continued)			
Color Key on Drawing:	**1980'S Construction**		
1-02	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	2	Unit Heaters	Capacitors and Electronic Components
	8	Surge Arrestors	Petroleum Products
	3	Vent Stack Electric Motors	Capacitors and Electronic Components
	5	Small Electric Motors	Capacitors and Electronic Components
	5	Abandoned Control Panels	Capacitors and Electronic Components
	~15 Gallons	55 Gallon Drum of Turbine Oil	Petroleum Products
	~15 Gallons	55 Gallon Drum of Anti-Freeze	Chemical Products
1-03	48 LF	Six 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Electric Water Heater	Capacitors and Electronic Components
	1	Steam Cleaner Motor	Capacitors and Electronic Components
	1	Hydraulic Motor	Capacitors and Electronic Components
	4	Large Electrical Switches	Capacitors and Electronic Components
	1	5 Gallon Bucket of Lubricant Oil	Petroleum Products
1-04	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	5	5 Gallon Buckets of Filter Spray	Chemical Products
1-05	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
1-06	32 LF	Four 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Exit Sign	Batteries
	1	1 Gallon Paint Can	Petroleum
1-07	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
1-08	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
	1 Can	Raid Roach Spray	Aerosol
1-09	8 LF	One 2 x 4' Fluorescent Lights	Mercury Vapor
1-10	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
Façade B	1	HVAC Blower	Capacitors and Electronic Components

TABLE III
UNIVERSAL WASTE MATERIAL AND OHM SUMMARY TABLE
300 MAXIM ROAD AND 100 RESERVE ROAD
HARTFORD, CONNECTICUT

Room Number	Quantity	Identified Component	Constituent of Concern
Northwest Guard Shack			
1-01	32 LF	Two 4 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	2	Disconnected Switched	Capacitors and Electronic Components
	1	Window Air Conditioner	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
	1	CRTV	Electronic Waste
	1	Mini Fridge	CFC Gas/HCFC Gas, Capacitors, and Electronic Components
1-02	2	Compact Fluorescent Bulbs	Mercury Vapor
Coal Pond Pump House			
Color Key on Drawing:	**1980'S Construction**		
1-01	24 LF	Three 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Unit Heater	Capacitors and Electronic Components
	2	Medium Electric Motors	Capacitors and Electronic Components
De-Mineralization Shack			
Color Key on Drawing:	**1980'S Construction**		
1-01	16 LF	Two 2 x 4' Fluorescent Lights	Mercury Vapor
	1	Silica Analyzer Control Box	Capacitors and Electronic Components
	1	Small Breaker Box	Capacitors and Electronic Components
Façade A	1	Sodium or Metal Halide Light	Mercury Vapor
	1		DEHP Ballasts
Façade B	1	Sodium or Metal Halide Light	Mercury Vapor
	1		DEHP Ballasts
Façade C	1	Sodium or Metal Halide Light	Mercury Vapor
	1		DEHP Ballasts

APPENDIX A

SITE PLAN

SP-1

TRUE NORTH

PROJECT NORTH

CONNECTICUT RIVER

Power Block Facility

Waste Processing Facility

COAL PILE

COAL POND

BARGE DOCK

COAL BARGE UNLOADING BUILDING

COAL CONVEYOR #1

TRANSFER BUILDING

COAL UNLOADING CONVEYOR

REFUSE DERIVED CONVEYOR

RDF SUPPLY CONVEYOR 1/2

RDF SUPPLY CONVEYOR 1/3

RDF SUPPLY CONVEYOR 2/3

RDF SUPPLY CONVEYOR 3/7

FLOOD WALL

DEMINERALIZATION SHACK

SCREEN HOUSE #3

SCREEN HOUSE #2

SCREEN HOUSE #1

CONCRETE LOADING RAMP

COMBUSTION UNIT 13

COMBUSTION UNIT 12

COMBUSTION UNIT 11

MAINTENANCE GARAGE

TRUCK WHEEL WASH BUILDING

COAL CONVEYOR #2

COAL CONVEYOR #3

PUG MILL

BOILER #10

BOILER #9

CONSTRUCTION

CONSTRUCTION

TURBINE OPERATING BUILDING

ASH HANDLING

RDF SILOS

RDF SILOS

PBF ADMINISTRATION BUILDING

SCRUBBER CONTROL BUILDING

DRY SCRUBBER 1

DRY SCRUBBER 2

DRY SCRUBBER 3

LIME SLURRY

CONCRETE STACK

#11

#12

#13

#14

JET TURBINE GENERATORS

JET SHOP

JET SHOP

COAL POND PUMP HOUSE

ODOR CONTROL EQUIPMENT

CONC PAD

CONC PAD

CONC PAD

TOOL STORAGE

ADMINISTRATIVE BUILDING

ADMINISTRATIVE BLDG.

PARKING LOT

GATE

GATE

GRCE MACERATOR

ASSEMBLE/DEMOLDE & STORAGE

MAIN PROCESSING AREA

SCALE HOUSE 3

SCALE HOUSE 2

SCALE HOUSE 1

SCALE HOUSE

ROAD

SCALE HOUSE 3

CONCRETE PAD

NORTHWEST GUARD SHACK

EMPLOYEE PARKING LOT

SCRAP YARD

SCRAP YARD

BRIDGE

DAK

CHARTER

NEW

GATE 20

GATE 20 ENTRANCE

O/W SEPARATOR

GATE 40 WAREHOUSE

ENTRANCE

GATE 40

MAXIM ROAD

RESERVE ROAD

CHARTER OAK BRIDGE ENTRANCE RAMP

SITE PLAN

0 100' 200'

GRAPHIC SCALE

KEY:

- 1990's CONSTRUCTION
- 1980's CONSTRUCTION
- 1970'S CONSTRUCTION
- 1950'S CONSTRUCTION
- 1940'S CONSTRUCTION
- 1930'S CONSTRUCTION
- 1920'S CONSTRUCTION
- AREA NOT IN SCOPE

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PE
PROJECT NO.: 24.000.10FT

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

OVERALL SITE PLAN

SHEET NO.

SP-1

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road - Site Plan.dwg

APPENDIX B

GENERAL LAYOUT PLANS AND ROOF PLANS WITH SAMPLE LOCATIONS

WESTON & SAMPSON

MATERIALS INNOVATION & RECYCLING AUTHORITY

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE PROJECT NUMBER: 24-138.10T1

INDEX OF DRAWINGS

SP-1	OVERALL SITE PLAN
WPF-1	WASTE PROCESSING FACILITY - ADMINISTRATIVE BUILDING & TOOL STORAGE
WPF-2	WASTE PROCESSING FACILITY - RDF BUILDING, WASTE PROCESSING & MSW BUILDING - FLOOR PLANS
WPF-3	WASTE PROCESSING FACILITY - RDF BUILDING, WASTE PROCESSING & MSW BUILDING - ROOFS
WPF-4	WASTE PROCESSING FACILITY - MANEUVERING HALL & TRANSFER BUILDING
WPF-5	WASTE PROCESSING FACILITY - COAL CONVEYORS, COAL BARGE UNLOADING, ODOR CONTROL FACILITY & SCALE HOUSES
PBF-1	POWER BLOCK FACILITY - BELOW GRADE
PBF-2	POWER BLOCK FACILITY - GRADE LEVEL
PBF-3	POWER BLOCK FACILITY - ELEVATIONS 45' AND 48'
PBF-4	POWER BLOCK FACILITY - ELEVATIONS 55', 56.25' AND 57'
PBF-5	POWER BLOCK FACILITY - ELEVATIONS 64' AND 67.25'
PBF-6	POWER BLOCK FACILITY - ELEVATIONS 73', 77' AND 83.75'
PBF-7	POWER BLOCK FACILITY - ELEVATIONS 84' AND 89'
PBF-8	POWER BLOCK FACILITY - ELEVATION 104'
PBF-9	POWER BLOCK FACILITY - ELEVATIONS 106', 114' AND 116'
PBF-10	POWER BLOCK FACILITY - ELEVATIONS 127', 131' AND 140'
PBF-11	POWER BLOCK FACILITY - ELEVATION 146'
PBF-12	POWER BLOCK FACILITY - ROOF
PBF-13	POWER BLOCK FACILITY - ADMINISTRATION BUILDING
PBF-14	POWER BLOCK FACILITY - GATE 40 WAREHOUSE, JET SHOP, JET TURBINES & SCRUBBER CONTROL BUILDING
PBF-15	POWER BLOCK FACILITY - SCREEN HOUSES 1 AND 3
PBF-16	POWER BLOCK FACILITY - ASH LOADOUT BUILDING, COAL POND PUMP HOUSE AND NORTHWEST GUARD SHACK
PBF-17	POWER BLOCK FACILITY - BAG HOUSES, DEMINERALIZATION SHACK, DRY SCRUBBERS, MAINTENANCE GARAGE AND TRUCK WASH BUILDING

SITE PHOTO

LOCATION MAP

NOVEMBER 1, 2024

EAGLE Environmental, Inc.

8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reseve Road - 300 Maxim Road - Coversheet.dwg

SIDE-D

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

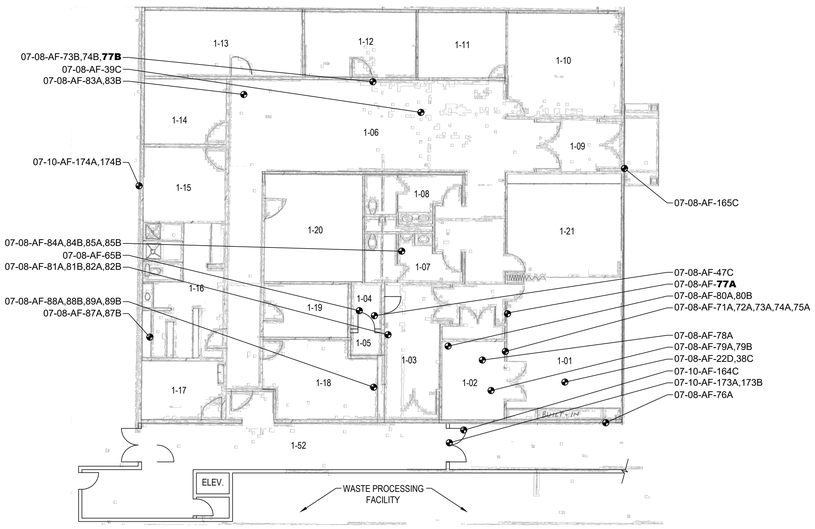

WASTE PROCESSING FACILITY - ADMINISTRATIVE BUILDING - FIRST FLOOR

NOT TO SCALE

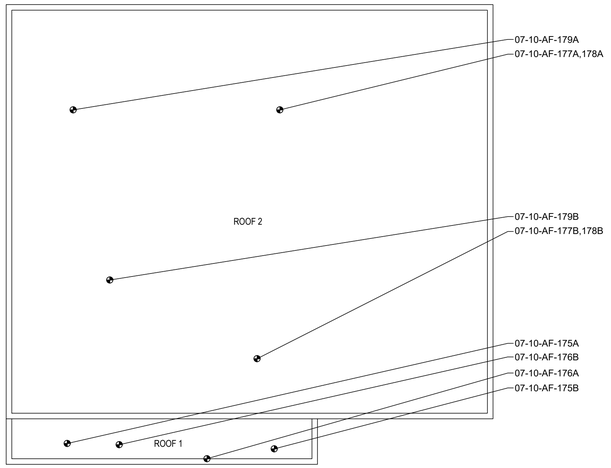

WASTE PROCESSING FACILITY - ADMINISTRATIVE BUILDING - ROOF

NOT TO SCALE

WASTE PROCESSING FACILITY KEY PLAN

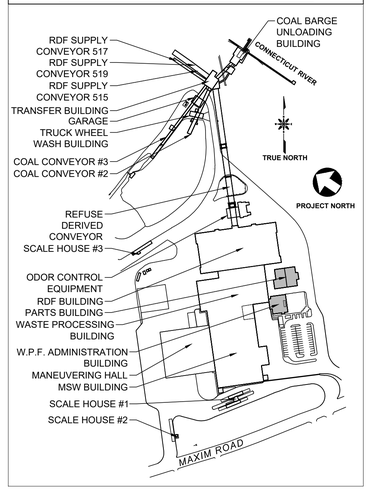

SIDE-C

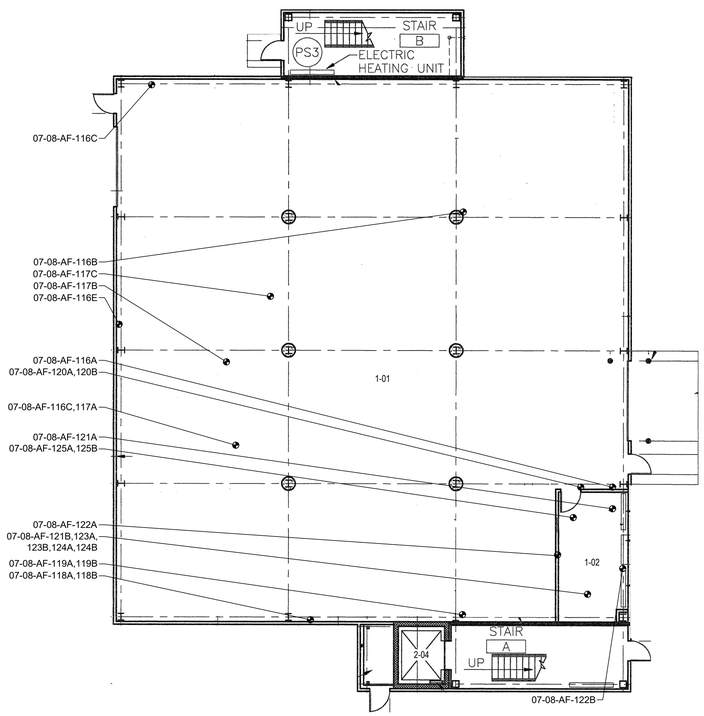

WASTE PROCESSING FACILITY - TOOL STORAGE - FIRST FLOOR

NOT TO SCALE

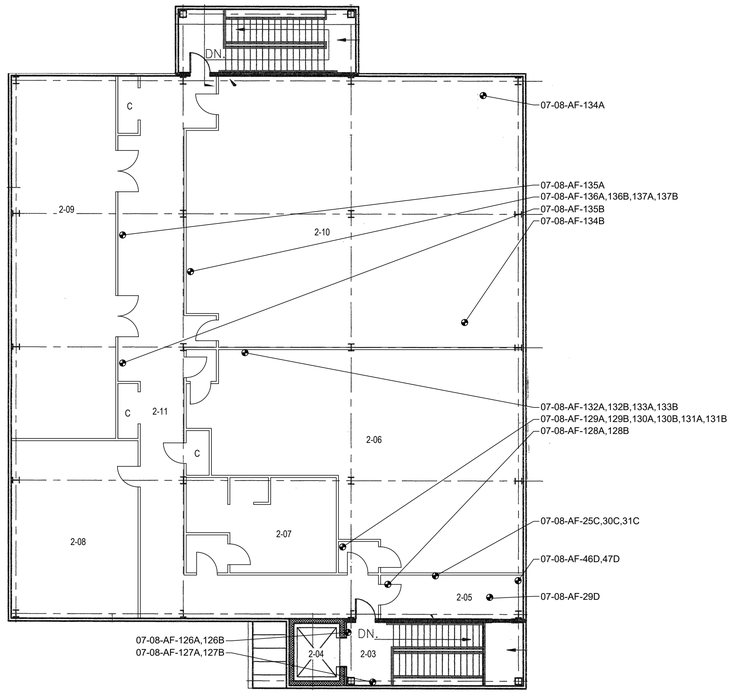

WASTE PROCESSING FACILITY - TOOL STORAGE - SECOND FLOOR

NOT TO SCALE

SIDE-B

SIDE-A (MAXIM ROAD)

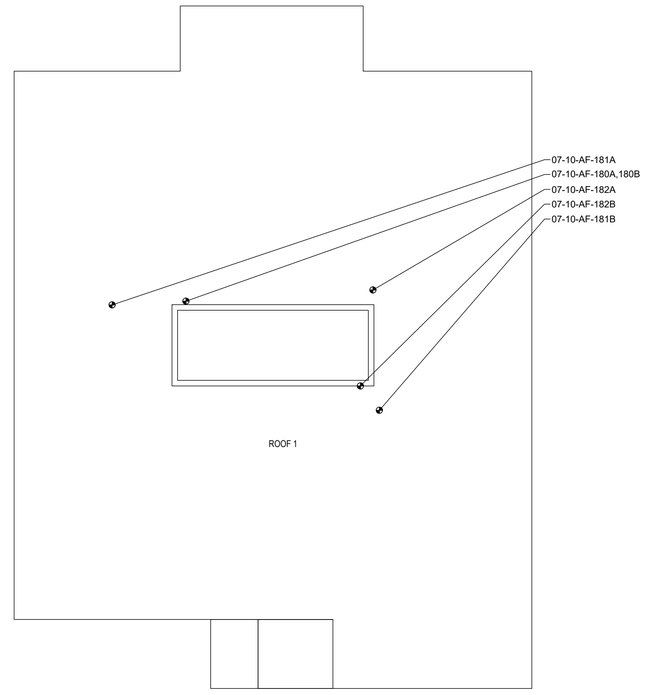

WASTE PROCESSING FACILITY - TOOL STORAGE - ROOF

NOT TO SCALE

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMtlCAD\100 Reseve Road - 300 Maxim Road-WPF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PE
PROJECT NO.: 24-138.10TI

REVISIONS

NO.	DATE:	DESCRIPTION:

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
WASTE PROCESSING FACILITY ADMINISTRATIVE BUILDING & TOOL STORAGE

SHEET NO.
WPF-1

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

SIDE-D

SIDE-C

SIDE-A (MAXIM ROAD)

SIDE-B

07-03-AF-65A
07-03-AF-63B,64B
07-03-AF-63A,64A
07-03-AF-66A
2-22
2-23
2-24
2-25
07-03-AF-69A,69B,70A,70B
07-03-AF-65B,66B
2-26
2-27
MATCH LINE-A

MATCH LINE-A
2-27
07-05-AF-92B
2-29
07-05-AF-92A
2-28
07-05-AF-90A,90B,91A,91B
07-03-AF-67AX,67BX
2-30

WASTE PROCESSING MEZZANINE
NOT TO SCALE

07-16-AF-168B
RDF STORAGE AREA EXPANSION
R7
RDF PIT
1-31
RDF STORAGE
STATIONARY PACKER
RDF STORAGE AREA EXPANSION
R10
ABOVE
1-20
PROCESSING
WASTE PROCESSING MEZZANINE ABOVE
07-02-AF-61A,61B
07-02-AF-60A,60B
07-02-AF-63A,63B
07-02-AF-62A,62B
07-02-AF-29A,29B,29C
07-02-AF-25A
07-02-AF-32A,32B
07-02-AF-04B
07-02-AF-03B
07-02-AF-26B,27B,28B
07-02-AF-25B
1-10
07-02-AF-30A,31A
07-02-AF-22A
07-02-AF-24A,24B,26A,27A,28A
10-01-AF-**656A,656B**
07-02-AF-23A,23B
07-02-AF-22B
07-02-AF-22C
07-16-AF-172A,172B
07-02-AF-19A,21A
07-02-AF-**18A**
07-02-AF-**18B**
1-06
PRIMARY BAGHOUSE
1-07
PRIMARY SHREDDER
1-08
PRIMARY BAGHOUSE
1-09
PRIMARY SHREDDER
OFFICE
07-02-AF-17A,17B
1-11
1-13
07-03-AF-30B,31B
1-12
07-03-AF-33A,33B,34A,34B,35A,35B
07-03-AF-**10C**
1-14
C
07-03-AF-38B,40A,40B,41A,41B,42A,42B,43A,44A,44B
07-03-AF-36A,36B,37A,37B,38A,39A,39B
MSW RECEIVING – STORAGE
07-03-AF-45B,48B
07-03-AF-49A,50A
1-15
07-03-AF-45A,46A,47A,48A
1-21
ELEC. EQUIPMENT
1-19
07-02-AF-59A,59B
COMPRESSOR
1-18
07-02-AF-57A,57B,58A,58B
07-16-AF-168A
07-02-AF-51A,51B
07-03-AF-50B
07-03-AF-55B
1-16
SHOP AREA
RESIDUE – FERROUS LOADOUT
1-17
07-02-AF-53A,53B,56A,56B
07-02-AF-01B,43B
07-16-AF-170A,170B
07-02-AF-04C
07-16-AF-167A
07-02-AF-02B
1-05
07-02-AF-17B
07-16-AF-166B
MSW RECEIVING STORAGE AREA EXPANSION
M9
1-03

RDF BUILDING - FIRST FLOOR
NOT TO SCALE

WASTE PROCESSING BUILDING - FIRST FLOOR
NOT TO SCALE

MSW BUILDING - FIRST FLOOR
NOT TO SCALE

07-02-AF-53B
07-02-AF-52B,54B
07-02-AF-53A
07-02-AF-52A
07-02-AF-54A

INTERIOR ROOF
NOT TO SCALE

INTERIOR ROOF
NOT TO SCALE

07-02-AF-11A
ABOVE
ABOVE
07-02-AF-12A,12B
07-02-AF-14B
07-02-AF-13A,15A
07-02-AF-16B
07-02-AF-14A
07-02-AF-**10B**
1-04
1-04
CAT WALKS ABOVE
07-02-AF-16A
07-02-AF-13B,15B
07-02-AF-**10A**
07-16-AF-167B
07-16-AF-164B
07-16-AF-165B

WASTE PROCESSING FACILITY KEY PLAN

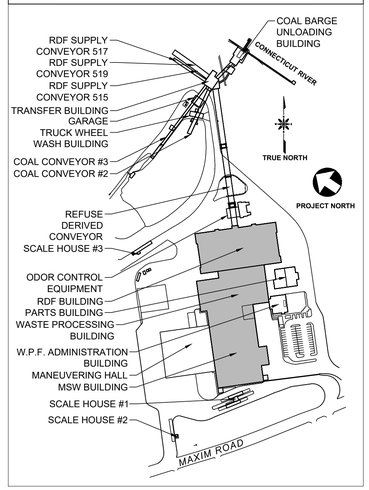

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

REVISIONS
NO. | DATE: | DESCRIPTION:

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10TI

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
WASTE PROCESSING FACILITY
RDF BUILDING, WASTE
PROCESSING, MEZZANINE &
MSW BUILDING

SHEET NO.
WPF-2

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reseve Road - 300 Maxim Road-WPF.dwg

SIDE-D

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

SIDE-C

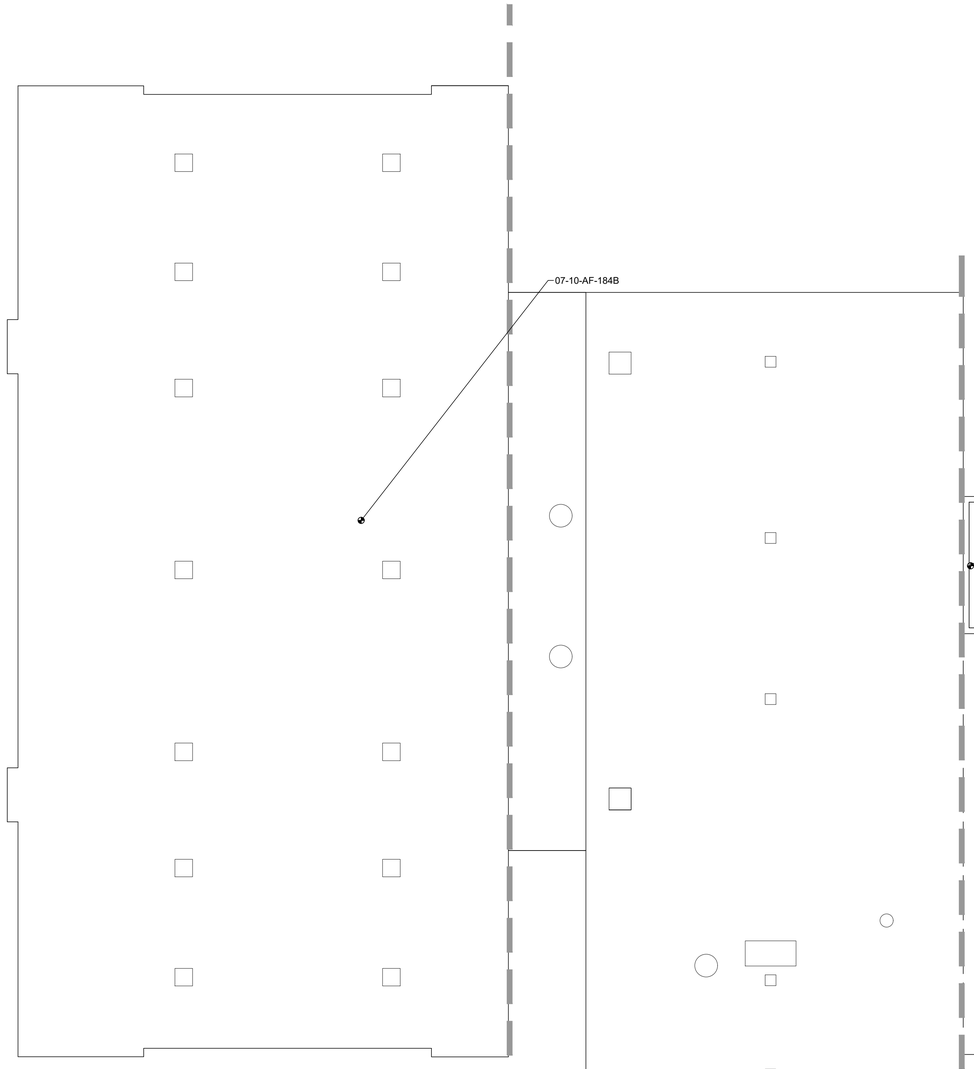

RDF BUILDING - ROOF
NOT TO SCALE

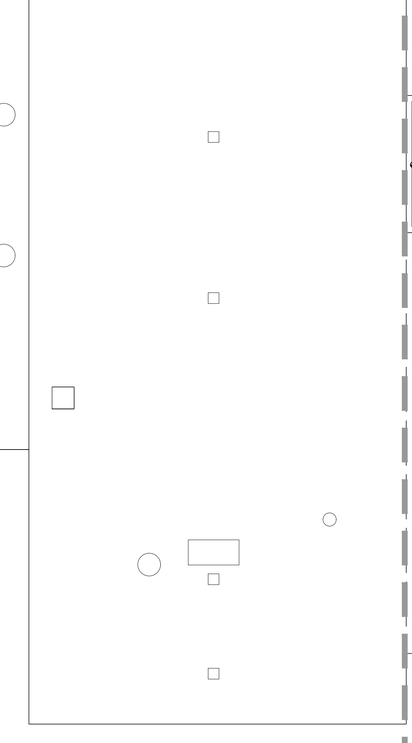

WASTE PROCESSING BUILDING - ROOF
NOT TO SCALE

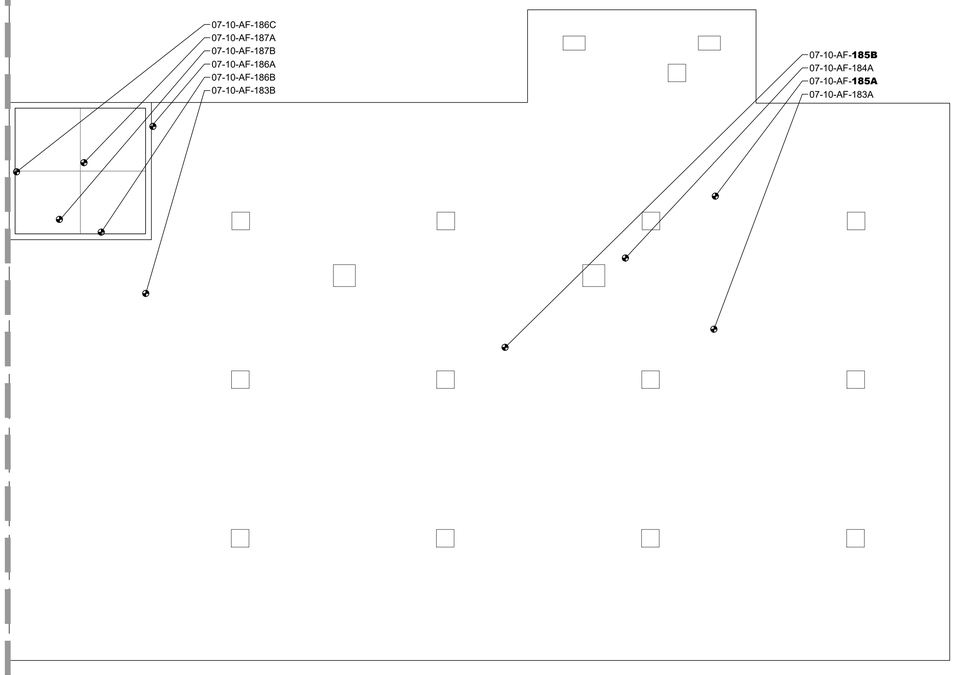

MSW BUILDING - ROOF
NOT TO SCALE

SIDE-A (MAXIM ROAD)

SIDE-B

WASTE PROCESSING FACILITY KEY PLAN

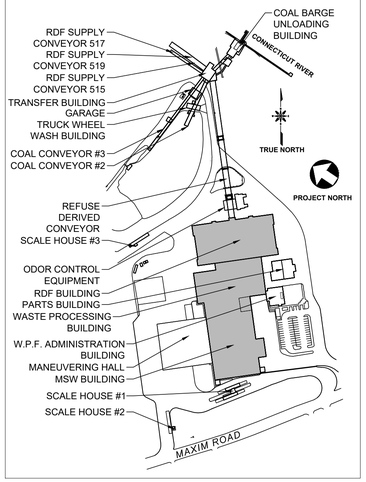

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE AS NOTED
REVIEWED BY: PE
PROJECT NO. 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
WASTE PROCESSING FACILITY
RDF BUILDING ROOF, WASTE PROCESSING ROOF & MSW BUILDING ROOF

SHEET NO.
WPF-3

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reseve Road - 300 Maxim Road-WPF.dwg

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

SIDE-D

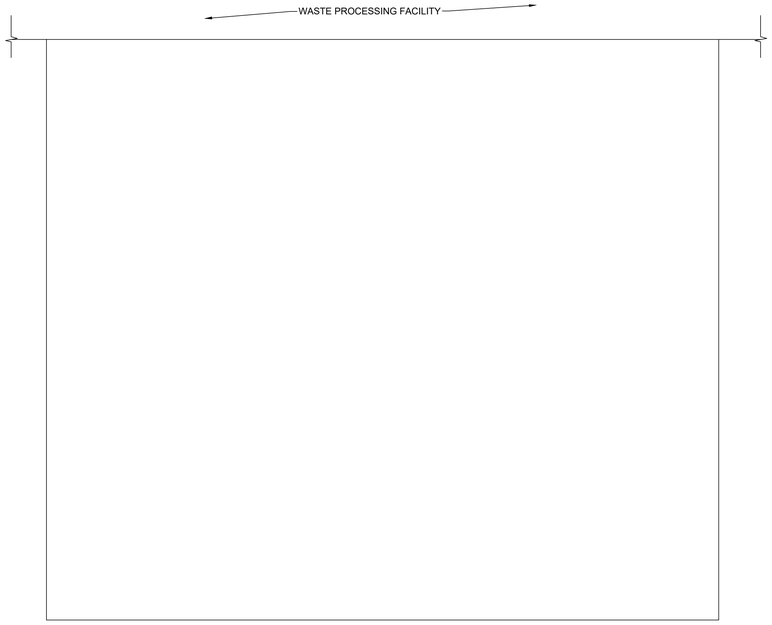

SIDE-C

WASTE PROCESSING FACILITY -
MANEUVERING HALL - ROOF
NOT TO SCALE

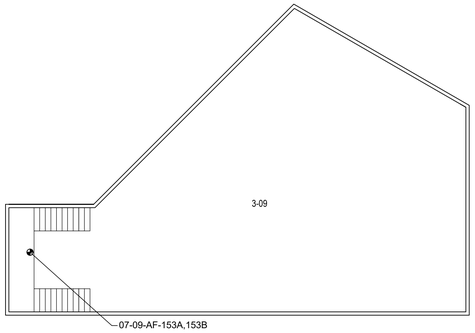

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - THIRD FLOOR
NOT TO SCALE

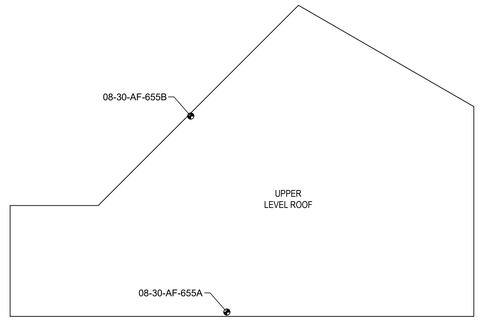

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - UPPER LEVEL ROOF
NOT TO SCALE

WASTE PROCESSING FACILITY KEY PLAN

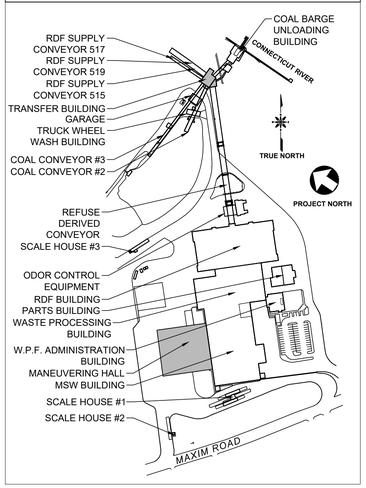

WASTE PROCESSING FACILITY -
MANEUVERING HALL - FIRST FLOOR
NOT TO SCALE

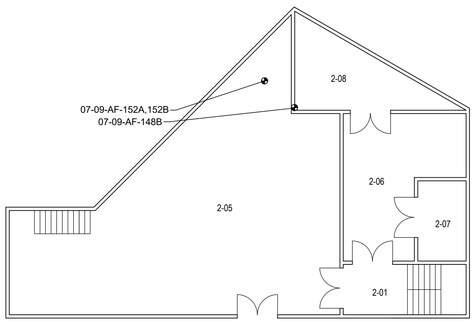

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - SECOND FLOOR
NOT TO SCALE

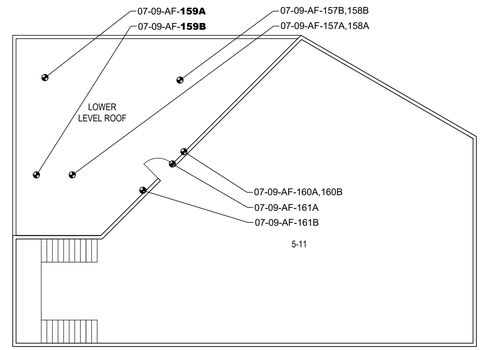

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - FIFTH FLOOR
NOT TO SCALE

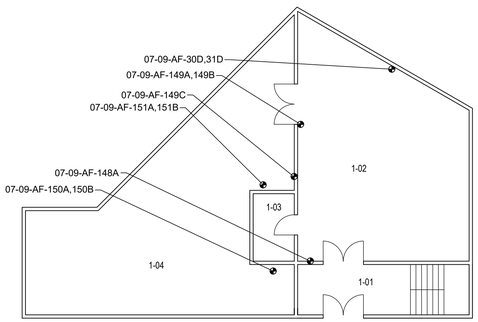

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - FIRST FLOOR
NOT TO SCALE

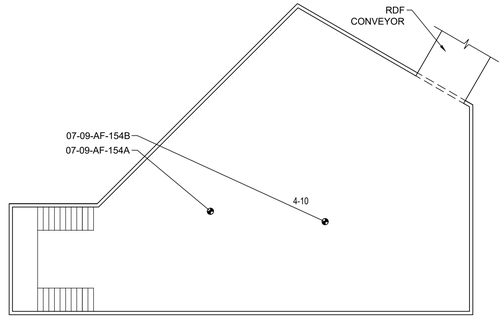

WASTE PROCESSING FACILITY -
TRANSFER BUILDING - FOURTH FLOOR
NOT TO SCALE

SIDE-B

SIDE-A (MAXIM ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reseve Road - 300 Maxim Road-WPF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION:

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10TI

PROJECT TITLE:
HAZARDOUS BUILDING
MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
WASTE PROCESSING FACILITY
MANEUVERING HALL &
TRANSFER BUILDING

SHEET NO.
WPF-4

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

SIDE-D

SIDE-C

SIDE-A (MAXIM ROAD)

SIDE-B

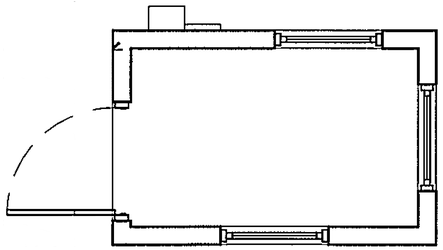

WASTE PROCESSING FACILITY - SCALE HOUSE #3

NOT TO SCALE

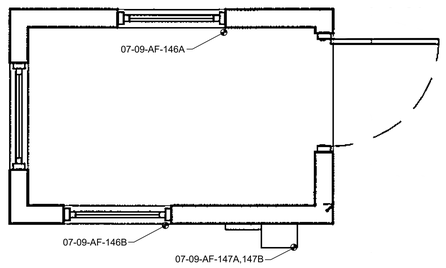

WASTE PROCESSING FACILITY - SCALE HOUSE #2

NOT TO SCALE

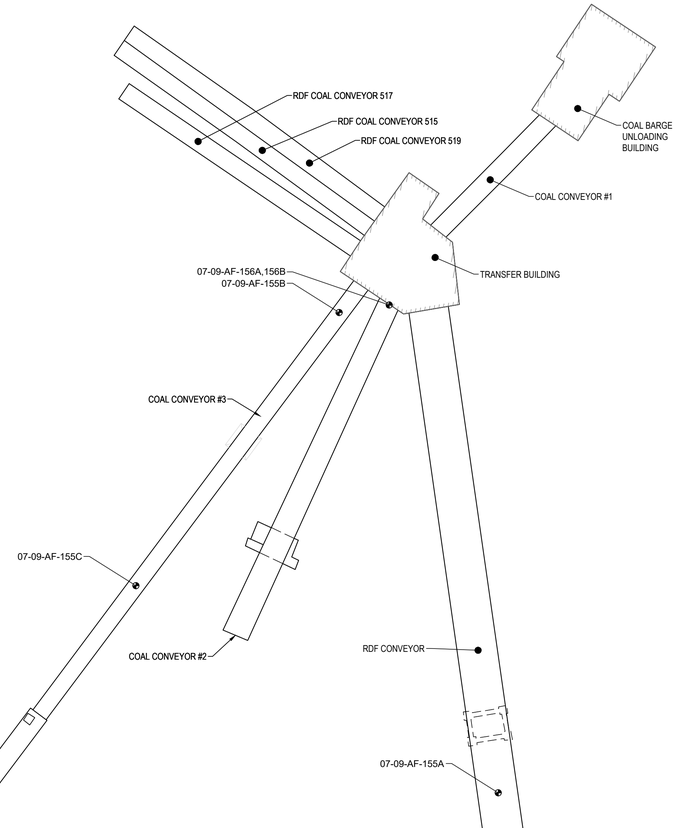

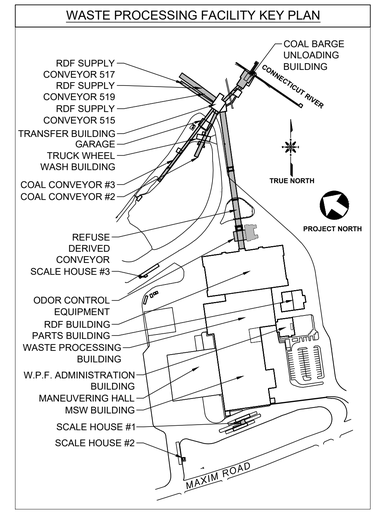

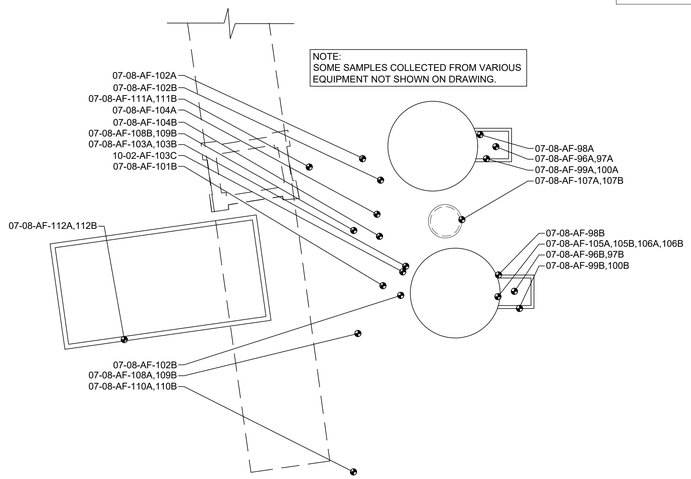

WASTE PROCESSING FACILITY - ODOR CONTROL EQUIPMENT

NOT TO SCALE

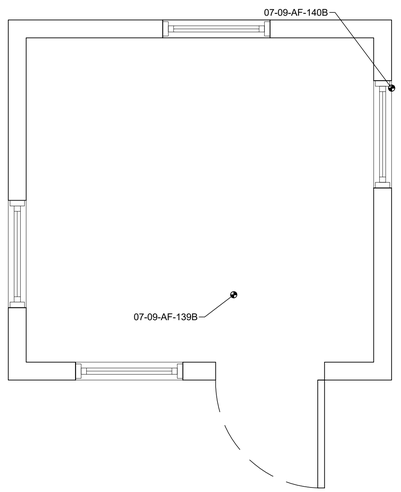

WASTE PROCESSING FACILITY - SCALE HOUSE #1 - FIRST FLOOR

NOT TO SCALE

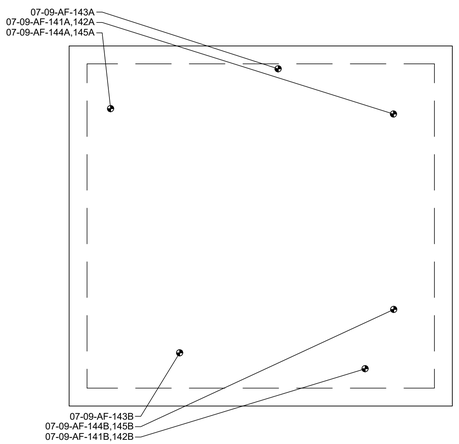

WASTE PROCESSING FACILITY - SCALE HOUSE #1 - ROOF

NOT TO SCALE

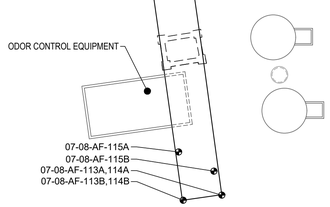

WASTE PROCESSING FACILITY - COAL CONVEYORS

NOT TO SCALE

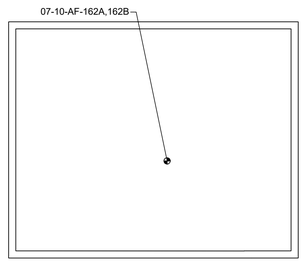

WASTE PROCESSING FACILITY - COAL BARGE UNLOADING - LEVEL 4

NOT TO SCALE

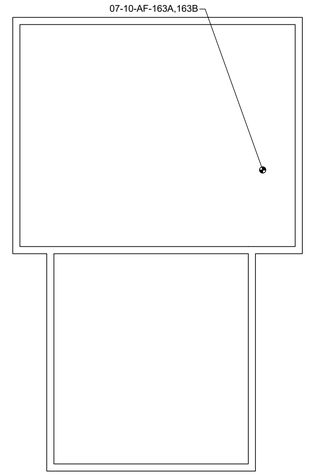

WASTE PROCESSING FACILITY - COAL BARGE UNLOADING - LEVEL 9

NOT TO SCALE

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMtlCAD\100 Reseve Road - 300 Maxim Road-WPF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10TI

REVISIONS

NO.	DATE:	DESCRIPTION:

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

WASTE PROCESSING FACILITY SCALE HOUSES, COAL CONVEYORS, ODOR CONTROL EQUIPMENT & COAL BARGE UNLOADING

SHEET NO.

WPF-5

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

SIDE-B

SIDE-D

BOILER HOUSE

TURBINE HALL

N.U. BUILDING

07-25-AF-**272E**
07-19-AF-565A,565B
07-31-AF-**366A**,**366B**
07-31-AF-**303C**
07-23-AF-**280E**
07-19-AF-367A,367B
07-19-AF-217J,249H,361D
07-19-AF-192H
00-58
00-59
ELEV. 25'
00-04
00-60
ELEV. 31'
00-62
ELEV. 31'
INACCESSIBLE
ABOVE

10-01-AF-**691B**
10-01-AF-**691A**
08-02-AF-692B
08-02-AF-692A
08-02-AF-690A,690B
08-02-AF-687B,688B
08-02-AF-690C
10-01-AF-**687C**,**688C**
08-02-AF-685A
10-01-AF-**687A**,**688A**
10-01-AF-**686A**
08-02-AF-685B
08-02-AF-701A,701B
00-71
ELEV. 21'
07-31-AF-217E,243E,249F
07-30-AF-22E
07-29-AF-**236C**
07-30-AF-249F,217E,243E,342B
07-30-AF-350A,350B,351A,351B
07-30-AF-353A,353B
07-31-AF-345B,346B
07-31-AF-**294B**,**295B**,**303B**
07-30-AF-217H,217I,243E,356A,356B
07-30-AF-357A
07-30-AF-357B
07-31-AF-349A,349B
07-31-AF-**347B**
07-30-AF-358A,358B
07-30-AF-254C,359A,359B,360A,360B
07-30-AF-358C
ST-1
07-19-AF-363A,363B
07-19-AF-192G
07-19-AF-364A,364B
ELEV. 25'
00-57
00-56
ELEV. 11'
CONCRETE AIR SHAFT
TURBINE #5
TURBINE #6
07-30-AF-355A,355B
07-30-AF-354A,354B
07-30-AF-358D
07-30-AF-217G
07-30-AF-270B,271B
07-19-AF-339A,340A
07-31-AF-341A,341B
07-31-AF-343A,344A
07-30-AF-343B,344B
07-15-AF-**193A**,**193B**
07-31-AF-**295B**
07-31-AF-345A,346A
08-01-AF-384A,384B
07-30-AF-344B,345B
07-30-AF-**347A**
08-01-AF-380A,381A
08-01-AF-382A
08-01-AF-383A,383B
08-01-AF-385A,385B
ELEV.
ELEV. 22.5'
ELEV. 25'
0-11
0-07
0-08
0-12
0-10
0-09
07-30-AF-249G
08-01-AF-**304C**
00-02
ELEV. 11'
07-30-AF-378A,378B
07-30-AF-348A
08-01-AF-**377A**
00-01
(RAISED)
07-30-AF-249G
07-30-AF-249G
07-30-AF-342C
07-30-AF-352C
07-30-AF-361B,361C
07-30-AF-361A,362A
07-30-AF-362B,362C
00-03
ELEV. 31'
00-61
INACCESSIBLE

POWER BLOCK FACILITY KEY PLAN

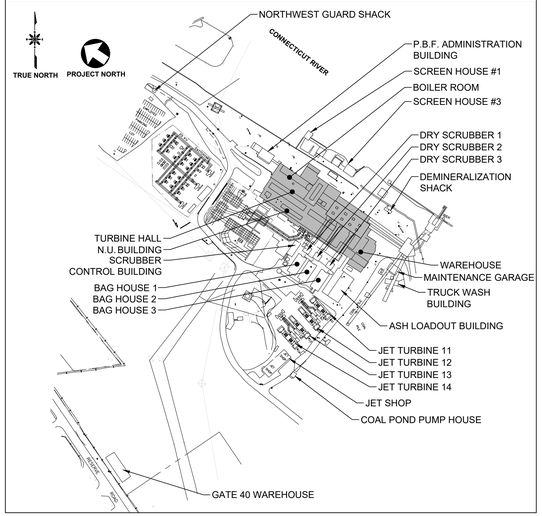

POWER BLOCK FACILITY - BELOW GRADE

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS

NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY BELOW GRADE

SHEET NO.
PBF-1

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

SIDE-B

SIDE-D

SIDE-A (RESERVE ROAD)

BOILER HOUSE

TURBINE HALL

N.U. BUILDING

0-01 0-02 0-03 0-04 0-05 0-06A 0-06B 0-07 0-08 0-08A 0-08B 0-11 0-12 0-13 0-14 0-15 0-16 0-17 0-18 0-19 0-20 0-21 0-22 0-23 0-24 0-25

1-09 1-10 1-13 1-14 1-15 1-16 1-17 1-18 1-19 1-20 1-21 1-22 1-23 1-24 1-25 1-26 1-27 1-28 1-29 1-30 1-31 1-63 1-64 1-65 1-66 1-67 1-68 1-69 1-70

11 SCC 12 SCC 13 SCC

3B CONVEYOR

WAREHOUSE

ELEV. 31' ELEV. 36' ELEV. 37'

ST-1 ST-2 ST-3

CONCRETE AIR SHAFT

INACCESSIBLE

ABOVE BELOW

07-19-AF-**248B**
07-19-AF-253B
07-19-AF-**261A**,**262A**
07-19-AF-**261B**,**262B**
07-19-AF-**261E**,**262D**
07-19-AF-**261D**,**262D**
07-19-AF-263A
07-19-AF-**261C**,**262C**
07-19-AF-263B
07-15-AF-255A,256A
07-15-AF-255B,256B
07-15-AF-259A,260A
07-15-AF-259B,260B
07-19-AF-284C
07-19-AF-364B
07-19-AF-284A
08-08-AF-476A
07-19-AF-287A
07-19-AF-286A
07-19-AF-285A
08-08-AF-**477A**,**477B**,**478A**,**478B**
10-02-AF-**702A**,**702B**
08-08-AF-**475B**
08-08-AF-473B
08-08-AF-474B
07-18-AF-241A
07-23-AF-**280C**
07-18-AF-**239A**,**239B**,240A,240B,**241A**,**241B**
08-08-AF-474A
07-19-AF-244B,245B
07-18-AF-**248A**
07-15-AF-182C,250A
07-15-AF-252A,252B
07-15-AF-254A,254B
08-08-AF-**473A**
08-08-AF-476B
07-19-AF-238A
07-19-AF-247A,247B
08-08-AF-**475A**
07-19-AF-244A,245A
07-23-AF-**299B**
07-15-AF-257A,258A
07-15-AF-257B,258B
07-15-AF-243D,249A
07-19-AF-**264B**
07-18-AF-255
07-19-AF-**251A**,**251B**
07-19-AF-**264A**
07-18-AF-242B,243B
07-18-AF-242A,243A
07-18-AF-242C,243C
07-15-AF-202A,202B
07-15-AF-203A
07-15-AF-204A
07-15-AF-203B
07-15-AF-204B
07-15-AF-205A,205C
07-15-AF-208A,208B,208C
07-15-AF-207A
07-16-AF-218A
07-18-AF-**246A**,**246B**
07-18-AF-122F,**236A**
07-19-AF-235A
07-19-AF-192B
07-19-AF-237A
07-19-AF-234A
08-08-AF-460B
07-22-AF-**279A**,**279B**
07-22-AF-**280A**,**280B**
07-19-AF-281B
07-19-AF-281A
07-22-AF-**282A**,**282B**
07-22-AF-**283A**,**283B**
07-23-AF-**295A**
07-23-AF-**294A**
07-19-AF-281A
07-19-AF-281B
07-19-AF-**269A**,**269B**
07-15-AF-253A,253B
07-15-AF-255A,255B
07-15-AF-252A,252B,252C
07-19-AF-**267A**,**267B**
07-19-AF-288A,288B
07-19-AF-289A,289B
07-19-AF-290A,290B,290C
07-19-AF-291A,291B
08-01-AF-376A,376B
08-01-AF-375B
07-19-AF-276A,276B
07-19-AF-368A,368B
07-22-AF-**275B**
07-22-AF-**275A**
07-19-AF-192C
07-19-AF-256C
10-02-AF-701A,701B
07-19-AF-256C
07-22-AF-217B,217E
07-19-AF-256A,257A
07-22-AF-**272A**
07-22-AF-**272B**
07-22-AF-257A,257B
07-17-AF-**219A**,**219B**,**219C**
07-15-AF-206A,206B
07-15-AF-207B
07-15-AF-205B
07-15-AF-206C
07-15-AF-361E,369A,369B
07-15-AF-370A,370B
08-01-AF-375A
08-01-AF-**374A**,**374B**
07-22-AF-**292A**,**292B**
07-22-AF-293A,293B
07-31-AF-371A,371B
07-31-AF-373A,373B
07-31-AF-**372A**,**372B**
08-01-AF-292A,292B
08-01-AF-387A,387B,388A,388B
08-05-AF-191B
08-01-AF-389A,389B,**390A**,391A
08-08-AF-465A,465B
08-08-AF-463B
08-08-AF-463A
08-08-AF-464A,464B
08-01-AF-386A,386B
08-05-AF-380B,381B,385C,395A,395B,395C
08-01-AF-392A,393A
08-05-AF-398A,399A
08-05-AF-396A,398A,399A
08-05-AF-400A,401A,402A,**403A**
08-05-AF-189B,190B
08-05-AF-406B
08-05-AF-**406A**,**406B**
08-05-AF-413A
07-17-AF-217A
08-05-AF-410A,410B,411A,411B
08-05-AF-408A,408B
08-05-AF-**377B**,**409A**,**409B**
08-08-AF-**456A**,**456B**
08-08-AF-461B
08-08-AF-461A
08-08-AF-462A,462B
08-05-AF-407A
08-05-AF-407B
08-05-AF-**404A**,**404B**
08-05-AF-**405A**,**405B**
08-08-AF-460B
08-08-AF-460A
08-05-AF-401A,402A,403A
08-01-AF-379B
08-08-AF-**457A**,458A
08-08-AF-459A
07-23-AF-319A

POWER BLOCK FACILITY KEY PLAN

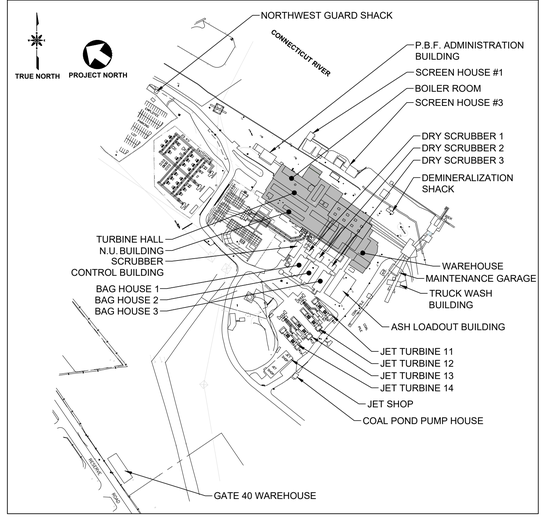

POWER BLOCK FACILITY - GRADE LEVEL

NOT TO SCALE

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
GRADE LEVEL

SHEET NO.
PBF-2

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

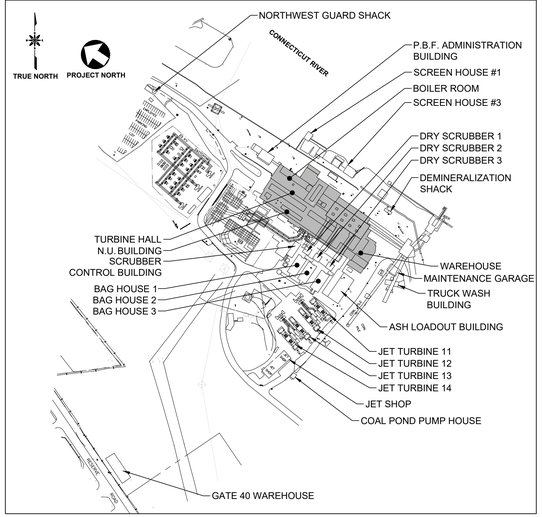

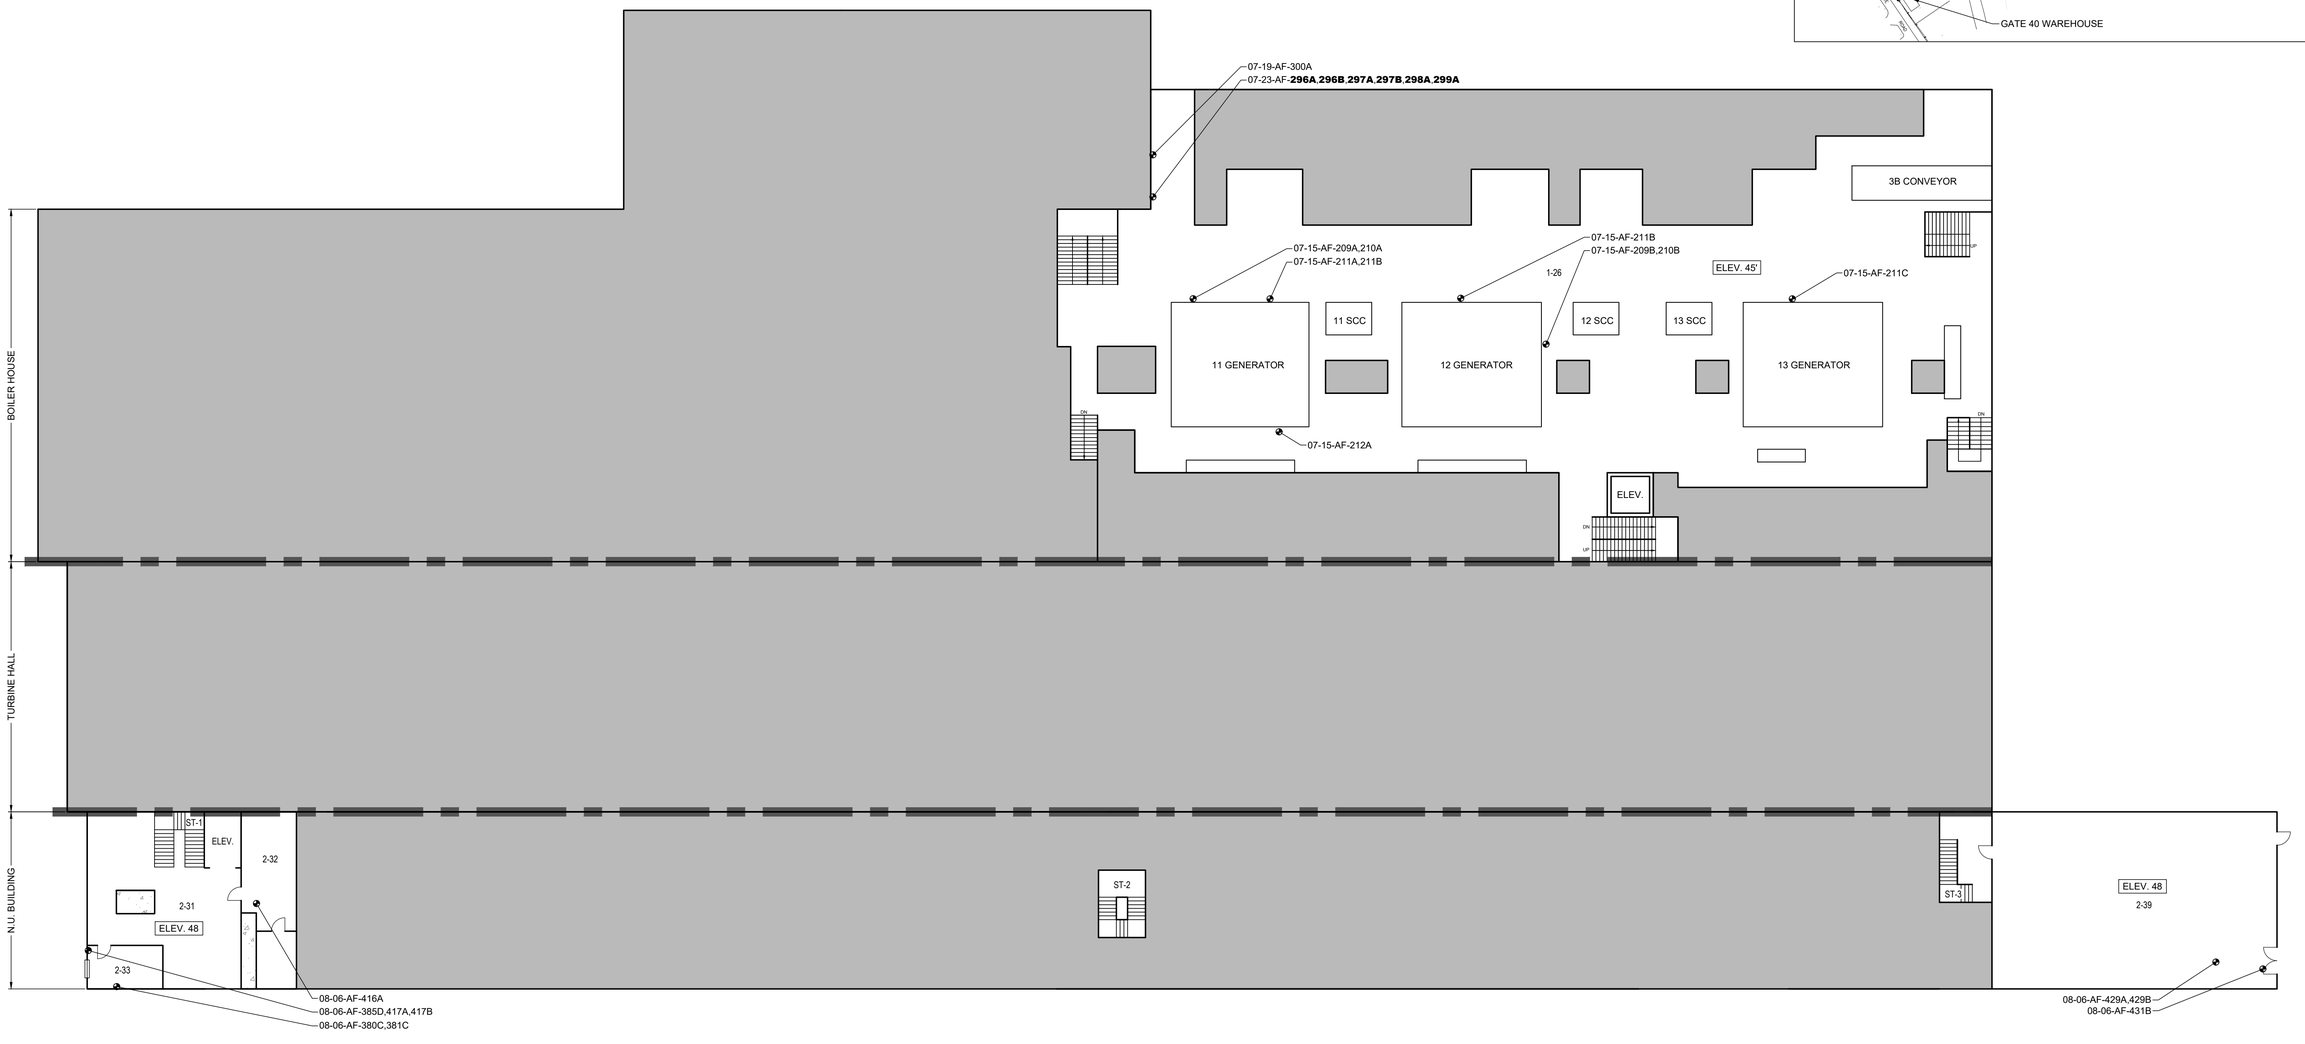

POWER BLOCK FACILITY - ELEVATIONS 45' AND 48'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
ELEVATIONS 45' AND 48'

SHEET NO.
PBF-3

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

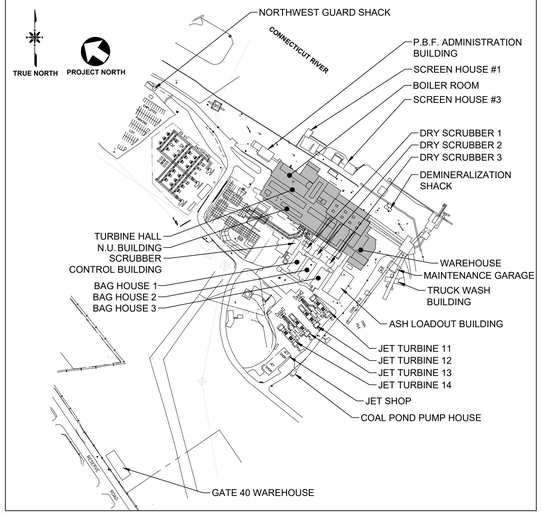

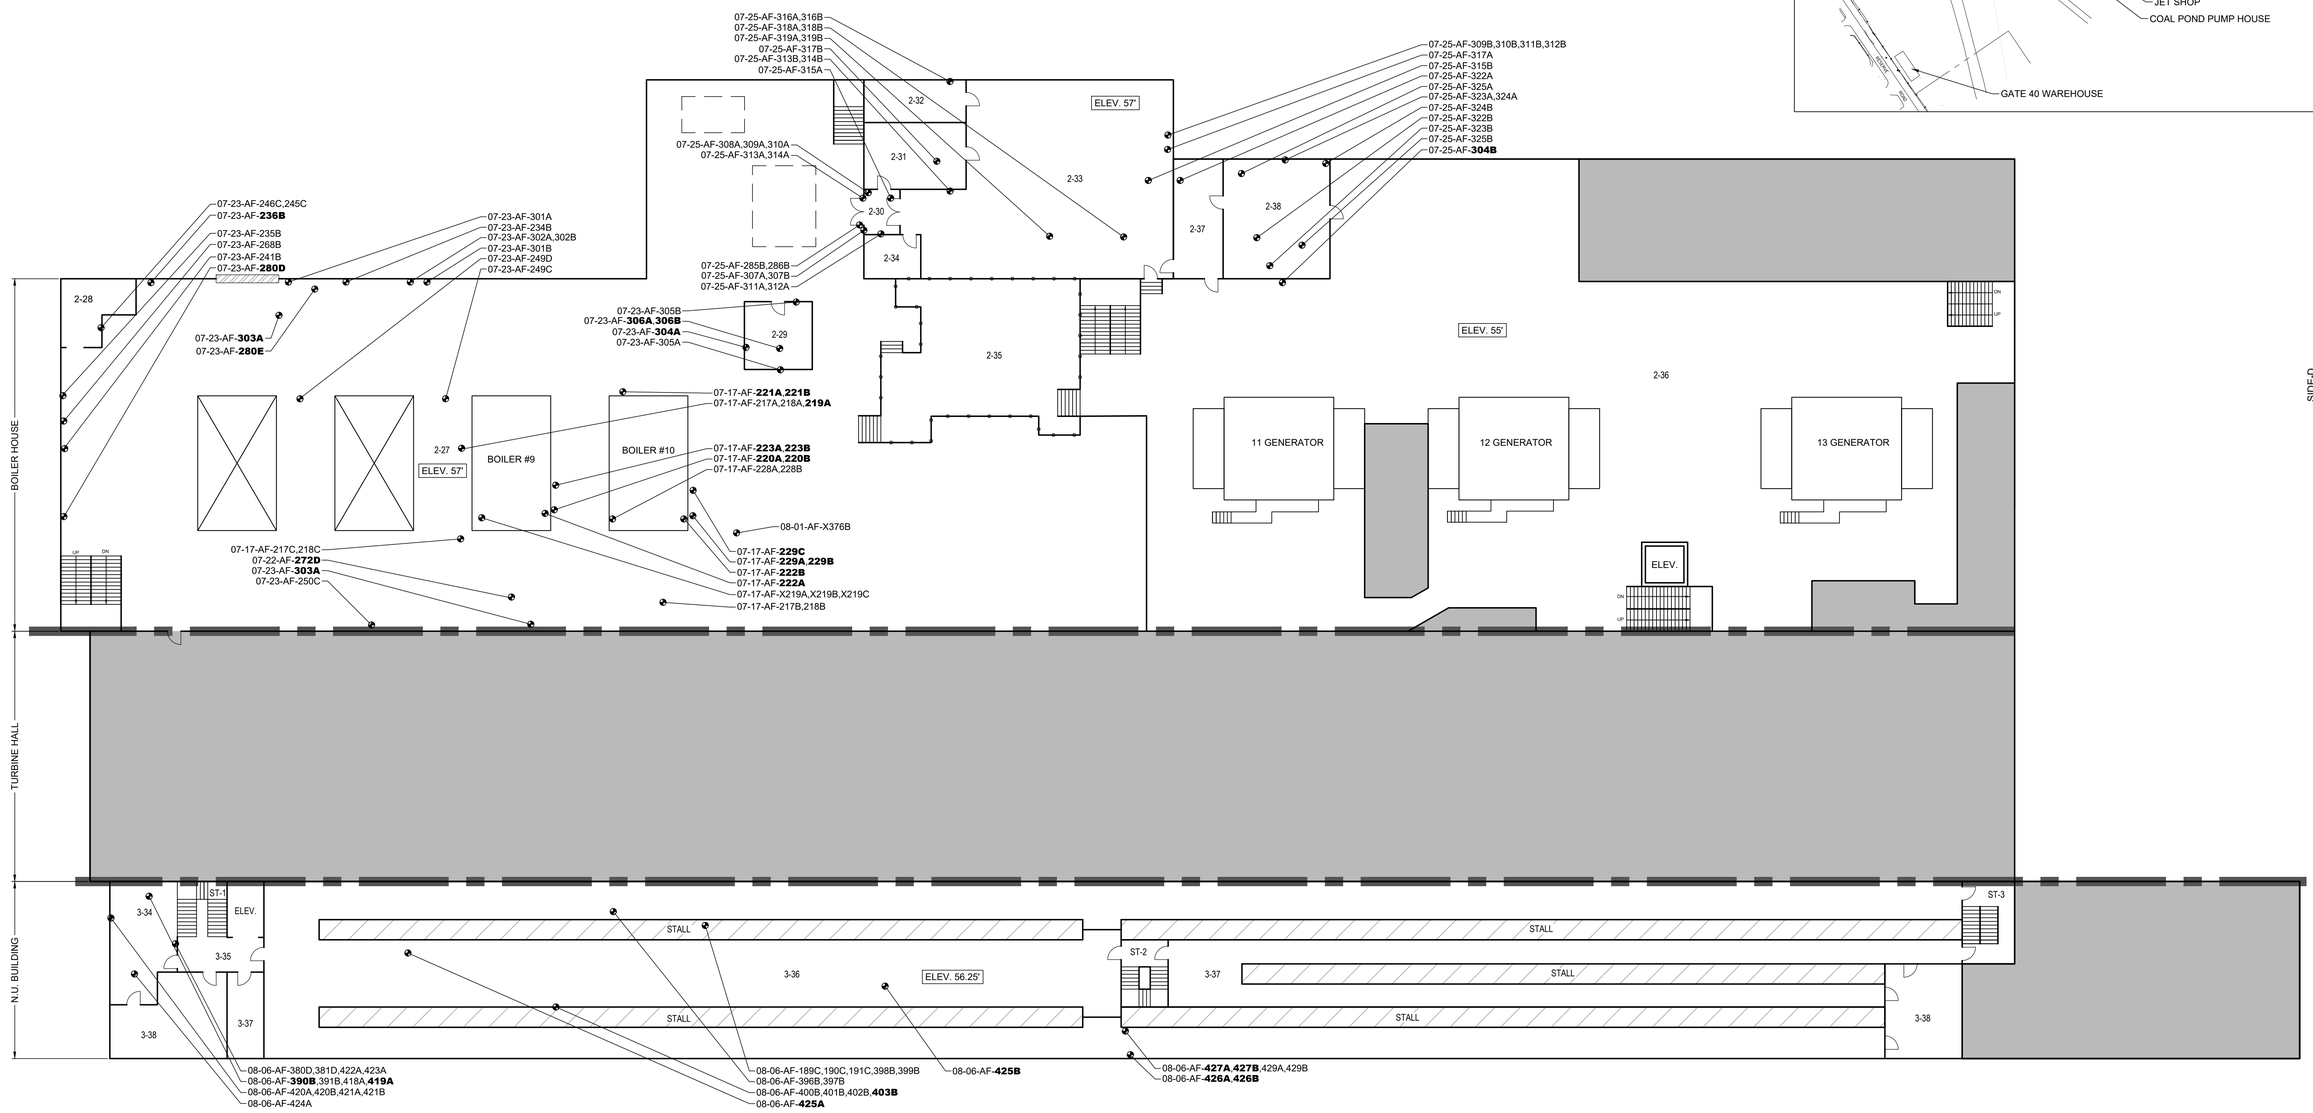

POWER BLOCK FACILITY - ELEVATIONS 55', 56.25' AND 57'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
ELEVATIONS 55', 56.25' AND 57'

SHEET NO.
PBF-4

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

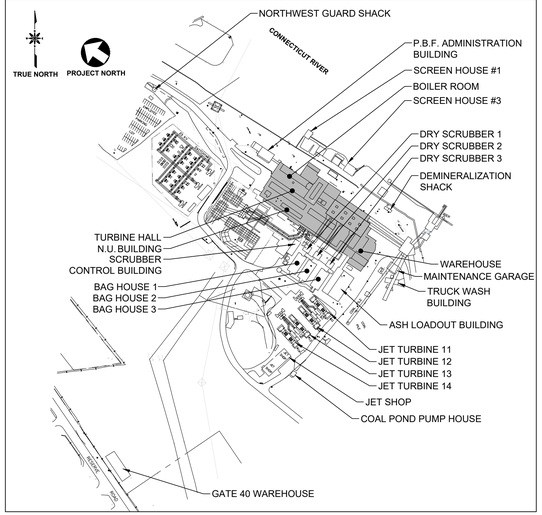

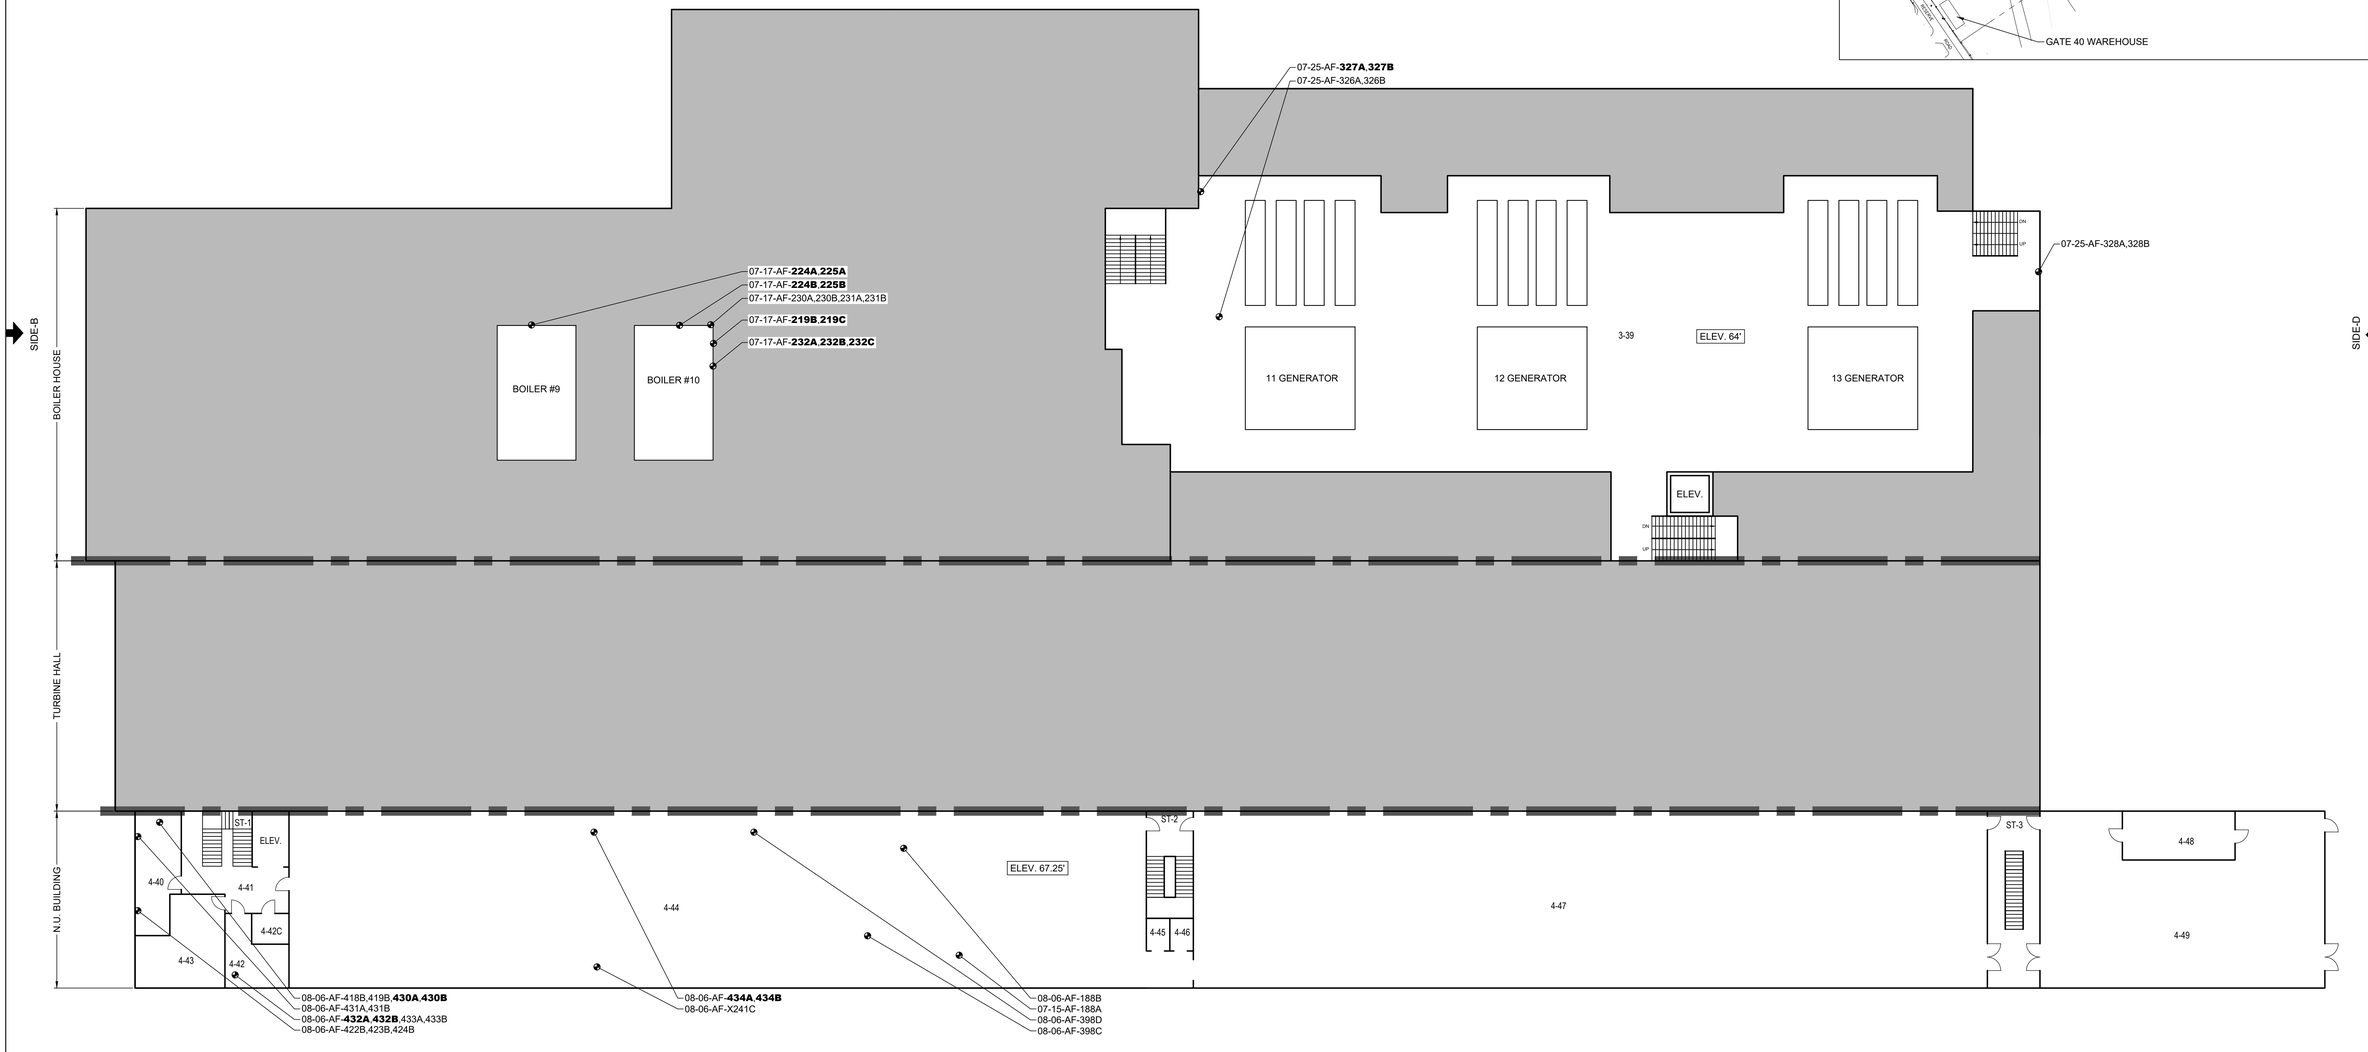

POWER BLOCK FACILITY - ELEVATIONS 64' AND 67.25'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY ELEVATIONS 64' AND 67.25'

SHEET NO.
PBF-5

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

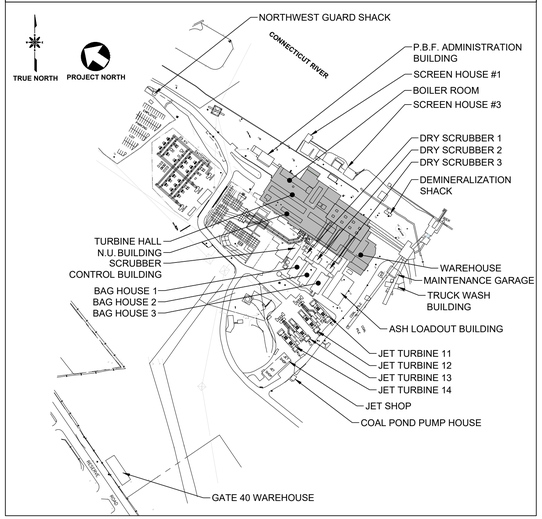

SIDE-B

SIDE-D

BOILER HOUSE

TURBINE HALL

N.U. BUILDING

BOILER #9

BOILER #10

07-17-AF-**227A,227B**

07-17-AF-**226A,226B**

ELEV. 77'

4-40

11 GENERATOR

12 GENERATOR

13 GENERATOR

ELEV. 73'

ELEV.

DN

UP

08-07-AF-**442A,442B**

ST-1

ELEV.

5-51

5-52

5-56

5-50

5-55

5-54

5-53

10-02-AF-704B

ELEV. 83.75'

5-57

ST-2

5-59

5-60

08-07-AF-438A,438B

08-07-AF-**390C,435A**

08-07-AF-436B,437B

08-07-AF-380D,381D

08-07-AF-**435B**

08-07-AF-436A,437A,439A,439B,440A,440B

08-07-AF-284C

08-07-AF-441A,443B

08-07-AF-441B,442B

08-07-AF-444A,44B

08-07-AF-380D,381D

08-07-AF-**303D**

10-02-AF-704A

08-07-AF-445B,446B,447B

08-07-AF-445A,446A,447A

08-07-AF-449A,449B

08-07-AF-448A,448B

08-07-AF-450A,450B

08-07-AF-**455A,455B**

08-07-AF-216B

08-07-AF-451A,452A,453A,454A

08-07-AF-451B,452B,453B,454B

POWER BLOCK FACILITY - ELEVATIONS 73', 77' AND 83.75'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024

DRAWN BY: BB

SCALE: AS NOTED

REVIEWED BY: PF

PROJECT NO.: 24-138.10T1

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

POWER BLOCK FACILITY
ELEVATIONS 73', 77' AND 83.75'

SHEET NO.

PBF-6

SIDE-C

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

POWER BLOCK FACILITY KEY PLAN

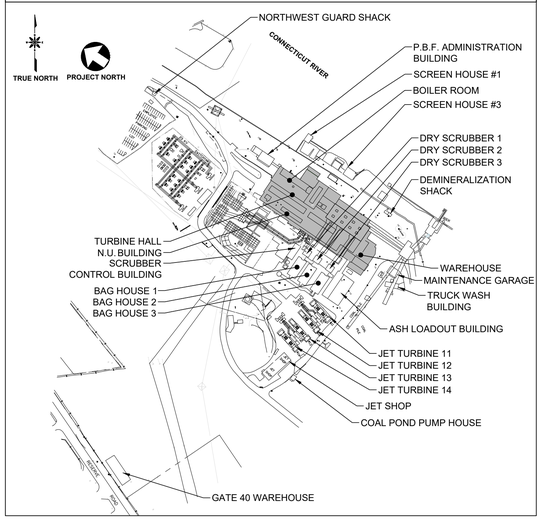

SIDE-B

SIDE-D

BOILER HOUSE

TURBINE HALL

N.U. BUILDING

11 AUGER BIN

12 AUGER BIN

13 AUGER BIN

07-16-AF-214B

07-16-AF-214A

07-16-AF-215A

BOILER #9

BOILER #10

11 GENERATOR

12 GENERATOR

13 GENERATOR

ELEV. 89'

5-41

07-16-AF-215B

07-17-AF-X216B

07-25-AF-330A,330B

07-25-AF-329B

07-25-AF-329A

5-42

07-29-AF-217D

07-29-AF-249E

T

07-29-AF-334A,334B

07-29-AF-217E

6-54

ELEV. 84'

ELEV.

ROOF

ROOF

POWER BLOCK FACILITY - ELEVATIONS 84' AND 89'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

POWER BLOCK FACILITY
ELEVATIONS 84' AND 89'

SHEET NO.

PBF-7

SHEET 13 OF 23

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

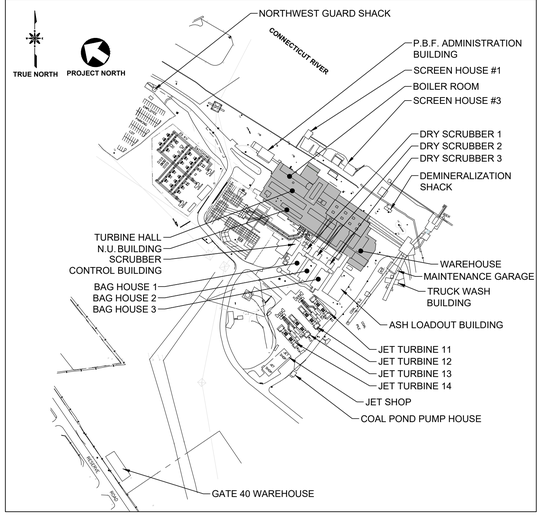

SIDE-B

SIDE-D

POWER BLOCK FACILITY - ELEVATION 104'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

POWER BLOCK FACILITY
ELEVATION 104'

SHEET NO.

PBF-8

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

SIDE-B

SIDE-D

SIDE-A (RESERVE ROAD)

POWER BLOCK FACILITY KEY PLAN

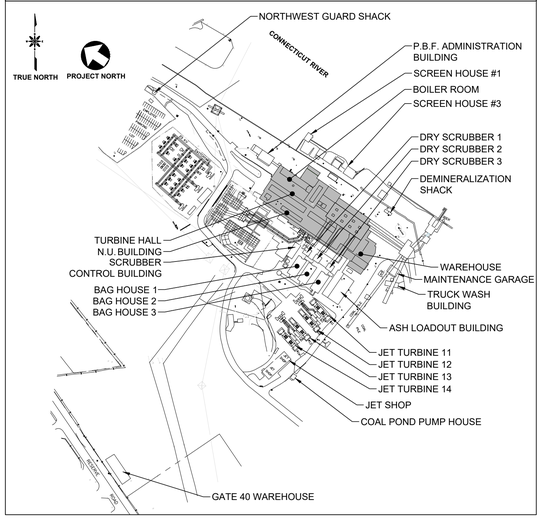

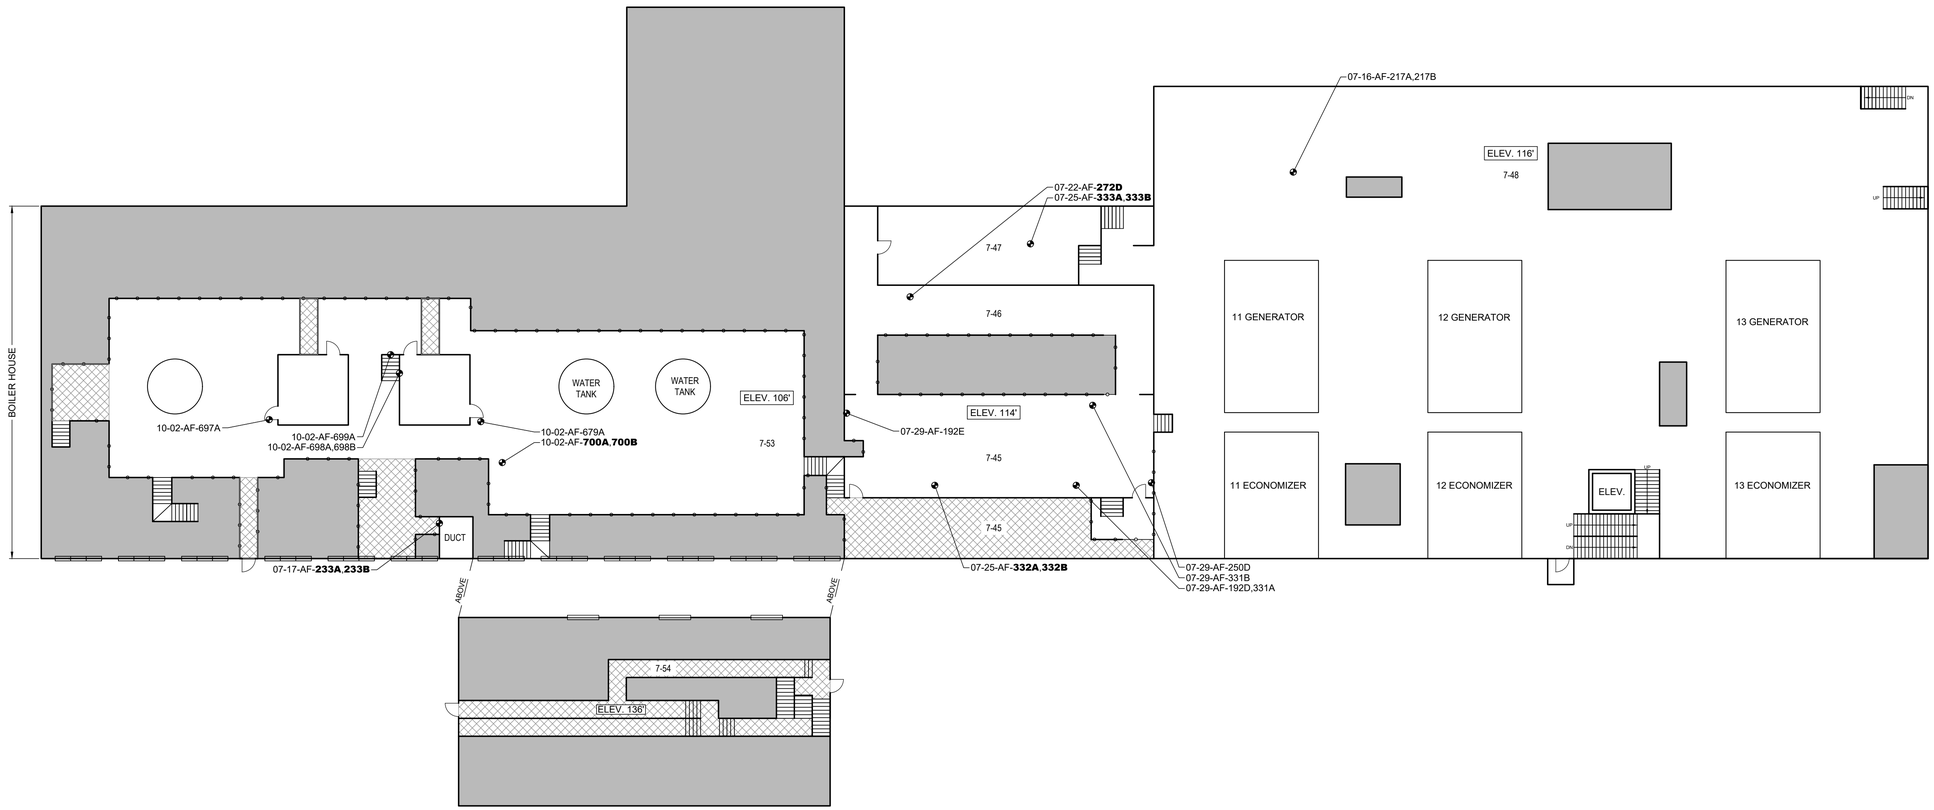

POWER BLOCK FACILITY - ELEVATIONS 106', 114' AND 116'

NOT TO SCALE

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
ELEVATIONS 106', 114' AND 116'

SHEET NO.
PBF-9

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

SIDE-C

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

POWER BLOCK FACILITY KEY PLAN

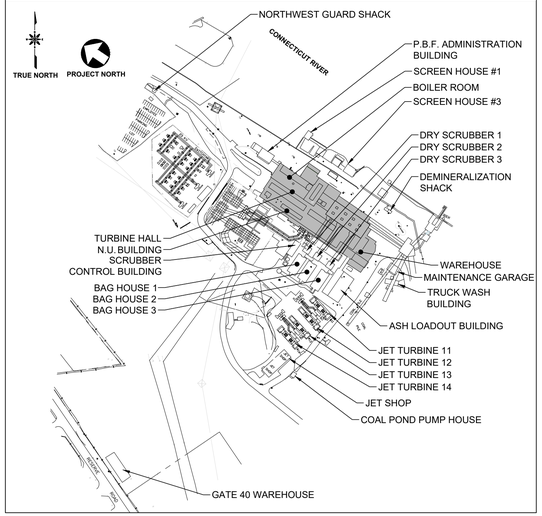

SIDE-B

SIDE-D

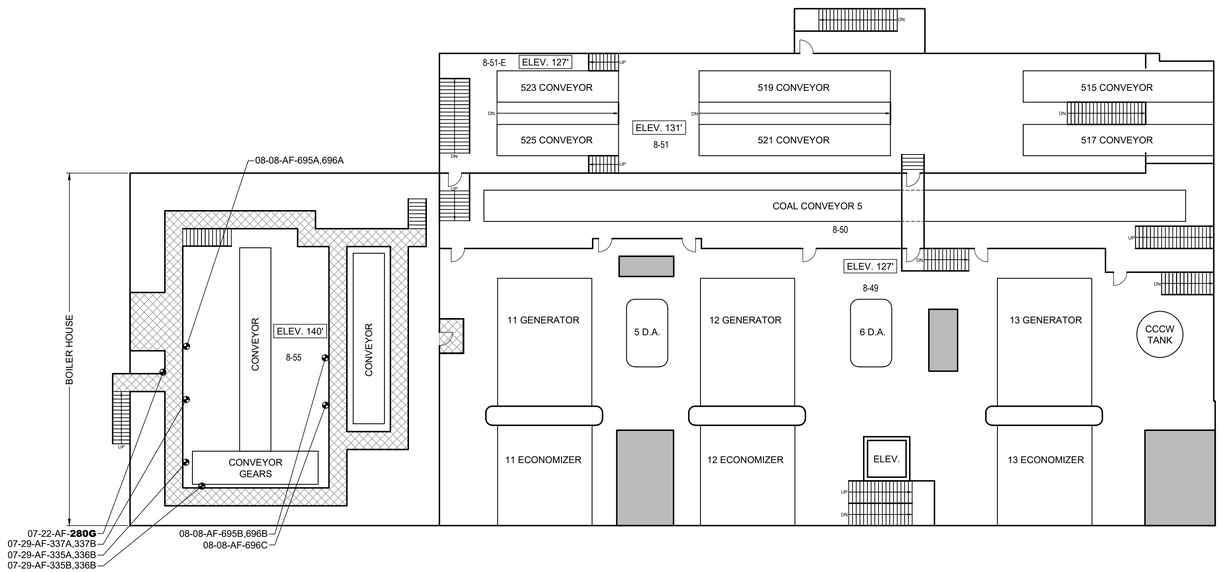

POWER BLOCK FACILITY - ELEVATIONS 127', 131' AND 140'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
ELEVATIONS 127', 131' AND 140'

SHEET NO.
PBF-10

SIDE-C

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

POWER BLOCK FACILITY KEY PLAN

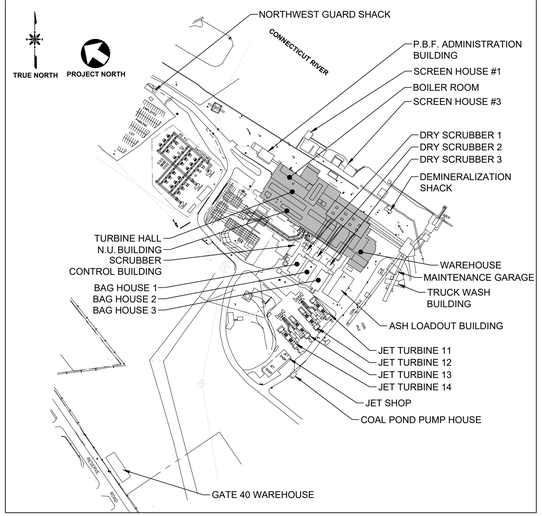

SIDE-B

SIDE-D

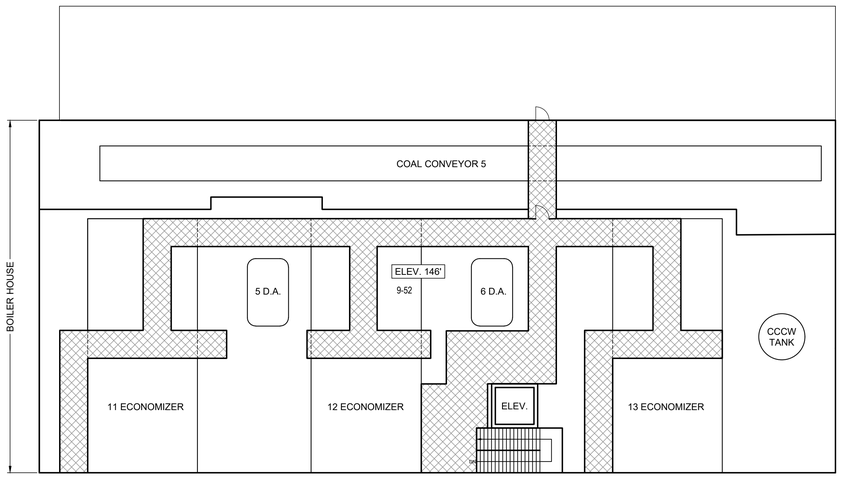

POWER BLOCK FACILITY - ELEVATION 146'

NOT TO SCALE

SIDE-A (RESERVE ROAD)

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY ELEVATION 146'

SHEET NO.
PBF-11

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

SIDE-B

SIDE-D

SIDE-A (RESERVE ROAD)

BOILER HOUSE

TURBINE HALL

N.U. BUILDING

WAREHOUSE

INACCESSIBLE

PUGMILL (INACCESSIBLE)

ROOF 1
ROOF 2
ROOF 3
ROOF 4
ROOF 5
ROOF 6
ROOF 7
ROOF 8
ROOF 9
ROOF 10
ROOF 11

08-27-AF-**632B**
08-27-AF-631B
08-27-AF-635A
08-27-AF-**603E**
08-28-AF-**629A**
08-08-AF-**472A**,**472B**
08-27-AF-635B
08-27-AF-636C
08-08-AF-474C
08-08-AF-**475C**
08-29-AF-640A,640B
08-29-AF-636A
08-29-AF-**639A**
08-29-AF-637A,**638A**
08-29-AF-**638B**
08-28-AF-**645A**
08-29-AF-641A,642A
08-29-AF-**645B**
08-29-AF-643A
08-28-AF-**630A**
08-27-AF-**629A**
08-27-AF-**632A**
08-27-AF-633A,634A
08-27-AF-631A
08-27-AF-**644A**,**644B**
08-27-AF-641B,642B
08-27-AF-643B
08-27-AF-**629B**
08-29-AF-641B,642B
08-29-AF-643B
08-29-AF-646B
08-29-AF-652A,652B
08-29-AF-647A
08-29-AF-647B
08-27-AF-627A
08-29-AF-649A,650A,651A
08-29-AF-636B
08-29-AF-637B
08-29-AF-636C
08-29-AF-639B
08-28-AF-**624B**,**625B**
08-29-AF-648A
08-29-AF-648B
08-29-AF-646A
08-28-AF-652A,652B
08-27-AF-620E
08-28-AF-**623A**
08-27-AF-633B,634B
08-28-AF-**624A**,**625A**
08-27-AF-602F
08-27-AF-**630B**
08-27-AF-626A
08-27-AF-603E
08-28-AF-**623B**
08-27-AF-603B
08-27-AF-601C
08-27-AF-603D,621A
08-27-AF-622A
08-27-AF-**603B**
08-27-AF-620C
08-27-AF-457C,619B,620A
08-27-AF-**603D**
08-27-AF-603B
08-27-AF-622B
08-28-AF-**628B**
08-27-AF-626B
08-27-AF-627B
08-27-AF-621C
08-28-AF-**628A**
08-27-AF-**607B**
08-27-AF-**607A**
08-27-AF-605B,606B
08-27-AF-**604B**
08-27-AF-**605A**
08-27-AF-**604A**
08-27-AF-217G
08-27-AF-610A,610B
08-27-AF-335C,336C
08-27-AF-**608A**
08-27-AF-**608B**
08-27-AF-614A,614B
08-27-AF-**615A**,**615B**,616A,617A,617B,618A,618B
08-27-AF-619A,620A
08-27-AF-595A,595B,596A,**597A**,598A
08-27-AF-599A,600A,601A,602A
08-27-AF-593A,593B
08-27-AF-**603A**
08-27-AF-594A,594B
08-27-AF-601B,602B
08-27-AF-592A,592B
08-27-AF-588C,**590C**,591A,591B
08-27-AF-611A
08-27-AF-584A,584B,**585A**,**585B**
08-27-AF-582A,583A
08-27-AF-582B,583B,587A,587B
08-27-AF-588A,588B,589A,589B,**590A**,**590B**
08-27-AF-586A
08-27-AF-612A
08-27-AF-596B,**597B**,598B
08-27-AF-609A
08-27-AF-600C,602C,**603C**
08-27-AF-609B
08-27-AF-611B
08-27-AF-601C,602D,609C
08-27-AF-612B
08-27-AF-**613B**
08-27-AF-**613A**
08-29-AF-685A
08-27-AF-613A,613B

POWER BLOCK FACILITY KEY PLAN

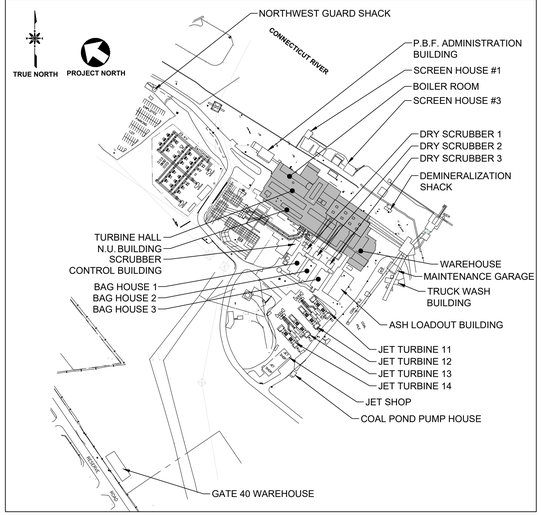

POWER BLOCK FACILITY - ROOF

NOT TO SCALE

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10TI

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY ROOF

SHEET NO.
PBF-12

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

POWER BLOCK FACILITY KEY PLAN

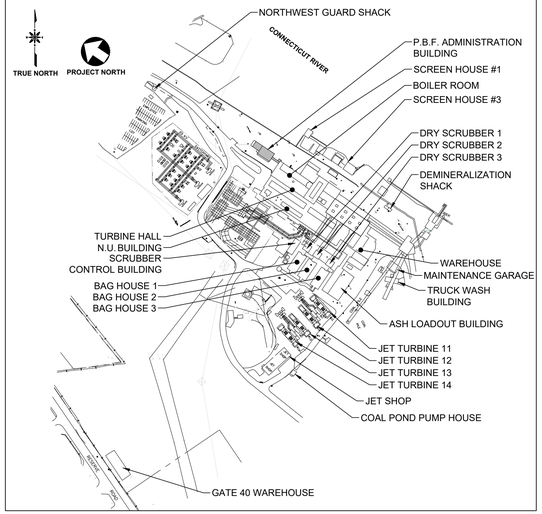

SIDE-B

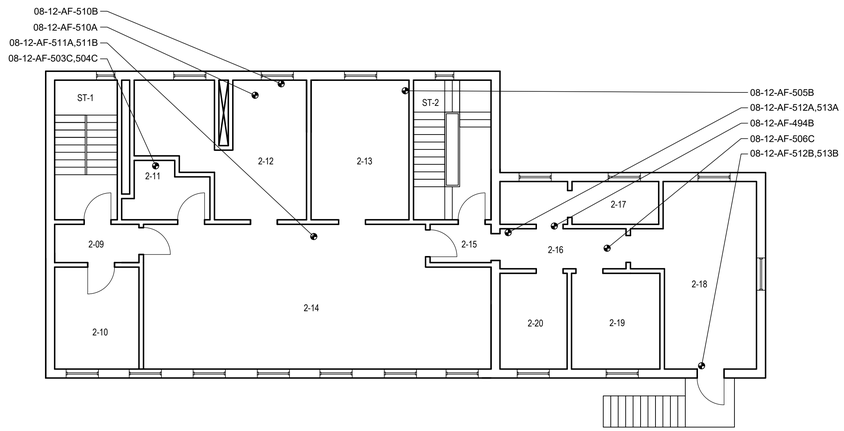

POWER BLOCK FACILITY - ADMINISTRATION BUILDING SECOND FLOOR

NOT TO SCALE

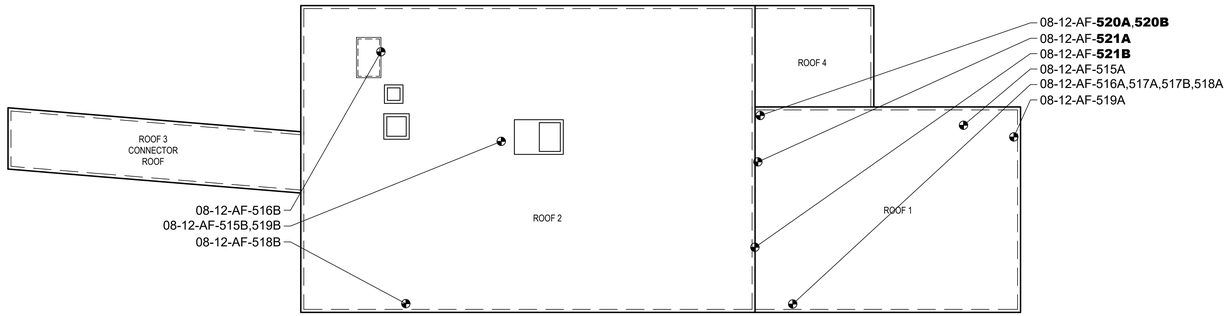

POWER BLOCK FACILITY - ADMINISTRATION BUILDING ROOF

NOT TO SCALE

SIDE-D

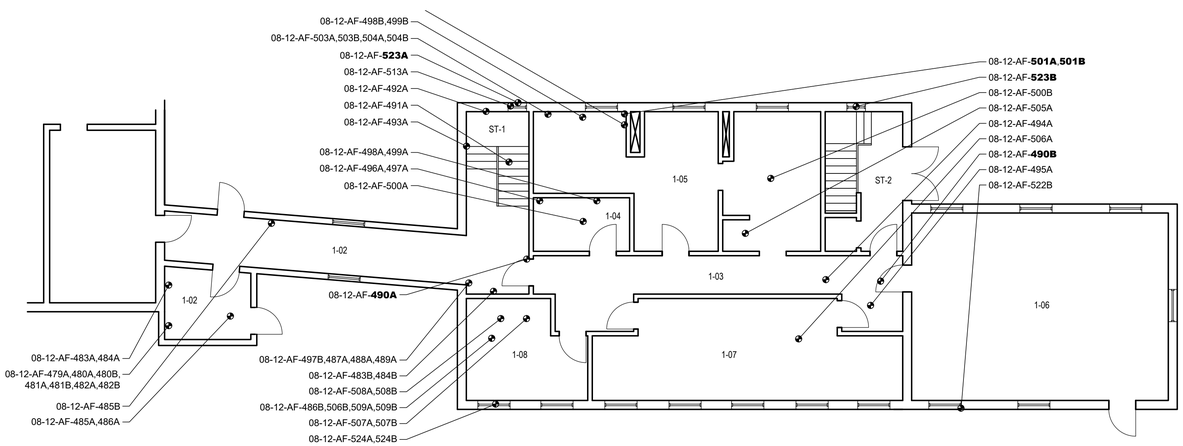

POWER BLOCK FACILITY - ADMINISTRATION BUILDING GROUND FLOOR

NOT TO SCALE

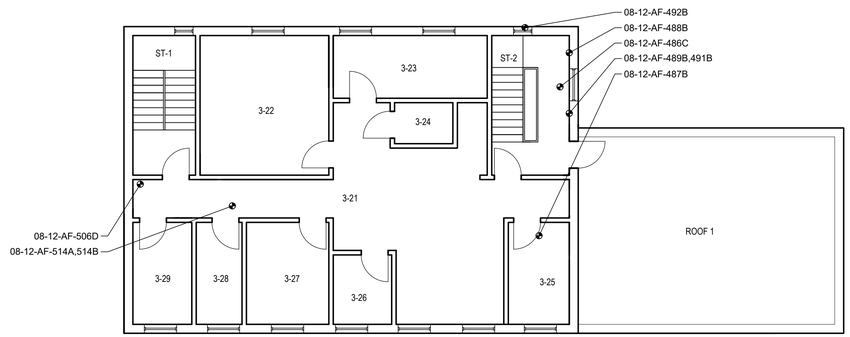

POWER BLOCK FACILITY - ADMINISTRATION BUILDING THIRD FLOOR

NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
ADMINISTRATION BUILDING

SHEET NO.
PBF-13

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

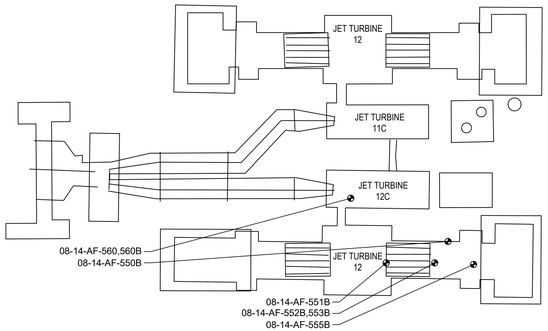

POWER BLOCK FACILITY - JET TURBINES 11 AND 12

NOT TO SCALE

SIDE-C

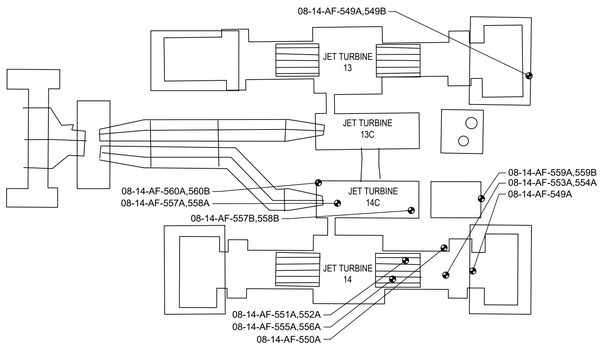

POWER BLOCK FACILITY - JET TURBINES 13 AND 14

NOT TO SCALE

POWER BLOCK FACILITY KEY PLAN

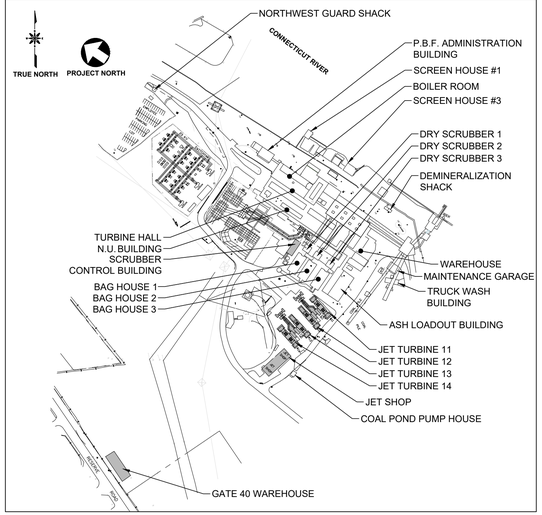

SIDE-B

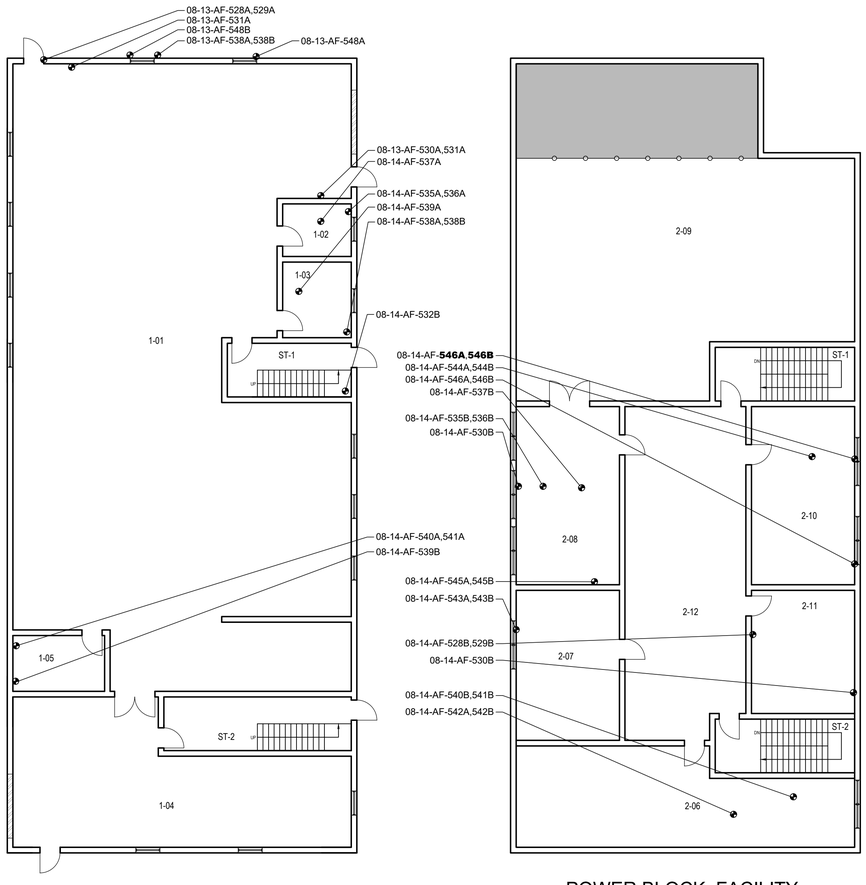

POWER BLOCK FACILITY - JET SHOP FIRST FLOOR

NOT TO SCALE

POWER BLOCK FACILITY - JET SHOP SECOND FLOOR

NOT TO SCALE

SIDE-D

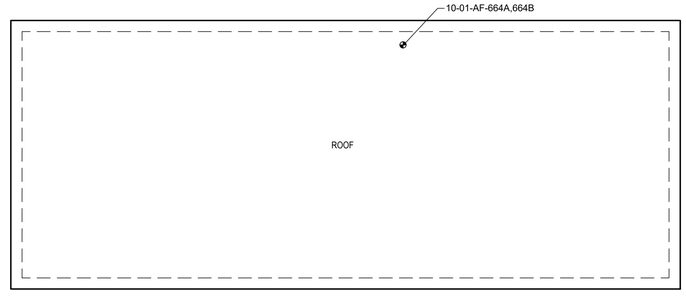

POWER BLOCK FACILITY - GATE 40 WAREHOUSE ROOF

NOT TO SCALE

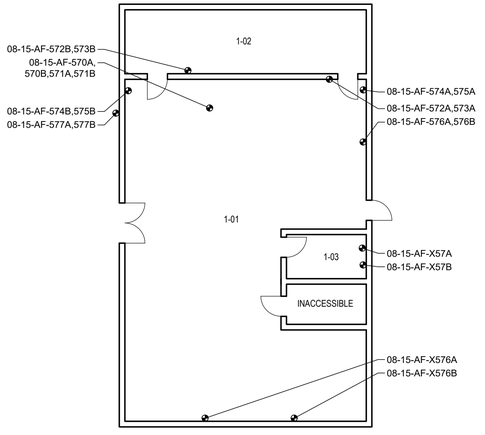

POWER BLOCK FACILITY - SCRUBBER CONTROL BUILDING

NOT TO SCALE

SIDE-A (RESERVE ROAD)

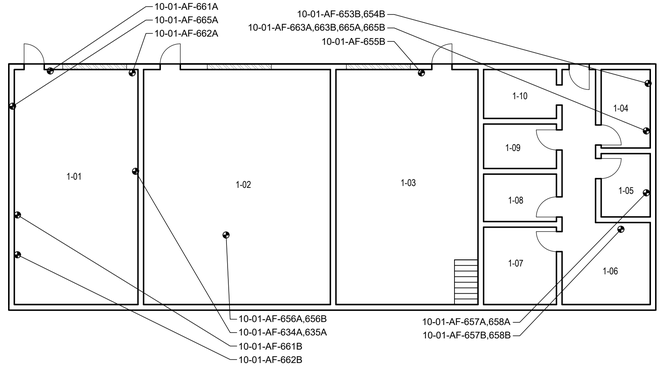

POWER BLOCK FACILITY - GATE 40 WAREHOUSE FIRST FLOOR

NOT TO SCALE

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBM\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:

HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:

WESTON & SAMPSON
SOUTH MEADOWS

100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:

POWER BLOCK FACILITY
GATE 40 WAREHOUSE, JET SHOP,
JET TURBINES & SCRUBBER
CONTROL BUILDING

SHEET NO.

PBF-14

SHEET 20 OF 23

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

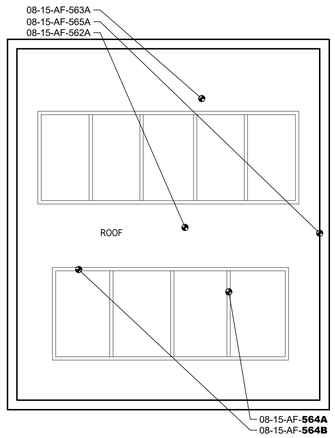

POWER BLOCK FACILITY -
SCREEN HOUSE #1 ROOF
NOT TO SCREEN

SIDE-C

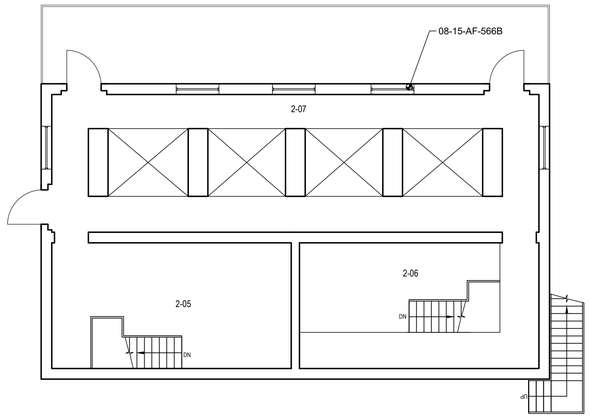

POWER BLOCK FACILITY -
SCREEN HOUSE #3 SECOND FLOOR
NOT TO SCREEN

POWER BLOCK FACILITY KEY PLAN

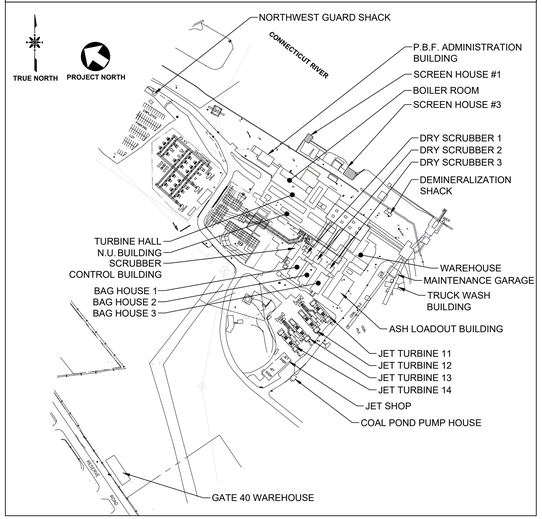

SIDE-B

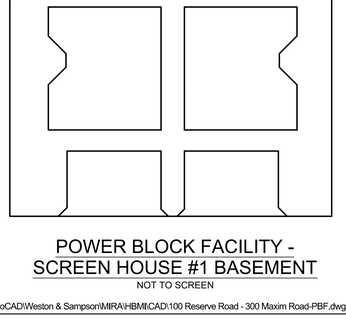

POWER BLOCK FACILITY -
SCREEN HOUSE #1 FIRST FLOOR
NOT TO SCREEN

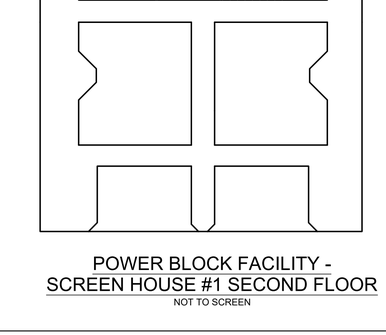

POWER BLOCK FACILITY -
SCREEN HOUSE #1 THIRD FLOOR
NOT TO SCREEN

POWER BLOCK FACILITY -
SCREEN HOUSE #3 FIRST FLOOR
NOT TO SCREEN

POWER BLOCK FACILITY -
SCREEN HOUSE #3 ROOF
NOT TO SCREEN

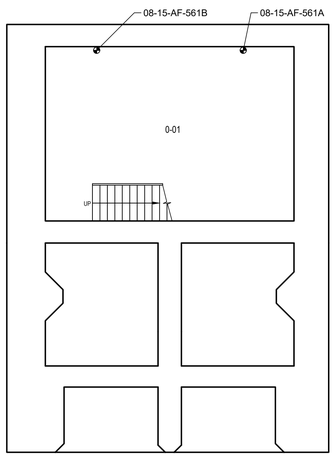

POWER BLOCK FACILITY -
SCREEN HOUSE #1 BASEMENT
NOT TO SCREEN

POWER BLOCK FACILITY -
SCREEN HOUSE #1 SECOND FLOOR
NOT TO SCREEN

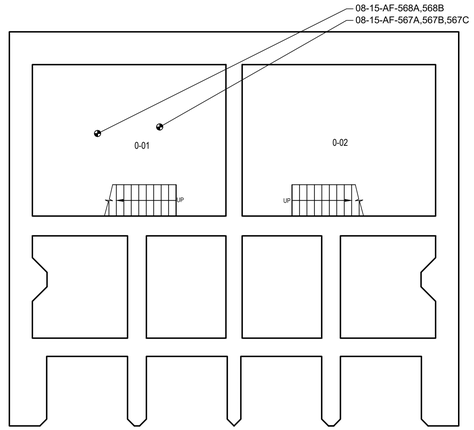

POWER BLOCK FACILITY -
SCREEN HOUSE #3 BASEMENT
NOT TO SCREEN

SIDE-A (RESERVE ROAD)

SIDE-D

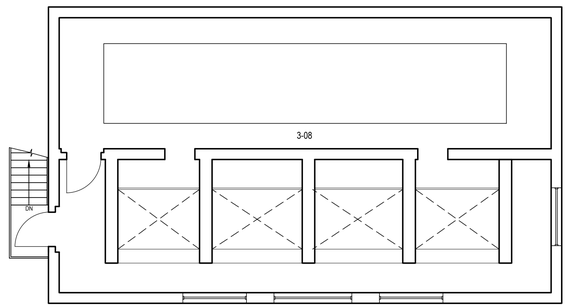

POWER BLOCK FACILITY -
SCREEN HOUSE #3 THIRD FLOOR
NOT TO SCREEN

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING
MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
SCREEN HOUSE #1 &
SCREEN HOUSE #3

SHEET NO.
PBF-15

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

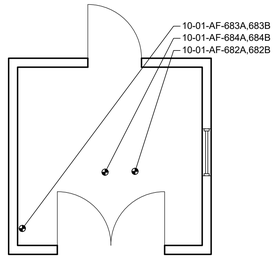

POWER BLOCK FACILITY -
COAL POND PUMP HOUSE
FIRST FLOOR
NOT TO SCALE

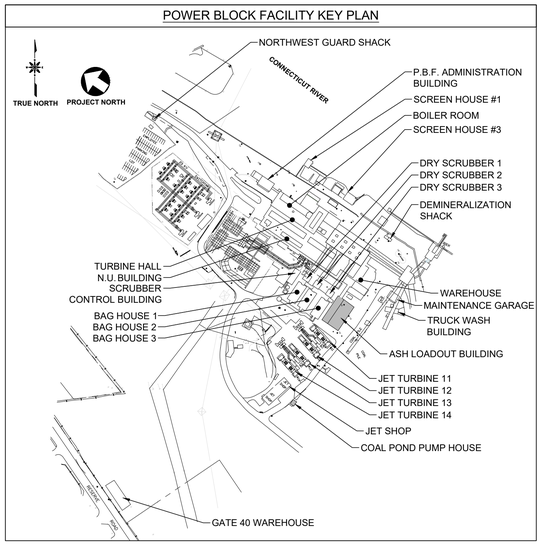

SIDE-B

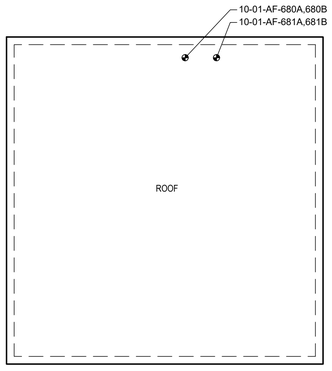

POWER BLOCK FACILITY -
NORTHWEST GUARD SHACK ROOF
NOT TO SCALE

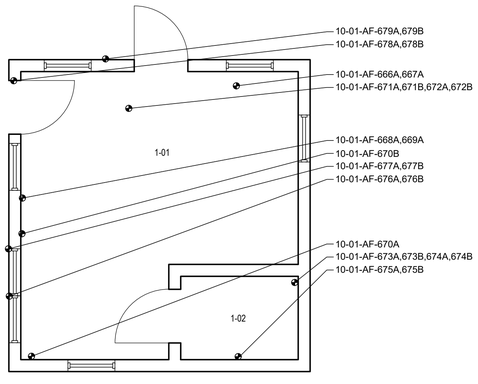

POWER BLOCK FACILITY -
NORTHWEST GUARD SHACK FIRST FLOOR
NOT TO SCALE

SIDE-D

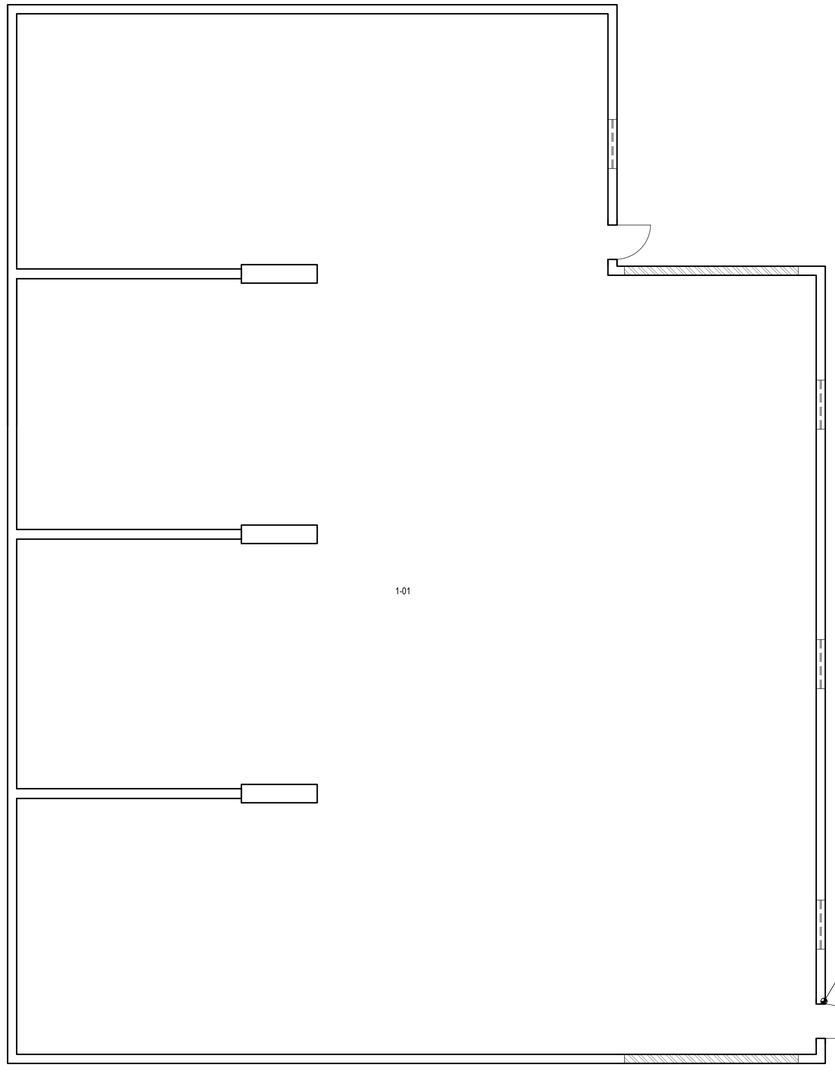

POWER BLOCK FACILITY -
ASH LOADOUT BUILDING
NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

REVISIONS		
NO.	DATE:	DESCRIPTION

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PE
PROJECT NO.: 24-138.10T1

PROJECT TITLE:
HAZARDOUS BUILDING
MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
N.W. GUARD SHACK, COAL
POND PUMP HOUSE AND ASH
LOADOUT BUILDING

SHEET NO.
PBF-16

KEY:

##-##-AF-#### = ASBESTOS SAMPLE LOCATION AND NUMBER

BOLDED SAMPLE NUMBERS INDICATE PRESENCE OF ASBESTOS IN CONCENTRATIONS EQUAL TO OR GREATER THAN 1% WITHIN SAMPLE SET.

0-00 = EAGLE ROOM NUMBER

ELEV. ## = ELEVATION

= AREA OF OPEN SPACE

= CONCRETE INFILL

= METAL GRATE

SIDE-C

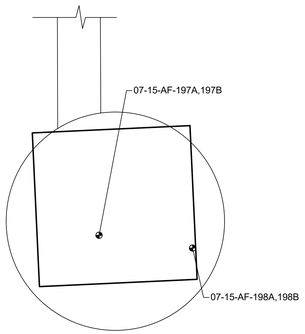

POWER BLOCK FACILITY - DRY SCRUBBER #1
NOT TO SCALE

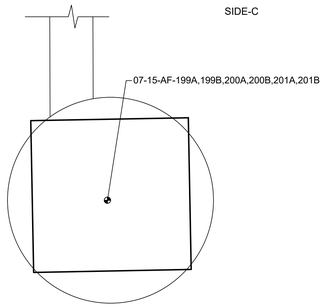

POWER BLOCK FACILITY - DRY SCRUBBER #2
NOT TO SCALE

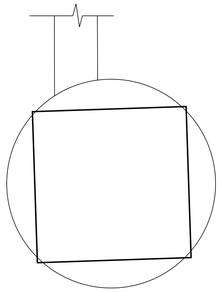

POWER BLOCK FACILITY - DRY SCRUBBER #3
NOT TO SCALE

SIDE-B

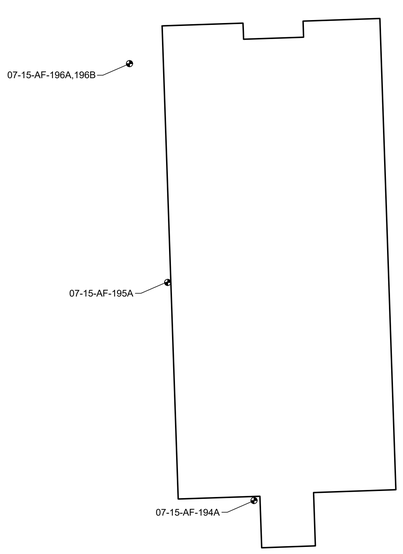

POWER BLOCK FACILITY - BAG HOUSE #1
NOT TO SCALE

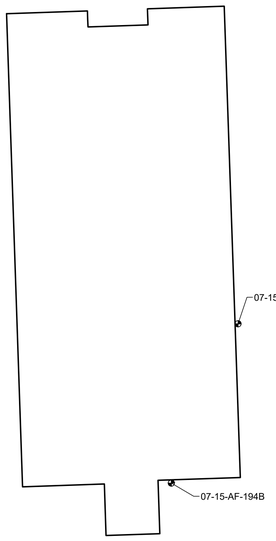

POWER BLOCK FACILITY - BAG HOUSE #2
NOT TO SCALE

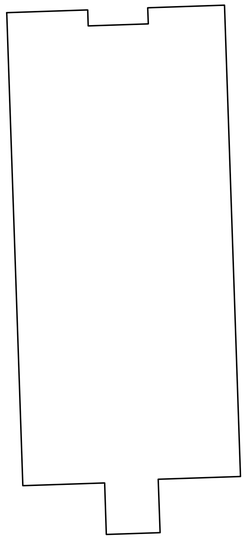

POWER BLOCK FACILITY - BAG HOUSE #3
NOT TO SCALE

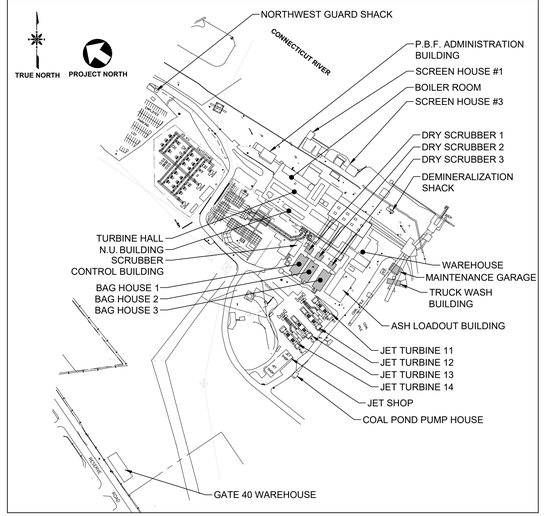

POWER BLOCK FACILITY KEY PLAN

SIDE-D

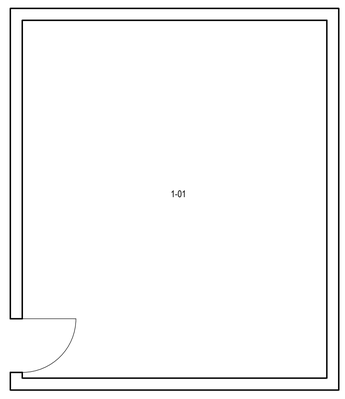

POWER BLOCK FACILITY - DEMINERALIZATION SHACK
NOT TO SCALE

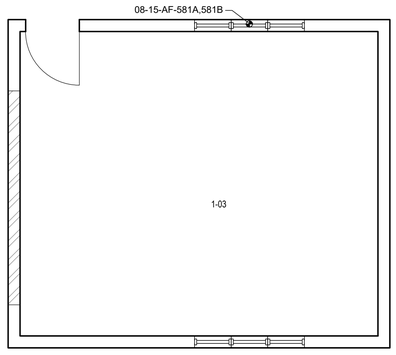

POWER BLOCK FACILITY - MAINTENANCE GARAGE
NOT TO SCALE

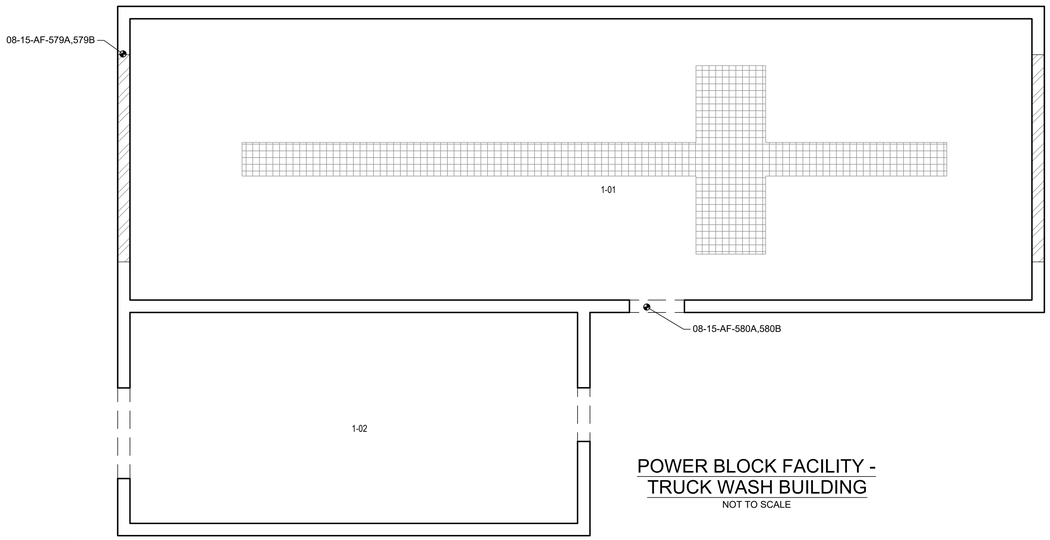

POWER BLOCK FACILITY - TRUCK WASH BUILDING
NOT TO SCALE

SIDE-A (RESERVE ROAD)

Z:\2024 Files\2024 AutoCAD\Weston & Sampson\MIRA\HBMI\CAD\100 Reserve Road - 300 Maxim Road-PBF.dwg

DATE: 11/01/2024
DRAWN BY: BB
SCALE: AS NOTED
REVIEWED BY: PF
PROJECT NO.: 24-138.10T1

REVISIONS

NO.	DATE:	DESCRIPTION

PROJECT TITLE:
HAZARDOUS BUILDING MATERIAL INSPECTION

PROJECT CLIENT AND PROJECT ADDRESS:
WESTON & SAMPSON
SOUTH MEADOWS
100 RESERVE ROAD & 300 MAXIM ROAD
HARTFORD, CONNECTICUT

EAGLE Environmental, Inc.
8 SOUTH MAIN STREET, SUITE 3
TERRYVILLE, CONNECTICUT 06786
860-589-8257

SHEET TITLE:
POWER BLOCK FACILITY
TRUCK WASH FACILITY, MAINT. SHOP, DEMINERALIZATION SHACK, DRY SCRUBBERS & BAG HOUSES

SHEET NO.
PBF-17

APPENDIX C

ASBESTOS BULK SAMPLE LABORATORY REPORTS

PBF

ASH LOADOUT

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Ash Loadout

Lab Order ID: **10060440**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-569A	Door frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060440_0001					Ashed
8-15-AF-569B	Door frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060440_0002					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (2)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

100060440

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Power Block Facility - Ash Loadout	***Enter samples between "<<" and ">>"*** ***Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	8/19/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sallab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-15-AF-569A		Door frame caulk - gray	Façade D
8-15-AF-569B		Door frame caulk - gray	Façade D

Accepted ☒

Rejected ☐

Relinquished By

8/20 (10.7)

Received By

PBF

COAL POND PUMP HOUSE

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Coal Pond Pump House

Lab Order ID: **10064366**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-682A	Gasket on water lines - gray	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10064366_0001					Ashed
10-1-AF-682B	Gasket on water lines - gray	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10064366_0002					Ashed
10-1-AF-683A	Sealent at metal frame / panel junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064366_0003					Ashed
10-1-AF-683B	Sealent at metal frame / panel junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064366_0004					Ashed
10-1-AF-684A	Soft liner in pipe - gray	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10064366_0005					Dissolved
10-1-AF-684B	Soft liner in pipe - gray	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10064366_0006					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (6)
Analyst

Approved Signatory

1506432606

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Coal Pond Pump House	***Enter samples between "<<" and ">>"*** ***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in set Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	10/3/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	24 Hour	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-1-AF-682A		Gasket on water lines - gray	Rm 1-01
10-1-AF-682B		Gasket on water lines - gray	Rm 1-01
10-1-AF-683A		Sealent at metal frame / panel junction - white	Rm 1-01
10-1-AF-683B		Sealent at metal frame / panel junction - white	Rm 1-01
10-1-AF-684A		Soft liner in pipe - gray	Rm 1-01
10-1-AF-684B		Soft liner in pipe - gray	Rm 1-01

Accepted ☑
Rejected ☐

Relinquished By

Received By

10/4 1030am

PBF

COMBUSTION UNITS 9 & 10

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-17-AF-217A	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10058043_0001					Teased
7-17-AF-217B	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10058043_0002					Teased
7-17-AF-217C	Soft pack pipe insulation - gray (elbow)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10058043_0003					Teased
7-17-AF-218A	Woven wrap over soft pack pipe insulation - white	**None Detected**	**95% Fiber Glass**	**5% Other**	Gray, White Fibrous Homogeneous
10058043_0004					Teased
7-17-AF-218B	Woven wrap over soft pack pipe insulation - white	**None Detected**	**95% Fiber Glass**	**5% Other**	White, Gray Fibrous Homogeneous
10058043_0005					Teased
7-17-AF-218C	Woven wrap over soft pack pipe insulation - white	**None Detected**	**95% Fiber Glass**	**5% Other**	White, Gray Fibrous Homogeneous
10058043_0006					Teased
7-17-AF-219A	Residual debris on pipes - white	**None Detected**	**20% Fiber Glass**	**80% Other**	Gray Fibrous Heterogeneous
10058043_0007	*small sample*				Teased
7-17-AF-219B	Residual debris on pipes - white	**30% Chrysotile**		**70% Other**	Gray Fibrous Heterogeneous
10058043_0008					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-17-AF-219C	Residual debris on pipes - white	**Not Analyzed**			
10058043_0009					
7-17-AF-X219A	Debris in interior boiler fire tube - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10058043_0010					Teased
7-17-AF-X219B	Debris in interior boiler fire tube - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10058043_0011					Teased
7-17-AF-X219C	Debris in interior boiler fire tube - white	**Not Submitted**			
10058043_0012					
7-17-AF-220A	Stored gasket	**15% Chrysotile**		**85% Other**	Gray Non-Fibrous Homogeneous
10058043_0013					Teased
7-17-AF-220B	Stored gasket	**Not Analyzed**			
10058043_0014					
7-17-AF-221A	Rope gasket at acess hatch to boiler	**60% Chrysotile**		**40% Other**	Gray Fibrous Homogeneous
10058043_0015					Teased
7-17-AF-221B	Rope gasket at acess hatch to boiler	**Not Analyzed**			
10058043_0016					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-17-AF-222A	Refractory packing at acess hatch - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10058043_0017					Crushed
7-17-AF-222B	Refractory packing at acess hatch - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10058043_0018					Crushed
7-17-AF-223A	Miscellaneous soft pack ring at water lines - white / fiberous	**15% Amosite**		**85% Other**	White Non-Fibrous Homogeneous
10058043_0019					Teased
7-17-AF-223B	Miscellaneous soft pack ring at water lines - white / fiberous	**Not Analyzed**			
10058043_0020					
7-17-AF-224A	Gasket at igniter sight glass	**70% Chrysotile**		**30% Other**	Gray Fibrous Homogeneous
10058043_0021					Teased
7-17-AF-224B	Gasket at igniter sight glass	**Not Analyzed**			
10058043_0022					
7-17-AF-225A	Rope gasket at ignition sight glass acess pannel	**70% Chrysotile**		**30% Other**	Gray Fibrous Homogeneous
10058043_0023					Teased
7-17-AF-225B	Rope gasket at ignition sight glass acess pannel	**Not Analyzed**			
10058043_0024					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-17-AF-226A	Stored refractory birck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10058043_0025					Crushed
7-17-AF-226B	Stored refractory birck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10058043_0026					Crushed
7-17-AF-227A	Sealent between interior boiler shell junctions	**40% Chrysotile**		**60% Other**	Gray Fibrous Homogeneous
10058043_0027					Teased
7-17-AF-227B	Sealent between interior boiler shell junctions	**Not Analyzed**			
10058043_0028					
7-17-AF-228A	Interior refractory packing on wire mesh.	**None Detected**	**30% Fiber Glass**	**70% Other**	Gray Fibrous Heterogeneous
10058043_0029					Teased
7-17-AF-228B	Interior refractory packing on wire mesh.	**None Detected**	**30% Fiber Glass**	**70% Other**	Gray Fibrous Heterogeneous
10058043_0030					Teased
7-17-AF-229A	Pipe wrap on 1" line - white / fiberous	**70% Chrysotile**		**30% Other**	White Fibrous Homogeneous
10058043_0031					Teased
7-17-AF-229B	Pipe wrap on 1" line - white / fiberous	**Not Analyzed**			
10058043_0032					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-17-AF-229C	Pipe wrap on 1" line - white / fiberous	**Not Analyzed**			
10058043_0033					
7-17-AF-230A	Electrical wire coating behind chemelex - white / woven	**None Detected**	**98% Fiber Glass**	**2% Other**	Gray Fibrous Homogeneous
10058043_0034					Teased
7-17-AF-230B	Electrical wire coating behind chemelex - white / woven	**None Detected**	**98% Fiber Glass**	**2% Other**	Gray Fibrous Homogeneous
10058043_0035					Teased
7-17-AF-231A	Taping compound around electrical wires	**None Detected**	**40% Cellulose** **20% Fiber Glass**	**40% Other**	Gray Fibrous Homogeneous
10058043_0036					Dissolved, Ashed
7-17-AF-231B	Taping compound around electrical wires	**None Detected**	**40% Cellulose** **20% Fiber Glass**	**40% Other**	Gray Fibrous Homogeneous
10058043_0037					Ashed
7-17-AF-232A	Soft fiberoud packing behind upper metal shell on boiler	**40% Chrysotile**	**20% Fiber Glass**	**40% Other**	Gray Fibrous Heterogeneous
10058043_0038					Teased
7-17-AF-232B	Soft fiberoud packing behind upper metal shell on boiler	**Not Analyzed**			
10058043_0039					
7-17-AF-232C	Soft fiberoud packing behind upper metal shell on boiler	**Not Analyzed**			
10058043_0040					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Combustion Units 9, 10

Lab Order ID: **10058043**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-17-AF-233A	Rope gasket to acess hatch to breaching duct	**70% Chrysotile**		**30% Other**	White Fibrous Homogeneous
10058043_0041					Teased
7-17-AF-233B	Rope gasket to acess hatch to breaching duct	**Not Analyzed**			
10058043_0042					
22E		**None Detected**	**40% Fiber Glass** **40% Cellulose**	**20% Other**	White, Silver Fibrous Homogeneous
10058043_0043	*not on coc; wrap*				Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (43)
Analyst

Approved Signatory

10058043

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	***Enter samples between "<<" and ">>"***
Project:	Weston and Sampson - MIRA - Combustion Units 9, 10	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in sets Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	7/19/2024 0:00	
Analysis:	PLM EPA 600R-93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-17-AF-217A		Soft pack pipe insulation - gray	Combustion unit 9 base level
7-17-AF-217B		Soft pack pipe insulation - gray	Combustion unit 10 base level
7-17-AF-217C		Soft pack pipe insulation - gray (elbow)	Combustion unit 10 base level
7-17-AF-218A		Woven wrap over soft pack pipe insulation - white	Combustion unit 9 base level
7-17-AF-218B		Woven wrap over soft pack pipe insulation - white	Combustion unit 10 base level
7-17-AF-218C		Woven wrap over soft pack pipe insulation - white	Combustion unit 10 base level
7-17-AF-219A		Residual debris on pipes - white	Combustion unit 9 base level
7-17-AF-219B		Residual debris on pipes - white	Combustion unit 10 second level
7-17-AF-219C		Residual debris on pipes - white	Combustion unit 10 second level

Relinquished By

Accepted ☑

Rejected ☐

7/24

Received By

10:20

7-17-AF-X219A		Debris in interior boiler fire tube - white	Combustion unit 9 base level
7-17-AF-X219B		Debris in interior boiler fire tube - white	Combustion unit 9 base level
7-17-AF-X219C		Debris in interior boiler fire tube - white	Combustion unit 9 base level
7-17-AF-220A		Stored gasket	Combustion unit 9 base level
7-17-AF-220B		Stored gasket	Combustion unit 9 base level
7-17-AF-221A		Rope gasket at acess hatch to boiler	Combustion unit 10 base level
7-17-AF-221B		Rope gasket at acess hatch to boiler	Combustion unit 10 base level
7-17-AF-222A		Refractory packing at acess hatch - gray	Combustion unit 9 base level
7-17-AF-222B		Refractory packing at acess hatch - gray	Combustion unit 10 base level
7-17-AF-223A		Miscellaneous soft pack ring at water lines - white / fiberous	Combustion unit 9 base level
7-17-AF-223B		Miscellaneous soft pack ring at water lines - white / fiberous	Combustion unit 9 base level
7-17-AF-224A		Gasket at igniter sight glass	Combustion unit 9 second level
7-17-AF-224B		Gasket at igniter sight glass	Combustion unit 10 second level
7-17-AF-225A		Rope gasket at ignition sight glass acess pannel	Combustion unit 9 second level
7-17-AF-225B		Rope gasket at ignition sight glass acess pannel	Combustion unit 10 second level
7-17-AF-226A		Stored refractory birck	Combustion unit 10 third level
7-17-AF-226B		Stored refractory birck	Combustion unit 10 third level
7-17-AF-227A		Sealent between interior boiler shell junctions	Combustion unit 10 third level

Relinquished By

Received By

3047

7-17-AF-227B		Sealent between interior boiler shell junctions	Combustion unit 10 third level
7-17-AF-228A		Interior refractory packing on wire mesh.	Combustion unit 10 base level
7-17-AF-228B		Interior refractory packing on wire mesh.	Combustion unit 10 base level
7-17-AF-229A		Pipe wrap on 1" line - white / fiberous	Combustion unit 10 base level
7-17-AF-229B		Pipe wrap on 1" line - white / fiberous	Combustion unit 10 base level
7-17-AF-229C		Pipe wrap on 1" line - white / fiberous	Combustion unit 10 base level
7-17-AF-230A		Electrical wire coating behind chemelex - white / woven	Combustion unit 10 second level
7-17-AF-230B		Electrical wire coating behind chemelex - white / woven	Combustion unit 10 second level
7-17-AF-231A		Taping compound around electrical wires	Combustion unit 10 second level
7-17-AF-231B		Taping compound around electrical wires	Combustion unit 10 second level
7-17-AF-232A		Soft fiberoud packing behind upper metal shell on boiler	Combustion unit 10 second level
7-17-AF-232B		Soft fiberoud packing behind upper metal shell on boiler	Combustion unit 10 second level
7-17-AF-232C		Soft fiberoud packing behind upper metal shell on boiler	Combustion unit 10 second level
7-17-AF-233A		Rope gasket to acess hatch to breaching duct	Combustion unit 10 fourth level
7-17-AF-233B		Rope gasket to acess hatch to breaching duct	Combustion unit 10 fourth level

Relinquished By

Received By

PBF

COMBUSTION UNITS 11, 12, 13 & BAG HOUSES

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-15-AF-194A	Large flex connector - black	None Detected	10% Fiber Glass	90% Other	Gray, Brown Fibrous Homogeneous
10058042_0001					Ashed
7-15-AF-194B	Large flex connector - black	None Detected	10% Fiber Glass	90% Other	Gray, Brown Fibrous Homogeneous
10058042_0002					Ashed
7-15-AF-195A	Gasket at air lock base motor switch	None Detected	5% Cellulose	95% Other	Green, Black Fibrous Homogeneous
10058042_0003					Ashed
7-15-AF-195B	Gasket at air lock base motor switch	None Detected	5% Cellulose	95% Other	Green, Black Fibrous Homogeneous
10058042_0004					Ashed
7-15-AF-196A	Sealant at aluminum fiberglass insulation covers at pipe - transparent	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10058042_0005					Ashed
7-15-AF-196B	Sealant at aluminum fiberglass insulation covers at pipe - transparent	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10058042_0006					Ashed
7-15-AF-197A	Window glazing compound in hoist room doors - black	None Detected	5% Cellulose	95% Other	Black Non-Fibrous Homogeneous
10058042_0007					Dissolved
7-15-AF-197B	Window glazing compound in hoist room doors - black	None Detected	5% Cellulose	95% Other	Black Non-Fibrous Homogeneous
10058042_0008					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-15-AF-198A	Insulator material between interior and exterior paneling - white	None Detected	10% Fiber Glass	90% Other	White Fibrous Homogeneous
10058042_0009					Dissolved
7-15-AF-198B	Insulator material between interior and exterior paneling - white	None Detected	10% Fiber Glass	90% Other	White Fibrous Homogeneous
10058042_0010					Dissolved
7-15-AF-199A	Felt paper - brown	None Detected	10% Cellulose	90% Other	Brown Fibrous Homogeneous
10058042_0011					Ashed
7-15-AF-199B	Felt paper - brown	None Detected	10% Cellulose	90% Other	Brown Fibrous Homogeneous
10058042_0012					Ashed
7-15-AF-200A	Caulk at roof vent - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0013					Ashed
7-15-AF-200B	Caulk at roof vent - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0014					Ashed
7-15-AF-201A	Expansion board at concrete bisc of columns - black	None Detected	5% Cellulose	95% Other	Black, Gray Non-Fibrous Homogeneous
10058042_0015					Crushed, Dissolved
7-15-AF-201B	Expansion board at concrete bisc of columns - black	None Detected	5% Cellulose	95% Other	Black, Gray Non-Fibrous Homogeneous
10058042_0016					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-16-AF-213A	Packing at tank under aluminum jacket - beige	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0017					Dissolved
7-16-AF-213B	Packing at tank under aluminum jacket - beige	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0018					Dissolved
7-16-AF-213C	Packing at tank under aluminum jacket - beige	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0019					Dissolved
7-15-AF-202A	Rubber gasket at hot water/trash zone access hatch	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10058042_0020					Ashed
7-15-AF-202B	Rubber gasket at hot water/trash zone access hatch	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10058042_0021					Ashed
7-15-AF-203A	Gasket at supply lines between valves - orange	None Detected		100% Other	Red, Orange Non-Fibrous Homogeneous
10058042_0022					Ashed
7-15-AF-203B	Gasket at supply lines between valves - orange	None Detected		100% Other	Orange, Red Non-Fibrous Homogeneous
10058042_0023					Ashed
7-15-AF-204A	Rope gasket at hopper funnel - white	None Detected	30% Fiber Glass	40% Other 30% Perlite	White, Red Fibrous Homogeneous
10058042_0024					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-15-AF-204B	Rope gasket at hopper funnel - white	**Data Not Present**			
10058042_0025					
7-15-AF-205A	Packing behind aluminum jacket at water tank - gray	**None Detected**	**5% Fiber Glass**	**95% Other**	Tan Non-Fibrous Homogeneous
10058042_0026					Crushed, Dissolved
7-15-AF-205B	Packing behind aluminum jacket at water tank - gray	**None Detected**	**5% Fiber Glass**	**95% Other**	Tan Non-Fibrous Homogeneous
10058042_0027					Dissolved, Crushed
7-15-AF-205C	Packing behind aluminum jacket at water tank - gray	**None Detected**	**5% Fiber Glass**	**95% Other**	Tan Non-Fibrous Homogeneous
10058042_0028					Crushed, Dissolved
7-15-AF-206A	Packing under aluminum jacket around steam tank - white	**None Detected**	**10% Cellulose**	**90% Other**	White Fibrous Homogeneous
10058042_0029					Dissolved
7-15-AF-206B	Packing under aluminum jacket around steam tank - white	**None Detected**	**10% Cellulose**	**90% Other**	White Fibrous Homogeneous
10058042_0030					Dissolved
7-15-AF-206C	Packing under aluminum jacket around steam tank - white	**None Detected**	**10% Cellulose**	**90% Other**	White Fibrous Homogeneous
10058042_0031					Dissolved
7-15-AF-207A	Sealant at aluminum jackets at pipes - metalic	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10058042_0032					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-15-AF-207B	Sealant at aluminum jackets at pipes - metalic	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10058042_0033					Ashed
7-15-AF-208A	Pipe insulation - soft/white	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0034					Dissolved
7-15-AF-208B	Pipe insulation - soft/white	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0035					Dissolved
7-15-AF-208C	Pipe insulation - soft/white	None Detected	10% Cellulose	90% Other	White Fibrous Homogeneous
10058042_0036					Dissolved
7-15-AF-209A	Large flex connector around entire boiler - black	None Detected	30% Fiber Glass	70% Other	Black, Tan Fibrous Homogeneous
10058042_0037					Dissolved
7-15-AF-209B	Large flex connector around entire boiler - black	None Detected	30% Fiber Glass	70% Other	Black, Tan Fibrous Homogeneous
10058042_0038					Dissolved
7-15-AF-210A	Rope gasket around flex connector	None Detected	30% Fiber Glass	70% Other	White Fibrous Homogeneous
10058042_0039					Dissolved
7-15-AF-210B	Rope gasket around flex connector	None Detected	30% Fiber Glass	70% Other	White Fibrous Homogeneous
10058042_0040					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-15-AF-211A	Refractory packing at interior boiler access door - gray	None Detected	5% Fiber Glass	95% Other	Tan Non-Fibrous Homogeneous
10058042_0041					Dissolved
7-15-AF-211B	Refractory packing at interior boiler access door - gray	None Detected	5% Fiber Glass	95% Other	Tan Non-Fibrous Homogeneous
10058042_0042					Dissolved
7-15-AF-211C	Refractory packing at interior boiler access door - gray	None Detected	5% Fiber Glass	95% Other	Tan Non-Fibrous Homogeneous
10058042_0043					Dissolved
7-15-AF-212A	Residual material on pipe - white	None Detected	5% Fiber Glass	95% Other	Tan Non-Fibrous Homogeneous
10058042_0044					Dissolved
7-16-AF-214A	Gasket at electrical scale funnel -blue	None Detected	5% Synthetic Fibers	95% Other	Gray Non-Fibrous Homogeneous
10058042_0045					Crushed
7-16-AF-214B	Gasket at electrical scale funnel -blue	None Detected	5% Synthetic Fibers	95% Other	Gray Non-Fibrous Homogeneous
10058042_0046					Crushed
7-16-AF-215A	Sealant at rope gasket - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0047					Ashed
7-16-AF-215B	Sealant at rope gasket - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0048					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-16-AF-216A	Patching component at boiler access hatch - gray	None Detected		95% Other 5% Quartz	Gray Non-Fibrous Homogeneous
10058042_0049					Crushed
7-16-AF-216B	Patching component at boiler access hatch - gray	None Detected		95% Other 5% Quartz	Gray Non-Fibrous Homogeneous
10058042_0050					Crushed
7-16-AF-217A	Cylindrical flex connector at hopper - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0051					Ashed
7-16-AF-217B	Cylindrical flex connector at hopper - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10058042_0052					Ashed
7-16-AF-218A	Diplag wrap over fiberglass	None Detected	5% Fiber Glass	95% Other	Tan Non-Fibrous Homogeneous
10058042_0053					Ashed
7-16-AF-219A	Coating on pipe - white at steam system	None Detected		100% Other	Tan, Black Non-Fibrous Homogeneous
10058042_0054					Crushed
7-16-AF-219B	Coating on pipe - white at steam system	None Detected		100% Other	Tan, Black Non-Fibrous Homogeneous
10058042_0055					Crushed
7-17-AF-X216A	Mineral wool behind corrugated metal paneling	None Detected	50% Fiber Glass	50% Perlite	Tan Fibrous Homogeneous
10058042_0056					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13

Lab Order ID: **10058042**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
7-17-AF-X216B	Mineral wool behind corrugated metal paneling	None Detected	50% Fiber Glass	50% Perlite	Tan Fibrous Homogeneous
10058042_0057					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (56)
Analyst

Approved Signatory

100598042

Client:	Eagle Environmental, Inc.	***Instructions:**	
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*	
Address:	8 South Main Street, Terryville, CT		
Phone:	860-589-8257	*To See an Example Click the*	
Fax:	860-585-7034	*bottom Example Tab.*	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com		
		Enter samples between "<<" and ">>"	
Project:	Weston and Sampson - MIRA - Bag Houses / Scrubbers / Combustion Units 11,12, 13	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***	
Client Notes:	Please stop on first positive in sets Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*	
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional*	
Date Submitted:	7/19/2024 0:00	*fields that do not show up on the official report, however they will be included*	
Analysis:	PLM EPA 600R-93/116	*in the electronic data returned to you*	
TurnAroundTime:	5 Day	*to facilitate your reintegration of the report data.*	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-15-AF-194A		Large flex connector - black	Bag House #1 - Façade B
7-15-AF-194B		Large flex connector - black	Bag House #2 - Façade D
7-15-AF-195A		Gasket at air lock base motor switch	Bag House #1 - Façade B
7-15-AF-195B		Gasket at air lock base motor switch	Bag House #2 - Façade D
7-15-AF-196A		Sealant at aluminum fiberglass insulation covers at pipe - transparent	Bag House #1 - Façade B
7-15-AF-196B		Sealant at aluminum fiberglass insulation covers at pipe - transparent	Bag House #1 - Façade B
7-15-AF-197A		Window glazing compound in hoist room doors - black	Dry Scrubber #1 - Façade A
7-15-AF-197B		Window glazing compound in hoist room doors - black	Dry Scrubber #1 - Façade A
7-15-AF-198A		Insulator material between interior and exterior paneling - white	Dry Scrubber #1 - Façade D
7-15-AF-198B		Insulator material between interior and exterior paneling - white	Dry Scrubber #1 - Façade D

Relinquished By

Accepted ☐

Rejected ☐

7/26

Received By

10:20

8042

7-15-AF-199A		Felt paper - brown	Electrical Room under Dry Scrubber #2
7-15-AF-199B		Felt paper - brown	Electrical Room under Dry Scrubber #2
7-15-AF-200A		Caulk at roof vent - black	Electrical Room under Dry Scrubber #2
7-15-AF-200B		Caulk at roof vent - black	Electrical Room under Dry Scrubber #2
7-15-AF-201A		Expansion board at concrete bisc of columns - black	Electrical Room under Dry Scrubber #2
7-15-AF-201B		Expansion board at concrete bisc of columns - black	Electrical Room under Dry Scrubber #2
7-16-AF-213A		Packing at tank under aluminum jacket - beige	Tank under scrubber 1 and 2
7-16-AF-213B		Packing at tank under aluminum jacket - beige	Tank under scrubber 1 and 2
7-16-AF-213C		Packing at tank under aluminum jacket - beige	Tank under scrubber 1 and 2
7-15-AF-202A		Rubber gasket at hot water/trash zone access hatch	Combustion unit 11, elevation 31'
7-15-AF-202B		Rubber gasket at hot water/trash zone access hatch	Combustion unit 11, elevation 31'
7-15-AF-203A		Gasket at supply lines between valves - orange	Combustion unit 11, elevation 31'
7-15-AF-203B		Gasket at supply lines between valves - orange	Combustion unit 12, elevation 31'
7-15-AF-204A		Rope gasket at hopper funnel - white	Combustion unit 11, elevation 31'
7-15-AF-204B		Rope gasket at hopper funnel - white	Combustion unit 12, elevation 31'
7-15-AF-205A		Packing behind aluminum jacket at water tank - gray	Combustion unit 11, elevation 31'
7-15-AF-205B		Packing behind aluminum jacket at water tank - gray	Combustion unit 12, elevation 31'
7-15-AF-205C		Packing behind aluminum jacket at water tank - gray	Combustion unit 11, elevation 31'

Relinquished By

Received By

7-15-AF-206A		Packing under aluminum jacket around steam tank - white	Combustion unit 11, elevation 36'
7-15-AF-206B		Packing under aluminum jacket around steam tank - white	Combustion unit 11, elevation 55'
7-15-AF-206C		Packing under aluminum jacket around steam tank - white	Combustion unit 12, elevation 36'
7-15-AF-207A		Sealant at aluminum jackets at pipes - metalic	Combustion unit 11, elevation 36'
7-15-AF-207B		Sealant at aluminum jackets at pipes - metalic	Combustion unit 12, elevation 36'
7-15-AF-208A		Pipe insulation - soft/white	Combustion unit 11, elevation 36'
7-15-AF-208B		Pipe insulation - soft/white	Combustion unit 11, elevation 36'
7-15-AF-208C		Pipe insulation - soft/white	Combustion unit 11, elevation 36'
7-15-AF-209A		Large flex connector around entire boiler - black	Combustion unit 11, elevation 45'
7-15-AF-209B		Large flex connector around entire boiler - black	Combustion unit 12, elevation 45'
7-15-AF-210A		Rope gasket around flex connector	Combustion unit 11, elevation 45'
7-15-AF-210B		Rope gasket around flex connector	Combustion unit 12, elevation 45'
7-15-AF-211A		Refractory packing at interior boiler access door - gray	Combustion unit 11, elevation 45'
7-15-AF-211B		Refractory packing at interior boiler access door - gray	Combustion unit 12, elevation 45'
7-15-AF-211C		Refractory packing at interior boiler access door - gray	Combustion unit 13, elevation 45'
7-15-AF-212A		Residual material on pipe - white	Combustion unit 11, elevation 45'
7-16-AF-214A		Gasket at electrical scale funnel -blue	Combustion unit 11, elevation 89'

Relinquished By

Received By

7-16-AF-214B		Gasket at electrical scale funnel -blue	Combustion unit 12, elevation 89'
7-16-AF-215A		Sealant at rope gasket - black	Combustion unit 11, elevation 89'
7-16-AF-215B		Sealant at rope gasket - black	Combustion unit 12, elevation 89'
7-16-AF-216A		Patching component at boiler access hatch - gray	Combustion unit 11, elevation 104'
7-16-AF-216B		Patching component at boiler access hatch - gray	Combustion unit 11, elevation 104'
7-16-AF-217A		Cylindrical flex connector at hopper - black	Combustion unit 11, elevation 116'
7-16-AF-217B		Cylindrical flex connector at hopper - black	Combustion unit 11, elevation 116'
7-16-AF-218A		Diplag wrap over fiberglass	Combustion unit 12, elevation 36'
7-16-AF-219A		Coating on pipe - white at steam system	Combustion unit 12, elevation 36'
7-16-AF-219B		Coating on pipe - white at steam system	Combustion unit 12, elevation 36'
7-17-AF-X216A		Mineral wool behind corrugated metal paneling	Bag House #1, Façade D
7-17-AF-X216B		Mineral wool behind corrugated metal paneling	Combustion Unit 13, elevation 89'

Relinquished By

Received By

PBF

FLOOD WALL

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Sea Wall

Lab Order ID: **10064356**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-2-AF-705A	Caulk in verticle concrete seams - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064356_0001					Ashed
10-2-AF-705B	Caulk in verticle concrete seams - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064356_0002					Ashed
10-2-AF-706A	Moisture barrier coating on concrete	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10064356_0003					Crushed, Dissolved
10-2-AF-706B	Moisture barrier coating on concrete	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Homogeneous
10064356_0004					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (4)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10064354

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Sea Wall
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	10/3/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	24 Hour

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-2-AF-705A		Caulk in verticle concrete seams - gray	Sea wall
10-2-AF-705B		Caulk in verticle concrete seams - gray	Sea wall
10-2-AF-706A		Moisture barrier coating on concrete	Sea wall
10-2-AF-706B		Moisture barrier coating on concrete	Sea wall

Accepted ☑

Rejected ☐

Relinquished By

Received By

Yes 10/4 10:30 am

PBF

GATE 40 WAREHOUSE

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Gate 40 warehouse

Lab Order ID: **10064357**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-653A	Sheet rock (wall)	**None Detected**	**10% Cellulose** **1% Fiber Glass**	**89% Other**	White Fibrous Homogeneous
10064357_0001					Crushed
10-1-AF-653B	Sheet rock (wall)	**None Detected**	**10% Cellulose** **1% Fiber Glass**	**89% Other**	White Fibrous Homogeneous
10064357_0002					Crushed
10-1-AF-654A	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Fibrous Homogeneous
10064357_0003					Teased
10-1-AF-654B	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Fibrous Homogeneous
10064357_0004					Teased
10-1-AF-655A	Vapor barrier facing over fiberglass wall panels - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064357_0005					Ashed
10-1-AF-655B	Vapor barrier facing over fiberglass wall panels - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064357_0006					Ashed
10-1-AF-656A	Sealent at stack seams - gray (stored stacks)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064357_0007					Crushed, Dissolved
10-1-AF-656B	Sealent at stack seams - gray (stored stacks)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064357_0008					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (26)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Gate 40 warehouse

Lab Order ID: **10064357**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-657A	Yellow adhesive associated with brown 4" vinyl cove base	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10064357_0009					Dissolved
10-1-AF-657B	Yellow adhesive associated with brown 4" vinyl cove base	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10064357_0010					Dissolved
10-1-AF-658A	4" Vinyl cove base - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0011					Dissolved
10-1-AF-658A	4" Vinyl cove base - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0012	*658B*				Dissolved
10-1-AF-659A	Sealant at duct work flanges - gray	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10064357_0013					Dissolved
10-1-AF-659B	Sealant at duct work flanges - gray	**Not Analyzed**			
10064357_0014					
10-1-AF-660A	Vapor barrier facing over fiberglass ceiling insulation - silver	**None Detected**	**65% Fiber Glass**	**35% Other**	Silver Fibrous Homogeneous
10064357_0015					Ashed
10-1-AF-660B	Vapor barrier facing over fiberglass ceiling insulation - silver	**None Detected**	**65% Fiber Glass**	**35% Other**	Silver Fibrous Homogeneous
10064357_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (26)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Gate 40 warehouse

Lab Order ID: **10064357**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-661A	Sealent at wall panel door frame junction - transparent	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0017					Dissolved
10-1-AF-661B	Sealent at wall panel door frame junction - transparent	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0018					Dissolved
10-1-AF-662A	Gasket at screws to metal wall panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10064357_0019					Ashed
10-1-AF-662B	Gasket at screws to metal wall panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10064357_0020					Ashed
10-1-AF-663A	Window frame caulk - gray	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0021					Dissolved
10-1-AF-663B	Window frame caulk - gray	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0022					Dissolved
10-1-AF-664A	Sealent around metal roof panel screws - transparent	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0023					Dissolved
10-1-AF-664B	Sealent around metal roof panel screws - transparent	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064357_0024					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (26)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Gate 40 warehouse

Lab Order ID: **10064357**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-665A	Exterior window glazing compound - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064357_0025					Dissolved
10-1-AF-665B	Exterior window glazing compound - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064357_0026					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (26)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

1006435 7

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Gate 40 warehouse	***Enter samples between "<<" and ">>"***
Client Notes:	Please stop on first positive in set Please do not split samples	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
P.O. #.	24-138.10T1	*Only Enter your data on the first sheet "Sheet1"*
Date Submitted:	10/3/2024 0:00	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	24 Hour	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-1-AF-653A		Sheet rock (wall)	Rm 1-01
10-1-AF-653B		Sheet rock (wall)	Rm 1-04
10-1-AF-654A		Joint compound associated with sheet rock wall - white	Rm 1-01
10-1-AF-654B		Joint compound associated with sheet rock wall - white	
10-1-AF-655A		Vapor barrier facing over fiberglass wall panels - white	Rm 1-01
10-1-AF-655B		Vapor barrier facing over fiberglass wall panels - white	Rm 1-03
10-1-AF-656A		Sealent at stack seams - gray (stored stacks)	Rm 1-02
10-1-AF-656B		Sealent at stack seams - gray (stored stacks)	Rm 1-02
10-1-AF-657A		Yellow adhesive associated with brown 4" vinyl cove base	Rm 1-05
10-1-AF-657B		Yellow adhesive associated with brown 4" vinyl cove base	Rm 1-06
10-1-AF-658A		4" Vinyl cove base - brown	Rm 1-05
10-1-AF-658A		4" Vinyl cove base - brown	Rm 1-06
10-1-AF-659A		Sealent at duct work flanges - gray	Rm 1-06
10-1-AF-659B		Sealent at duct work flanges - gray	Rm 1-06
10-1-AF-660A		Vapor barrier facing over fiberglass ceiling insulation - silver	Rm 1-08

Relinquished By

Received By

Yes 10/4 10:30am

Accepted ☑

Rejected ☐

10004357

10-1-AF-660B		Vapor barrier facing over fiberglass ceiling insulation - silver	Rm 1-08
10-1-AF-661A		Sealent at wall panel door frame junction - transparent	Façade A
10-1-AF-661B		Sealent at wall panel door frame junction - transparent	Façade D
10-1-AF-662A		Gasket at screws to metal wall panels - black	Façade A
10-1-AF-662B		Gasket at screws to metal wall panels - black	Façade D
10-1-AF-663A		Window frame caulk - gray	Façade B
10-1-AF-663B		Window frame caulk - gray	Façade B
10-1-AF-664A		Sealent around metal roof panel screws - transparent	Roof
10-1-AF-664B		Sealent around metal roof panel screws - transparent	Roof
10-1-AF-665A		Exterior window glazing compound - gray	Façade B
10-1-AF-665B		Exterior window glazing compound - gray	Façade B

Relinquished By

Received By

PBF

JET SHOP & JET TURBINES

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-13-AF-528A	Sheet rock (wall)	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10060437_0001					Dissolved
8-14-AF-528B	Sheet rock (wall)	**None Detected**	**5% Cellulose**	**95% Other**	Yellow Non-Fibrous Homogeneous
10060437_0002	*mastic; no sheetrock*				Ashed
8-13-AF-529A	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0003					Dissolved
8-14-AF-529B	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0004					Dissolved
8-13-AF-530A	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060437_0005					Ashed
8-14-AF-530B	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060437_0006					Ashed
8-13-AF-531A	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060437_0007					Ashed
8-13-AF-532A	4" vinyl cove base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-13-AF-532B	4" vinyl cove base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0009					Ashed
8-13-AF-533A	1/8" gasket material - green (stored)	**None Detected**	**5% Fiber Glass** **5% Wollastonite**	**90% Other**	Green Non-Fibrous Homogeneous
10060437_0010					Dissolved
8-13-AF-533B	1/8" gasket material - green (stored)	**None Detected**	**5% Fiber Glass** **5% Wollastonite**	**90% Other**	Green Non-Fibrous Homogeneous
10060437_0011					Dissolved
8-13-AF-534A	1/32" gasket material - black (stored)	**None Detected**	**80% Fiber Glass**	**20% Other**	Gray, Black Fibrous Homogeneous
10060437_0012					Ashed
8-13-AF-534A	1/32" gasket material - black (stored)	**None Detected**	**80% Fiber Glass**	**20% Other**	Black, Gray Fibrous Homogeneous
10060437_0013	*bag labeled 534B*				Ashed
8-14-AF-535A	Floor tile mastic - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0014					Ashed
8-14-AF-535B	Floor tile mastic - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0015					Ashed
8-14-AF-536A	12"x12" vinyl floor tile - light blue	**None Detected**		**100% Other**	Blue Non-Fibrous Homogeneous
10060437_0016					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-536B	12"x12" vinyl floor tile - light blue	**None Detected**		**100% Other**	Blue Non-Fibrous Homogeneous
10060437_0017					Dissolved
8-14-AF-537A	2'x4' acoustical ceiling tile - pin hole & fissure	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10060437_0018					Dissolved
8-14-AF-537B	2'x4' acoustical ceiling tile - pin hole & fissure	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10060437_0019					Dissolved
8-14-AF-538A	12"x12" vinyl floor tile - white with gray specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0020					Dissolved
8-14-AF-538B	12"x12" vinyl floor tile - white with gray specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0021					Dissolved
8-14-AF-539A	2'x4' acoustical ceiling tile - pin hole & crater	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10060437_0022					Dissolved
8-14-AF-539B	2'x4' acoustical ceiling tile - pin hole & crater	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10060437_0023					Dissolved
8-14-AF-540A	Mud base associated with 6"x6" gray quary tile - gray	**None Detected**		**95% Other** **5% Quartz**	Gray Non-Fibrous Homogeneous
10060437_0024					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-540B	Mud base associated with 6"x6" gray quary tile - gray	**None Detected**		**95% Other** **5% Quartz**	Gray Non-Fibrous Homogeneous
10060437_0025					Crushed
8-14-AF-541A	Grout associated with 6"x6" gray quary tile - gray	**None Detected**		**95% Other** **5% Quartz**	Gray Non-Fibrous Homogeneous
10060437_0026					Crushed
8-14-AF-541B	Grout associated with 6"x6" gray quary tile - gray	**None Detected**		**95% Other** **5% Quartz**	Gray Non-Fibrous Homogeneous
10060437_0027					Crushed
8-14-AF-542A	2'x4' acoustical ceiling tile - plain face	**None Detected**	**5% Fiber Glass** **5% Cellulose**	**90% Other**	Tan Fibrous Homogeneous
10060437_0028					Dissolved
8-14-AF-542B	2'x4' acoustical ceiling tile - plain face	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10060437_0029					Dissolved
8-14-AF-543A	Caulk at window surround - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0030					Ashed
8-14-AF-543B	Caulk at window surround - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0031					Ashed
8-14-AF-544A	Carpet adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060437_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-544B	Carpet adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060437_0033					Dissolved
8-14-AF-545A	Sink under coating - cream	**None Detected**	**10% Cellulose**	**90% Other**	Cream Non-Fibrous Homogeneous
10060437_0034					Dissolved
8-14-AF-545B	Sink under coating - cream	**None Detected**	**10% Cellulose**	**90% Other**	Cream Non-Fibrous Homogeneous
10060437_0035					Dissolved
8-14-AF-546A	Sealent between window sash in frame - black	**8% Chrysotile**		**92% Other**	Black Non-Fibrous Homogeneous
10060437_0036					Ashed
8-14-AF-546B	Sealent between window sash in frame - black	**Not Analyzed**			
10060437_0037					
8-14-AF-548A	Caulk at window frame / wall panel junction - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10060437_0038					Ashed
8-14-AF-548B	Caulk at window frame / wall panel junction - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10060437_0039					Ashed
8-14-AF-549A	window glazing compound in viewing window - black (D-side)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0040					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-549A	window glazing compound in viewing window - black (D-side)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0041					Ashed
8-14-AF-550A	Caulk at angle iron seams - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10060437_0042					Ashed
8-14-AF-550B	Caulk at angle iron seams - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10060437_0043					Ashed
8-14-AF-551A	Whool packing around jet exhaust - white	**None Detected**	**90% Fiber Glass**	**10% Other**	White Fibrous Homogeneous
10060437_0044					Ashed
8-14-AF-551B	Whool packing around jet exhaust - white	**None Detected**	**90% Fiber Glass**	**10% Other**	White Fibrous Homogeneous
10060437_0045					Ashed
8-14-AF-552A	Nylon jacket over whool packing around jet exhaust - gray	**None Detected**	**20% Fiber Glass**	**80% Other**	Gray Fibrous Homogeneous
10060437_0046					Ashed
8-14-AF-552B	Nylon jacket over whool packing around jet exhaust - gray	**None Detected**	**20% Fiber Glass**	**80% Other**	Gray Fibrous Homogeneous
10060437_0047					Ashed
8-14-AF-553A	Tar on metal roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0048					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-553B	Tar on metal roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0049					Ashed
8-14-AF-554A	Top layer roofing canvas over tar - metalic	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10060437_0050					Ashed
8-14-AF-554B	Top layer roofing canvas over tar - metalic	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Homogeneous
10060437_0051					Ashed
8-14-AF-555A	Caulk at metal wall pannel / grate junction at stack - white / hard	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0052					Dissolved
8-14-AF-555B	Caulk at metal wall pannel / grate junction at stack - white / hard	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060437_0053					Dissolved
8-14-AF-556A	Gasket behind screws through metal wall panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0054					Ashed
8-14-AF-556B	Gasket behind screws through metal wall panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0055					Ashed
8-14-AF-557A	Tar paper on metal rood deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0056					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-14-AF-557B	Tar paper on metal rood deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0057					Ashed
8-14-AF-558A	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0058					Ashed
8-14-AF-558B	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0059					Ashed
8-14-AF-559A	Window glazing compound in control gauge window under tank - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0060					Ashed
8-14-AF-559B	Window glazing compound in control gauge window under tank - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060437_0061					Ashed
8-14-AF-560A	Coating on power output box - white	**None Detected**	**10% Fiber Glass**	**90% Other**	White Non-Fibrous Homogeneous
10060437_0062					Ashed
8-14-AF-560B	Coating on power output box - white	**None Detected**	**10% Fiber Glass**	**90% Other**	White Non-Fibrous Homogeneous
10060437_0063					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (63)
Analyst

Approved Signatory

10060437

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-13-AF-528A		Sheet rock (wall)	Rm 1-01
8-14-AF-528B		Sheet rock (wall)	Rm 2-11
8-13-AF-529A		Joint compound associated with sheet rock wall - white	Rm 1-01
8-14-AF-529B		Joint compound associated with sheet rock wall - white	Rm 2-11
8-13-AF-530A		4" vinyl cove base adhesive - yellow	Rm 1-01
8-14-AF-530B		4" vinyl cove base adhesive - yellow	Rm 2-11
8-13-AF-531A		4" vinyl cove base - gray	Rm 1-01
8-13-AF-532A		4" vinyl cove base - white	Rm 1-01
8-13-AF-532B		4" vinyl cove base - white	St-1
8-13-AF-533A		1/8" gasket material - green (stored)	Rm 1-01
8-13-AF-533B		1/8" gasket material - green (stored)	Rm 1-01
8-13-AF-534A		1/32" gasket material - black (stored)	Rm 1-01
8-13-AF-534A		1/32" gasket material - black (stored)	Rm 1-01
8-14-AF-535A		Floor tile mastic - white	Rm 1-02
8-14-AF-535B		Floor tile mastic - white	Rm 2-11
8-14-AF-536A		12"x12" vinyl floor tile - light blue	Rm 1-02
8-14-AF-536B		12"x12" vinyl floor tile - light blue	Rm 2-11

Accepted ☐

Rejected ☐

Relinquished By

Received By

8/20 10:50

0437

8-14-AF-537A		2'x4' acoustical ceiling tile - pin hole & fissure	Rm 1-02
8-14-AF-537B		2'x4' acoustical ceiling tile - pin hole & fissure	Rm 2-11
8-14-AF-538A		12"x12" vinyl floor tile - white with gray specs	Rm 1-03
8-14-AF-538B		12"x12" vinyl floor tile - white with gray specs	Rm 1-03
8-14-AF-539A		2'x4' acoustical ceiling tile - pin hole & crater	Rm 1-03
8-14-AF-539B		2'x4' acoustical ceiling tile - pin hole & crater	Rm 1-05
8-14-AF-540A		Mud base associated with 6"x6" gray quary tile - gray	Rm 1-05
8-14-AF-540B		Mud base associated with 6"x6" gray quary tile - gray	Rm 2-06
8-14-AF-541A		Grout associated with 6"x6" gray quary tile - gray	Rm 1-05
8-14-AF-541B		Grout associated with 6"x6" gray quary tile - gray	Rm 2-06
8-14-AF-542A		2'x4' acoustical ceiling tile - plain face	Rm 2-06
8-14-AF-542B		2'x4' acoustical ceiling tile - plain face	Rm 2-06
8-14-AF-543A		Caulk at window surround - black	Rm 2-07
8-14-AF-543B		Caulk at window surround - black	Rm 2-07
8-14-AF-544A		Carpet adhesive - yellow	Rm 2-10
8-14-AF-544B		Carpet adhesive - yellow	Rm 2-10
8-14-AF-545A		Sink under coating - cream	Rm 2-11
8-14-AF-545B		Sink under coating - cream	Rm 2-11
8-14-AF-546A		Sealent between window sash in frame - black	Rm 2-10
8-14-AF-546B		Sealent between window sash in frame - black	Rm 2-10
8-14-AF-548A		Caulk at window frame / wall panel junction - brown	Façade C
8-14-AF-548B		Caulk at window frame / wall panel junction - brown	Façade C
8-14-AF-549A		window glazing compound in viewing window - black (D-side)	Turbo jet 14
8-14-AF-549A		window glazing compound in viewing window - black (D-side)	Turbo jet 13
8-14-AF-550A		Caulk at angle iron seams - brown	Turbo jet 14
8-14-AF-550B		Caulk at angle iron seams - brown	Turbo jet 12
8-14-AF-551A		Whool packing around jet exhaust - white	Turbo jet 14
8-14-AF-551B		Whool packing around jet exhaust - white	Turbo jet 12
8-14-AF-552A		Nylon jacket over whool packing around jet exhaust - gray	Turbo jet 14
8-14-AF-552B		Nylon jacket over whool packing around jet exhaust - gray	Turbo jet 12
8-14-AF-553A		Tar on metal roof deck - black	Turbo jet 14
8-14-AF-553B		Tar on metal roof deck - black	Turbo jet 12
8-14-AF-554A		Top layer roofing canvas over tar - metalic	Turbo jet 14
8-14-AF-554B		Top layer roofing canvas over tar - metalic	Turbo jet 12

Relinquished By

Received By

8-14-AF-555A		Caulk at metal wall pannel / grate junction at stack - white / hard	Turbo jet 14
8-14-AF-555B		Caulk at metal wall pannel / grate junction at stack - white / hard	Turbo jet 12
8-14-AF-556A		Gasket behind screws through metal wall panels - black	Turbo jet 14
8-14-AF-556B		Gasket behind screws through metal wall panels - black	Turbo jet 14
8-14-AF-557A		Tar paper on metal rood deck - black	Tubro jet 14 control rm roof
8-14-AF-557B		Tar paper on metal rood deck - black	Tubro jet 14 control rm roof
8-14-AF-558A		Reglet caulk - black	Tubro jet 14 control rm roof
8-14-AF-558B		Reglet caulk - black	Tubro jet 14 control rm roof
8-14-AF-559A		Window glazing compound in control gauge window under tank - black	Turbo jet 14 control rm
8-14-AF-559B		Window glazing compound in control gauge window under tank - black	Turbo jet 14 control rm
8-14-AF-560A		Coating on power output box - white	Turbo jet 12 control rm roof
8-14-AF-560B		Coating on power output box - white	Turbo jet 12 control rm roof

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines

Lab Order ID: **10060437**
Analysis: TBS
Date Received: 09/12/2024
Date Reported: 09/13/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-14-AF-544A *10060437_0032*	**Carpet adhesive - yellow**	**30.%**	**0%**	None Detected	
8-14-AF-545A *10060437_0034*	**Sink under coating - cream**	**37%**	**0%**	None Detected	
8-14-AF-553A *10060437_0048*	**Tar on metal roof deck - black**	**81%**	**0%**	None Detected	
8-14-AF-558A *10060437_0058*	**Reglet caulk - black**	**76%**	**0%**	None Detected	
8-14-AF-559A *10060437_0060*	**Window glazing compound in control gauge window under tan**	**66%**	**30.%**	None Detected	
8-14-AF-560A *10060437_0062*	**Coating on power output box - white**	**68%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (6)
Analyst

Approved Signatory

1006043TEM
9/12/24
CK
7:41 AM

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Jet shop & jet turbines
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	TEM: Chatfield
TurnAroundTime:	24 Hour

"Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<

8-14-AF-544A		Carpet adhesive - yellow	Rm 2-10
8-14-AF-545A		Sink under coating - cream	Rm 2-11
8-14-AF-553A		Tar on metal roof deck - black	Turbo jet 14
8-14-AF-558A		Reglet caulk - black	Tubro jet 14 control rm roof
8-14-AF-559A		Window glazing compound in control gauge window under tank - black	Turbo jet 14 control rm
8-14-AF-560A		Coating on power output box - white	Turbo jet 12 control rm roof

>>

Relinquished By

Received By

PBF

LIME SLURRY & STACK

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Lime Slurry and Stack

Lab Order ID: **10062047**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-29-AF-653A	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0001					Dissolved, Ashed
8-29-AF-653B	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0002					Ashed, Dissolved
8-29-AF-653C	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0003					Ashed, Dissolved
8-29-AF-654A	Residual door frame caulk	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10062047_0004					Ashed
8-29-AF-654B	Residual door frame caulk	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10062047_0005					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (5)
Analyst

Approved Signatory

10062047

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Lime Slurry and Stack
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/6/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-29-AF-653A		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-653B		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-653C		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-654A		Residual door frame caulk	Stack
8-29-AF-654B		Residual door frame caulk	Stack

Accepted ☒

Rejected ☐

Relinquished By

9/9 10.2

Received By

PBF

NORTHEAST UTILITIES BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-1-AF-295C	Electrical wire coating on >.25" lines - white	**25% Chrysotile**	**10% Cellulose**	**65% Other**	Gray Fibrous Homogeneous
10059567_0001					Teased
8-1-AF-377A	6" Transite electrical conduit	**10% Chrysotile** **5% Crocidolite**		**85% Other**	Gray Fibrous Homogeneous
10059567_0002					Dissolved, Crushed
8-5-AF-377B	6" Transite electrical conduit	**Not Analyzed**			
10059567_0003					
8-1-AF-304C	Transite pannel	**15% Chrysotile**		**85% Other**	Gray Fibrous Homogeneous
10059567_0004					Dissolved
8-1-AF-378A	Sealent in interior duct work seams - red	**None Detected**	**10% Wollastonite** **5% Fiber Glass**	**85% Other**	Gray Fibrous Homogeneous
10059567_0005					Ashed
8-1-AF-378B	Sealent in interior duct work seams - red	**None Detected**	**10% Wollastonite** **5% Fiber Glass**	**85% Other**	Gray Fibrous Homogeneous
10059567_0006					Ashed
8-1-AF-379A	Tar like flooring - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0007					Dissolved
8-1-AF-379B	Tar like flooring - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0008					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-1-AF-380A	Plaster rough coat wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0009					Dissolved
8-5-AF-380B	Plaster rough coat wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0010					Dissolved
8-6-AF-380C	Plaster rough coat wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0011					Dissolved
8-6-AF-380D	Plaster rough coat wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0012					Dissolved
8-7-AF-380E	Plaster rough coat wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0013					Dissolved
8-1-AF-381A	Plaster skim coat wall - white	**None Detected**	**2% Other**	**98% Other**	White Fibrous Homogeneous
10059567_0014					Dissolved
8-5-AF-381B	Plaster skim coat wall - white	**None Detected**	**2% Other**	**98% Other**	White Fibrous Homogeneous
10059567_0015					Dissolved
8-6-AF-381C	Plaster skim coat wall - white	**None Detected**	**2% Other**	**98% Other**	White Fibrous Homogeneous
10059567_0016					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-6-AF-381D	Plaster skim coat wall - white	**None Detected**	**2% Other**	**98% Other**	White Fibrous Homogeneous
10059567_0017					Dissolved
8-7-AF-381E	Plaster skim coat wall - white	**None Detected**	**2% Other**	**98% Other**	White Fibrous Homogeneous
10059567_0018					Dissolved
8-1-AF-382A	Patching cement at conduit penetrations - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0019					Dissolved
8-1-AF-382B	Patching cement at conduit penetrations - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0020					Dissolved
8-1-AF-383A	Poured composite flooring - speckled / blue	**None Detected**		**80% Other** **20% Ceramic**	Blue, White Non-Fibrous Homogeneous
10059567_0021					Dissolved
8-1-AF-383B	Poured composite flooring - speckled / blue	**None Detected**		**80% Other** **20% Quartz**	White, Blue Non-Fibrous Homogeneous
10059567_0022					Dissolved
8-1-AF-384A	Window frame caulk - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0023					Ashed
8-1-AF-384B	Window frame caulk - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-1-AF-385A	Tar moisture barrier on interior facing exterior brick - black (at north end of building)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0025					Dissolved
8-1-AF-385B	Tar moisture barrier on interior facing exterior brick - black (at north end of building)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0026					Dissolved
8-5-AF-385C	Tar moisture barrier on interior facing exterior brick - black (at north end of building)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0027					Dissolved
8-6-AF-385D	Tar moisture barrier on interior facing exterior brick - black (at north end of building)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0028					Dissolved
8-1-AF-386A	Window glazing compound in partition windows - black	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0029					Ashed
8-1-AF-386B	Window glazing compound in partition windows - black	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0030					Ashed
8-1-AF-387A	Thinset associated with 6"x6" wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0031					Dissolved
8-1-AF-387B	Thinset associated with 6"x6" wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0032					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-1-AF-388A	Grout associated with 6"x6" wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0033					Dissolved
8-1-AF-388B	Grout associated with 6"x6" wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0034					Dissolved
8-1-AF-389A	Flooring leveler - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0035					Dissolved
8-1-AF-389B	Flooring leveler - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0036					Dissolved
8-1-AF-390A	Floor tile mastic - black	**2% Chrysotile**		**98% Other**	Black Fibrous Homogeneous
10059567_0037					Dissolved
8-6-AF-390B	Floor tile mastic - black	**Not Analyzed**			
10059567_0038					
8-7-AF-390C	Floor tile mastic - black	**Not Analyzed**			
10059567_0039					
8-1-AF-391A	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059567_0040					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-6-AF-391B	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059567_0041					Dissolved
8-1-AF-392A	Gypsum board (wall)	**None Detected**	**10% Cellulose**	**90% Gypsum**	Brown, Gray Fibrous Heterogeneous
10059567_0042					Teased
8-7-AF-392B	Gypsum board (ceiling backer)	**None Detected**	**10% Cellulose**	**90% Gypsum**	Brown, Gray Fibrous Heterogeneous
10059567_0043					Teased
8-1-AF-393A	Joint compound associated with gypsum wall board - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0044					Dissolved
8-1-AF-393B	Joint compound associated with gypsum wall board - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0045					Dissolved
8-5-AF-394A	12"x12" vinyl floor tile - maroon with beige specs	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0046					Dissolved
8-5-AF-394B	12"x12" vinyl floor tile - maroon with beige specs	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0047					Dissolved
8-5-AF-395A	Skim coat on lath behind chair rail - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0048					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-5-AF-395B	Skim coat on lath behind chair rail - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0049					Dissolved
8-5-AF-395C	Skim coat on lath behind chair rail - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0050					Dissolved
8-5-AF-191B	Black ceramic Insulator	**None Detected**		**100% Other**	Black, White Non-Fibrous Homogeneous
10059567_0051					Crushed
8-6-AF-191C	Black ceramic Insulator	**None Detected**		**100% Other**	Black, White Non-Fibrous Homogeneous
10059567_0052					Crushed
8-5-AF-190B	Stall conduit backer plate	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0053					Crushed, Dissolved
8-6-AF-190C	Stall conduit backer plate	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0054					Dissolved, Crushed
8-5-AF-189B	Cementirious stall wall	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0055					Dissolved
8-6-AF-189C	Cementirious stall wall	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0056					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-5-AF-396A	Grout associated with stall conduit backer plate - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0057					Dissolved
8-6-AF-396B	Grout associated with stall conduit backer plate - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0058					Dissolved
8-5-AF-397A	Ceramic conduit through stall backer plate - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0059					Crushed
8-6-AF-397B	Ceramic conduit through stall backer plate - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0060					Crushed
8-5-AF-398A	Skim coat over concrete stalls - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0061					Crushed
8-6-AF-398B	Skim coat over concrete stalls - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0062					Crushed
8-6-AF-398C	Skim coat over concrete stalls - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0063					Dissolved
8-5-AF-399A	Mortar associated with cementitious block behind skim coat - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0064					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-6-AF-399B	Mortar associated with cementitious block behind skim coat - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0065					Dissolved
8-5-AF-400A	Cementitious block at stall walls behind skim coat - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0066					Dissolved
8-6-AF-400B	Cementitious block at stall walls behind skim coat - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0067					Dissolved
8-5-AF-401A	Felt paper between ceramic insulator and capacitor - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059567_0068					Dissolved
8-6-AF-401B	Felt paper between ceramic insulator and capacitor - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059567_0069					Dissolved
8-5-AF-402A	Protective paper over capacitor - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059567_0070					Dissolved
8-6-AF-402B	Protective paper over capacitor - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059567_0071					Dissolved
8-5-AF-403A	Interior paper in capacitor - white	**70% Chrysotile**	**20% Synthetic Fibers**	**10% Other**	Gray Fibrous Homogeneous
10059567_0072					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-6-AF-403B	Interior paper in capacitor - white	**Not Analyzed**			
10059567_0073					
8-5-AF-404A	Tar at conduit penetration - black	**5% Chrysotile**		**95% Other**	Black Fibrous Homogeneous
10059567_0074					Dissolved
8-5-AF-404B	Tar at conduit penetration - black	**Not Analyzed**			
10059567_0075					
8-5-AF-405A	Mastic at duct work penetraion through wall - black	**5% Chrysotile**		**95% Other**	Black Fibrous Homogeneous
10059567_0076					Dissolved
8-5-AF-405B	Mastic at duct work penetraion through wall - black	**Not Analyzed**			
10059567_0077					
8-5-AF-406A	Expansion board at 1938 addition building junction - black (verticle & horizontal)	**4% Chrysotile**		**96% Other**	Black, Brown Fibrous Homogeneous
10059567_0078					Dissolved
8-5-AF-406B	Expansion board at 1938 addition building junction - black (verticle & horizontal)	**Not Analyzed**			
10059567_0079					
8-6-AF-406C	Expansion board at 1938 addition building junction - black (verticle & horizontal)	**Not Analyzed**			
10059567_0080					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-5-AF-407A	Foam at conduit penetrations through exterior walls - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0081					Ashed
8-5-AF-407B	Foam at conduit penetrations through exterior walls - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0082					Ashed
8-5-AF-408A	Cementitious conduit backer plate at exterior wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0083					Dissolved
8-5-AF-408B	Cementitious conduit backer plate at exterior wall - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0084					Dissolved
8-5-AF-409A	Tar coating on metal conduits - brown	**2% Chrysotile** **2% Crocidolite**		**96% Other**	Brown, Black Fibrous Homogeneous
10059567_0085					Dissolved
8-5-AF-409B	Tar coating on metal conduits - brown	**Not Analyzed**			
10059567_0086					
8-5-AF-217K	Soft pack pipe insulation - gray	**None Detected**	**60% Mineral Wool**	**40% Other**	Gray Fibrous Homogeneous
10059567_0087					Dissolved
8-5-AF-410A	Mastic at fiberglass end caps - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0088					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-5-AF-410B	Mastic at fiberglass end caps - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0089					Dissolved
8-5-AF-411A	Pipe dope on 3" diameter pipes - white	**None Detected**	**5% Fiber Glass** **5% Wollastonite**	**90% Other**	Tan Fibrous Homogeneous
10059567_0090					Dissolved
8-5-AF-411B	Pipe dope on 3" diameter pipes - white	**None Detected**	**5% Wollastonite** **5% Fiber Glass**	**90% Other**	Tan Fibrous Homogeneous
10059567_0091					Ashed
8-5-AF-412A	Cloth flex connector - white	**None Detected**	**95% Cellulose**	**5% Other**	Tan Fibrous Homogeneous
10059567_0092					Teased
8-5-AF-412B	Cloth flex connector - white	**None Detected**	**95% Cellulose**	**5% Other**	Tan Fibrous Homogeneous
10059567_0093					Dissolved
8-5-AF-413A	Door frame caulk - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0094					Dissolved
8-5-AF-413B	Door frame caulk - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0095					Dissolved
8-5-AF-414A	Debris on stored pipe - gray / soft	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0096					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-5-AF-414B	Debris on stored pipe - gray / soft	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0097					Dissolved
8-5-AF-415A	12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0098					Dissolved
8-5-AF-415B	12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0099					Dissolved
8-6-AF-X416A	Terracotta block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0100					Dissolved
8-7-AF-X416B	Terracotta block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0101					Dissolved
8-6-AF-417A	Joint compound on brick behind plaster rough coat - cream	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0102					Dissolved
8-6-AF-417B	Joint compound on brick behind plaster rough coat - cream	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0103					Dissolved
8-6-AF-418A	9"x9" vinyl floor tile - maroon with checker board pattern	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0104					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-6-AF-418B	9"x9" vinyl floor tile - maroon with checker board pattern	**Not Analyzed**			
10059567_0105					
8-6-AF-419A	12"x12" vinyl floor tile - white with gray streaks	**2% Chrysotile**		**98% Other**	Gray Non-Fibrous Homogeneous
10059567_0106	*unable to separate mastic*				Dissolved
8-6-AF-419B	12"x12" vinyl floor tile - white with gray streaks	**Not Analyzed**			
10059567_0107					
8-6-AF-420A	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059567_0108					Dissolved
8-6-AF-420B		**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059567_0194	*not on coc*				Dissolved
8-6-AF-421A	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0109					Ashed
8-6-AF-421A	4" vinyl cove base - gray	**None Detected**		**100% Quartz**	Gray Non-Fibrous Homogeneous
10059567_0110					Ashed
8-6-AF-422A	Gypsum wall board over plaster	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0111	*joint compound only*				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-6-AF-422B	Gypsum wall board over plaster	**None Detected**	**10% Cellulose**	**90% Other**	Gray Non-Fibrous Homogeneous
10059567_0112					Crushed
8-6-AF-423A	Joint compound associated with gypsum wall board over plaster - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0113					Crushed
8-6-AF-423B	Joint compound associated with gypsum wall board over plaster - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0114					Crushed
8-6-AF-424A	2'x4' acoustical ceiling tile - pin hole & fissure pattern	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Other** **10% Perlite**	Gray Fibrous Homogeneous
10059567_0115					Ashed
8-6-AF-424B	2'x4' acoustical ceiling tile - pin hole & fissure pattern	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Perlite** **10% Other**	Gray Fibrous Homogeneous
10059567_0116					Ashed
8-6-AF-425A	Mastic at stall ceilings - brown	**5% Chrysotile**		**95% Other**	Brown Non-Fibrous Homogeneous
10059567_0117					Dissolved
8-6-AF-425B	Mastic at stall ceilings - brown	**Not Analyzed**			
10059567_0118					
8-6-AF-426A	Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	**5% Chrysotile**		**95% Other**	Gray, Black Non-Fibrous Homogeneous
10059567_0119					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-6-AF-426B	Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	**Not Analyzed**			
10059567_0120					
8-6-AF-427A	Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	**60% Chrysotile**		**40% Other**	Gray Fibrous Homogeneous
10059567_0121					Teased
8-6-AF-427B	Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	**Not Analyzed**			
10059567_0122					
8-6-AF-429A	Sealant in interior duct seams - yellow	**None Detected**	**5% Wollastonite**	**95% Other**	Yellow, Tan Non-Fibrous Homogeneous
10059567_0123					Dissolved
8-6-AF-429B	Sealant in interior duct seams - yellow	**None Detected**	**5% Fiber Glass**	**95% Other**	Tan, Yellow Non-Fibrous Homogeneous
10059567_0124					Dissolved
8-6-AF-430A	9"x9" vinyl floor tile - black	**8% Chrysotile**		**92% Other**	Black, Brown Non-Fibrous Homogeneous
10059567_0125					Dissolved
8-6-AF-430B	9"x9" vinyl floor tile - black	**Not Analyzed**			
10059567_0126					
8-6-AF-431A	Adhesive behind gypsum board on plaster - black	**None Detected**	**15% Cellulose**	**85% Other**	Black Non-Fibrous Homogeneous
10059567_0127					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-6-AF-431B	Adhesive behind gypsum board on plaster - black	**None Detected**	**15% Cellulose**	**85% Other**	Black Non-Fibrous Homogeneous
10059567_0128					Dissolved
8-6-AF-432A	Cloth wrap over hard pack pipe insulation - white (residual)	**5% Chrysotile**	**70% Fiber Glass**	**25% Other**	White Fibrous Homogeneous
10059567_0129					Dissolved
8-6-AF-432B	Cloth wrap over hard pack pipe insulation - white (residual)	**Not Analyzed**			
10059567_0130					
8-6-AF-433A	Hard pack pipe insulation on water line to radiator - white (residual)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059567_0131					Teased
8-6-AF-433B	Hard pack pipe insulation on water line to radiator - white (residual)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059567_0132					Teased
8-6-AF-188B	Stall shelf - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0133					Crushed
8-6-AF-X241C	Window glazing compound in reinforced chicken wire windows - white	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10059567_0134					Crushed, Dissolved
8-6-AF-434A	<.25" Wire coating in switch boxes - white	**30% Chrysotile**		**70% Other**	Black Non-Fibrous Homogeneous
10059567_0135					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-6-AF-434B	<.25" Wire coating in switch boxes - white	**Not Analyzed**			
10059567_0136					
8-7-AF-435A	9"x9" vinyl floor tile - beige	**6% Chrysotile**		**94% Other**	Tan Non-Fibrous Homogeneous
10059567_0137					Dissolved
8-7-AF-435B	9"x9" vinyl floor tile - beige	**Not Analyzed**			
10059567_0138					
8-7-AF-436A	Mud base associated with 6"x6" ceramic tile at window sills - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0139					Crushed
8-7-AF-436B	Mud base associated with 6"x6" ceramic tile at window sills - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0140					Crushed
8-7-AF-437A	Grout associated with 6"x6" ceramic tile at window sills - gray	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0141					Crushed
8-7-AF-437B	Grout associated with 6"x6" ceramic tile at window sills - gray	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0142					Crushed
8-7-AF-438A	Thinset associated with 6" ceramic cove base - white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Heterogeneous
10059567_0143					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-7-AF-438B	Thinset associated with 6" ceramic cove base - white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Heterogeneous
10059567_0144					Crushed
8-7-AF-439A	Sheet rock at windows	**None Detected**	**10% Cellulose**	**90% Other**	Gray Non-Fibrous Homogeneous
10059567_0145					Crushed
8-7-AF-439B	Sheet rock at windows	**None Detected**	**10% Cellulose**	**90% Other**	Gray Non-Fibrous Homogeneous
10059567_0146					Crushed
8-7-AF-440A	Joint compound associated with sheetrock at windows - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0147					Crushed
8-7-AF-440B	Joint compound associated with sheetrock at windows - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0148					Crushed
8-7-AF-441A	Soap stone shower surround - black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10059567_0149					Crushed
8-7-AF-441B	Soap stone shower surround - black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10059567_0150					Crushed
8-7-AF-442A	Caulk at soap stone pannel seams - black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059567_0151					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-7-AF-442B	Caulk at soap stone pannel seams - black	**Not Analyzed**			
10059567_0152					
8-7-AF-248C	Window glazing compound in plain sash windows - white	**None Detected**		**100% Other**	Red, Tan Non-Fibrous Heterogeneous
10059567_0153					Crushed, Dissolved
8-7-AF-444A	Cork floor tile mastic - white	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10059567_0154					Dissolved
8-7-AF-444B	Cork floor tile mastic - white	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10059567_0155					Dissolved
8-7-AF-445A	Mud set associated with 6"x4" blue composite glazed wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0156					Crushed
8-7-AF-445B	Mud set associated with 6"x4" blue composite glazed wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0157					Crushed
8-7-AF-446A	Grout associated with 6"x4" blue composite glazed wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0158					Crushed
8-7-AF-446B	Grout associated with 6"x4" blue composite glazed wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0159					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-7-AF-447A	6"x4" blue painted red composite material glazed wall tile	**None Detected**		**100% Other**	Red, Gray Non-Fibrous Heterogeneous
10059567_0160					Crushed
8-7-AF-447B	6"x4" blue painted red composite material glazed wall tile	**None Detected**		**100% Other**	Gray, Red Non-Fibrous Heterogeneous
10059567_0161					Crushed
8-7-AF-303D	Electrical wire coating on <.25" lines - white	**50% Chrysotile**		**50% Other**	Gray, Black Fibrous Homogeneous
10059567_0162					Teased
8-7-AF-448A	Resin on secondary current transformers - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0163					Dissolved
8-7-AF-448B	Resin on secondary current transformers - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059567_0164					Dissolved
8-7-AF-449A	Non-conductive backer pannel board for electric circuts - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0165					Crushed
8-7-AF-449B	Non-conductive backer pannel board for electric circuts - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0166					Crushed
8-7-AF-450A	Residual flooring mastic on wood planking - yellow	**None Detected**	**40% Cellulose**	**60% Other**	Yellow Non-Fibrous Homogeneous
10059567_0167					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-7-AF-450B	Residual flooring mastic on wood planking - yellow	**None Detected**	**40% Cellulose**	**60% Other**	Yellow Non-Fibrous Homogeneous
10059567_0168					Dissolved
8-7-AF-452A	Glue daubs associated with 1'x1' acoustical ceiling tile - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0169					Dissolved
8-7-AF-452B	Glue daubs associated with 1'x1' acoustical ceiling tile - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059567_0170					Dissolved
8-7-AF-453A	1'x1' acoustical ceiling tile - worm hole pattern	**None Detected**	**95% Fiber Glass**	**5% Other**	White, Tan Fibrous Homogeneous
10059567_0171					Ashed
8-7-AF-453B	1'x1' acoustical ceiling tile - worm hole pattern	**None Detected**	**95% Cellulose**	**5% Other**	Tan, White Fibrous Homogeneous
10059567_0172					Ashed
8-7-AF-454A	2'x2' acoustical ceiling tile - rough face	**None Detected**	**70% Fiber Glass** **20% Mineral Wool**	**10% Other**	Gray Fibrous Homogeneous
10059567_0173					Teased
8-7-AF-454B	2'x2' acoustical ceiling tile - rough face	**None Detected**	**70% Fiber Glass** **20% Mineral Wool**	**10% Other**	Gray Fibrous Homogeneous
10059567_0174					Teased
8-7-AF-455A	Wrap over electrical conduit in air shaft - white	**70% Chrysotile**		**30% Other**	Gray Fibrous Homogeneous
10059567_0175					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-7-AF-455B	Wrap over electrical conduit in air shaft - white	**Not Analyzed**			
10059567_0176	*not on coc*				
8-8-AF-456A	Verticle caulk over expansion board - gray	**5% Chrysotile**		**95% Other**	Gray Non-Fibrous Homogeneous
10059567_0177					Dissolved
8-8-AF-456B	Verticle caulk over expansion board - gray	**Not Analyzed**			
10059567_0178					
8-8-AF-457A	Exterior window glazing compound in reinforced chicken wire windows - white	**None Detected**		**100% Other**	Beige, Gray Non-Fibrous Homogeneous
10059567_0179					Dissolved
8-8-AF-458A	Exterior window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0180					Ashed
8-8-AF-459A	Exterior door frame caulk - cream	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059567_0181					Dissolved, Crushed
8-8-AF-460A	Caulk at concrete foundation birck wall junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0182					Ashed
8-8-AF-460B	Caulk at concrete foundation birck wall junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059567_0183					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-8-AF-461A	Exterior door frame caulk associated with newer door systems - beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059567_0184					Ashed
8-8-AF-461B	Exterior door frame caulk associated with newer door systems - beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059567_0185					Ashed
8-8-AF-462A	Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	**None Detected**	**10% Cellulose**	**90% Other**	Black Non-Fibrous Homogeneous
10059567_0186					Dissolved
8-8-AF-462B	Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	**None Detected**	**10% Cellulose**	**90% Other**	Black Non-Fibrous Homogeneous
10059567_0187					Dissolved
8-8-AF-463A	Door frame caulk associated with office entry door - dark gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0188					Ashed
8-8-AF-463B	Door frame caulk associated with office entry door - dark gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0189					Ashed
8-8-AF-464A	Window frame caulk associated with office windows - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0190					Ashed
8-8-AF-464B	Window frame caulk associated with office windows - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0191					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-8-AF-465A	Caulk at pre-cast concrete belt course - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0192					Ashed
8-8-AF-465B	Caulk at pre-cast concrete belt course - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059567_0193					Ashed
8-8-AF-398D		**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059567_0196	*not on coc*				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (109)
Megan Javonovich (86)
Analyst

Approved Signatory

10059567

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the*
Fax:	860-585-7034	*bottom Example Tab.*
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
		Enter samples between "<<" and ">>"
Project:	Weston and Sampson - MIRA - Northeast Utilities Building	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in sets Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional*
Date Submitted:	8/9/2024 0:00	*fields that do not show up on the official report, however they will be included*
Analysis:	PLM EPA 600R-93/116	*in the electronic data returned to you*
TurnAroundTime:	5 Day	*to facilitate your reintegration of the report data.*

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-1-AF-295C		Electrical wire coating on >.25" lines - white	Rm 00-02 Elevation 11'
8-1-AF-377A		6" Transite electrical conduit	Rm 00-02 Elevation 11'
8-5-AF-377B		6" Transite electrical conduit	Rm 1-25 Elevation 37'
8-1-AF-304C		Transite pannel	Rm 00-02 Elevation 11'
8-1-AF-378A		Sealent in interior duct work seams - red	Rm 00-02 Elevation 11'
8-1-AF-378B		Sealent in interior duct work seams - red	Rm 00-02 Elevation 11'
8-1-AF-379A		Tar like flooring - black	Rm 0-05
8-1-AF-379B		Tar like flooring - black	Rm 0-05
8-1-AF-380A		Plaster rough coat wall - gray	Rm 0-07
8-5-AF-380B		Plaster rough coat wall - gray	Rm 1-17 Elevation 37'
8-6-AF-380C		Plaster rough coat wall - gray	Rm 2-33
8-6-AF-380D		Plaster rough coat wall - gray	Rm 3-34 Elevation 56'.25"
8-7-AF-380E		Plaster rough coat wall - gray	Rm 5-50 Elevation 83".75"

Accepted ☐

Rejected ☐

Relinquished By

Received By 8/12 10:30

8-1-AF-381A		Plaster skim coat wall - white	Rm 0-07
8-5-AF-381B		Plaster skim coat wall - white	Rm 1-17 Elevation 37'
8-6-AF-381C		Plaster skim coat wall - white	Rm 2-33
8-6-AF-381D		Plaster skim coat wall - white	Rm 3-34 Elevation 56'.25"
8-7-AF-381E		Plaster skim coat wall - white	Rm 5-50 Elevation 83".75"
8-1-AF-382A		Patching cement at conduit penetrations - gray	Rm 0-09
8-1-AF-382B		Patching cement at conduit penetrations - gray	Rm 0-09
8-1-AF-383A		Poured composite flooring - speckled / blue	Rm 0-10
8-1-AF-383B		Poured composite flooring - speckled / blue	Rm 0-10
8-1-AF-384A		Window frame caulk - white	Rm 0-11
8-1-AF-384B		Window frame caulk - white	Rm 0-11
8-1-AF-385A		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 0-12
8-1-AF-385B		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 0-12
8-5-AF-385C		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 1-17 Elevation 37'
8-6-AF-385D		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 2-33
8-1-AF-386A		Window glazing compound in partition windows - black	Rm 1-13 Elevation 37'
8-1-AF-386B		Window glazing compound in partition windows - black	Rm 1-13 Elevation 37'
8-1-AF-387A		Thinset associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-387B		Thinset associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-388A		Grout associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-388B		Grout associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-389A		Flooring leveler - white	Rm 1-15 Elevation 37'
8-1-AF-389B		Flooring leveler - white	Rm 1-15 Elevation 37'
8-1-AF-390A		Floor tile mastic - black	Rm 1-15 Elevation 37'
8-6-AF-390B		Floor tile mastic - black	Rm 3-34 Elevation 56'.25"
8-7-AF-390C		Floor tile mastic - black	Rm 5-50 Elevation 83".75"
8-1-AF-391A		Floor tile mastic - yellow	Rm 1-15 Elevation 37'
8-6-AF-391B		Floor tile mastic - yellow	Rm 3-34 Elevation 56'.25"
8-1-AF-392A		Gypsum board (wall)	Rm 1-16 Elevation 37'
8-7-AF-392B		Gypsum board (ceiling backer)	Rm 5-58 Elevation 83'.75"

Relinquished By

Received By

8-1-AF-393A		Joint compound associated with gypsum wall board - white	Rm 1-16 Elevation 37'
8-1-AF-393B		Joint compound associated with gypsum wall board - white	Rm 1-16 Elevation 37'
8-5-AF-394A		12"x12" vinyl floor tile - maroon with beige specs	Rm 1-17 Elevation 37'
8-5-AF-394B		12"x12" vinyl floor tile - maroon with beige specs	Rm 1-17 Elevation 37'
8-5-AF-395A		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-395B		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-395C		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-191B		Black ceramic Insulator	Rm 1-19 Elevation 37'
8-6-AF-191C		Black ceramic Insulator	Rm 3-34 Elevation 56'.25"
8-5-AF-190B		Stall conduit backer plate	Rm 1-19 Elevation 37'
8-6-AF-190C		Stall conduit backer plate	Rm 3-34 Elevation 56'.25"
8-5-AF-189B		Cementirious stall wall	Rm 1-19 Elevation 37'
8-6-AF-189C		Cementirious stall wall	Rm 3-34 Elevation 56'.25"
8-5-AF-396A		Grout associated with stall conduit backer plate - gray	Rm 1-19 Elevation 37'
8-6-AF-396B		Grout associated with stall conduit backer plate - gray	Rm 3-36 Elevation 56'.25"
8-5-AF-397A		Ceramic conduit through stall backer plate - white	Rm 1-19 Elevation 37'
8-6-AF-397B		Ceramic conduit through stall backer plate - white	Rm 3-36 Elevation 56'.25"
8-5-AF-398A		Skim coat over concrete stalls - gray	Rm 1-19 Elevation 37'
8-6-AF-398B		Skim coat over concrete stalls - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-398C		Skim coat over concrete stalls - gray	Rm 4-44 Elevation 67'.25"
8-5-AF-399A		Mortar associated with cementitious block behind skim coat - gray	Rm 1-19 Elevation 37'
8-6-AF-399B		Mortar associated with cementitious block behind skim coat - gray	Rm 3-34 Elevation 56'.25"
8-5-AF-400A		Cementitious block at stall walls behind skim coat - gray	Rm 1-19 Elevation 37'
8-6-AF-400B		Cementitious block at stall walls behind skim coat - gray	Rm 3-34 Elevation 56'.25"
8-5-AF-401A		Felt paper between ceramic insulator and capacitor - black	Rm 1-19 Elevation 37'
8-6-AF-401B		Felt paper between ceramic insulator and capacitor - black	Rm 3-34 Elevation 56'.25"
8-5-AF-402A		Protective paper over capacitor - black	Rm 1-19 Elevation 37'
8-6-AF-402B		Protective paper over capacitor - black	Rm 3-34 Elevation 56'.25"

Relinquished By

Received By

8-5-AF-403A		Interior paper in capacitor - white	Rm 1-19 Elevation 37'
8-6-AF-403B		Interior paper in capacitor - white	Rm 3-34 Elevation 56'.25"
8-5-AF-404A		Tar at conduit penetration - black	Rm 1-22 (tunnel)
8-5-AF-404B		Tar at conduit penetration - black	Rm 1-22 (tunnel)
8-5-AF-405A		Mastic at duct work penetraion through wall - black	Rm 1-22 (tunnel)
8-5-AF-405B		Mastic at duct work penetraion through wall - black	Rm 1-22 (tunnel)
8-5-AF-406A		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 1-24 Elevation 37'
8-5-AF-406B		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 1-24 Elevation 37'
8-6-AF-406C		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 3-36 Elevation 56'.25"
8-5-AF-407A		Foam at conduit penetrations through exterior walls - black	Rm 1-25 Elevation 37'
8-5-AF-407B		Foam at conduit penetrations through exterior walls - black	Rm 1-25 Elevation 37'
8-5-AF-408A		Cementitious conduit backer plate at exterior wall - gray	Rm 1-25 Elevation 37'
8-5-AF-408B		Cementitious conduit backer plate at exterior wall - gray	Rm 1-25 Elevation 37'
8-5-AF-409A		Tar coating on metal conduits - brown	Rm 1-25 Elevation 37'
8-5-AF-409B		Tar coating on metal conduits - brown	Rm 1-25 Elevation 37'
8-5-AF-217K		Soft pack pipe insulation - gray	Rm 1-26 (tunnel)
8-5-AF-410A		Mastic at fiberglass end caps - white	Rm 1-26 (tunnel)
8-5-AF-410B		Mastic at fiberglass end caps - white	Rm 1-26 (tunnel)
8-5-AF-411A		Pipe dope on 3" diameter pipes - white	Rm 1-26 (tunnel)
8-5-AF-411B		Pipe dope on 3" diameter pipes - white	Rm 1-26 (tunnel)
8-5-AF-412A		Cloth flex connector - white	Rm 1-27 Elevation 37'
8-5-AF-412B		Cloth flex connector - white	Rm 1-27 Elevation 37'
8-5-AF-413A		Door frame caulk - white	Rm 1-27 Elevation 37'
8-5-AF-413B		Door frame caulk - white	Rm 1-27 Elevation 37'
8-5-AF-414A		Debris on stored pipe - gray / soft	Rm 1-28 Elevation 37'
8-5-AF-414B		Debris on stored pipe - gray / soft	Rm 1-28 Elevation 37'
8-5-AF-415A		12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	Rm 1-30 Elevation 37'
8-5-AF-415B		12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	Rm 1-30 Elevation 37'
8-6-AF-X416A		Terracotta block mortar - gray	Rm 2-32
8-7-AF-X416B		Terracotta block mortar - gray	St-1

Relinquished By

Received By

9 of 17

8-6-AF-417A		Joint compound on brick behind plaster rough coat - cream	Rm 2-33
8-6-AF-417B		Joint compound on brick behind plaster rough coat - cream	Rm 2-33
8-6-AF-418A		9"x9" vinyl floor tile - maroon with checker board pattern	Rm 3-34 Elevation 56'.25"
8-6-AF-418B		9"x9" vinyl floor tile - maroon with checker board pattern	Rm 4-40 Elevation 67'.25"
8-6-AF-419A		12"x12" vinyl floor tile - white with gray streaks	Rm 3-34 Elevation 56'.25"
8-6-AF-419B		12"x12" vinyl floor tile - white with gray streaks	Rm 4-40 Elevation 67'.25"
8-6-AF-420A		4" vinyl cove base adhesive - yellow	Rm 3-34 Elevation 56'.25"
8-6-AF-421A		4" vinyl cove base - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-421A		4" vinyl cove base - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-422A		Gypsum wall board over plaster	Rm 3-34 Elevation 56'.25"
8-6-AF-422B		Gypsum wall board over plaster	Rm 4-40 Elevation 67'.25"
8-6-AF-423A		Joint compound associated with gypsum wall board over plaster - white	Rm 3-34 Elevation 56'.25"
8-6-AF-423B		Joint compound associated with gypsum wall board over plaster - white	Rm 4-40 Elevation 67'.25"
8-6-AF-424A		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 3-34 Elevation 56'.25"
8-6-AF-424B		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 4-40 Elevation 67'.25"
8-6-AF-425A		Mastic at stall ceilings - brown	Rm 3-36 Elevation 56'.25"
8-6-AF-425B		Mastic at stall ceilings - brown	Rm 3-36 Elevation 56'.25"
8-6-AF-426A		Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	Rm 3-36 Elevation 56'.25"
8-6-AF-426B		Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	Rm 3-36 Elevation 56'.25"
8-6-AF-427A		Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	Rm 3-36 Elevation 56'.25"
8-6-AF-427B		Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	Rm 3-36 Elevation 56'.25"
8-6-AF-429A		Sealant in interior duct seams - yellow	Rm 2-39 Elevation 48'
8-6-AF-429B		Sealant in interior duct seams - yellow	Rm 2-39 Elevation 48'
8-6-AF-430A		9"x9" vinyl floor tile - black	Rm 4-40 Elevation 67'.25"
8-6-AF-430B		9"x9" vinyl floor tile - black	Rm 4-40 Elevation 67'.25"
8-6-AF-431A		Adhesive behind gypsum board on plaster - black	Rm 4-40 Elevation 67'.25"
8-6-AF-431B		Adhesive behind gypsum board on plaster - black	Rm 4-40 Elevation 67'.25"

Relinquished By

Received By

8-6-AF-432A		Cloth wrap over hard pack pipe insulation - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-432B		Cloth wrap over hard pack pipe insulation - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-433A		Hard pack pipe insulation on water line to radiator - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-433B		Hard pack pipe insulation on water line to radiator - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-188B		Stall shelf - blue	Rm 4-44 Elevation 67'.25"
8-6-AF-X241C		Window glazing compound in reinforced chicken wire windows - white	Rm 4-44 Elevation 67'.25"
8-6-AF-434A		<.25" Wire coating in switch boxes - white	Rm 4-44 Elevation 67'.25"
8-6-AF-434B		<.25" Wire coating in switch boxes - white	Rm 4-44 Elevation 67'.25"
8-7-AF-435A		9"x9" vinyl floor tile - beige	Rm 5-50 Elevation 83'.75"
8-7-AF-435B		9"x9" vinyl floor tile - beige	Rm 5-50 Elevation 83'.75"
8-7-AF-436A		Mud base associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-436B		Mud base associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-437A		Grout associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-437B		Grout associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-438A		Thinset associated with 6" ceramic cove base - white	Rm 5-50 Elevation 83'.75"
8-7-AF-438B		Thinset associated with 6" ceramic cove base - white	Rm 5-50 Elevation 83'.75"
8-7-AF-439A		Sheet rock at windows	Rm 5-50 Elevation 83'.75"
8-7-AF-439B		Sheet rock at windows	Rm 5-50 Elevation 83'.75"
8-7-AF-440A		Joint compound associated with sheetrock at windows - white	Rm 5-50 Elevation 83'.75"
8-7-AF-440B		Joint compound associated with sheetrock at windows - white	Rm 5-50 Elevation 83'.75"
8-7-AF-441A		Soap stone shower surround - black	Rm 5-52 Elevation 83'.75"
8-7-AF-441B		Soap stone shower surround - black	Rm 5-52 Elevation 83'.75"
8-7-AF-442A		Caulk at soap stone pannel seams - black	Rm 5-52 Elevation 83'.75"
8-7-AF-442B		Caulk at soap stone pannel seams - black	Rm 5-52 Elevation 83'.75"
8-7-AF-248C		Window glazing compound in plain sash windows - white	Rm 5-53 Elevation 83'.75"

Relinquished By

Received By

8-7-AF-444A		Cork floor tile mastic - white	Rm 5-57 Elevation 83'.75"
8-7-AF-444B		Cork floor tile mastic - white	Rm 5-57 Elevation 83'.75"
8-7-AF-445A		Mud set associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-445B		Mud set associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-446A		Grout associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-446B		Grout associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-447A		6"x4" blue painted red composite material glazed wall tile	Rm 5-57 Elevation 83'.75"
8-7-AF-447B		6"x4" blue painted red composite material glazed wall tile	Rm 5-57 Elevation 83'.75"
8-7-AF-303D		Electrical wire coating on <.25" lines - white	Rm 5-57 Elevation 83'.75"
8-7-AF-448A		Resin on secondary current transformers - black	Rm 5-57 Elevation 83'.75"
8-7-AF-448B		Resin on secondary current transformers - black	Rm 5-57 Elevation 83'.75"
8-7-AF-449A		Non-conductive backer pannel board for electric circuts - blue	Rm 5-57 Elevation 83'.75"
8-7-AF-449B		Non-conductive backer pannel board for electric circuts - blue	Rm 5-57 Elevation 83'.75"
8-7-AF-450A		Residual flooring mastic on wood planking - yellow	Rm 5-58 Elevation 83'.75"
8-7-AF-450B		Residual flooring mastic on wood planking - yellow	Rm 5-58 Elevation 83'.75"
8-7-AF-452A		Glue daubs associated with 1'x1' acoustical ceiling tile - brown	Rm 5-58 Elevation 83'.75"
8-7-AF-452B		Glue daubs associated with 1'x1' acoustical ceiling tile - brown	Rm 5-58 Elevation 83'.75"
8-7-AF-453A		1'x1' acoustical ceiling tile - worm hole pattern	Rm 5-58 Elevation 83'.75"
8-7-AF-453B		1'x1' acoustical ceiling tile - worm hole pattern	Rm 5-58 Elevation 83'.75"
8-7-AF-454A		2'x2' acoustical ceiling tile - rough face	Rm 5-58 Elevation 83'.75"
8-7-AF-454B		2'x2' acoustical ceiling tile - rough face	Rm 5-58 Elevation 83'.75"
8-7-AF-455A		Wrap over electrical conduit in air shaft - white	St-2
8-7-AF-455B		Wrap over electrical conduit in air shaft - white	St-2

Relinquished By

Received By

8-8-AF-456A		Verticle caulk over expansion board - gray	Façade A
8-8-AF-456B		Verticle caulk over expansion board - gray	Façade A
8-8-AF-457A		Exterior window glazing compound in reinforced chicken wire windows - white	Façade A
8-8-AF-458A		Exterior window frame caulk - gray	Façade A
8-8-AF-459A		Exterior door frame caulk - cream	Façade A
8-8-AF-460A		Caulk at concrete foundation birck wall junction - white	Façade A
8-8-AF-460B		Caulk at concrete foundation birck wall junction - white	Façade A
8-8-AF-461A		Exterior door frame caulk associated with newer door systems - beige	Façade A
8-8-AF-461B		Exterior door frame caulk associated with newer door systems - beige	Façade A
8-8-AF-462A		Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	Façade A
8-8-AF-462B		Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	Façade A
8-8-AF-463A		Door frame caulk associated with office entry door - dark gray	Façade B
8-8-AF-463B		Door frame caulk associated with office entry door - dark gray	Façade B
8-8-AF-464A		Window frame caulk associated with office windows - light gray	Façade B
8-8-AF-464B		Window frame caulk associated with office windows - light gray	Façade B
8-8-AF-465A		Caulk at pre-cast concrete belt course - gray	Façade B
8-8-AF-465B		Caulk at pre-cast concrete belt course - gray	Façade B

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: TBS
Date Received: 08/26/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-1-AF-385A	**Tar moisture barrier on interior facing exterior brick - black (at north e**	**8.1%**	**0%**	None Detected	
10059567_0025					
8-5-AF-410A	**Mastic at fiberglass end caps - white**	**32%**	**0%**	None Detected	
10059567_0088					
8-5-AF-411A	**Pipe dope on 3" diameter pipes - white**	**52%**	**0%**	None Detected	
10059567_0090					
8-6-AF-431A	**Adhesive behind gypsum board on plaster - black**	**61%**	**0%**	None Detected	
10059567_0127					
8-7-AF-448A	**Resin on secondary current transformers - black**	**98%**	**0%**	None Detected	
10059567_0163					
8-7-AF-452A	**Glue daubs associated with 1'x1' acoustical ceiling tile - brown**	**52%**	**0%**	None Detected	
10059567_0169					
8-8-AF-457A	**Exterior window glazing compound in reinforced chicken wire windows -**	**9.8%**	**87%**	None Detected	
10059567_0179					
8-8-AF-458A	**Exterior window frame caulk - gray**	**83%**	**0%**	None Detected	
10059567_0180					

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Russell Shelton (12)
Analyst

Approved Signatory

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA - Northeast Utilities Building

Lab Order ID: **10059567**
Analysis: TBS
Date Received: 08/26/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-8-AF-459A *10059567_0181*	**Exterior door frame caulk - cream**	**28%**	**0%**	None Detected	
8-8-AF-460A *10059567_0182*	**Caulk at concrete foundation birck wall junction - white**	**77%**	**0%**	None Detected	
8-8-AF-462A *10059567_0186*	**Horizontal expansion board at concrete foundation CMU junctio**	**73%**	**0%**	None Detected	
8-8-AF-465A *10059567_0192*	**Caulk at pre-cast concrete belt course - gray**	**84%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Russell Shelton (12)
Analyst

Approved Signatory

10059567

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the*
Fax:	860-585-7034	*bottom Example Tab.*
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
		Enter samples between "<<" and ">>"
Project:	Weston and Sampson - MIRA - Northeast Utilities Building	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in sets Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional*
Date Submitted:	8/9/2024 0:00	*fields that do not show up on the official report, however they will be included*
Analysis:	PLM EPA 600R-93/116	*in the electronic data returned to you*
TurnAroundTime:	5 Day	*to facilitate your reintegration of the report data.*

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-1-AF-295C		Electrical wire coating on >.25" lines - white	Rm 00-02 Elevation 11'
8-1-AF-377A		6" Transite electrical conduit	Rm 00-02 Elevation 11'
8-5-AF-377B		6" Transite electrical conduit	Rm 1-25 Elevation 37'
8-1-AF-304C		Transite pannel	Rm 00-02 Elevation 11'
8-1-AF-378A		Sealent in interior duct work seams - red	Rm 00-02 Elevation 11'
8-1-AF-378B		Sealent in interior duct work seams - red	Rm 00-02 Elevation 11'
8-1-AF-379A		Tar like flooring - black	Rm 0-05
8-1-AF-379B		Tar like flooring - black	Rm 0-05
8-1-AF-380A		Plaster rough coat wall - gray	Rm 0-07
8-5-AF-380B		Plaster rough coat wall - gray	Rm 1-17 Elevation 37'
8-6-AF-380C		Plaster rough coat wall - gray	Rm 2-33
8-6-AF-380D		Plaster rough coat wall - gray	Rm 3-34 Elevation 56'.25"
8-7-AF-380E		Plaster rough coat wall - gray	Rm 5-50 Elevation 83".75"

Accepted ☐

Rejected ☐

Relinquished By

Received By 8/12 10:30

8-1-AF-381A		Plaster skim coat wall - white	Rm 0-07
8-5-AF-381B		Plaster skim coat wall - white	Rm 1-17 Elevation 37'
8-6-AF-381C		Plaster skim coat wall - white	Rm 2-33
8-6-AF-381D		Plaster skim coat wall - white	Rm 3-34 Elevation 56'.25"
8-7-AF-381E		Plaster skim coat wall - white	Rm 5-50 Elevation 83".75"
8-1-AF-382A		Patching cement at conduit penetrations - gray	Rm 0-09
8-1-AF-382B		Patching cement at conduit penetrations - gray	Rm 0-09
8-1-AF-383A		Poured composite flooring - speckled / blue	Rm 0-10
8-1-AF-383B		Poured composite flooring - speckled / blue	Rm 0-10
8-1-AF-384A		Window frame caulk - white	Rm 0-11
8-1-AF-384B		Window frame caulk - white	Rm 0-11
8-1-AF-385A		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 0-12
8-1-AF-385B		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 0-12
8-5-AF-385C		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 1-17 Elevation 37'
8-6-AF-385D		Tar moisture barrier on interior facing exterior brick - black (at north end of building)	Rm 2-33
8-1-AF-386A		Window glazing compound in partition windows - black	Rm 1-13 Elevation 37'
8-1-AF-386B		Window glazing compound in partition windows - black	Rm 1-13 Elevation 37'
8-1-AF-387A		Thinset associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-387B		Thinset associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-388A		Grout associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-388B		Grout associated with 6"x6" wall tile - gray	Rm 1-13 Elevation 37'
8-1-AF-389A		Flooring leveler - white	Rm 1-15 Elevation 37'
8-1-AF-389B		Flooring leveler - white	Rm 1-15 Elevation 37'
8-1-AF-390A		Floor tile mastic - black	Rm 1-15 Elevation 37'
8-6-AF-390B		Floor tile mastic - black	Rm 3-34 Elevation 56'.25"
8-7-AF-390C		Floor tile mastic - black	Rm 5-50 Elevation 83".75"
8-1-AF-391A		Floor tile mastic - yellow	Rm 1-15 Elevation 37'
8-6-AF-391B		Floor tile mastic - yellow	Rm 3-34 Elevation 56'.25"
8-1-AF-392A		Gypsum board (wall)	Rm 1-16 Elevation 37'
8-7-AF-392B		Gypsum board (ceiling backer)	Rm 5-58 Elevation 83'.75"

Relinquished By

Received By

8-1-AF-393A		Joint compound associated with gypsum wall board - white	Rm 1-16 Elevation 37'
8-1-AF-393B		Joint compound associated with gypsum wall board - white	Rm 1-16 Elevation 37'
8-5-AF-394A		12"x12" vinyl floor tile - maroon with beige specs	Rm 1-17 Elevation 37'
8-5-AF-394B		12"x12" vinyl floor tile - maroon with beige specs	Rm 1-17 Elevation 37'
8-5-AF-395A		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-395B		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-395C		Skim coat on lath behind chair rail - white	Rm 1-17 Elevation 37'
8-5-AF-191B		Black ceramic Insulator	Rm 1-19 Elevation 37'
8-6-AF-191C		Black ceramic Insulator	Rm 3-34 Elevation 56'.25"
8-5-AF-190B		Stall conduit backer plate	Rm 1-19 Elevation 37'
8-6-AF-190C		Stall conduit backer plate	Rm 3-34 Elevation 56'.25"
8-5-AF-189B		Cementirious stall wall	Rm 1-19 Elevation 37'
8-6-AF-189C		Cementirious stall wall	Rm 3-34 Elevation 56'.25"
8-5-AF-396A		Grout associated with stall conduit backer plate - gray	Rm 1-19 Elevation 37'
8-6-AF-396B		Grout associated with stall conduit backer plate - gray	Rm 3-36 Elevation 56'.25"
8-5-AF-397A		Ceramic conduit through stall backer plate - white	Rm 1-19 Elevation 37'
8-6-AF-397B		Ceramic conduit through stall backer plate - white	Rm 3-36 Elevation 56'.25"
8-5-AF-398A		Skim coat over concrete stalls - gray	Rm 1-19 Elevation 37'
8-6-AF-398B		Skim coat over concrete stalls - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-398C		Skim coat over concrete stalls - gray	Rm 4-44 Elevation 67'.25"
8-5-AF-399A		Mortar associated with cementitious block behind skim coat - gray	Rm 1-19 Elevation 37'
8-6-AF-399B		Mortar associated with cementitious block behind skim coat - gray	Rm 3-34 Elevation 56'.25"
8-5-AF-400A		Cementitious block at stall walls behind skim coat - gray	Rm 1-19 Elevation 37'
8-6-AF-400B		Cementitious block at stall walls behind skim coat - gray	Rm 3-34 Elevation 56'.25"
8-5-AF-401A		Felt paper between ceramic insulator and capacitor - black	Rm 1-19 Elevation 37'
8-6-AF-401B		Felt paper between ceramic insulator and capacitor - black	Rm 3-34 Elevation 56'.25"
8-5-AF-402A		Protective paper over capacitor - black	Rm 1-19 Elevation 37'
8-6-AF-402B		Protective paper over capacitor - black	Rm 3-34 Elevation 56'.25"

Relinquished By

Received By

8-5-AF-403A		Interior paper in capacitor - white	Rm 1-19 Elevation 37'
8-6-AF-403B		Interior paper in capacitor - white	Rm 3-34 Elevation 56'.25"
8-5-AF-404A		Tar at conduit penetration - black	Rm 1-22 (tunnel)
8-5-AF-404B		Tar at conduit penetration - black	Rm 1-22 (tunnel)
8-5-AF-405A		Mastic at duct work penetraion through wall - black	Rm 1-22 (tunnel)
8-5-AF-405B		Mastic at duct work penetraion through wall - black	Rm 1-22 (tunnel)
8-5-AF-406A		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 1-24 Elevation 37'
8-5-AF-406B		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 1-24 Elevation 37'
8-6-AF-406C		Expansion board at 1938 addition building junction - black (verticle & horizontal)	Rm 3-36 Elevation 56'.25"
8-5-AF-407A		Foam at conduit penetrations through exterior walls - black	Rm 1-25 Elevation 37'
8-5-AF-407B		Foam at conduit penetrations through exterior walls - black	Rm 1-25 Elevation 37'
8-5-AF-408A		Cementitious conduit backer plate at exterior wall - gray	Rm 1-25 Elevation 37'
8-5-AF-408B		Cementitious conduit backer plate at exterior wall - gray	Rm 1-25 Elevation 37'
8-5-AF-409A		Tar coating on metal conduits - brown	Rm 1-25 Elevation 37'
8-5-AF-409B		Tar coating on metal conduits - brown	Rm 1-25 Elevation 37'
8-5-AF-217K		Soft pack pipe insulation - gray	Rm 1-26 (tunnel)
8-5-AF-410A		Mastic at fiberglass end caps - white	Rm 1-26 (tunnel)
8-5-AF-410B		Mastic at fiberglass end caps - white	Rm 1-26 (tunnel)
8-5-AF-411A		Pipe dope on 3" diameter pipes - white	Rm 1-26 (tunnel)
8-5-AF-411B		Pipe dope on 3" diameter pipes - white	Rm 1-26 (tunnel)
8-5-AF-412A		Cloth flex connector - white	Rm 1-27 Elevation 37'
8-5-AF-412B		Cloth flex connector - white	Rm 1-27 Elevation 37'
8-5-AF-413A		Door frame caulk - white	Rm 1-27 Elevation 37'
8-5-AF-413B		Door frame caulk - white	Rm 1-27 Elevation 37'
8-5-AF-414A		Debris on stored pipe - gray / soft	Rm 1-28 Elevation 37'
8-5-AF-414B		Debris on stored pipe - gray / soft	Rm 1-28 Elevation 37'
8-5-AF-415A		12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	Rm 1-30 Elevation 37'
8-5-AF-415B		12" abandoned conduit sleeve - gray (first sleeve in interior from exterior)	Rm 1-30 Elevation 37'
8-6-AF-X416A		Terracotta block mortar - gray	Rm 2-32
8-7-AF-X416B		Terracotta block mortar - gray	St-1

Relinquished By

Received By

9 of 17

8-6-AF-417A		Joint compound on brick behind plaster rough coat - cream	Rm 2-33
8-6-AF-417B		Joint compound on brick behind plaster rough coat - cream	Rm 2-33
8-6-AF-418A		9"x9" vinyl floor tile - maroon with checker board pattern	Rm 3-34 Elevation 56'.25"
8-6-AF-418B		9"x9" vinyl floor tile - maroon with checker board pattern	Rm 4-40 Elevation 67'.25"
8-6-AF-419A		12"x12" vinyl floor tile - white with gray streaks	Rm 3-34 Elevation 56'.25"
8-6-AF-419B		12"x12" vinyl floor tile - white with gray streaks	Rm 4-40 Elevation 67'.25"
8-6-AF-420A		4" vinyl cove base adhesive - yellow	Rm 3-34 Elevation 56'.25"
8-6-AF-421A		4" vinyl cove base - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-421A		4" vinyl cove base - gray	Rm 3-34 Elevation 56'.25"
8-6-AF-422A		Gypsum wall board over plaster	Rm 3-34 Elevation 56'.25"
8-6-AF-422B		Gypsum wall board over plaster	Rm 4-40 Elevation 67'.25"
8-6-AF-423A		Joint compound associated with gypsum wall board over plaster - white	Rm 3-34 Elevation 56'.25"
8-6-AF-423B		Joint compound associated with gypsum wall board over plaster - white	Rm 4-40 Elevation 67'.25"
8-6-AF-424A		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 3-34 Elevation 56'.25"
8-6-AF-424B		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 4-40 Elevation 67'.25"
8-6-AF-425A		Mastic at stall ceilings - brown	Rm 3-36 Elevation 56'.25"
8-6-AF-425B		Mastic at stall ceilings - brown	Rm 3-36 Elevation 56'.25"
8-6-AF-426A		Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	Rm 3-36 Elevation 56'.25"
8-6-AF-426B		Expansion joint caulk at A-wall 1938 addition junction over expansion board - beige	Rm 3-36 Elevation 56'.25"
8-6-AF-427A		Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	Rm 3-36 Elevation 56'.25"
8-6-AF-427B		Rope gasket between concrete stall junction at the 1938 addition junction - white / fiberous	Rm 3-36 Elevation 56'.25"
8-6-AF-429A		Sealant in interior duct seams - yellow	Rm 2-39 Elevation 48'
8-6-AF-429B		Sealant in interior duct seams - yellow	Rm 2-39 Elevation 48'
8-6-AF-430A		9"x9" vinyl floor tile - black	Rm 4-40 Elevation 67'.25"
8-6-AF-430B		9"x9" vinyl floor tile - black	Rm 4-40 Elevation 67'.25"
8-6-AF-431A		Adhesive behind gypsum board on plaster - black	Rm 4-40 Elevation 67'.25"
8-6-AF-431B		Adhesive behind gypsum board on plaster - black	Rm 4-40 Elevation 67'.25"

Relinquished By

Received By

8-6-AF-432A		Cloth wrap over hard pack pipe insulation - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-432B		Cloth wrap over hard pack pipe insulation - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-433A		Hard pack pipe insulation on water line to radiator - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-433B		Hard pack pipe insulation on water line to radiator - white (residual)	Rm 4-42 Elevation 67'.25"
8-6-AF-188B		Stall shelf - blue	Rm 4-44 Elevation 67'.25"
8-6-AF-X241C		Window glazing compound in reinforced chicken wire windows - white	Rm 4-44 Elevation 67'.25"
8-6-AF-434A		<.25" Wire coating in switch boxes - white	Rm 4-44 Elevation 67'.25"
8-6-AF-434B		<.25" Wire coating in switch boxes - white	Rm 4-44 Elevation 67'.25"
8-7-AF-435A		9"x9" vinyl floor tile - beige	Rm 5-50 Elevation 83'.75"
8-7-AF-435B		9"x9" vinyl floor tile - beige	Rm 5-50 Elevation 83'.75"
8-7-AF-436A		Mud base associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-436B		Mud base associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-437A		Grout associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-437B		Grout associated with 6"x6" ceramic tile at window sills - gray	Rm 5-50 Elevation 83'.75"
8-7-AF-438A		Thinset associated with 6" ceramic cove base - white	Rm 5-50 Elevation 83'.75"
8-7-AF-438B		Thinset associated with 6" ceramic cove base - white	Rm 5-50 Elevation 83'.75"
8-7-AF-439A		Sheet rock at windows	Rm 5-50 Elevation 83'.75"
8-7-AF-439B		Sheet rock at windows	Rm 5-50 Elevation 83'.75"
8-7-AF-440A		Joint compound associated with sheetrock at windows - white	Rm 5-50 Elevation 83'.75"
8-7-AF-440B		Joint compound associated with sheetrock at windows - white	Rm 5-50 Elevation 83'.75"
8-7-AF-441A		Soap stone shower surround - black	Rm 5-52 Elevation 83'.75"
8-7-AF-441B		Soap stone shower surround - black	Rm 5-52 Elevation 83'.75"
8-7-AF-442A		Caulk at soap stone pannel seams - black	Rm 5-52 Elevation 83'.75"
8-7-AF-442B		Caulk at soap stone pannel seams - black	Rm 5-52 Elevation 83'.75"
8-7-AF-248C		Window glazing compound in plain sash windows - white	Rm 5-53 Elevation 83'.75"

Relinquished By

Received By

8-7-AF-444A		Cork floor tile mastic - white	Rm 5-57 Elevation 83'.75"
8-7-AF-444B		Cork floor tile mastic - white	Rm 5-57 Elevation 83'.75"
8-7-AF-445A		Mud set associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-445B		Mud set associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-446A		Grout associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-446B		Grout associated with 6"x4" blue composite glazed wall tile - gray	Rm 5-57 Elevation 83'.75"
8-7-AF-447A		6"x4" blue painted red composite material glazed wall tile	Rm 5-57 Elevation 83'.75"
8-7-AF-447B		6"x4" blue painted red composite material glazed wall tile	Rm 5-57 Elevation 83'.75"
8-7-AF-303D		Electrical wire coating on <.25" lines - white	Rm 5-57 Elevation 83'.75"
8-7-AF-448A		Resin on secondary current transformers - black	Rm 5-57 Elevation 83'.75"
8-7-AF-448B		Resin on secondary current transformers - black	Rm 5-57 Elevation 83'.75"
8-7-AF-449A		Non-conductive backer pannel board for electric circuts - blue	Rm 5-57 Elevation 83'.75"
8-7-AF-449B		Non-conductive backer pannel board for electric circuts - blue	Rm 5-57 Elevation 83'.75"
8-7-AF-450A		Residual flooring mastic on wood planking - yellow	Rm 5-58 Elevation 83'.75"
8-7-AF-450B		Residual flooring mastic on wood planking - yellow	Rm 5-58 Elevation 83'.75"
8-7-AF-452A		Glue daubs associated with 1'x1' acoustical ceiling tile - brown	Rm 5-58 Elevation 83'.75"
8-7-AF-452B		Glue daubs associated with 1'x1' acoustical ceiling tile - brown	Rm 5-58 Elevation 83'.75"
8-7-AF-453A		1'x1' acoustical ceiling tile - worm hole pattern	Rm 5-58 Elevation 83'.75"
8-7-AF-453B		1'x1' acoustical ceiling tile - worm hole pattern	Rm 5-58 Elevation 83'.75"
8-7-AF-454A		2'x2' acoustical ceiling tile - rough face	Rm 5-58 Elevation 83'.75"
8-7-AF-454B		2'x2' acoustical ceiling tile - rough face	Rm 5-58 Elevation 83'.75"
8-7-AF-455A		Wrap over electrical conduit in air shaft - white	St-2
8-7-AF-455B		Wrap over electrical conduit in air shaft - white	St-2

Relinquished By

Received By

8-8-AF-456A		Verticle caulk over expansion board - gray	Façade A
8-8-AF-456B		Verticle caulk over expansion board - gray	Façade A
8-8-AF-457A		Exterior window glazing compound in reinforced chicken wire windows - white	Façade A
8-8-AF-458A		Exterior window frame caulk - gray	Façade A
8-8-AF-459A		Exterior door frame caulk - cream	Façade A
8-8-AF-460A		Caulk at concrete foundation birck wall junction - white	Façade A
8-8-AF-460B		Caulk at concrete foundation birck wall junction - white	Façade A
8-8-AF-461A		Exterior door frame caulk associated with newer door systems - beige	Façade A
8-8-AF-461B		Exterior door frame caulk associated with newer door systems - beige	Façade A
8-8-AF-462A		Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	Façade A
8-8-AF-462B		Horizontal expansion board at concrete foundation CMU junction - black (at 1938 addition junction)	Façade A
8-8-AF-463A		Door frame caulk associated with office entry door - dark gray	Façade B
8-8-AF-463B		Door frame caulk associated with office entry door - dark gray	Façade B
8-8-AF-464A		Window frame caulk associated with office windows - light gray	Façade B
8-8-AF-464B		Window frame caulk associated with office windows - light gray	Façade B
8-8-AF-465A		Caulk at pre-cast concrete belt course - gray	Façade B
8-8-AF-465B		Caulk at pre-cast concrete belt course - gray	Façade B

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-582A	Mop down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0001					Dissolved
8-27-AF-582B	Mop down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0002					Dissolved
8-27-AF-583A	Felt paper over foam under top layer membrane - black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Fibrous Homogeneous
10061619_0003					Crushed, Dissolved
8-27-AF-583B	Felt paper over foam under top layer membrane - black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Fibrous Homogeneous
10061619_0004					Crushed, Dissolved
8-27-AF-584A	Flashing cement - black	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10061619_0005					Dissolved, Crushed
8-27-AF-584B	Flashing cement - black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Heterogeneous
10061619_0006					Crushed, Dissolved
8-27-AF-585A	Caulk at aluminum flashing brick façade junction - gray	**5% Chrysotile**		**95% Other**	Gray Non-Fibrous Homogeneous
10061619_0007					Ashed
8-27-AF-585B	Caulk at aluminum flashing brick façade junction - gray	**5% Chrysotile**		**95% Other**	Gray Non-Fibrous Homogeneous
10061619_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-586A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0009					Ashed
8-27-AF-586B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0010					Ashed
8-27-AF-587A	Soft cement roof deck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10061619_0011					Dissolved, Crushed
8-27-AF-587B	Soft cement roof deck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10061619_0012					Crushed, Dissolved
8-27-AF-588A	Rolled asphalt roofing	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10061619_0013					Crushed, Dissolved
8-27-AF-588B	Rolled asphalt roofing	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10061619_0014					Crushed, Dissolved
8-27-AF-589A	Tar felt paper under rolled roofing on concrete deck	**None Detected**	**30% Cellulose**	**70% Other**	Black Non-Fibrous Homogeneous
10061619_0015					Dissolved, Crushed
8-27-AF-589B	Tar felt paper under rolled roofing on concrete deck	**None Detected**	**30% Cellulose**	**70% Other**	Black Non-Fibrous Homogeneous
10061619_0016					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-590A	Flashing cement - black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10061619_0017					Crushed, Dissolved
8-27-AF-590B	Flashing cement - black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10061619_0018					Crushed, Dissolved
8-27-AF-588C	Rolled asphalt roofing	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10061619_0019					Dissolved, Crushed
8-27-AF-590C	Flashing cement - black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10061619_0020					Dissolved, Crushed
8-27-AF-591A	Soft concrete roof deck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10061619_0021					Dissolved, Crushed
8-27-AF-591B	Soft concrete roof deck	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10061619_0022					Crushed, Dissolved
8-27-AF-592A	Mop down tar under gravel - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0023					Dissolved, Crushed
8-27-AF-592B	Mop down tar under gravel - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0024					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-593A	Felt paper at perimeter-black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Fibrous Homogeneous
10061619_0025					Crushed, Dissolved
8-27-AF-593B	Felt paper at perimeter-black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Fibrous Homogeneous
10061619_0026					Dissolved, Crushed
8-27-AF-594A	Caulk at mechanical box-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0027					Ashed
8-27-AF-594B	Caulk at mechanical box-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0028					Ashed
8-27-AF-595A	Bottom layer tar on corrugated metal roof deck-black (bottom layer)	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Non-Fibrous Homogeneous
10061619_0029					Dissolved
8-27-AF-595B	Bottom layer tar on corrugated metal roof deck-black (bottom layer)	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Non-Fibrous Homogeneous
10061619_0030					Dissolved
8-27-AF-596A	Tar on cement-black (layer 2)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0031					Dissolved
8-27-AF-596B	Tar on cement-black (layer 2)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-597A	Felt paper over tar on cement-black (layer 3)	**3% Chrysotile**	**20% Cellulose**	**77% Other**	Black Fibrous Homogeneous
10061619_0033					Dissolved, Crushed
8-27-AF-597B	Felt paper over tar on cement-black (layer 3)	**None Detected**	**80% Cellulose**	**20% Other**	Black, Brown Fibrous Homogeneous
10061619_0034					Crushed, Dissolved
8-27-AF-598A	Adhesive under EPDM membrane over foam-yellow (top layer)	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061619_0035					Dissolved
8-27-AF-598B	Adhesive under EPDM membrane over foam-yellow (top layer)	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061619_0036					Dissolved
8-27-AF-599A	Felt paper under coping above top layer brick on parapet - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0037					Dissolved, Crushed
8-27-AF-600A	Adhesive under rubber membrane under wood parapet - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061619_0038					Dissolved
8-27-AF-600B	Adhesive under rubber membrane under wood parapet - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061619_0039					Dissolved
8-27-AF-601A	Caulk in coping seams-grey/rubbery	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0040					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-601B	Caulk in coping seams-grey/rubbery	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0041					Ashed
8-27-AF-601C	Caulk in coping seams-grey/rubbery	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0042					Ashed
8-27-AF-602A	Skim coat/over coat on coping	**None Detected**		**100% Other**	Gray, White Non-Fibrous Heterogeneous
10061619_0043					Dissolved, Crushed
8-27-AF-602B	Skim coat/over coat on coping	**None Detected**		**100% Other**	White, Gray Non-Fibrous Heterogeneous
10061619_0044					Dissolved, Crushed
8-27-AF-602C	Skim coat/over coat on coping	**None Detected**		**100% Other**	White, Gray Non-Fibrous Heterogeneous
10061619_0045					Dissolved, Crushed
8-27-AF-602D	Skim coat/over coat on coping	**None Detected**		**100% Other**	White, Gray Non-Fibrous Heterogeneous
10061619_0046					Dissolved, Crushed
8-27-AF-603A	Original caulk at base of coping on parapet - gray / hard	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0047					Ashed
8-27-AF-603B	Original caulk at base of coping on parapet - gray / hard	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0048					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-604A	Original window glazing compound at skylights-grey / britlle / hard	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10061619_0049					Ashed
8-27-AF-604B	Original window glazing compound at skylights-grey / britlle / hard	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10061619_0050					Ashed
8-27-AF-605A	Flashing cement at skylight casing/frame junction-black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10061619_0051					Ashed
8-27-AF-605B	Flashing cement at skylight casing/frame junction-black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10061619_0052					Ashed
8-27-AF-606A	Newer window glazing compound over original-brown/rubbery	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10061619_0053					Ashed
8-27-AF-606B	Newer window glazing compound over original-brown/rubbery	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10061619_0054					Ashed
8-27-AF-607A	Mastic in metal pitched roof pannel seams at air handler room-black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10061619_0055					Dissolved
8-27-AF-607B	Mastic in metal pitched roof pannel seams at air handler room-black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10061619_0056					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-608A	Tar coating on structural steel in air handler room - black	**2% Chrysotile**		**98% Other**	Black Non-Fibrous Homogeneous
10061619_0057					Dissolved
8-27-AF-608B	Tar coating on structural steel in air handler room - black	**None Detected**		**100% Other**	Red, Black Non-Fibrous Homogeneous
10061619_0058					Dissolved
8-27-AF-335C	1'x1' Fire block - white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10061619_0059					Dissolved, Crushed
8-27-AF-336C	1'x1' Fire block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10061619_0060					Crushed, Dissolved
8-27-AF-609A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0061					Ashed
8-27-AF-609B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0062					Ashed
8-27-AF-609C	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0063					Ashed
8-27-AF-610A	Caulk at louvers-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0064					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-610B	Caulk at louvers-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061619_0065					Ashed
8-27-AF-611A	Perimeter flashing cement at parapit	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10061619_0066					Dissolved, Crushed
8-27-AF-611B	Perimeter flashing cement at parapit	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Heterogeneous
10061619_0067					Dissolved, Crushed
8-27-AF-612A	Mop down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0068					Dissolved
8-27-AF-612B	Mop down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0069					Dissolved
8-27-AF-613A	Tar felt paper at parapet under membrane-black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10061619_0070					Dissolved, Crushed
8-27-AF-613B	Tar felt paper at parapet under membrane-black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10061619_0071					Dissolved, Crushed
8-27-AF-614A	Tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0072					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-27-AF-614B	Tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061619_0073					Dissolved
8-27-AF-615A	Tar behind rolled asphalt roofing at skylight curb-black	**4% Chrysotile**		**96% Other**	Black Non-Fibrous Homogeneous
10061619_0074					Dissolved
8-27-AF-615B	Tar behind rolled asphalt roofing at skylight curb-black	**4% Chrysotile**		**96% Other**	Black Non-Fibrous Homogeneous
10061619_0075					Dissolved
8-27-AF-616A	Felt paper over tar under asphalt roofing at skylight curb	**None Detected**	**60% Cellulose**	**40% Other**	Black Fibrous Homogeneous
10061619_0076					Crushed, Dissolved
8-27-AF-616B	Felt paper over tar under asphalt roofing at skylight curb	**None Detected**	**60% Cellulose**	**40% Other**	Black Fibrous Homogeneous
10061619_0077					Dissolved, Crushed
8-27-AF-617A	Rolled asphalt at skylight curb	**None Detected**	**20% Cellulose**	**80% Other**	Gray, Black Fibrous Homogeneous
10061619_0078					Dissolved, Crushed
8-27-AF-617B	Rolled asphalt at skylight curb	**None Detected**	**20% Cellulose**	**80% Other**	Black, Gray Fibrous Homogeneous
10061619_0079					Dissolved, Crushed
8-27-AF-618A	Flashing cement at base of skylight-black	**None Detected**	**10% Cellulose**	**90% Other**	Black Non-Fibrous Homogeneous
10061619_0080					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Nathaniel J Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-27-AF-618B	Flashing cement at base of skylight-black	**None Detected**	**10% Cellulose**	**90% Other**	Black Non-Fibrous Homogeneous
10061619_0081					Dissolved
8-27-AF-457C	Exterior window glazing compound in reinforced chicken wire windows - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10061619_0082					Crushed
8-27-AF-619A	Caulk at louver and window frame-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10061619_0083					Ashed
8-27-AF-619B	Caulk at louver and window frame-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10061619_0084					Ashed
8-27-AF-620A	Skim coat over concrete façade-white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10061619_0085					Dissolved, Crushed
8-27-AF-620B	Skim coat over concrete façade-white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10061619_0086					Crushed, Dissolved
8-27-AF-620C	Skim coat over concrete façade-white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10061619_0087					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (87)
Analyst

Approved Signatory

10061619

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
		Enter samples between "<<" and ">>"
Project:	Weston and Sampson - MIRA - Northeast Utilities Building Roofs	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in sets Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional*
Date Submitted:	9/3/2024 0:00	*fields that do not show up on the official report, however they will be included*
Analysis:	PLM EPA 600R-93/116	*in the electronic data returned to you*
TurnAroundTime:	5 Day	*to facilitate your reintegration of the report data.*

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27
Phone: 336.292.38
Fax: 336.292.3313
Email: lab@sailab.

Sample Number	Data 1	Sample Description	Data 2
<<			
8-27-AF-582A		Mop down tar on concrete roof deck - black	Lower level roof #1
8-27-AF-582B		Mop down tar on concrete roof deck - black	Lower level roof #1
8-27-AF-583A		Felt paper over foam under top layer membrane - black	Lower level roof #1
8-27-AF-583B		Felt paper over foam under top layer membrane - black	Lower level roof #1
8-27-AF-584A		Flashing cement - black	Lower level roof #1
8-27-AF-584B		Flashing cement - black	Lower level roof #1
8-27-AF-585A		Caulk at aluminum flashing brick façade junction - gray	Lower level roof #1
8-27-AF-585B		Caulk at aluminum flashing brick façade junction - gray	Lower level roof #1
8-27-AF-586A		Reglet caulk-black	Lower level roof #1
8-27-AF-586B		Reglet caulk-black	Lower level roof #1
8-27-AF-587A		Soft cement roof deck	Lower level roof #1
8-27-AF-587B		Soft cement roof deck	Lower level roof #1
8-27-AF-588A		Rolled asphalt roofing	Lower level roof #2
8-27-AF-588B		Rolled asphalt roofing	Lower level roof #2
8-27-AF-589A		Tar felt paper under rolled roofing on concrete deck	Lower level roof #2
8-27-AF-589B		Tar felt paper under rolled roofing on concrete deck	Lower level roof #2
8-27-AF-590A		Flashing cement - black	Lower level roof #2

Relinquished By

Accepted ☒

Rejected ☐

Received By

9/4 10:20am

10061619

8-27-AF-590B		Flashing cement - black	Lower level roof #2
8-27-AF-588C		Rolled asphalt roofing	Lower level roof #3
8-27-AF-590C		Flashing cement - black	Lower level roof #3
8-27-AF-591A		Soft concrete roof deck	Lower level roof #3
8-27-AF-591B		Soft concrete roof deck	Lower level roof #3
8-27-AF-592A		Mop down tar under gravel -black	Lower level roof #4
8-27-AF-592B		Mop down tar under gravel -black	Lower level roof #4
8-27-AF-593A		Felt paper at perimeter-black	Lower level roof #4
8-27-AF-593B		Felt paper at perimeter-black	Lower level roof #4
8-27-AF-594A		Caulk at mechanical box-grey	Lower level roof #4
8-27-AF-594B		Caulk at mechanical box-grey	Lower level roof #4
8-27-AF-595A		Bottom layer tar on corrugated metal roof deck-black (bottom layer)	Upper level roof #5
8-27-AF-595B		Bottom layer tar on corrugated metal roof deck-black (bottom layer)	Upper level roof #5
8-27-AF-596A		Tar on cement-black (layer 2)	Upper level roof #5
8-27-AF-596B		Tar on cement-black (layer 2)	Upper level roof #5
8-27-AF-597A		Felt paper over tar on cement-black (layer 3)	Upper level roof #5
8-27-AF-597B		Felt paper over tar on cement-black (layer 3)	Upper level roof #5
8-27-AF-598A		Adhesive under EPDM membrane over foam-yellow (top layer)	Upper level roof #5
8-27-AF-598B		Adhesive under EPDM membrane over foam-yellow (top layer)	Upper level roof #5
8-27-AF-599A		Felt paper under coping above top layer brick on parapet - black	Upper level roof #5
8-27-AF-600A		Adhesive under rubber membrane under wood parapet - yellow	Upper level roof #5
8-27-AF-600B		Adhesive under rubber membrane under wood parapet - yellow	Upper level roof #5
8-27-AF-601A		Caulk in coping seams-grey/rubbery	Upper level roof #5
8-27-AF-601B		Caulk in coping seams-grey/rubbery	Upper level roof #5
8-27-AF-601C		Caulk in coping seams-grey/rubbery	Upper level roof #6
8-27-AF-602A		Skim coat/over coat on coping	Upper level roof #5
8-27-AF-602B		Skim coat/over coat on coping	Upper level roof #5
8-27-AF-602C		Skim coat/over coat on coping	Upper level roof #5
8-27-AF-602D		Skim coat/over coat on coping	Upper level roof #6
8-27-AF-603A		Original caulk at base of coping on parapet - gray / hard	Upper level roof #5
8-27-AF-603B		Original caulk at base of coping on parapet - gray / hard	Upper level roof #5
8-27-AF-604A		Original window glazing compound at skylights-grey / britlle / hard	Upper level roof #5
8-27-AF-604B		Original window glazing compound at skylights-grey / britlle / hard	Upper level roof #5
8-27-AF-605A		Flashing cement at skylight casing/frame junction-black	Upper level roof #5
8-27-AF-605B		Flashing cement at skylight casing/frame junction-black	Upper level roof #5
8-27-AF-606A		Newer window glazing compound over original-brown/rubbery	Upper level roof #5

Relinquished By

Received By

10061619

8-27-AF-606B		Newer window glazing compound over original-brown/rubbery	Upper level roof #5
8-27-AF-607A		Mastic in metal pitched roof pannel seams at air handler room-black	Upper level roof #5 (pitched roof above air handler)
8-27-AF-607B		Mastic in metal pitched roof pannel seams at air handler room-black	Upper level roof #5 (pitched roof above air handler)
8-27-AF-608A		Tar coating on structural steel in air handler room - black	Upper level roof #5 (pitched roof above air handler)
8-27-AF-608B		Tar coating on structural steel in air handler room - black	Upper level roof #5 (pitched roof above air handler)
8-27-AF-335C		1'x1' Fire block - white	Upper level roof #5 (pitched roof above air handler)
8-27-AF-336C		1'x1' Fire block mortar - gray	Upper level roof #5 (pitched roof above air handler)
8-27-AF-609A		Reglet caulk-black	Upper level roof #5
8-27-AF-609B		Reglet caulk-black	Upper level roof #5
8-27-AF-609C		Reglet caulk-black	Upper level roof #6
8-27-AF-610A		Caulk at louvers-grey	Upper level roof #5
8-27-AF-610B		Caulk at louvers-grey	Upper level roof #5
8-27-AF-611A		Perimeter flashing cement at parapit	Upper level roof #5
8-27-AF-611B		Perimeter flashing cement at parapit	Upper level roof #5
8-27-AF-612A		Mop down tar on concrete roof deck - black	Upper level roof #6
8-27-AF-612B		Mop down tar on concrete roof deck - black	Upper level roof #7
8-27-AF-613A		Tar felt paper at parapet under membrane-black	Upper level roof #7
8-27-AF-613B		Tar felt paper at parapet under membrane-black	Upper level roof #7
8-27-AF-614A		Tar on concrete roof deck-black	Elevator pent house roof
8-27-AF-614B		Tar on concrete roof deck-black	Elevator pent house roof
8-27-AF-615A		Tar behind rolled asphalt roofing at skylight curb-black	Elevator pent house roof

Relinquished By

Received By

100616619

8-27-AF-615B		Tar behind rolled asphalt roofing at skylight curb-black	Elevator pent house roof
8-27-AF-616A		Felt paper over tar under asphalt roofing at skylight curb	Elevator pent house roof
8-27-AF-616B		Felt paper over tar under asphalt roofing at skylight curb	Elevator pent house roof
8-27-AF-617A		Rolled asphalt at skylight curb	Elevator pent house roof
8-27-AF-617B		Rolled asphalt at skylight curb	Elevator pent house roof
8-27-AF-618A		Flashing cement at base of skylight-black	Elevator pent house roof
8-27-AF-618B		Flashing cement at base of skylight-black	Elevator pent house roof
8-27-AF-457C		Exterior window glazing compound in reinforced chicken wire windows - white	Elevator pent house Exterior Façade D
8-27-AF-619A		Caulk at louver and window frame-white	Elevator pent house Exterior Façade D
8-27-AF-619B		Caulk at louver and window frame-white	Elevator pent house Exterior Façade D
8-27-AF-620A		Skim coat over concrete façade-white	Elevator pent house Exterior Façade D
8-27-AF-620B		Skim coat over concrete façade-white	Elevator pent house Exterior Façade A
8-27-AF-620C		Skim coat over concrete façade-white	Elevator pent house Exterior Façade C

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: TBS
Date Received: 10/07/2024
Date Reported: 10/08/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-27-AF-582A / *10061619_0001*	**Mop down tar on concrete roof deck - black**	**30.%**	**0%**	None Detected	
8-27-AF-584A / *10061619_0005*	**Flashing cement - black**	**4.5%**	**30.%**	None Detected	
8-27-AF-586A / *10061619_0009*	**Reglet caulk-black**	**51%**	**0%**	None Detected	
8-27-AF-589A / *10061619_0015*	**Tar felt paper under rolled roofing on concrete deck**	**99%**	**0%**	None Detected	
8-27-AF-592A / *10061619_0023*	**Mop down tar under gravel -black**	**9.3%**	**0%**	None Detected	
8-27-AF-594A / *10061619_0027*	**Caulk at mechanical box -grey**	**86%**	**0%**	None Detected	
8-27-AF-595A / *10061619_0029*	**Bottom layer tar on corrugated metal roof deck-black (bottom layer**	**10.%**	**0%**	None Detected	
8-27-AF-596A / *10061619_0031*	**Tar on cement-black (layer 2)**	**18%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Ired Gulley (20)
Analyst

Approved Signatory

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: TBS
Date Received: 10/07/2024
Date Reported: 10/08/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)		LCL-UCL (Wt. %)
8-27-AF-598A	**Adhesive under EPDM membrane over foam-yellow (top layer)**	**99%**	**0%**	None Detected		
10061619_0035						
8-27-AF-600A	**Adhesive under rubber membrane under wood parapet - yellow**	**59%**	**0%**	None Detected		
10061619_0038						
8-27-AF-601A	**Caulk in coping seams-grey/rubbery**	**18%**	**0%**	None Detected		
10061619_0040						
8-27-AF-603A	**Original caulk at base of coping on parapet - gray / hard**	**18%**	**0%**	None Detected		
10061619_0047						
8-27-AF-609A	**Reglet caulk-black**	**56%**	**0%**	None Detected		
10061619_0061						
8-27-AF-610A	**Caulk at louvers-grey**	**43%**	**0%**	**2.8%**	**Chrysotile**	**2.6 - 3.1%**
10061619_0064						
8-27-AF-611A	**Perimeter flashing cement at parapit**	**21%**	**58%**	**0.64%**	**Chrysotile**	**0.58 - 0.71%**
10061619_0066						
8-27-AF-612A	**Mop down tar on concrete roof deck - black**	**85%**	**0%**	None Detected		
10061619_0068						

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Ired Gulley (20)
Analyst

Approved Signatory

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA - Northeast Utilities Building Roofs

Lab Order ID: **10061619**
Analysis: TBS
Date Received: 10/07/2024
Date Reported: 10/08/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-27-AF-614A *10061619_0072*	**Tar on concrete roof deck-black**	**99%**	**0%**	None Detected	
8-27-AF-618A *10061619_0080*	**Flashing cement at base of skylight-black**	**72%**	**0%**	None Detected	
8-27-AF-457C *10061619_0082*	**Exterior window glazing compound in reinforced chicken wire windows -**	**8.8%**	**90.%**	None Detected	
8-27-AF-619A *10061619_0083*	**Caulk at louver and window frame-white**	**83%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Ired Gulley (20)
Analyst

Approved Signatory

100216194TEM
10/4/24
4:05pm
CK

Client:	Eagle Environmental, Inc.	*Instructions:*	
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*	
Address:	8 South Main Street, Terryville, CT		
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*	
Fax:	860-585-7034		
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com		
Project:	Weston and Sampson - MIRA - Northeast Utilities Building Roofs	***Enter samples between "<<" and ">>"***	
Client Notes:	Please stop on first positive in sets Please do not split samples	***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***	
P.O. #.	24-138.10T1	*Only Enter your data on the first sheet "Sheet1"*	
Date Submitted:	9/3/2024 0:00	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*	
Analysis:	TEM: Chatfield		
Turn Around Time:	24 Hour		

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<

8-27-AF-582A		Mop down tar on concrete roof deck - black	Lower level roof #1
8-27-AF-584A		Flashing cement - black	Lower level roof #1
8-27-AF-586A		Reglet caulk-black	Lower level roof #1
8-27-AF-589A		Tar felt paper under rolled roofing on concrete deck	Lower level roof #2
8-27-AF-592A		Mop down tar under gravel -black	Lower level roof #4
8-27-AF-594A		Caulk at mechanical box-grey	Lower level roof #4
8-27-AF-595A		Bottom layer tar on corrugated metal roof deck-black (bottom layer)	Upper level roof #5
8-27-AF-596A		Tar on cement-black (layer 2)	Upper level roof #5
8-27-AF-598A		Adhesive under EPDM membrane over foam-yellow (top layer)	Upper level roof #5
8-27-AF-600A		Adhesive under rubber membrane under wood parapet - yellow	Upper level roof #5
8-27-AF-601A		Caulk in coping seams-grey/rubbery	Upper level roof #5
8-27-AF-603A		Original caulk at base of coping on parapet - gray / hard	Upper level roof #5
8-27-AF-609A		Reglet caulk-black	Upper level roof #5
8-27-AF-610A		Caulk at louvers-grey	Upper level roof #5
8-27-AF-611A		Perimeter flashing cement at parapit	Upper level roof #5
8-27-AF-612A		Mop down tar on concrete roof deck - black	Upper level roof #6
8-27-AF-614A		Tar on concrete roof deck-black	Elevator pent house roof

Relinquished By

Received By

8-27-AF-618A		Flashing cement at base of skylight-black	Elevator pent house roof
8-27-AF-457C		Exterior window glazing compound in reinforced chicken wire windows - white	Elevator pent house Exterior Façade D
8-27-AF-619A		Caulk at louver and window frame-white	Elevator pent house Exterior Façade D

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - N.U. Building additional samples

Lab Order ID: **10062115**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
8-30-AF-236D	Mastic on fiberglass end caps - white	**5% Chrysotile**		**95% Other**	White Non-Fibrous Homogeneous
10062115_0001					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (1)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10062115

Client:	Eagle Environmental, Inc.	***Instructions:**	
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*	
Address:	8 South Main Street, Terryville, CT		
Phone:	860-589-8257	*To See an Example Click the*	
Fax:	860-585-7034	*bottom Example Tab.*	
Email:	vfarkas@eagleenviro.com		
	bashe@eagleenviro.com		
		Enter samples between "<<" and ">>"	
Project:	Weston and Sampson - MIRA, Power Block Facility - N.U. Building additional samples	***Begin Samples with a "<< "above the first sample***	
		and end with a ">>" below the last sample.	
Client Notes:	Please stop on first positive in set Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*	
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional*	
Date Submitted:	9/6/2024 0:00	*fields that do not show up on the official report, however they will be included*	
Analysis:	PLM EPA 600R - 93/116	*in the electronic data returned to you*	
TurnAroundTime:	5 Day	*to facilitate your reintegration of the report data.*	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-30-AF-236D		Mastic on fiberglass end caps - white	Rm 5-53 Elevation 83'.75"

Accepted ☒

Rejected ☐

B Mueller 9/9 1039am

Relinquished By

Received By

PBF

NORTHWEST GUARD SHACK

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Northwest Guard Shack

Lab Order ID: **10064387**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
10-1-AF-666A	Brown floor tile mastic associated with white 12"x12" VFT	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064387_0001					Dissolved
10-1-AF-666B	Brown floor tile mastic associated with white 12"x12" VFT	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10064387_0002					Dissolved
10-1-AF-667A	12"x12" Vinyl floor tile - white with gray specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0003					Dissolved
10-1-AF-667B	12"x12" Vinyl floor tile - white with gray specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0004					Dissolved
10-1-AF-668A	Yellow vinyl cove base adhesive associated with white 4" VCB	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10064387_0005					Dissolved
10-1-AF-668B	Yellow vinyl cove base adhesive associated with white 4" VCB	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10064387_0006					Dissolved
10-1-AF-669A	4" Vinyl cove base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0007					Ashed
10-1-AF-669B	4" Vinyl cove base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (33)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Northwest Guard Shack

Lab Order ID: **10064387**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-670A	Single coat plaster skim coat on brick - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0009					Crushed
10-1-AF-670B	Single coat plaster skim coat on brick - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0010					Crushed
10-1-AF-670C	Single coat plaster skim coat on brick - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0011					Crushed
10-1-AF-671A	Sheet rock (ceiling)	**None Detected**	**10% Cellulose**	**90% Other**	White, Brown Non-Fibrous Homogeneous
10064387_0012					Teased
10-1-AF-671B	Sheet rock (ceiling)	**None Detected**	**10% Cellulose**	**90% Other**	Brown, White Non-Fibrous Homogeneous
10064387_0013					Teased
10-1-AF-672A	Joint compound associated with sheet rock ceiling - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0014					Teased
10-1-AF-672B	Joint compound associated with sheet rock ceiling - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0015					Teased
10-1-AF-673A	Thinset associated with 4"x4" ceramic wall tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0016					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (33)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Northwest Guard Shack

Lab Order ID: **10064387**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-673B	Thinset associated with 4"x4" ceramic wall tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0017					Crushed
10-1-AF-674A	Grout associated with 4"x4" ceramic wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0018					Crushed
10-1-AF-674B	Grout associated with 4"x4" ceramic wall tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0019					Crushed
10-1-AF-675A	Caulk at sink - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0020					Ashed
10-1-AF-675B	Caulk at sink - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10064387_0021					Ashed
10-1-AF-676A	Caulk at concrete window sill seam - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0022					Ashed
10-1-AF-676B	Caulk at concrete window sill seam - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0023					Ashed
10-1-AF-677A	Window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (33)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Northwest Guard Shack

Lab Order ID: **10064387**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-677B	Window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0025					Ashed
10-1-AF-678A	Door frame caulk - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0026					Ashed
10-1-AF-678B	Door frame caulk - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10064387_0027					Ashed
10-1-AF-679A	Flashing cement at concrete belt course - black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10064387_0028					Dissolved
10-1-AF-679B	Flashing cement at concrete belt course - black	**Not Analyzed**			
10064387_0029					
10-1-AF-680A	Ice and water sheild - black	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Non-Fibrous Homogeneous
10064387_0030					Dissolved
10-1-AF-680B	Ice and water sheild - black	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Non-Fibrous Homogeneous
10064387_0031					Dissolved
10-1-AF-681A	Architectural asphalt roof shingle - black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Non-Fibrous Homogeneous
10064387_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (33)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Northwest Guard Shack

Lab Order ID: **10064387**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-1-AF-681B	Architectural asphalt roof shingle - black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Non-Fibrous Homogeneous
10064387_0033					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (33)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

100643787

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Northwest Guard Shack
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	10/3/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	24 Hour

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-1-AF-666A		Brown floor tile mastic associated with white 12"x12" VFT	Rm 1-01
10-1-AF-666B		Brown floor tile mastic associated with white 12"x12" VFT	Rm 1-02
10-1-AF-667A		12"x12" Vinyl floor tile - white with gray specs	Rm 1-01
10-1-AF-667B		12"x12" Vinyl floor tile - white with gray specs	Rm 1-02
10-1-AF-668A		Yellow vinyl cove base adhesive associated with white 4" VCB	Rm 1-01
10-1-AF-668B		Yellow vinyl cove base adhesive associated with white 4" VCB	Rm 1-02
10-1-AF-669A		4" Vinyl cove base - white	Rm 1-01
10-1-AF-669B		4" Vinyl cove base - white	Rm 1-02
10-1-AF-670A		Single coat plaster skim coat on brick - white	Rm 1-01
10-1-AF-670B		Single coat plaster skim coat on brick - white	Rm 1-01
10-1-AF-670C		Single coat plaster skim coat on brick - white	Rm 1-02
10-1-AF-671A		Sheet rock (ceiling)	Rm 1-01
10-1-AF-671B		Sheet rock (ceiling)	Rm 1-01
10-1-AF-672A		Joint compound associated with sheet rock ceiling - white	Rm 1-01
10-1-AF-672B		Joint compound associated with sheet rock ceiling - white	Rm 1-01
10-1-AF-673A		Thinset associated with 4"x4" ceramic wall tile - white	Rm 1-02

Accepted ☒

Rejected ☐

Relinquished By

Received By

10/4 10:20 am

100643387

10-1-AF-673B		Thinset associated with 4"x4" ceramic wall tile - white	Rm 1-02
10-1-AF-674A		Grout associated with 4"x4" ceramic wall tile - gray	Rm 1-02
10-1-AF-674B		Grout associated with 4"x4" ceramic wall tile - gray	Rm 1-02
10-1-AF-675A		Caulk at sink - white	Rm 1-02
10-1-AF-675B		Caulk at sink - white	Rm 1-02
10-1-AF-676A		Caulk at concrete window sill seam - gray	Façade B
10-1-AF-676B		Caulk at concrete window sill seam - gray	Façade B
10-1-AF-677A		Window frame caulk - gray	Façade B
10-1-AF-677B		Window frame caulk - gray	Façade B
10-1-AF-678A		Door frame caulk - light gray	Façade B
10-1-AF-678B		Door frame caulk - light gray	Façade B
10-1-AF-679A		Flashing cement at concrete belt course - black	Façade C
10-1-AF-679B		Flashing cement at concrete belt course - black	Façade C
10-1-AF-680A		Ice and water sheild - black	Roof
10-1-AF-680B		Ice and water sheild - black	Roof
10-1-AF-681A		Architectural asphalt roof shingle - black	Roof
10-1-AF-681B		Architectural asphalt roof shingle - black	Roof

Relinquished By

Received By

PBF

ADMIN BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-12-AF-479A	Floor tile mastic - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0001	*very small sample*				Dissolved
8-12-AF-479B	Floor tile mastic - black	**None Detected**	**5% Cellulose**	**95% Other**	Black Non-Fibrous Homogeneous
10060371_0002					Dissolved
8-12-AF-480A	Residual floor tile mastic - yellow	**None Detected**		**100% Other**	Gray, Yellow Non-Fibrous Heterogeneous
10060371_0003	*mastic/leveling compound*				Dissolved, Crushed
8-12-AF-480B	Residual floor tile mastic - yellow	**None Detected**		**100% Other**	Black, Tan Non-Fibrous Heterogeneous
10060371_0004	*mixed mastics/leveling compound - small sample*				Crushed, Dissolved
8-12-AF-481A	Thinset associated with 7"x7" gray quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0005					Crushed
8-12-AF-481B	Thinset associated with 7"x7" gray quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0006					Crushed
8-12-AF-482A	Grout associated with 7"x7" gray quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0007					Crushed
8-12-AF-482B	Grout associated with 7"x7" gray quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0008					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-12-AF-483A	Sheet rock (wall)	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10060371_0009					Crushed
8-12-AF-483B	Sheet rock (wall)	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10060371_0010					Crushed
8-12-AF-484A	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0011					Crushed
8-12-AF-484B	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0012					Crushed
8-12-AF-485A	2'x2' acoustical ceiling tile - pin hole and fissure	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Other** **10% Perlite**	Gray, White Fibrous Heterogeneous
10060371_0013					Teased
8-12-AF-485B	2'x2' acoustical ceiling tile - pin hole and fissure	**None Detected**	**40% Fiber Glass** **40% Cellulose**	**10% Perlite** **10% Other**	White, Gray Fibrous Heterogeneous
10060371_0014					Teased
8-12-AF-486A	Paper insulation over fiberglass on pipes	**None Detected**	**70% Cellulose** **15% Fiber Glass**	**15% Other**	Silver, Tan Fibrous Heterogeneous
10060371_0015					Ashed
8-12-AF-486B	Paper insulation over fiberglass on pipes	**None Detected**	**70% Cellulose** **15% Fiber Glass**	**15% Other**	White, Silver Fibrous Heterogeneous
10060371_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-13-AF-486C	Paper insulation over fiberglass on pipes	**None Detected**	**70% Cellulose** **15% Fiber Glass**	**15% Other**	White, Silver Fibrous Heterogeneous
10060371_0017					Ashed
8-12-AF-487A	12"x12" vinyl floor tile - beige with gray specs and streaks	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0018					Dissolved
8-13-AF-487B	12"x12" vinyl floor tile - beige with gray specs and streaks	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0019					Dissolved
8-12-AF-488A	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0020					Dissolved
8-13-AF-488B	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0021					Dissolved
8-12-AF-489A	4" vinyl cove base - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0022					Ashed
8-13-AF-489B	4" vinyl cove base - brown	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0023					Ashed
8-12-AF-490A	Window glazing compound in hallway doors - black	**6% Chrysotile**		**94% Other**	Black Non-Fibrous Homogeneous
10060371_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-12-AF-490B	Window glazing compound in hallway doors - black	**Not Analyzed**			
10060371_0025					
8-12-AF-491A	Vinyl stair tred adhesive - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0026					Ashed
8-13-AF-491B	Vinyl stair tred adhesive - gray	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060371_0027					Ashed
8-12-AF-492A	Mortar associated with cube glass block windows - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0028					Crushed
8-13-AF-492B	Mortar associated with cube glass block windows - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0029					Crushed
8-12-AF-493A	Mortar associated with 2'x3' glazed wall tile - gray	**None Detected**		**100% Other**	Gray, Tan Non-Fibrous Heterogeneous
10060371_0030	*small sample*				Crushed
8-12-AF-493B		**None Detected**		**100% Other**	Gray, Tan Non-Fibrous Heterogeneous
10060371_0096	*not on COC - very small sample*				Crushed
8-12-AF-494A	2"x2' acoustical ceiling tile - rough face	**None Detected**	**90% Fiber Glass**	**10% Other**	Gray Fibrous Heterogeneous
10060371_0031					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-12-AF-494B	2"x2' acoustical ceiling tile - rough face	**None Detected**	**90% Fiber Glass**	**10% Other**	Gray Fibrous Heterogeneous
10060371_0032					Teased
8-12-AF-495A	Interior duct adhesive behind fiberglass - yellow	**Insufficient Sample**			
10060371_0033					
8-12-AF-496A	Thinset associated with 1"x1" ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0034					Crushed
8-12-AF-496B	Thinset associated with 1"x1" ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0035					Crushed
8-12-AF-497A	Grout associated with 1"x1" ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0036					Crushed
8-12-AF-497B	Grout associated with 1"x1" ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0037					Crushed
8-12-AF-498A	Adhesive associated with 1"x1" ceramic cream wall tile - yellow	**None Detected**		**100% Other**	Cream Non-Fibrous Homogeneous
10060371_0038					Ashed
8-12-AF-498B	Adhesive associated with 1"x1" ceramic cream wall tile - yellow	**None Detected**		**100% Other**	Cream Non-Fibrous Homogeneous
10060371_0039					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
8-12-AF-499A	Grout associated with 1"x1" ceramic wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0040					Crushed
8-12-AF-499B	Grout associated with 1"x1" ceramic wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0041					Crushed
8-12-AF-500A	Sealent at outer ductwork seams - red	**None Detected**		**100% Other**	Brown, White Non-Fibrous Homogeneous
10060371_0042	*small sample*				Ashed
8-12-AF-500B	Sealent at outer ductwork seams - red	**None Detected**		**100% Other**	Brown, White Non-Fibrous Homogeneous
10060371_0043	*small sample*				Ashed
8-12-AF-501A	Moisture barrier on interior face of exterior brick - black (A-wall)	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10060371_0044					Ashed
8-12-AF-501B	Moisture barrier on interior face of exterior brick - black (A-wall)	**Not Analyzed**			
10060371_0045					
8-12-AF-502A	Interlocking adhesive under ceramic floor tile - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0046					Crushed
8-12-AF-502B	Interlocking adhesive under ceramic floor tile - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0047					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-12-AF-503A	Plaster skim coat - white (wall)	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0048					Crushed
8-12-AF-503B	Plaster skim coat - white (wall)	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0049					Crushed
8-12-AF-503C	Plaster skim coat - white (wall)	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0050	*bag labeled 504C*				Crushed
8-12-AF-504A	Plaster rough coat - gray (wall)	**None Detected**		**100% Other**	Gray, Tan Non-Fibrous Heterogeneous
10060371_0051					Crushed
8-12-AF-504B	Plaster rough coat - gray (wall)	**None Detected**		**100% Other**	Tan, Gray Non-Fibrous Heterogeneous
10060371_0052					Crushed
8-12-AF-504C	Plaster rough coat - gray (wall)	**None Detected**		**100% Other**	Gray, Tan Non-Fibrous Heterogeneous
10060371_0053					Crushed
8-12-AF-505A	Terrazzo shower basin mudset - gray	**None Detected**		**100% Other**	Gray, Cream Non-Fibrous Heterogeneous
10060371_0054	*very small sample*				Crushed
8-12-AF-505B	Terrazzo shower basin mudset - gray	**None Detected**		**100% Other**	Cream, Gray Non-Fibrous Heterogeneous
10060371_0055					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-12-AF-506A	Skim coat on concrete ceiling deck - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0056					Crushed
8-12-AF-506B	Skim coat on concrete ceiling deck - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0057					Crushed
8-12-AF-506C	Skim coat on concrete ceiling deck - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0058					Crushed
8-13-AF-506D	Skim coat on concrete ceiling deck - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060371_0059					Crushed
8-12-AF-507A	Sealant in air handler seams - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0060					Ashed
8-12-AF-507B	Sealant in air handler seams - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0061					Ashed
8-12-AF-508A	Vinyl flex connector - white	**None Detected**	**90% Fiber Glass**	**10% Other**	White, Gray Fibrous Heterogeneous
10060371_0062					Teased
8-12-AF-508B	Vinyl flex connector - white	**None Detected**	**90% Fiber Glass**	**10% Other**	Gray, White Fibrous Heterogeneous
10060371_0063					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-12-AF-509A	Pipe dope on steam lines - white	**None Detected**		**100% Other**	Black, White Non-Fibrous Homogeneous
10060371_0064					Ashed
8-12-AF-509B	Pipe dope on steam lines - white	**None Detected**		**100% Other**	Black, White Non-Fibrous Homogeneous
10060371_0065					Ashed
8-12-AF-510A	Tar at radiator penetrations through floor - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0066					Ashed
8-12-AF-510B	Tar at radiator penetrations through floor - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0067					Ashed
8-12-AF-511A	Flooring leveler under 2'x2' rubber square tred - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0068					Crushed
8-12-AF-511B	Flooring leveler under 2'x2' rubber square tred - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0069					Crushed
8-12-AF-512A	Carpet adhesive - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0070					Dissolved
8-12-AF-512B	Carpet adhesive - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0071					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-12-AF-513A	4" vinyl cove base - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0072					Ashed
8-12-AF-513B	4" vinyl cove base - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060371_0073					Ashed
8-13-AF-514A	Tar coating on 3" roof drain pipe - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0074					Dissolved
8-13-AF-514B	Tar coating on 3" roof drain pipe - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0075					Dissolved
8-13-AF-515A	Mopped down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0076					Dissolved
8-13-AF-515B	Mopped down tar on concrete roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0077					Dissolved
8-13-AF-516A	Adhesive behind rubber membrane on parapet wall - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0078					Dissolved
8-13-AF-516B	Adhesive behind rubber membrane on parapet wall - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10060371_0079					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-13-AF-517A	Felt paper between built up foam under rubber membrane at pitched junction between parapet and roof field - black	**None Detected**		**100% Other**	Orange, Black Non-Fibrous Heterogeneous
10060371_0080					Dissolved
8-13-AF-517B	Felt paper between built up foam under rubber membrane at pitched junction between parapet and roof field - black	**None Detected**		**100% Other**	Orange, Black Non-Fibrous Heterogeneous
10060371_0081					Dissolved
8-13-AF-518A	Caulk - gray (at coping seams above parapet)	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10060371_0082					Ashed
8-13-AF-518B	Caulk - gray (at hand railings)	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0083					Ashed
8-13-AF-519A	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0084					Ashed
8-13-AF-519B	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060371_0085					Ashed
8-13-AF-520A	Flashing cement - black (at coping / building junction)	**8% Chrysotile**		**92% Other**	Gray, Black Non-Fibrous Homogeneous
10060371_0086					Ashed
8-13-AF-520B	Flashing cement - black (at coping / building junction)	**Not Analyzed**			
10060371_0087					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: PLM
Date Received: 08/19/2024
Date Reported: 08/26/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-13-AF-521A	Caulk at aluminum flashing / building junction - light gray	**3% Chrysotile**		**97% Other**	Black, Gray Non-Fibrous Homogeneous
10060371_0088					Ashed
8-13-AF-521B	Caulk at aluminum flashing / building junction - light gray	**Not Analyzed**			
10060371_0089					
8-13-AF-522A	Window frame caulk - gray	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Homogeneous
10060371_0090					Ashed
8-13-AF-522B	Window frame caulk - gray	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Homogeneous
10060371_0091					Ashed
8-13-AF-523A	Caulk at cube glass block windows - gray / hard / brittle	**5% Chrysotile**		**95% Other**	Gray, Green Non-Fibrous Heterogeneous
10060371_0092					Ashed
8-13-AF-523B	Caulk at cube glass block windows - gray / hard / brittle	**Not Analyzed**			
10060371_0093					
8-13-AF-524A	Caulk at louver - gray / hard / brittle	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10060371_0094					Crushed
8-13-AF-524B	Caulk at louver - gray / hard / brittle	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10060371_0095					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (96)
Analyst

Approved Signatory

160604371

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Power Block Facility Admin Building	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.* *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	
Date Submitted:		*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-12-AF-479A		Floor tile mastic - black	Rm 1-01
8-12-AF-479B		Floor tile mastic - black	ST-1
8-12-AF-480A		Residual floor tile mastic - yellow	Rm 1-01
8-12-AF-480B		Residual floor tile mastic - yellow	Rm 1-01
8-12-AF-481A		Thinset associated with 7"x7" gray quary tile - gray	Rm 1-01
8-12-AF-481B		Thinset associated with 7"x7" gray quary tile - gray	Rm 1-01
8-12-AF-482A		Grout associated with 7"x7" gray quary tile - gray	Rm 1-01
8-12-AF-482B		Grout associated with 7"x7" gray quary tile - gray	Rm 1-01
8-12-AF-483A		Sheet rock (wall)	Rm 1-01
8-12-AF-483B		Sheet rock (wall)	ST-1
8-12-AF-484A		Joint compound associated with sheet rock wall - white	Rm 1-01
8-12-AF-484B		Joint compound associated with sheet rock wall - white	ST-1
8-12-AF-485A		2'x2' acoustical ceiling tile - pin hole and fissure	Rm 1-01
8-12-AF-485B		2'x2' acoustical ceiling tile - pin hole and fissure	Rm 1-01
8-12-AF-486A		Paper insulation over fiberglass on pipes	Rm 1-01
8-12-AF-486B		Paper insulation over fiberglass on pipes	Rm 1-08
8-13-AF-486C		Paper insulation over fiberglass on pipes	ST-2

~~Accepted~~ ☑

~~Rejected~~ ☐

Relinquished By

Received By

8/19 10:30am

10060371

8-12-AF-487A		12"x12" vinyl floor tile - beige with gray specs and streaks	ST-1
8-13-AF-487B		12"x12" vinyl floor tile - beige with gray specs and streaks	Rm 3-25
8-12-AF-488A		4" vinyl cove base adhesive - yellow	ST-1
8-13-AF-488B		4" vinyl cove base adhesive - yellow	ST-2
8-12-AF-489A		4" vinyl cove base - brown	ST-1
8-13-AF-489B		4" vinyl cove base - brown	ST-2
8-12-AF-490A		Window glazing compound in hallway doors - black	ST-1
8-12-AF-490B		Window glazing compound in hallway doors - black	Rm 1-03
8-12-AF-491A		Vinyl stair tred adhesive - gray	ST-1
8-13-AF-491B		Vinyl stair tred adhesive - gray	ST-2
8-12-AF-492A		Mortar associated with cube glass block windows - gray	ST-1
8-13-AF-492B		Mortar associated with cube glass block windows - gray	ST-2
8-12-AF-493A		Mortar associated with 2'x3' glazed wall tile - gray	ST-1
8-12-AF-494A		2"x2' acoustical ceiling tile - rough face	Rm 1-03
8-12-AF-494B		2"x2' acoustical ceiling tile - rough face	Rm 2-16
8-12-AF-495A		Interior duct adhesive behind fiberglass - yellow	Rm 1-03
8-12-AF-496A		Thinset associated with 1"x1" ceramic floor tile - gray	Rm 1-04
8-12-AF-496B		Thinset associated with 1"x1" ceramic floor tile - gray	Rm 1-05
8-12-AF-497A		Grout associated with 1"x1" ceramic floor tile - gray	Rm 1-04
8-12-AF-497B		Grout associated with 1"x1" ceramic floor tile - gray	Rm 1-05
8-12-AF-498A		Adhesive associated with 1"x1" ceramic cream wall tile - yellow	Rm 1-04
8-12-AF-498B		Adhesive associated with 1"x1" ceramic cream wall tile - yellow	Rm 1-05
8-12-AF-499A		Grout associated with 1"x1" ceramic wall tile - gray	Rm 1-04
8-12-AF-499B		Grout associated with 1"x1" ceramic wall tile - gray	Rm 1-05
8-12-AF-500A		Sealent at outer ductwork seams - red	Rm 1-04
8-12-AF-500B		Sealent at outer ductwork seams - red	Rm 1-05
8-12-AF-501A		Moisture barrier on interior face of exterior brick - black (A-wall)	Rm 1-04
8-12-AF-501B		Moisture barrier on interior face of exterior brick - black (A-wall)	Rm 1-04
8-12-AF-502A		Interlocking adhesive under ceramic floor tile - yellow	Rm 1-04
8-12-AF-502B		Interlocking adhesive under ceramic floor tile - yellow	Rm 1-04
8-12-AF-503A		Plaster skim coat - white (wall)	Rm 1-05
8-12-AF-503B		Plaster skim coat - white (wall)	Rm 1-05
8-12-AF-503C		Plaster skim coat - white (wall)	Rm 2-11

Relinquished By

Received By

16060371

8-12-AF-504A		Plaster rough coat - gray (wall)	Rm 1-05
8-12-AF-504B		Plaster rough coat - gray (wall)	Rm 1-05
8-12-AF-504C		Plaster rough coat - gray (wall)	Rm 2-11
8-12-AF-505A		Terrazzo shower basin mudset - gray	Rm 1-05
8-12-AF-505B		Terrazzo shower basin mudset - gray	Rm 2-13
8-12-AF-506A		Skim coat on concrete ceiling deck - white	Rm 1-07
8-12-AF-506B		Skim coat on concrete ceiling deck - white	Rm 1-08
8-12-AF-506C		Skim coat on concrete ceiling deck - white	Rm 2-16
8-13-AF-506D		Skim coat on concrete ceiling deck - white	Rm 3-21
8-12-AF-507A		Sealant in air handler seams - black	Rm 1-08
8-12-AF-507B		Sealant in air handler seams - black	Rm 1-08
8-12-AF-508A		Vinyl flex connector - white	Rm 1-08
8-12-AF-508B		Vinyl flex connector - white	Rm 1-08
8-12-AF-509A		Pipe dope on steam lines - white	Rm 1-08
8-12-AF-509B		Pipe dope on steam lines - white	Rm 1-08
8-12-AF-510A		Tar at radiator penetrations through floor - black	Rm 2-12
8-12-AF-510B		Tar at radiator penetrations through floor - black	Rm 2-12
8-12-AF-511A		Flooring leveler under 2'x2' rubber square tred - gray	Rm 2-14
8-12-AF-511B		Flooring leveler under 2'x2' rubber square tred - gray	Rm 2-14
8-12-AF-512A		Carpet adhesive - yellow	Rm 2-16
8-12-AF-512B		Carpet adhesive - yellow	Rm 2-18
8-12-AF-513A		4" vinyl cove base - blue	Rm 2-16
8-12-AF-513B		4" vinyl cove base - blue	Rm 2-18
8-13-AF-514A		Tar coating on 3" roof drain pipe - black	Rm 3-21
8-13-AF-514B		Tar coating on 3" roof drain pipe - black	Rm 3-21
8-13-AF-515A		Mopped down tar on concrete roof deck - black	Roof #1 (lower level roof)
8-13-AF-515B		Mopped down tar on concrete roof deck - black	Roof #2 (top roof)
8-13-AF-516A		Adhesive behind rubber membrane on parapet wall - yellow	Roof #1 (lower level roof)
8-13-AF-516B		Adhesive behind rubber membrane on parapet wall - yellow	Roof #2 (top roof)
8-13-AF-517A		Felt paper between built up foam under rubber membrane at pitched junction between parapet and roof field - black	Roof #1 (lower level roof)
8-13-AF-517B		Felt paper between built up foam under rubber membrane at pitched junction between parapet and roof field - black	Roof #1 (lower level roof)

Relinquished By

Received By

10060371

8-13-AF-518A		Caulk - gray (at coping seams above parapet)	Roof #1 (lower level roof)
8-13-AF-518B		Caulk - gray (at hand railings)	Roof #2 (top roof)
8-13-AF-519A		Reglet caulk - black	Roof #1 (lower level roof)
8-13-AF-519B		Reglet caulk - black	Roof #2 (top roof)
8-13-AF-520A		Flashing cement - black (at coping / building junction)	Roof #1 (lower level roof)
8-13-AF-520B		Flashing cement - black (at coping / building junction)	Roof #1 (lower level roof)
8-13-AF-521A		Caulk at aluminum flashing / building junction - light gray	Roof #1 (lower level roof)
8-13-AF-521B		Caulk at aluminum flashing / building junction - light gray	Roof #1 (lower level roof)
8-13-AF-522A		Window frame caulk - gray	Façade A
8-13-AF-522B		Window frame caulk - gray	Façade C
8-13-AF-523A		Caulk at cube glass block windows - gray / hard / brittle	Façade A
8-13-AF-523B		Caulk at cube glass block windows - gray / hard / brittle	Façade A
8-13-AF-524A		Caulk at louver - gray / hard / brittle	Façade C
8-13-AF-524B		Caulk at louver - gray / hard / brittle	Façade C

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: TBS
Date Received: 09/12/2024
Date Reported: 09/13/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-12-AF-479B *10060371_0002*	**Floor tile mastic - black**	**85%**	**0%**	None Detected	
8-12-AF-480A *10060371_0003*	**Residual floor tile mastic - yellow**	**16%**	**0%**	None Detected	
8-12-AF-489A *10060371_0022*	**4" vinyl cove base - brown**	**58%**	**0%**	None Detected	
8-12-AF-491A *10060371_0026*	**Vinyl stair tred adhesive - gray**	**68%**	**0%**	None Detected	
8-12-AF-500A *10060371_0042*	**Sealent at outer ductwork seams - red**	**61%**	**0%**	None Detected	
8-12-AF-509A *10060371_0064*	**Pipe dope on steam lines - white**	**23%**	**29%**	None Detected	
8-12-AF-512A *10060371_0070*	**Carpet adhesive - yellow**	**47%**	**0%**	None Detected	
8-13-AF-514A *10060371_0074*	**Tar coating on 3" roof drain pipe - black**	**23%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (12)
Analyst

Approved Signatory

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block
Facility Admin Building

Lab Order ID: **10060371**
Analysis: TBS
Date Received: 09/12/2024
Date Reported: 09/13/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)		LCL-UCL (Wt. %)
8-13-AF-515A *10060371_0076*	**Mopped down tar on concrete roof deck - black**	**86%**	**0%**	None Detected		
8-13-AF-519A *10060371_0084*	**Reglet caulk - black**	**59%**	**0%**	None Detected		
8-13-AF-522A *10060371_0090*	**Window frame caulk - gray**	**75%**	**0%**	**0.25%**	**Chrysotile**	**0.22 - 0.27%**
8-13-AF-524A *10060371_0094*	**Caulk at louver - gray / hard / brittle**	**14%**	**77%**	**0.087%**	**Anthophyllite**	**0.078 - 0.095%**

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (12)
Analyst

Nathaniel J Durham
Approved Signatory

1006037 TEM
9/12/24
7:39AM
CK.

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility Admin Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	TEM: Chatfield
TurnAroundTime:	24 Hour

"Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<

8-12-AF-479B		Floor tile mastic - black	ST-1
8-12-AF-480A		Residual floor tile mastic - yellow	Rm 1-01
8-12-AF-489A		4" vinyl cove base - brown	ST-1
8-12-AF-491A		Vinyl stair tred adhesive - gray	ST-1
8-12-AF-500A		Sealent at outer ductwork seams - red	Rm 1-04
8-12-AF-509A		Pipe dope on steam lines - white	Rm 1-08
8-12-AF-512A		Carpet adhesive - yellow	Rm 2-16
8-13-AF-514A		Tar coating on 3" roof drain pipe - black	Rm 3-21
8-13-AF-515A		Mopped down tar on concrete roof deck - black	Roof #1 (lower level roof)
8-13-AF-519A		Reglet caulk - black	Roof #1 (lower level roof)
8-13-AF-522A		Window frame caulk - gray	Façade A
8-13-AF-524A		Caulk at louver - gray / hard / brittle	Façade C

>>

Accepted ☑

Rejected ☐

Relinquished By

Received By

PBF

BOILER ROOMS, TURBINE HALL, EXTERIOR & ROOFS

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-18-AF-234A	Concrete floor - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0001					Crushed
7-23-AF-234B	Concrete floor - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0002					Crushed
7-18-AF-235A	Terracotta block morter - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0003					Crushed
7-22-AF-235B	Terracotta block morter - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0004					Crushed
7-18-AF-192B	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0005					Crushed
7-19-AF-192C	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0006					Crushed
7-22-AF-192XC	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0007					Crushed
7-25-AF-192D	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0008					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-25-AF-192E	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0009					Crushed
7-30-AF-192F	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0010					Crushed
7-31-AF-192G	2" concrete fire proofing	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0011					Crushed
7-29-AF-547A	Paper insulation over fiberglass	**5% Chrysotile**	**20% Cellulose**	**75% Other**	White, Silver Fibrous Homogeneous
10059151_0012					Dissolved
7-18-AF-236A	Mastic on fiberglass endcaps - white	**8% Chrysotile**		**92% Other**	White Non-Fibrous Homogeneous
10059151_0013					Dissolved
7-23-AF-236B	Mastic on fiberglass endcaps - white	**Not Analyzed**			
10059151_0014					
7-29-AF-236C	Mastic on fiberglass endcaps - white	**Not Analyzed**			
10059151_0015					
7-18-AF-237A	Pipe dope on 2" water lines - white	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0016					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-237B	Pipe dope on 2" water lines - white	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0017	*small sample*				Crushed
7-29-AF-237C	Pipe dope on 2" water lines - white	**None Detected**		**100% Other**	Gray, Tan Non-Fibrous Heterogeneous
10059151_0018					Crushed
7-18-AF-238A	Pipe dope on 3" lines - orange	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10059151_0019					Crushed
7-29-AF-238B	Pipe dope on 3" lines - orange	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10059151_0020					Crushed
7-18-AF-239A	Mastic in interior breaching duct seams - black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059151_0021					Dissolved
7-18-AF-239B	Mastic in interior breaching duct seams - black	**Not Analyzed**			
10059151_0022					
7-18-AF-240A	Felt paper at interior boiler breaching behind angle iron - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059151_0023					Dissolved
7-18-AF-240B	Felt paper at interior boiler breaching behind angle iron - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059151_0024					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-18-AF-241A	Debris on top of breaching duct - white	**15% Amosite** **3% Crocidolite**		**82% Other**	Gray, White Fibrous Heterogeneous
10059151_0025					Teased
7-18-AF-241B	Debris on top of breaching duct - white	**Not Analyzed**			
10059151_0026					
7-18-AF-X241A	Window glazing compound in reinforced chicken wire windows - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0027					Dissolved, Crushed
7-23-AF-X241B	Window glazing compound in reinforced chicken wire windows - white	**None Detected**	**10% Wollastonite**	**90% Other**	Gray Non-Fibrous Homogeneous
10059151_0028					Dissolved
7-18-AF-242A	Insol block-19 at tanks - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0029					Teased
7-18-AF-242B	Insol block-19 at tanks - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0030					Teased
7-18-AF-242C	Insol block-19 at tanks - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0031					Teased
7-18-AF-243A	Protective cloth wrap over soft pack insulation	**None Detected**	**95% Fiber Glass**	**5% Other**	White Fibrous Homogeneous
10059151_0032					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-18-AF-243B	Protective cloth wrap over soft pack insulation	**None Detected**	**95% Fiber Glass**	**5% Other**	White Fibrous Homogeneous
10059151_0033					Teased
7-30-AF-243C	Protective cloth wrap over soft pack insulation	**None Detected**	**95% Fiber Glass**	**5% Other**	White Fibrous Homogeneous
10059151_0034					Teased
7-18-AF-244A	Plaster rough coat - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0035					Crushed
7-18-AF-244B	Plaster rough coat - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0036					Crushed
7-23-AF-244C	Plaster rough coat - brown	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0037					Crushed
7-18-AF-245A	Plaster skim coat - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0038					Crushed
7-18-AF-245B	Plaster skim coat - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0039					Crushed
7-23-AF-245C	Plaster skim coat - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0040					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel J Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-18-AF-246A	Window frame caulk - brown	**8% Chrysotile**		**92% Other**	Brown, Gray Non-Fibrous Heterogeneous
10059151_0041					Ashed
7-18-AF-246B	Window frame caulk - brown	**Not Analyzed**			
10059151_0042					
7-18-AF-247A	Stored gasket - gray	**None Detected**	**40% Cellulose**	**60% Other**	Black Fibrous Homogeneous
10059151_0043					Ashed
7-18-AF-247B	Stored gasket - gray	**None Detected**	**40% Cellulose**	**60% Other**	Black Fibrous Homogeneous
10059151_0044					Ashed
7-18-AF-248A	Window glazing compound in plain sash windows - white	**10% Chrysotile**		**90% Other**	Gray Non-Fibrous Homogeneous
10059151_0045					Ashed
7-19-AF-248B	Window glazing compound in plain sash windows - white	**Not Analyzed**			
10059151_0046					
7-22-AF-249A	calcium silicate insulation	**None Detected**	**20% Fiber Glass**	**80% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0047					Teased
7-23-AF-249B	calcium silicate insulation	**None Detected**	**20% Fiber Glass**	**80% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0048					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-249C	calcium silicate insulation	**None Detected**	**20% Fiber Glass**	**80% Other**	Gray, White Non-Fibrous Homogeneous
10059151_0049					Teased
7-19-AF-250A	Paint on structural components and pipes - metalic	**None Detected**		**100% Other**	Silver Non-Fibrous Homogeneous
10059151_0050					Dissolved
7-19-AF-250B	Paint on structural components and pipes - metalic	**None Detected**		**100% Other**	Silver Non-Fibrous Homogeneous
10059151_0051					Dissolved
7-23-AF-250C	Paint on structural components and pipes - metalic	**None Detected**		**100% Other**	Silver Non-Fibrous Homogeneous
10059151_0052					Dissolved
7-25-AF-250D	Paint on structural components and pipes - metalic	**None Detected**		**100% Other**	Silver Non-Fibrous Homogeneous
10059151_0053					Dissolved
7-19-AF-251A	Gasket at boiler recirculator heat tracing circuit - white	**60% Chrysotile**	**30% Cellulose**	**10% Other**	Brown, White Fibrous Homogeneous
10059151_0054	`				Teased
7-19-AF-251B	Gasket at boiler recirculator heat tracing circuit - white	**Not Analyzed**			
10059151_0055					
7-19-AF-252A	Caulk between slabs - white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0056					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-19-AF-252B	Caulk between slabs - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0057					Ashed
7-19-AF-253A	Window glazing compound in sliding door windows - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0058					Ashed
7-19-AF-253B	Window glazing compound in sliding door windows - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0059					Ashed
7-19-AF-254A	Expansion board between slabs - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0060					Dissolved
7-19-AF-254B	Expansion board between slabs - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0061					Dissolved
7-19-AF-255A	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0062					Dissolved
7-19-AF-255B	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0063					Dissolved
7-19-AF-256A	12"x12" vinyl floor tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0064					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-19-AF-256B	12"x12" vinyl floor tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0065					Dissolved
7-19-AF-257A	4" vinyl cove base adhesive - dark yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0066					Dissolved
7-19-AF-257B	4" vinyl cove base adhesive - dark yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0067					Dissolved
7-19-AF-258A	4" vinyl cove base - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0068					Ashed
7-19-AF-258B	4" vinyl cove base - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0069					Ashed
7-19-AF-259A	Sheet rock (wall)	**None Detected**	**10% Cellulose**	**90% Other**	White, Brown Non-Fibrous Homogeneous
10059151_0070					Teased
8-1-AF-259B	Sheet rock (wall)	**None Detected**	**10% Cellulose**	**90% Other**	White, Brown Non-Fibrous Homogeneous
10059151_0071					Teased
7-19-AF-260A	Joint compound associated with sheet rock - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0072					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-1-AF-260B	Joint compound associated with sheet rock - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0073					Teased
7-19-AF-261A	Spray applied fire proofing - thin / soft (type 1)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0074					Teased
7-19-AF-261B	Spray applied fire proofing - thin / soft (type 1)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0075					Teased
7-19-AF-261C	Spray applied fire proofing - thin / soft (type 1)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0076					Teased
7-19-AF-261D	Spray applied fire proofing - thin / soft (type 1)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0077					Teased
7-19-AF-261E	Spray applied fire proofing - thin / soft (type 1)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0078					Teased
7-19-AF-262A	Spray applied fire proofing - thick / hard (type 2)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0079					Teased
7-19-AF-262B	Spray applied fire proofing - thick / hard (type 2)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0080					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-19-AF-262C	Spray applied fire proofing - thick / hard (type 2)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0081					Teased
7-19-AF-262D	Spray applied fire proofing - thick / hard (type 2)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0082					Teased
7-19-AF-262E	Spray applied fire proofing - thick / hard (type 2)	**None Detected**	**20% Fiber Glass**	**60% Other** **20% Vermiculite**	Gray Fibrous Homogeneous
10059151_0083					Teased
7-19-AF-263A	Sealent at duct work seams - orange	**None Detected**		**100% Other**	Orange Non-Fibrous Homogeneous
10059151_0084					Dissolved
7-19-AF-263B	Sealent at duct work seams - orange	**None Detected**		**100% Other**	Orange Non-Fibrous Homogeneous
10059151_0085					Dissolved
7-19-AF-264A	Absorption pannels	**20% Chrysotile**		**80% Other**	Brown Non-Fibrous Homogeneous
10059151_0086					Crushed
7-19-AF-264B	Absorption pannels	**Not Analyzed**			
10059151_0087					
7-19-AF-265A	Gasket at air compressor unit - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059151_0088					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-19-AF-265B	Gasket at air compressor unit - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059151_0089					Ashed
7-19-AF-266A	Stored pipe insulation - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0090					Teased
7-19-AF-266B	Stored pipe insulation - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0091					Teased
7-19-AF-266C	Stored pipe insulation - white	**None Detected**	**30% Cellulose**	**70% Other**	White Fibrous Homogeneous
10059151_0092					Teased
7-19-AF-267A	Residual insulator in electrical box - gray / hard	**20% Chrysotile**		**80% Other**	Gray Non-Fibrous Homogeneous
10059151_0093					Teased
7-19-AF-267B	Residual insulator in electrical box - gray / hard	**Not Analyzed**			
10059151_0094					
7-19-AF-268A	Brick mortar - gray	**None Detected**	**40% Cellulose**	**60% Other**	Brown, Gray Fibrous Homogeneous
10059151_0095					Ashed, Teased
7-23-AF-268B	Brick mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0096					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-19-AF-269A	Tar coating on pipe - black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059151_0097					Dissolved
7-19-AF-269B	Tar coating on pipe - black	**Not Analyzed**			
10059151_0098					
7-19-AF-270A	Red 6"x6" quary tile setting cement	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0099					Crushed
7-30-AF-270B	Red 6"x6" quary tile setting cement	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0100					Crushed
7-19-AF-271A	Grout associated with red 6"x6" quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0101					Crushed
7-30-AF-271B	Grout associated with red 6"x6" quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0102					Crushed
7-22-AF-218B	Diplag wrap over calcium silicate	**None Detected**	**95% Fiber Glass**	**5% Other**	White Fibrous Homogeneous
10059151_0103					Teased
7-22-AF-272A	Residual mudded fitting insulation - gray	**40% Chrysotile**		**60% Other**	Gray Fibrous Homogeneous
10059151_0104					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-22-AF-272B	Residual mudded fitting insulation - gray	**Not Analyzed**			
10059151_0105					
7-22-AF-272C	Residual mudded fitting insulation - gray	**Not Analyzed**			
10059151_0106					
7-22-AF-272D	Residual mudded fitting insulation - gray	**Not Analyzed**			
10059151_0107					
7-25-AF-272E	Residual mudded fitting insulation - gray	**Not Analyzed**			
10059151_0108					
7-31-AF-272F	Residual mudded fitting insulation - gray	**Not Analyzed**			
10059151_0109					
7-22-AF-273A	Cement like sleeve in pipe conduit through floor - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0110					Crushed
7-22-AF-273B	Cement like sleeve in pipe conduit through floor - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0111					Crushed
7-22-AF-274A	Sink undercoating - cream	**None Detected**	**10% Cellulose**	**90% Other**	Cream Non-Fibrous Homogeneous
10059151_0112					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-22-AF-274B	Sink undercoating - cream	**None Detected**	**10% Cellulose**	**90% Other**	Cream Non-Fibrous Homogeneous
10059151_0113					Dissolved
7-22-AF-275A	Window glazing compound in plexyglass doors - gray	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0114	*mostly paint*				Dissolved
7-22-AF-275B	Window glazing compound in plexyglass doors - gray	**4% Chrysotile**		**96% Other**	Gray Non-Fibrous Homogeneous
10059151_0115					Dissolved
7-22-AF-276A	Ice and water shield over sprinkler room	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0116					Ashed
7-22-AF-276B	Ice and water shield over sprinkler room	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0117					Ashed
7-22-AF-277A	Tar paper in pipe penetration conduit through floor - black	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10059151_0118					Dissolved
7-22-AF-277B	Tar paper in pipe penetration conduit through floor - black	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10059151_0119					Dissolved
7-22-AF-278A	Residual debris in large pipe conduit through wall - white	**30% Chrysotile**		**70% Other**	White Fibrous Homogeneous
10059151_0120					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-22-AF-278B	Residual debris in large pipe conduit through wall - white	**Not Analyzed**			
10059151_0121					
7-22-AF-279A	Gasket on distribution line (typical)	**60% Chrysotile**		**40% Other**	Gray Fibrous Homogeneous
10059151_0122					Teased
7-22-AF-279B	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0123					
7-22-AF-280A	Magnesiumsilicate insulation on pipes (residual)	**30% Chrysotile**		**70% Other**	Gray, White Fibrous Heterogeneous
10059151_0124					Teased
7-22-AF-280B	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0125					
7-23-AF-280C	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0126					
7-23-AF-280D	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0127					
7-23-AF-280E	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0128					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-29-AF-280F	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0129					
7-31-AF-280G	Magnesiumsilicate insulation on pipes (residual)	**Not Analyzed**			
10059151_0130					
7-22-AF-281A	Brushed on paint on structural steel beam - black	**None Detected**		**100% Other**	Black, Orange Non-Fibrous Heterogeneous
10059151_0131					Dissolved
7-22-AF-281B	Brushed on paint on structural steel beam - black	**None Detected**		**100% Other**	Orange, Black Non-Fibrous Heterogeneous
10059151_0132					Dissolved
7-22-AF-281C	Brushed on paint on structural steel beam - black	**None Detected**		**100% Other**	Black, Orange Non-Fibrous Heterogeneous
10059151_0133					Dissolved
7-22-AF-282A	Tar on masonry brick - black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059151_0134					Dissolved
7-22-AF-282B	Tar on masonry brick - black	**Not Analyzed**			
10059151_0135					
7-22-AF-283A	Residual packing around perimeter of pipe conduit through wall - white	**20% Chrysotile**		**80% Other**	Gray, White Fibrous Heterogeneous
10059151_0136					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-22-AF-283B	Residual packing around perimeter of pipe conduit through wall - white	**Not Analyzed**			
10059151_0137					
7-22-AF-284A	Spray applied cementitious coating on foundation	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10059151_0138					Teased
7-22-AF-284B	Spray applied cementitious coating on foundation	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10059151_0139					Teased
7-22-AF-284C	Spray applied cementitious coating on foundation	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10059151_0140					Teased
7-22-AF-285A	Window glazing compound in door window - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0141					Ashed
7-23-AF-285B	Window glazing compound in door window - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0142					Ashed
7-22-AF-286A	Door frame caulk - beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0143					Ashed
7-23-AF-286B	Door frame caulk - beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0144					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-22-AF-287A	Styrofoam between interior and exterior panneling	**None Detected**		**100% Other**	Yellow, Gray Non-Fibrous Homogeneous
10059151_0145					Ashed
7-22-AF-287B	Styrofoam between interior and exterior panneling	**None Detected**		**100% Other**	Yellow, Gray Non-Fibrous Homogeneous
10059151_0146					Ashed
7-22-AF-288A	Sealent around rubber gasket - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10059151_0147					Ashed
7-22-AF-288B	Sealent around rubber gasket - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10059151_0148					Ashed
7-22-AF-289A	Expansion seam caulk at CMU / brick junction - white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0149					Ashed
7-22-AF-289B	Expansion seam caulk at CMU / brick junction - white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0150					Ashed
7-22-AF-290A	Refractory block at 6 H.P. heater - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0151					Teased
7-22-AF-290B	Refractory block at 6 H.P. heater - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0152					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-22-AF-290C	Refractory block at 6 H.P. heater - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0153					Teased
7-22-AF-291A	Caulk at foundation floor junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0154					Ashed
7-22-AF-291A	Caulk at foundation floor junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0155					Ashed
7-22-AF-292A	Caulk at abandoned window surround - gray	**5% Chrysotile**		**95% Other**	Gray, Tan Non-Fibrous Homogeneous
10059151_0156					Dissolved
7-22-AF-292B	Caulk at abandoned window surround - gray	**Not Analyzed**			
10059151_0157					
7-22-AF-293A	Window glazing compound in office partition windows - white	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10059151_0158	*mostly paint*				Dissolved, Crushed
7-22-AF-293B	Window glazing compound in office partition windows - white	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10059151_0159	*mostly paint*				Dissolved, Crushed
7-23-AF-294A	Electrical wire coating on >.25" lines - yellow	**10% Chrysotile**		**90% Other**	Gray Non-Fibrous Homogeneous
10059151_0160					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-31-AF-294B	Electrical wire coating on >.25" lines - yellow	**Not Analyzed**			
10059151_0161					
7-23-AF-295A	Electrical wire coating on >.25" lines - white	**30% Chrysotile**		**70% Other**	Gray Fibrous Homogeneous
10059151_0162					Teased
7-31-AF-295B	Electrical wire coating on >.25" lines - white	**Not Analyzed**			
10059151_0163					
7-23-AF-296A	Caulk at orignal building / addition junction - beige	**6% Chrysotile**		**94% Other**	Tan, Black Non-Fibrous Homogeneous
10059151_0164					Ashed
7-23-AF-296B	Caulk at orignal building / addition junction - beige	**Not Analyzed**			
10059151_0165					
7-23-AF-297A	Tar like verticle expansion board at original building / addition junction - black	**3% Chrysotile**	**15% Cellulose**	**82% Other**	Black Non-Fibrous Heterogeneous
10059151_0166					Dissolved
7-23-AF-297B	Tar like verticle expansion board at original building / addition junction - black	**Not Analyzed**			
10059151_0167					
7-23-AF-298A	Vapor paper behind brick - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059151_0168					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-298B	Vapor paper behind brick - black	**None Detected**	**80% Cellulose**	**20% Other**	Black Fibrous Homogeneous
10059151_0169					Ashed
7-23-AF-299A	Damp proofing (behind brick) - black	**5% Chrysotile**		**95% Other**	Gray, Black Non-Fibrous Heterogeneous
10059151_0170					Crushed, Teased
7-23-AF-299B	Damp proofing (on foundation) - black	**Not Analyzed**			
10059151_0171					
7-23-AF-300A	Tar at original brick at Dwall floor junction - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0172					Crushed
7-23-AF-300B	Tar at original brick at Dwall floor junction - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0173					Crushed
7-23-AF-301A	Mortar over lintell at window - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0174					Crushed
7-23-AF-301B	Mortar over lintell at window - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0175					Crushed
7-23-AF-302A	Tar on lintell under windows - black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Heterogeneous
10059151_0176					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel J Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-302B	Tar on lintell under windows - black	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10059151_0177					Dissolved
7-23-AF-303A	Electrical wire coating on <.25" lines - white	**70% Chrysotile**		**30% Other**	White, Gray Fibrous Homogeneous
10059151_0178					Teased
7-31-AF-303B	Electrical wire coating on <.25" lines - white	**Not Analyzed**			
10059151_0179					
7-31-AF-303C	Electrical wire coating on <.25" lines - white (at G.E. rheo stat)	**Not Analyzed**			
10059151_0180					
7-23-AF-304A	Transite pannel	**15% Chrysotile**		**85% Other**	Gray Fibrous Homogeneous
10059151_0181					Teased
7-25-AF-304B	Transite pannel (in fume hood)	**Not Analyzed**			
10059151_0182					
7-23-AF-305A	Window glazing compound in office windows - beige	**None Detected**		**100% Other**	Tan, Black Non-Fibrous Homogeneous
10059151_0183					Dissolved
7-23-AF-305B	Window glazing compound in office windows - beige	**None Detected**		**100% Other**	Black, Tan Non-Fibrous Homogeneous
10059151_0184					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-306A	Tar at column ceiling junction - black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10059151_0185					Dissolved
7-23-AF-306B	Tar at column ceiling junction - black	**Not Analyzed**			
10059151_0186					
7-23-AF-307A	Expansion board between slabs - black	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Heterogeneous
10059151_0187					Dissolved
7-23-AF-307B	Expansion board between slabs - black	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Heterogeneous
10059151_0188					Dissolved
7-23-AF-308A	Flooring leveler - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0189					Crushed
7-23-AF-308B	Flooring leveler - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0190					Crushed
7-23-AF-309A	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0191					Dissolved
7-23-AF-309B	Floor tile mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0192					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-310A	12"x12" vinyl floor tile - blue gray specs	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0193					Dissolved
7-23-AF-310B	12"x12" vinyl floor tile - blue gray specs	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0194					Dissolved
7-31-AF-310C	12"x12" vinyl floor tile - blue gray specs	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0195					Dissolved
7-23-AF-311A	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0196					Ashed
7-23-AF-311B	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0197					Ashed
8-1-AF-311C	4" vinyl cove base adhesive - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0198					Ashed
7-23-AF-312A	4" vinyl cove base - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059151_0199					Ashed
7-23-AF-312B	4" vinyl cove base - brown	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10059151_0200					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-313A	Gypsum board (wall)	**None Detected**	**15% Cellulose**	**85% Other**	Gray Non-Fibrous Homogeneous
10059151_0201					Crushed
7-23-AF-313B	Gypsum board (wall)	**None Detected**	**15% Cellulose**	**85% Other**	Gray Non-Fibrous Homogeneous
10059151_0202					Crushed
7-23-AF-314A	Joint compound associated with gypsum - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0203					Crushed
7-23-AF-314B	Joint compound associated with gypsum - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0204					Crushed
7-23-AF-315A	Laminant 2'x4' ceiling tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0205					Ashed
7-23-AF-315B	Laminant 2'x4' ceiling tile - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0206					Ashed
7-23-AF-316A	Glue daubs on brick behind foam - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0207					Dissolved, Crushed
7-23-AF-316B	Glue daubs on brick behind foam - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0208					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-317A	Floor tile mastic - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0209					Dissolved
7-23-AF-317B	Floor tile mastic - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0210					Dissolved
7-31-AF-317C	Floor tile mastic - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0211					Dissolved
7-23-AF-318A	12"x12" vinyl floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0212					Dissolved
7-23-AF-318B	12"x12" vinyl floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0213					Dissolved
7-23-AF-319A	Sealent at duct seams - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0214					Ashed
7-23-AF-319B	Sealent at duct seams - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0215					Ashed
7-25-AF-322A	12"x12" vinyl floor tile - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0216					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-25-AF-322B	12"x12" vinyl floor tile - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0217					Dissolved
7-25-AF-323A	Ebony lab table tops	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0218					Crushed
7-25-AF-323B	Ebony lab table tops	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0219					Crushed
7-25-AF-324A	Adhesive at counter mounted sinks - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0220					Ashed
7-25-AF-324B	Adhesive at counter mounted sinks - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0221					Ashed
7-25-AF-325A	2'x4' acoustical ceiling tile - worm hole pattern	**None Detected**	**40% Fiber Glass** **40% Cellulose**	**10% Other** **10% Perlite**	Gray Fibrous Homogeneous
10059151_0222					Ashed
7-25-AF-325B	2'x4' acoustical ceiling tile - worm hole pattern	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Perlite** **10% Other**	Gray Fibrous Homogeneous
10059151_0223					Ashed
7-25-AF-326A	Stored fire hose	**None Detected**	**95% Cellulose**	**5% Other**	White Fibrous Homogeneous
10059151_0224					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-25-AF-326B	Stored fire hose	**None Detected**	**98% Fiber Glass**	**2% Other**	White Fibrous Homogeneous
10059151_0225					Teased
7-25-AF-327A	Residual flashing cement at cement cap - black	**5% Chrysotile**	**30% Cellulose**	**65% Other**	Black Fibrous Heterogeneous
10059151_0226					Dissolved
7-25-AF-327B	Residual flashing cement at cement cap - black	**Not Analyzed**			
10059151_0227					
7-25-AF-328A	8"x8" Glass block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0228					Crushed
7-25-AF-328B	8"x8" Glass block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0229					Crushed
7-25-AF-329A	1'x1' Acoustical ceiling tile - ridge pattern	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Perlite** **10% Other**	Gray Fibrous Homogeneous
10059151_0230					Ashed
7-25-AF-329B	1'x1' Acoustical ceiling tile - ridge pattern	**None Detected**	**40% Cellulose** **40% Fiber Glass**	**10% Perlite** **10% Other**	Gray Fibrous Homogeneous
10059151_0231					Ashed
7-25-AF-330A	Adhesive under rubber roof membrane over CEM shack - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0232					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-25-AF-330B	Adhesive under rubber roof membrane over CEM shack - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10059151_0233					Dissolved
7-25-AF-331A	Coating on column caps - black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Heterogeneous
10059151_0234					Dissolved, Crushed
7-25-AF-331B	Coating on columns cap - black	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10059151_0235					Crushed
7-25-AF-332A	Tar felt paper on column cap - black	**50% Chrysotile**		**50% Other**	Gray, Black Fibrous Homogeneous
10059151_0236					Teased
7-25-AF-332B	Tar felt paper on column cap - black	**Not Analyzed**			
10059151_0237					
7-25-AF-333A	Fiberous cement board	**20% Chrysotile**		**80% Other**	Gray Non-Fibrous Homogeneous
10059151_0238					Teased
7-25-AF-333B	Fiberous cement board	**Not Analyzed**			
10059151_0239					
7-29-AF-217D	Soft pack pipe insulation - gray	**None Detected**	**30% Cellulose**	**70% Other**	Cream Fibrous Homogeneous
10059151_0240					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-29-AF-217E	Soft pack pipe insulation - gray (at tank)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0241					Teased
7-29-AF-217F	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0242					Teased
7-30-AF-217G	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0243					Teased
7-30-AF-217H	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass** **10% Cellulose**	**50% Other**	Gray, White Fibrous Heterogeneous
10059151_0244					Teased
7-30-AF-217I	Soft pack pipe insulation - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0245					Teased
7-30-AF-217J	Soft pack pipe insulation - gray	**Not Submitted**			
10059151_0246					
7-29-AF-334A	Packing at fiberglass end caps - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0247					Teased
7-29-AF-334B	Packing at fiberglass end caps - gray	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0248					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-29-AF-335A	1'x1' Fire block - white (above coal hopper)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0249					Teased
7-29-AF-335B	1'x1' Fire block - white (above coal hopper)	**None Detected**	**40% Fiber Glass**	**60% Other**	Gray Fibrous Heterogeneous
10059151_0250					Teased
7-29-AF-336A	1'x1' Fire block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0251					Crushed
7-29-AF-336B	1'x1' Fire block mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0252					Crushed
7-29-AF-337A	Window glazing compound associated with windows above coal hopper - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0253					Dissolved
7-29-AF-337B	Window glazing compound associated with windows above coal hopper - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0254					Dissolved
7-29-AF-338A	Skim coat at abanded pipe conduit through wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0255					Crushed
7-29-AF-338B	Skim coat at abanded pipe conduit through wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0256					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-29-AF-339A	Mudset associated with 6" ceramic boarder tile - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0257					Crushed
7-31-AF-339B	Mudset associated with 6" ceramic boarder tile - light gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059151_0258					Crushed
7-29-AF-340A	Grout associated with 6" ceramic boarder tile - gray	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0259					Crushed
7-31-AF-340B	Grout associated with 6" ceramic boarder tile - gray	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0260					Crushed
7-29-AF-341A	Tar wire coating - black	**None Detected**	**70% Cellulose**	**30% Other**	Black, Gray Fibrous Homogeneous
10059151_0261					Dissolved
7-29-AF-341B	Tar wire coating - black	**None Detected**	**70% Cellulose**	**30% Other**	Black, Gray Fibrous Homogeneous
10059151_0262					Dissolved
7-29-AF-342A	Tar like pipe wrap - thin/bumpy/brown	**None Detected**		**100% Other**	Gray, Beige Non-Fibrous Heterogeneous
10059151_0263					Crushed, Dissolved
7-30-AF-342B	Tar like pipe wrap - thin/bumpy/brown	**None Detected**		**100% Other**	Beige, Gray Non-Fibrous Heterogeneous
10059151_0264					Crushed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-342C	Tar like pipe wrap - thin/bumpy/brown	**None Detected**		**100% Other**	Beige, Gray Non-Fibrous Heterogeneous
10059151_0265					Crushed, Dissolved
7-30-AF-193 B	Damp proofing in interior turbine shaft - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0266					Dissolved
7-30-AF-343A	Window glazing compound in turbine shaft window - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0267					Crushed, Dissolved
7-31-AF-343B	Window glazing compound in turbine shaft window - white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059151_0268					Dissolved
7-30-AF-344A	Sealent between turbine shaft window frame access pannel - gray	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10059151_0269					Dissolved
7-31-AF-344B	Sealent between turbine shaft window frame access pannel - gray	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10059151_0270					Dissolved
7-30-AF-345A	Glazed 1920's brick	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0271					Crushed
7-31-AF-345B	Glazed 1920's brick	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0272					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-30-AF-346A	Glazed 1920's brick mortar	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0273					Crushed
7-31-AF-346B	Glazed 1920's brick mortar	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0274					Crushed
7-30-AF-347A	Typical gasket for area on distribution lines - black	**60% Chrysotile**	**30% Fiber Glass**	**10% Other**	Tan Fibrous Homogeneous
10059151_0275					Teased
7-30-AF-347B	Typical gasket for area on distribution lines - black	**Not Analyzed**			
10059151_0276					
7-30-AF-348A	Not sent	**Not Submitted**			
10059151_0277					
7-30-AF-349A	Mineral wool jacket on stored turbine part	**None Detected**	**95% Mineral Wool**	**5% Other**	White Fibrous Homogeneous
10059151_0278					Teased
7-30-AF-349B	Mineral wool jacket on stored turbine part	**None Detected**	**95% Mineral Wool**	**5% Other**	White Fibrous Homogeneous
10059151_0279					Teased
7-30-AF-350A	Hard caulk at brick column junction - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0280					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-350B	Hard caulk at brick column junction - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0281					Ashed
7-30-AF-351A	Tar felt paper at column behind birck - black	**None Detected**	**60% Cellulose**	**40% Other**	Black Fibrous Homogeneous
10059151_0282					Dissolved, Teased
7-30-AF-351B	Tar felt paper at column behind birck - black	**None Detected**	**60% Cellulose**	**40% Other**	Black Fibrous Homogeneous
10059151_0283					Teased, Dissolved
7-30-AF-352A	Pipe insulation at saddles - white	**None Detected**	**20% Synthetic Fibers**	**80% Other**	White Non-Fibrous Homogeneous
10059151_0284					Teased
7-30-AF-352B	Pipe insulation at saddles - white	**None Detected**	**20% Synthetic Fibers**	**80% Other**	White Non-Fibrous Homogeneous
10059151_0285					Teased
7-30-AF-352C	Pipe insulation at saddles - white	**None Detected**	**20% Synthetic Fibers**	**80% Other**	White Non-Fibrous Homogeneous
10059151_0286					Teased
7-30-AF-353A	Tar in large pipe conduit through wall - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0287					Dissolved
7-30-AF-353B	Tar in large pipe conduit through wall - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0288					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-354A	Tar coating on turbine #5 - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10059151_0289					Dissolved
7-30-AF-354B	Tar coating on turbine #5 - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10059151_0290					Dissolved
7-30-AF-354C	Tar coating on turbine #5 - black (valve)	None Detected		100% Other	Black Non-Fibrous Homogeneous
10059151_0291					Dissolved
7-30-AF-355A	Debris under turbine #5 - white	None Detected	20% Cellulose	80% Other	Gray, Tan Non-Fibrous Heterogeneous
10059151_0292					Teased
7-30-AF-355B	Debris under turbine #5 - white	None Detected	20% Cellulose	80% Other	Tan, Gray Non-Fibrous Heterogeneous
10059151_0293					Teased
7-30-AF-356A	Coating on large cooling lines to turbines - gray	None Detected		100% Other	Gray, Tan Non-Fibrous Homogeneous
10059151_0294					Ashed
7-30-AF-356B	Coating on large cooling lines to turbines - gray	None Detected		100% Other	Gray, Tan Non-Fibrous Homogeneous
10059151_0295					Ashed
7-30-AF-357A	Pipe wrap insulation on large cooling lines to turbines	None Detected		100% Other	Brown, Black Non-Fibrous Heterogeneous
10059151_0296					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-357B	Pipe wrap insulation on large cooling lines to turbines	**None Detected**		**100% Other**	Brown, Black Non-Fibrous Heterogeneous
10059151_0297					Dissolved
7-30-AF-358A	Debris on pipe under fiber glass - white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10059151_0298					Dissolved
7-30-AF-358B	Debris on pipe under fiber glass - white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10059151_0299					Dissolved
7-30-AF-358C	Debris on pipe under fiber glass - white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10059151_0300					Dissolved
7-30-AF-358D	Debris on pipe under fiber glass - white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0301					Dissolved
7-30-AF-358E		**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10059151_0344	*not on coc*				Dissolved
7-30-AF-359A	Sealent at large cooling line / turbine junction - beige	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0302					Ashed
7-30-AF-359B	Sealent at large cooling line / turbine junction - beige	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0303					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-30-AF-360A	Cloth wrap at large cooling line / turbine junction under sealent - white	None Detected	80% Synthetic Fibers	20% Other	Black, White Fibrous Heterogeneous
10059151_0304					Dissolved
7-30-AF-360B	Cloth wrap at large cooling line / turbine junction under sealent - white	None Detected	80% Synthetic Fibers	20% Other	Black, White Fibrous Heterogeneous
10059151_0305					Dissolved
7-31-AF-361A	Hard pack pipe insulation under cloth wrap - white	None Detected	30% Mineral Wool	70% Other	White Non-Fibrous Homogeneous
10059151_0306					Teased
7-31-AF-361B	Hard pack pipe insulation under cloth wrap - white	None Detected	30% Mineral Wool	70% Other	White Non-Fibrous Homogeneous
10059151_0307					Teased
7-31-AF-361C	Hard pack pipe insulation under cloth wrap - white	None Detected	30% Mineral Wool	70% Other	White Non-Fibrous Homogeneous
10059151_0308					Teased
7-31-AF-361D	Hard pack pipe insulation under cloth wrap - white	None Detected	30% Mineral Wool	70% Other	White Non-Fibrous Homogeneous
10059151_0309					Teased
7-31-AF-361E	Hard pack pipe insulation under cloth wrap - white	None Detected	30% Mineral Wool	70% Other	White Non-Fibrous Homogeneous
10059151_0310					Teased
7-31-AF-362A	Mudded fitting insulation associated with hard pack pipe insulation - gray	None Detected	30% Mineral Wool	70% Other	Gray Non-Fibrous Homogeneous
10059151_0311					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-31-AF-362B	Mudded fitting insulation associated with hard pack pipe insulation - gray	**None Detected**	**30% Mineral Wool**	**70% Other**	Gray Non-Fibrous Homogeneous
10059151_0312					Teased
7-31-AF-362C	Mudded fitting insulation associated with hard pack pipe insulation - gray	**None Detected**	**30% Mineral Wool**	**70% Other**	Gray Non-Fibrous Homogeneous
10059151_0313					Teased
7-31-AF-363A	Spacer on ceramic insulator studs - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0314					Crushed, Dissolved
7-31-AF-363B	Spacer on ceramic insulator studs - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0315					Crushed, Dissolved
7-31-AF-364A	Ebony backer board for electrical monitors - black	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0316					Crushed
7-31-AF-364B	Ebony backer board for electrical monitors - black	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059151_0317					Crushed
7-31-AF-365A	Hard conduit insulator through concrete - black	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10059151_0318					Dissolved
7-31-AF-365B	Hard conduit insulator through concrete - black	**None Detected**	**20% Cellulose**	**80% Other**	Black Non-Fibrous Homogeneous
10059151_0319					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-31-AF-366A	Tar coating at penetration sleeve through floor - black	**3% Chrysotile**		**97% Other**	Black Non-Fibrous Homogeneous
10059151_0320					Dissolved
7-31-AF-366B	Tar coating at penetration sleeve through floor - black	**Not Analyzed**			
10059151_0321					
7-31-AF-367A	Mud set associated with glazed 1920's brick	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0322					Crushed
7-31-AF-367B	Mud set associated with glazed 1920's brick	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0323					Crushed
7-31-AF-368A	Door frame caulk to stairwell - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0324					Ashed
7-31-AF-368B	Door frame caulk to stairwell - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0325					Ashed
7-31-AF-369A	Cloth jacket around pipes inside trubine shell	**None Detected**	**70% Fiber Glass**	**30% Other**	White, Brown Fibrous Heterogeneous
10059151_0326					Teased, Dissolved
7-31-AF-369B	Cloth jacket around pipes inside trubine shell	**None Detected**	**70% Fiber Glass**	**30% Other**	White, Brown Fibrous Heterogeneous
10059151_0327					Teased, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-31-AF-370A	Gasket at turbine acess hatch - black	**None Detected**	**70% Fiber Glass**	**30% Other**	Black Fibrous Homogeneous
10059151_0328					Dissolved, Teased
7-31-AF-370B	Gasket at turbine acess hatch - black	**None Detected**	**70% Fiber Glass**	**30% Other**	Black Fibrous Homogeneous
10059151_0329					Dissolved, Teased
7-31-AF-371A	Door frame caulk - off white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0330					Ashed
7-31-AF-371B	Door frame caulk - off white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10059151_0331					Ashed
7-31-AF-372A	Expansion joint caulk at 20's / 50's construction junction - off white	**4% Chrysotile**		**96% Other**	Gray, White Non-Fibrous Heterogeneous
10059151_0332					Ashed
7-31-AF-372B	Expansion joint caulk at 20's / 50's construction junction - off white	**Not Analyzed**			
10059151_0333					
7-31-AF-373A	Vinyl flex connector - black	**None Detected**	**70% Fiber Glass**	**30% Other**	White, Black Fibrous Homogeneous
10059151_0334					Ashed, Teased
7-31-AF-373B	Vinyl flex connector - black	**None Detected**	**70% Fiber Glass**	**30% Other**	Black, White Fibrous Homogeneous
10059151_0335					Teased, Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Interiors

Lab Order ID: **10059151**
Analysis: PLM
Date Received: 08/06/2024
Date Reported: 08/13/2024
Date Amended: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-1-AF-374A	Window glazing compound in office partition window - light gray	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10059151_0336					Ashed
8-1-AF-374B	Window glazing compound in office partition window - light gray	**Not Analyzed**			
10059151_0337					
8-1-AF-375A	2'x4' acoustical ceiling tile - pin hole & fissure pattern	**None Detected**	**45% Mineral Wool** **45% Cellulose**	**10% Other**	Gray Fibrous Homogeneous
10059151_0338					Teased, Ashed
8-1-AF-375B	2'x4' acoustical ceiling tile - pin hole & fissure pattern	**None Detected**	**45% Mineral Wool** **45% Cellulose**	**10% Other**	Gray Fibrous Homogeneous
10059151_0339					Teased, Ashed
8-1-AF-376A	Tar at roof drain - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0340					Ashed
8-1-AF-376B	Tar at roof drain - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0341					Ashed
8-1-AF-X376A	Building dust on floor	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0342					Dissolved
8-1-AF-X376B	Building dust on floor	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059151_0343					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (223)
Byron Stroble (121)
Analyst

Nathaniel J Durham
Approved Signatory

1005915 IR
10/24/24
2:54p
CK.

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility Interiors
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<			
7-18-AF-234A		Concrete floor - gray	Rm 0-01 Elevation 31'
7-23-AF-234B		Concrete floor - gray	Rm 2-27 Elevation 57'
7-18-AF-235A		Terracotta block morter - brown	Rm 0-01 Elevation 31'
7-22-AF-235B		Terracotta block morter - brown	Rm 2-27 Elevation 57'
7-18-AF-192B		2" concrete fire proofing	Rm 0-01 Elevation 31'
7-19-AF-192C		2" concrete fire proofing	Rm 0-07 Elevation 31'
7-22-AF-192XC		2" concrete fire proofing	Rm 0-14 Elevation 35'
7-25-AF-192D		2" concrete fire proofing	Rm 7-45 Elevation 114'
7-25-AF-192E		2" concrete fire proofing	Rm 7-45 Elevation 114'
7-30-AF-192F		2" concrete fire proofing	Rm 00-56 Elevation 11'
7-31-AF-192G		2" concrete fire proofing	Rm 00-59 Elevation 35'
7-29-AF-547A		Paper insulation over fiberglass	Rm 00-56 Elevation 11'
7-18-AF-236A		Mastic on fiberglass endcaps - white	Rm 0-01 Elevation 31'
7-23-AF-236B		Mastic on fiberglass endcaps - white	Rm 2-27 Elevation 57'
7-29-AF-236C		Mastic on fiberglass endcaps - white	Rm 00-56 Elevation 11'
7-18-AF-237A		Pipe dope on 2" water lines - white	Rm 0-01 Elevation 31'

Accepted ☑
Rejected ☐

Relinquished By

Received By

7-25-AF-250D		Paint on structural components and pipes - metalic	Rm 7-45 Elevation 114'
7-19-AF-251A		Gasket at boiler recirculator heat tracing circuit - white	Rm 0-07 Elevation 31'
7-19-AF-251B		Gasket at boiler recirculator heat tracing circuit - white	Rm 0-07 Elevation 31'
7-19-AF-252A		Caulk between slabs - white	Rm 0-07 Elevation 31'
7-19-AF-252B		Caulk between slabs - white	Rm 0-07 Elevation 31'
7-19-AF-253A		Window glazing compound in sliding door windows - white	Rm 0-07 Elevation 31'
7-19-AF-253B		Window glazing compound in sliding door windows - white	Rm 0-07 Elevation 31'
7-19-AF-254A		Expansion board between slabs - black	Rm 0-07 Elevation 31'
7-19-AF-254B		Expansion board between slabs - black	Rm 0-07 Elevation 31'
7-19-AF-255A		Floor tile mastic - yellow	Rm 0-08A Elevation 31'
7-19-AF-255B		Floor tile mastic - yellow	Rm 0-08A Elevation 31'
7-19-AF-256A		12"x12" vinyl floor tile - white	Rm 0-08A Elevation 31'
7-19-AF-256B		12"x12" vinyl floor tile - white	Rm 0-08A Elevation 31'
7-19-AF-257A		4" vinyl cove base adhesive - dark yellow	Rm 0-08A Elevation 31'
7-19-AF-257B		4" vinyl cove base adhesive - dark yellow	Rm 0-08A Elevation 31'
7-19-AF-258A		4" vinyl cove base - black	Rm 0-08A Elevation 31'
7-19-AF-258B		4" vinyl cove base - black	Rm 0-08A Elevation 31'
7-19-AF-259A		Sheet rock (wall)	Rm 0-08B Elevation 31'
8-1-AF-259B		Sheet rock (wall)	Rm 1-66
7-19-AF-260A		Joint compound associated with sheet rock - white	Rm 0-08B Elevation 31'
8-1-AF-260B		Joint compound associated with sheet rock - white	Rm 1-66
7-19-AF-261A		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261B		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261C		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261D		Spray applied fire proofing - thin / soft (type 1)	Rm 1-10 Elevation 45'
7-19-AF-261E		Spray applied fire proofing - thin / soft (type 1)	Rm 1-10 Elevation 45'
7-19-AF-262A		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262B		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262C		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262D		Spray applied fire proofing - thick / hard (type 2)	Rm 1-10 Elevation 45'
7-19-AF-262E		Spray applied fire proofing - thick / hard (type 2)	Rm 1-10 Elevation 45'

Relinquished By

Received By

7-19-AF-263A		Sealent at duct work seams - orange	Rm 1-09 Elevation 45'
7-19-AF-263B		Sealent at duct work seams - orange	Rm 1-10 Elevation 45'
7-19-AF-264A		Absorption pannels	Rm 0-11 Elevation 31'
7-19-AF-264B		Absorption pannels	Rm 0-11 Elevation 31'
7-19-AF-265A		Gasket at air compressor unit - brown	Rm 0-11 Elevation 31'
7-19-AF-265B		Gasket at air compressor unit - brown	Rm 0-11 Elevation 31'
7-19-AF-266A		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-266B		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-266C		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-267A		Residual insulator in electrical box - gray / hard	Rm 0-12 Elevation 35'
7-19-AF-267B		Residual insulator in electrical box - gray / hard	Rm 0-12 Elevation 35'
7-19-AF-268A		Brick mortar - gray	Rm 0-12 Elevation 35'
7-23-AF-268B		Brick mortar - gray	Rm 2-27 Elevation 57'
7-19-AF-269A		Tar coating on pipe - black	Rm 0-12 Elevation 35'
7-19-AF-269B		Tar coating on pipe - black	Rm 0-12 Elevation 35'
7-19-AF-270A		Red 6"x6" quary tile setting cement	Rm 0-13 Elevation 35'
7-30-AF-270B		Red 6"x6" quary tile setting cement	Rm 00-56 Elevation 11'
7-19-AF-271A		Grout associated with red 6"x6" quary tile - gray	Rm 0-13 Elevation 35'
7-30-AF-271B		Grout associated with red 6"x6" quary tile - gray	Rm 00-56 Elevation 11'
7-22-AF-218B		Diplag wrap over calcium silicate	Rm 0-13 Elevation 35'
7-22-AF-272A		Residual mudded fitting insulation - gray	Rm 0-13 Elevation 35'
7-22-AF-272B		Residual mudded fitting insulation - gray	Rm 0-13 Elevation 35'
7-22-AF-272C		Residual mudded fitting insulation - gray	Rm 0-15 Elevation 35'
7-22-AF-272D		Residual mudded fitting insulation - gray	Rm 2-27 Elevation 57'
7-25-AF-272E		Residual mudded fitting insulation - gray	Rm 7-46 Elevation 114'
7-31-AF-272F		Residual mudded fitting insulation - gray	RM 00-58 Elevation 25'
7-22-AF-273A		Cement like sleeve in pipe conduit through floor - gray	Rm 0-13 Elevation 35'
7-22-AF-273B		Cement like sleeve in pipe conduit through floor - gray	Rm 0-13 Elevation 35'
7-22-AF-274A		Sink undercoating - cream	Rm 0-16 Elevation 35'
7-22-AF-274B		Sink undercoating - cream	Rm 0-16 Elevation 35'
7-22-AF-275A		Window glazing compound in plexyglass doors - gray	Rm 0-16 Elevation 35'
7-22-AF-275B		Window glazing compound in plexyglass doors - gray	Rm 0-16 Elevation 35'
7-22-AF-276A		Ice and water shield over sprinkler room	ST-1
7-22-AF-276B		Ice and water shield over sprinkler room	ST-1
7-22-AF-277A		Tar paper in pipe penetration conduit through floor - black	Rm 0-17 Elevation ~21'
7-22-AF-277B		Tar paper in pipe penetration conduit through floor - black	Rm 0-17 Elevation ~21'
7-22-AF-278A		Residual debris in large pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-278B		Residual debris in large pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-279A		Gasket on distribution line (typical)	Rm 0-17 Elevation ~21'

Relinquished By

Received By

7-22-AF-279B		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-22-AF-280A		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-22-AF-280B		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-23-AF-280C		Magnesiumsilicate insulation on pipes (residual)	Rm 0-01 Elevation 31'
7-23-AF-280D		Magnesiumsilicate insulation on pipes (residual)	Rm 2-27 Elevation 57'
7-23-AF-280E		Magnesiumsilicate insulation on pipes (residual)	Rm 2-27 Elevation 57'
7-29-AF-280F		Magnesiumsilicate insulation on pipes (residual)	Rm 8-55
7-31-AF-280G		Magnesiumsilicate insulation on pipes (residual)	Rm 00-59 Elevation 25'
7-22-AF-281A		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-281B		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-281C		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-282A		Tar on masonry brick - black	Rm 0-17 Elevation ~21'
7-22-AF-282B		Tar on masonry brick - black	Rm 0-17 Elevation ~21'
7-22-AF-283A		Residual packing around perimeter of pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-283B		Residual packing around perimeter of pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-284A		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-284B		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-284C		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-285A		Window glazing compound in door window - black	Rm 0-18 Elevation 31'
7-23-AF-285B		Window glazing compound in door window - black	Rm 2-30 Elevation 57'
7-22-AF-286A		Door frame caulk - beige	Rm 0-18 Elevation 31'
7-23-AF-286B		Door frame caulk - beige	Rm 2-30 Elevation 57'
7-22-AF-287A		Styrofoam between interior and exterior panneling	Rm 0-18 Elevation 31'
7-22-AF-287B		Styrofoam between interior and exterior panneling	Rm 0-18 Elevation 31'
7-22-AF-288A		Sealent around rubber gasket - red	Rm 0-19 Elevation 31'
7-22-AF-288B		Sealent around rubber gasket - red	Rm 0-19 Elevation 31'
7-22-AF-289A		Expansion seam caulk at CMU / brick junction - white	Rm 0-19 Elevation 31'
7-22-AF-289B		Expansion seam caulk at CMU / brick junction - white	Rm 0-19 Elevation 31'
7-22-AF-290A		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-290B		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-290C		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-291A		Caulk at foundation floor junction - white	Rm 0-20
7-22-AF-291A		Caulk at foundation floor junction - white	Rm 0-20
7-22-AF-292A		Caulk at abandoned window surround - gray	Rm 0-22
7-22-AF-292B		Caulk at abandoned window surround - gray	Rm 0-22
7-22-AF-293A		Window glazing compound in office partition windows - white	Rm 0-23

Relinquished By

Received By

7-22-AF-293B		Window glazing compound in office partition windows - white	Rm 0-23
7-23-AF-294A		Electrical wire coating on >.25" lines - yellow	Rm 0-17 Elevation ~21'
7-31-AF-294B		Electrical wire coating on >.25" lines - yellow	Rm 00-56 Elevation 11'
7-23-AF-295A		Electrical wire coating on >.25" lines - white	Rm 0-17 Elevation ~21'
7-31-AF-295B		Electrical wire coating on >.25" lines - white	Rm 00-56 Elevation 11'
7-23-AF-296A		Caulk at orignal building / addition junction - beige	Rm 1-26 Elevation 45'
7-23-AF-296B		Caulk at orignal building / addition junction - beige	Rm 1-26 Elevation 45'
7-23-AF-297A		Tar like verticle expansion board at original building / addition junction - black	Rm 1-26 Elevation 45'
7-23-AF-297B		Tar like verticle expansion board at original building / addition junction - black	Rm 1-26 Elevation 45'
7-23-AF-298A		Vapor paper behind brick - black	Rm 1-26 Elevation 45'
7-23-AF-298B		Vapor paper behind brick - black	Rm 1-26 Elevation 45'
7-23-AF-299A		Damp proofing (behind brick) - black	Rm 1-26 Elevation 45'
7-23-AF-299B		Damp proofing (on foundation) - black	Rm 0-18 Elevation 31'
7-23-AF-300A		Tar at original brick at Dwall floor junction - black	Rm 1-26 Elevation 45'
7-23-AF-300B		Tar at original brick at Dwall floor junction - black	Rm 1-26 Elevation 45'
7-23-AF-301A		Mortar over lintell at window - gray	Rm 2-27 Elevation 57'
7-23-AF-301B		Mortar over lintell at window - gray	Rm 2-27 Elevation 57'
7-23-AF-302A		Tar on lintell under windows - black	Rm 2-27 Elevation 57'
7-23-AF-302B		Tar on lintell under windows - black	Rm 2-27 Elevation 57'
7-23-AF-303A		Electrical wire coating on <.25" lines - white	Rm 2-27 Elevation 57'
7-31-AF-303B		Electrical wire coating on <.25" lines - white	Rm 00-56 Elevation 11'
7-31-AF-303C		Electrical wire coating on <.25" lines - white (at G.E. rheo stat)	Rm 00-59 Elevation 25'
7-23-AF-304A		Transite pannel	Rm 2-29 Elevation 57'
7-25-AF-304B		Transite pannel (in fume hood)	Rm 2-38 Elevation 55'
7-23-AF-305A		Window glazing compound in office windows - beige	Rm 2-29 Elevation 57'
7-23-AF-305B		Window glazing compound in office windows - beige	Rm 2-29 Elevation 57'
7-23-AF-306A		Tar at column ceiling junction - black	Rm 2-29 Elevation 57'
7-23-AF-306B		Tar at column ceiling junction - black	Rm 2-29 Elevation 57'
7-23-AF-307A		Expansion board between slabs - black	Rm 2-30 Elevation 57'
7-23-AF-307B		Expansion board between slabs - black	Rm 2-30 Elevation 57'
7-23-AF-308A		Flooring leveler - white	Rm 2-30 Elevation 57'
7-23-AF-308B		Flooring leveler - white	Rm 2-30 Elevation 57'
7-23-AF-309A		Floor tile mastic - yellow	Rm 2-30 Elevation 57'
7-23-AF-309B		Floor tile mastic - yellow	Rm 2-33 Elevation 57'
7-23-AF-310A		12"x12" vinyl floor tile - blue gray specs	Rm 2-30 Elevation 57'
7-23-AF-310B		12"x12" vinyl floor tile - blue gray specs	Rm 2-33 Elevation 57'

Relinquished By

Received By

7-31-AF-310C		12"x12" vinyl floor tile - blue gray specs	Rm 1-66
7-23-AF-311A		4" vinyl cove base adhesive - yellow	Rm 2-30 Elevation 57'
7-23-AF-311B		4" vinyl cove base adhesive - yellow	Rm 2-33 Elevation 57'
8-1-AF-311C		4" vinyl cove base adhesive - yellow	Rm 1-66
7-23-AF-312A		4" vinyl cove base - brown	Rm 2-30 Elevation 57'
7-23-AF-312B		4" vinyl cove base - brown	Rm 2-33 Elevation 57'
7-23-AF-313A		Gypsum board (wall)	Rm 2-30 Elevation 57'
7-23-AF-313B		Gypsum board (wall)	Rm 2-30 Elevation 57'
7-23-AF-314A		Joint compound associated with gypsum - white	Rm 2-30 Elevation 57'
7-23-AF-314B		Joint compound associated with gypsum - white	Rm 2-33 Elevation 57'
7-23-AF-315A		Laminant 2'x4' ceiling tile - white	Rm 2-30 Elevation 57'
7-23-AF-315B		Laminant 2'x4' ceiling tile - white	Rm 2-33 Elevation 57'
7-23-AF-316A		Glue daubs on brick behind foam - white	Rm 2-32 Elevation 57'
7-23-AF-316B		Glue daubs on brick behind foam - white	Rm 2-32 Elevation 57'
7-23-AF-317A		Floor tile mastic - black	Rm 2-33 Elevation 57'
7-23-AF-317B		Floor tile mastic - black	Rm 2-31 Elevation 57'
7-31-AF-317C		Floor tile mastic - black	Rm 1-66
7-23-AF-318A		12"x12" vinyl floor tile - gray	Rm 2-33 Elevation 57'
7-23-AF-318B		12"x12" vinyl floor tile - gray	Rm 2-33 Elevation 57'
7-23-AF-319A		Sealent at duct seams - gray	Rm 2-33 Elevation 57'
7-23-AF-319B		Sealent at duct seams - gray	Rm 2-33 Elevation 57'
7-25-AF-322A		12"x12" vinyl floor tile - white	Rm 2-37 Elevation 55'
7-25-AF-322B		12"x12" vinyl floor tile - white	Rm 2-38 Elevation 55'
7-25-AF-323A		Ebony lab table tops	Rm 2-38 Elevation 55'
7-25-AF-323B		Ebony lab table tops	Rm 2-38 Elevation 55'
7-25-AF-324A		Adhesive at counter mounted sinks - black	Rm 2-38 Elevation 55'
7-25-AF-324B		Adhesive at counter mounted sinks - black	Rm 2-38 Elevation 55'
7-25-AF-325A		2'x4' acoustical ceiling tile - worm hole pattern	Rm 2-38 Elevation 55'
7-25-AF-325B		2'x4' acoustical ceiling tile - worm hole pattern	Rm 2-38 Elevation 55'
7-25-AF-326A		Stored fire hose	Rm 3-39 Elevation 64'
7-25-AF-326B		Stored fire hose	Rm 3-39 Elevation 64'
7-25-AF-327A		Residual flashing cement at cement cap - black	Rm 3-39 Elevation 64'
7-25-AF-327B		Residual flashing cement at cement cap - black	Rm 3-39 Elevation 64'
7-25-AF-328A		8"x8" Glass block mortar - gray	Rm 3-39 Elevation 64'
7-25-AF-328B		8"x8" Glass block mortar - gray	Rm 3-39 Elevation 64'
7-25-AF-329A		1'x1' Acoustical ceiling tile - ridge pattern	Rm 5-42 Elevation 89'
7-25-AF-329B		1'x1' Acoustical ceiling tile - ridge pattern	Rm 5-42 Elevation 89'
7-25-AF-330A		Adhesive under rubber roof membrane over CEM shack - yellow	Rm 5-42 Elevation 89'

Relinquished By

Received By

7-25-AF-330B		Adhesive under rubber roof membrane over CEM shack - yellow	Rm 5-42 Elevation 89'
7-25-AF-331A		Coating on column caps - black	Rm 7-45 Elevation 114'
7-25-AF-331B		Coating on columns cap - black	Rm 7-45 Elevation 114'
7-25-AF-332A		Tar felt paper on column cap - black	Rm 7-45 Elevation 114'
7-25-AF-332B		Tar felt paper on column cap - black	Rm 7-45 Elevation 114'
7-25-AF-333A		Fiberous cement board	Rm 7-47 Elevation 114'
7-25-AF-333B		Fiberous cement board	Rm 7-47 Elevation 114'
7-29-AF-217D		Soft pack pipe insulation - gray	Rm 6-54 Elevation 84'
7-29-AF-217E		Soft pack pipe insulation - gray (at tank)	Rm 6-54 Elevation 84'
7-29-AF-217F		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217G		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217H		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217I		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217J		Soft pack pipe insulation - gray	Rm 00-62 Elevation 31'
7-29-AF-334A		Packing at fiberglass end caps - gray	Rm 6-54 Elevation 84'
7-29-AF-334B		Packing at fiberglass end caps - gray	Rm 6-54 Elevation 84'
7-29-AF-335A		1'x1' Fire block - white (above coal hopper)	Rm 8-55
7-29-AF-335B		1'x1' Fire block - white (above coal hopper)	Rm 8-55
7-29-AF-336A		1'x1' Fire block mortar - gray	Rm 8-55
7-29-AF-336B		1'x1' Fire block mortar - gray	Rm 8-55
7-29-AF-337A		Window glazing compound associated with windows above coal hopper - white	Rm 8-55
7-29-AF-337B		Window glazing compound associated with windows above coal hopper - white	Rm 8-55
7-29-AF-338A		Skim coat at abanded pipe conduit through wall - white	Rm 00-56 Elevation 11'
7-29-AF-338B		Skim coat at abanded pipe conduit through wall - white	Rm 00-56 Elevation 11'
7-29-AF-339A		Mudset associated with 6" ceramic boarder tile - light gray	Rm 00-56 Elevation 11'
7-31-AF-339B		Mudset associated with 6" ceramic boarder tile - light gray	Rm 00-56 Elevation 11'
7-29-AF-340A		Grout associated with 6" ceramic boarder tile - gray	Rm 00-56 Elevation 11'
7-31-AF-340B		Grout associated with 6" ceramic boarder tile - gray	Rm 00-56 Elevation 11'
7-29-AF-341A		Tar wire coating - black	Rm 00-56 Elevation 11'
7-29-AF-341B		Tar wire coating - black	Rm 00-56 Elevation 11'
7-29-AF-342A		Tar like pipe wrap - thin/bumpy/brown	Rm 00-56 Elevation 11'
7-30-AF-342B		Tar like pipe wrap - thin/bumpy/brown	Rm 00-56 Elevation 11'
7-30-AF-342C		Tar like pipe wrap - thin/bumpy/brown	Rm 00-56 Elevation 11'
7-30-AF-193 B		Damp proofing in interior turbine shaft - black	Rm 00-56 Elevation 11'
7-30-AF-343A		Window glazing compound in turbine shaft window - white	Rm 00-56 Elevation 11'
7-31-AF-343B		Window glazing compound in turbine shaft window - white	Rm 00-56 Elevation 11'

Relinquished By

Received By

7-30-AF-344A		Sealent between turbine shaft window frame access pannel - gray	Rm 00-56 Elevation 11'
7-31-AF-344B		Sealent between turbine shaft window frame access pannel - gray	Rm 00-56 Elevation 11'
7-30-AF-345A		Glazed 1920's brick	Rm 00-56 Elevation 11'
7-31-AF-345B		Glazed 1920's brick	Rm 00-56 Elevation 11'
7-30-AF-346A		Glazed 1920's brick mortar	Rm 00-56 Elevation 11'
7-31-AF-346B		Glazed 1920's brick mortar	Rm 00-56 Elevation 11'
7-30-AF-347A		Typical gasket for area on distribution lines - black	Rm 00-56 Elevation 11'
7-30-AF-347B		Typical gasket for area on distribution lines - black	Rm 00-56 Elevation 11'
7-30-AF-348A		Not sent	
7-30-AF-349A		Mineral wool jacket on stored turbine part	Rm 00-56 Elevation 11'
7-30-AF-349B		Mineral wool jacket on stored turbine part	Rm 00-56 Elevation 11'
7-30-AF-350A		Hard caulk at brick column junction - black	Rm 00-56 Elevation 11'
7-30-AF-350B		Hard caulk at brick column junction - black	Rm 00-56 Elevation 11'
7-30-AF-351A		Tar felt paper at column behind birck - black	Rm 00-56 Elevation 11'
7-30-AF-351B		Tar felt paper at column behind birck - black	Rm 00-56 Elevation 11'
7-30-AF-352A		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-352B		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-352C		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-353A		Tar in large pipe conduit through wall - black	Rm 00-56 Elevation 11'
7-30-AF-353B		Tar in large pipe conduit through wall - black	Rm 00-56 Elevation 11'
7-30-AF-354A		Tar coating on turbine #5 - black	Rm 00-56 Elevation 11'
7-30-AF-354B		Tar coating on turbine #5 - black	Rm 00-56 Elevation 11'
7-30-AF-354C		Tar coating on turbine #5 - black (valve)	Rm 00-56 Elevation 11'
7-30-AF-355A		Debris under turbine #5 - white	Rm 00-56 Elevation 11'
7-30-AF-355B		Debris under turbine #5 - white	Rm 00-56 Elevation 11'
7-30-AF-356A		Coating on large cooling lines to turbines - gray	Rm 00-56 Elevation 11'
7-30-AF-356B		Coating on large cooling lines to turbines - gray	Rm 00-56 Elevation 11'
7-30-AF-357A		Pipe wrap insulation on large cooling lines to turbines	Rm 00-56 Elevation 11'
7-30-AF-357B		Pipe wrap insulation on large cooling lines to turbines	Rm 00-56 Elevation 11'
7-30-AF-358A		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358B		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358C		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358D		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-359A		Sealent at large cooling line / turbine junction - beige	Rm 00-56 Elevation 11'
7-30-AF-359B		Sealent at large cooling line / turbine junction - beige	Rm 00-56 Elevation 11'
7-30-AF-360A		Cloth wrap at large cooling line / turbine junction under sealent - white	Rm 00-56 Elevation 11'

Relinquished By

Received By

7-30-AF-360B		Cloth wrap at large cooling line / turbine junction under sealent - white	Rm 00-56 Elevation 11'
7-31-AF-361A		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361B		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361C		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361D		Hard pack pipe insulation under cloth wrap - white	Rm 00-62 Elevation 31'
7-31-AF-361E		Hard pack pipe insulation under cloth wrap - white	Rm 1-63 Elevation 63'
7-31-AF-362A		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-362B		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-362C		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-363A		Spacer on ceramic insulator studs - black	Rm 00-56 Elevation 11'
7-31-AF-363B		Spacer on ceramic insulator studs - black	Rm 00-56 Elevation 11'
7-31-AF-364A		Ebony backer board for electrical monitors - black	Rm 00-56 Elevation 11'
7-31-AF-364B		Ebony backer board for electrical monitors - black	Rm 00-56 Elevation 11'
7-31-AF-365A		Hard conduit insulator through concrete - black	Rm 00-58 Elevation 25'
7-31-AF-365B		Hard conduit insulator through concrete - black	Rm 00-58 Elevation 25'
7-31-AF-366A		Tar coating at penetration sleeve through floor - black	Rm 00-59 Elevation 25'
7-31-AF-366B		Tar coating at penetration sleeve through floor - black	Rm 00-59 Elevation 25'
7-31-AF-367A		Mud set associated with glazed 1920's brick	Rm 00-6- Elevation 25'
7-31-AF-367B		Mud set associated with glazed 1920's brick	Rm 00-6- Elevation 25'
7-31-AF-368A		Door frame caulk to stairwell - white	Rm 1-63 Elevation 63'
7-31-AF-368B		Door frame caulk to stairwell - white	Rm 1-63 Elevation 63'
7-31-AF-369A		Cloth jacket around pipes inside trubine shell	Rm 1-63 Elevation 63'
7-31-AF-369B		Cloth jacket around pipes inside trubine shell	Rm 1-63 Elevation 63'
7-31-AF-370A		Gasket at turbine acess hatch - black	Rm 1-63 Elevation 63'
7-31-AF-370B		Gasket at turbine acess hatch - black	Rm 1-63 Elevation 63'
7-31-AF-371A		Door frame caulk - off white	Rm 1-64
7-31-AF-371B		Door frame caulk - off white	Rm 1-64
7-31-AF-372A		Expansion joint caulk at 20's / 50's construction junction - off white	Rm 1-64
7-31-AF-372B		Expansion joint caulk at 20's / 50s construction junction - off white	Rm 1-64
7-31-AF-373A		Vinyl flex connector - black	Rm 1-65
7-31-AF-373B		Vinyl flex connector - black	Rm 1-65
8-1-AF-374A		Window glazing compound in office partition window - light gray	Rm 1-66

Relinquished By

Received By

8-1-AF-374B		Window glazing compound in office partition window - light gray	Rm 1-66
8-1-AF-375A		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 1-67
8-1-AF-375B		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 1-70
8-1-AF-376A		Tar at roof drain - black	Rm 1-68
8-1-AF-376B		Tar at roof drain - black	Rm 1-68
8-1-AF-X376A		Building dust on floor	Rm 0-01 Elevation 31'
8-1-AF-X376B		Building dust on floor	Rm 00-56 Elevation 11'

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block Facility Interiors

Lab Order ID: **10059151**
Analysis: TBS
Date Received: 08/19/2024
Date Reported: 08/21/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)		LCL-UCL (Wt. %)
7-18-AF-X241A	Window glazing compound in reinforced chicken wire windows -	8.7%	90.%	0.0095%	Anthophyllite	0.0086 - 0.010%
10059151_0027						
7-23-AF-302A	Tar on lintell under windows - black	45%	0%	None Detected		
10059151_0176						
7-23-AF-317A	Floor tile mastic - black	64%	0%	None Detected		
10059151_0209						
7-29-AF-341A	Tar wire coating - black	98%	0%	None Detected		
10059151_0261						
7-30-AF-193 B	Damp proofing in interior turbine shaft - black	80.%	0%	1.0%	Chrysotile	0.92 - 1.1%
10059151_0266						
7-30-AF-345A	Glazed 1920's brick	0.73%	0%	None Detected		
10059151_0271						

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (6)
Analyst

Approved Signatory

10059151

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility Interiors
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #:	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample and and with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-18-AF-234A		Concrete floor - gray	Rm 0-01 Elevation 31'
7-23-AF-234B		Concrete floor - gray	Rm 2-27 Elevation 57'
7-18-AF-235A		Terracotta block mortar - brown	Rm 0-01 Elevation 31'
7-22-AF-235B		Terracotta block mortar - brown	Rm 2-27 Elevation 57'
7-18-AF-192B		2" concrete fire proofing	Rm 0-01 Elevation 31'
7-19-AF-192C		2" concrete fire proofing	Rm 0-07 Elevation 31'
7-22-AF-192XC		2" concrete fire proofing	Rm 0-14 Elevation 35'
7-25-AF-192D		2" concrete fire proofing	Rm 7-45 Elevation 114'
7-25-AF-192E		2" concrete fire proofing	Rm 7-45 Elevation 114'
7-30-AF-192F		2" concrete fire proofing	Rm 00-56 Elevation 11'
7-31-AF-192G		2" concrete fire proofing	Rm 00-59 Elevation 25'
7-29-AF-22E		Paper insulation over fireplace	Rm 00-56 Elevation 11'
7-18-AF-236A		Mastic on fiberglass endcaps - white	Rm 0-01 Elevation 31'
7-23-AF-236B		Mastic on fiberglass endcaps - white	Rm 2-27 Elevation 57'
7-29-AF-236C		Mastic on fiberglass endcaps - white	Rm 00-56 Elevation 11'
7-18-AF-237A		Pipe dope on 2" water lines - white	Rm 0-01 Elevation 31'

Accepted ☑

Rejected ☐

Relinquished By

Received By

10:30am 8/6

10059151

7-23-AF-237B		Pipe dope on 2" water lines - white	Rm 2-27 Elevation 57'
7-29-AF-237C		Pipe dope on 2" water lines - white	Rm 00-56 Elevation 11'
7-18-AF-238A		Pipe dope on 3" lines - orange	Rm 0-01 Elevation 31'
7-29-AF-238B		Pipe dope on 3" lines - orange	Rm 8-55
7-18-AF-239A		Mastic in interior breaching duct seams - black	Rm 0-01 Elevation 31'
7-18-AF-239B		Mastic in interior breaching duct seams - black	Rm 0-01 Elevation 31'
7-18-AF-240A		Felt paper at interior boiler breaching behind angle iron - black	Rm 0-01 Elevation 31'
7-18-AF-240B		Felt paper at interior boiler breaching behind angle iron - black	Rm 0-01 Elevation 31'
7-18-AF-241A		Debris on top of breaching duct - white	Rm 0-01 Elevation 31'
7-18-AF-241B		Debris on top of breaching duct - white	Rm 0-01 Elevation 31'
7-18-AF-X241A		Window glazing compound in reinforced chicken wire windows - white	Rm 0-01 Elevation 31'
7-23-AF-X241B		Window glazing compound in reinforced chicken wire windows - white	Rm 2-27 Elevation 57'
7-18-AF-242A		Insol block-19 at tanks - white	Rm 0-01 Elevation 31'
7-18-AF-242B		Insol block-19 at tanks - white	Rm 0-01 Elevation 31'
7-18-AF-242C		Insol block-19 at tanks - white	Rm 0-01 Elevation 31'
7-18-AF-243A		Protective cloth wrap over soft pack insulation	Rm 0-01 Elevation 31'
7-18-AF-243B		Protective cloth wrap over soft pack insulation	Rm 0-06B Elevation 31'
7-30-AF-243C		Protective cloth wrap over soft pack insulation	Rm 00-56 Elevation 11'
7-18-AF-244A		Plaster rough coat - brown	Rm 0-02 Elevation 31'
7-18-AF-244B		Plaster rough coat - brown	Rm 0-04 Elevation 31'
7-23-AF-244C		Plaster rough coat - brown	2-28 Elevation 57'
7-18-AF-245A		Plaster skim coat - white	Rm 0-02 Elevation 31'
7-18-AF-245B		Plaster skim coat - white	Rm 0-04 Elevation 31'
7-23-AF-245C		Plaster skim coat - white	2-28 Elevation 57'
7-18-AF-246A		Window frame caulk - brown	Rm 0-02 Elevation 31'
7-18-AF-246B		Window frame caulk - brown	Rm 0-02 Elevation 31'
7-18-AF-247A		Stored gasket - gray	Rm 0-04 Elevation 31'
7-18-AF-247B		Stored gasket - gray	Rm 0-04 Elevation 31'
7-18-AF-248A		Window glazing compound in paint sash windows - white	Rm 0-08 Elevation 31'
7-19-AF-248B		Window glazing compound in paint sash windows - white	Rm 1-09 Elevation 45'
7-22-AF-249A		calcium silicate insulation	Rm 0-13 Elevation 36'
7-23-AF-249B		calcium silicate insulation	Rm 2-27 Elevation 57'
7-30-AF-249C		calcium silicate insulation	Rm 00-56 Elevation 11'
7-19-AF-250A		Paint on structural components and pipes - metalic	Rm 0-07 Elevation 31'
7-19-AF-250B		Paint on structural components and pipes - metalic	Rm 0-11 Elevation 31'
7-23-AF-250C		Paint on structural components and pipes - metalic	Rm 2-27 Elevation 57'

Relinquished By

Received By

1005915

7-25-AF-250D		Paint on structural components and pipes - metalic	Rm 7-45 Elevation 114'
7-19-AF-251A		Gasket at boiler recirculator heat tracing circuit - white	Rm 0-07 Elevation 31'
7-19-AF-251B		Gasket at boiler recirculator heat tracing circuit - white	Rm 0-07 Elevation 31'
7-19-AF-252A		Caulk between slabs - white	Rm 0-07 Elevation 31'
7-19-AF-252B		Caulk between slabs - white	Rm 0-07 Elevation 31'
7-19-AF-253A		Window glazing compound in sliding door windows - white	Rm 0-07 Elevation 31'
7-19-AF-253B		Window glazing compound in sliding door windows - white	Rm 0-07 Elevation 31'
7-19-AF-254A		Expansion board between slabs - black	Rm 0-07 Elevation 31'
7-19-AF-254B		Expansion board between slabs - black	Rm 0-07 Elevation 31'
7-19-AF-255A		Floor tile mastic - yellow	Rm 0-08A Elevation 31'
7-19-AF-255B		Floor tile mastic - yellow	Rm 0-08A Elevation 31'
7-19-AF-256A		12"x12" vinyl floor tile - white	Rm 0-08A Elevation 31'
7-19-AF-256B		12"x12" vinyl floor tile - white	Rm 0-08A Elevation 31'
7-19-AF-257A		4" vinyl cove base adhesive - dark yellow	Rm 0-08A Elevation 31'
7-19-AF-257B		4" vinyl cove base adhesive - dark yellow	Rm 0-08A Elevation 31'
7-19-AF-258A		4" vinyl cove base - black	Rm 0-08A Elevation 31'
7-19-AF-258B		4" vinyl cove base - black	Rm 0-08A Elevation 31'
7-19-AF-259A		Sheet rock (wall)	Rm 0-08B Elevation 31'
8-1-AF-259B		Sheet rock (wall)	Rm 1-66
7-19-AF-260A		Joint compound associated with sheet rock - white	Rm 0-08B Elevation 31'
8-1-AF-260B		Joint compound associated with sheet rock - white	Rm 1-66
7-19-AF-261A		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261B		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261C		Spray applied fire proofing - thin / soft (type 1)	Rm 1-09 Elevation 45'
7-19-AF-261D		Spray applied fire proofing - thin / soft (type 1)	Rm 1-10 Elevation 45'
7-19-AF-261E		Spray applied fire proofing - thin / soft (type 1)	Rm 1-10 Elevation 45'
7-19-AF-262A		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262B		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262C		Spray applied fire proofing - thick / hard (type 2)	Rm 1-09 Elevation 45'
7-19-AF-262D		Spray applied fire proofing - thick / hard (type 2)	Rm 1-10 Elevation 45'
7-19-AF-262E		Spray applied fire proofing - thick / hard (type 2)	Rm 1-10 Elevation 45'

Relinquished By

Received By

10059151

7-19-AF-263A		Sealent at duct work seams - orange	Rm 1-09 Elevation 45'
7-19-AF-263B		Sealent at duct work seams - orange	Rm 1-10 Elevation 45'
7-19-AF-264A		Absorption pannels	Rm 0-11 Elevation 31'
7-19-AF-264B		Absorption pannels	Rm 0-11 Elevation 31'
7-19-AF-265A		Gasket at air compressor unit - brown	Rm 0-11 Elevation 31'
7-19-AF-265B		Gasket at air compressor unit - brown	Rm 0-11 Elevation 31'
7-19-AF-266A		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-266B		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-266C		Stored pipe insulation - white	Rm 0-12 Elevation 35'
7-19-AF-267A		Residual insulator in electrical box - gray / hard	Rm 0-12 Elevation 35'
7-19-AF-267B		Residual insulator in electrical box - gray / hard	Rm 0-12 Elevation 35'
7-19-AF-268A		Brick mortar - gray	Rm 0-12 Elevation 35'
7-23-AF-268B		Brick mortar - gray	Rm 2-27 Elevation 57'
7-19-AF-269A		Tar coating on pipe - black	Rm 0-12 Elevation 35'
7-19-AF-269B		Tar coating on pipe - black	Rm 0-12 Elevation 35'
7-19-AF-270A		Red 6"x6" quary tile setting cement	Rm 0-13 Elevation 35'
7-30-AF-270B		Red 6"x6" quary tile setting cement	Rm 00-56 Elevation 11'
7-19-AF-271A		Grout associated with red 6"x6" quary tile - gray	Rm 0-13 Elevation 35'
7-30-AF-271B		Grout associated with red 6"x6" quary tile - gray	Rm 00-56 Elevation 11'
7-22-AF-218B		Diplag wrap over calcium silicate	Rm 0-13 Elevation 35'
7-22-AF-272A		Residual mudded fitting insulation - gray	Rm 0-13 Elevation 35'
7-22-AF-272B		Residual mudded fitting insulation - gray	Rm 0-13 Elevation 35'
7-22-AF-272C		Residual mudded fitting insulation - gray	Rm 0-15 Elevation 35'
7-22-AF-272D		Residual mudded fitting insulation - gray	Rm 2-27 Elevation 57'
7-25-AF-272E		Residual mudded fitting insulation - gray	Rm 7-48 Elevation 114'
7-31-AF-272F		Residual mudded fitting insulation - gray	RM 00-58 Elevation 25'
7-22-AF-273A		Cement like sleeve in pipe conduit through floor - gray	Rm 0-13 Elevation 35'
7-22-AF-273B		Cement like sleeve in pipe conduit through floor - gray	Rm 0-13 Elevation 35'
7-22-AF-274A		Sink undercoating - cream	Rm 0-16 Elevation 35'
7-22-AF-274B		Sink undercoating - cream	Rm 0-16 Elevation 35'
7-22-AF-275A		Window glazing compound in plexyglass doors - gray	Rm 0-16 Elevation 35'
7-22-AF-275B		Window glazing compound in plexyglass doors - gray	Rm 0-16 Elevation 35'
7-22-AF-276A		Ice and water shield over sprinkler room	ST-1
7-22-AF-276B		Ice and water shield over sprinkler room	ST-1
7-22-AF-277A		Tar paper in pipe penetration conduit through floor - black	Rm 0-17 Elevation -21'
7-22-AF-277B		Tar paper in pipe penetration conduit through floor - black	Rm 0-17 Elevation -21'
7-22-AF-278A		Residual debris in large pipe conduit through wall - white	Rm 0-17 Elevation -21'
7-22-AF-278B		Residual debris in large pipe conduit through wall - white	Rm 0-17 Elevation -21'
7-22-AF-279A		Gasket on distribution line (typical)	Rm 0-17 Elevation -21'

Relinquished By

Received By

10059151

7-22-AF-279B		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-22-AF-280A		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-22-AF-280B		Magnesiumsilicate insulation on pipes (residual)	Rm 0-17 Elevation ~21'
7-23-AF-280C		Magnesiumsilicate insulation on pipes (residual)	Rm 0-01 Elevation 31'
7-23-AF-280D		Magnesiumsilicate insulation on pipes (residual)	Rm 2-27 Elevation 57'
7-23-AF-280E		Magnesiumsilicate insulation on pipes (residual)	Rm 2-27 Elevation 57'
7-29-AF-280F		Magnesiumsilicate insulation on pipes (residual)	Rm 8-55
7-31-AF-280G		Magnesiumsilicate insulation on pipes (residual)	Rm 00-59 Elevation 25'
7-22-AF-281A		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-281B		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-281C		Brushed on paint on structural steel beam - black	Rm 0-17 Elevation ~21'
7-22-AF-282A		Tar on masonry brick - black	Rm 0-17 Elevation ~21'
7-22-AF-282B		Tar on masonry brick - black	Rm 0-17 Elevation ~21'
7-22-AF-283A		Residual packing around perimeter of pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-283B		Residual packing around perimeter of pipe conduit through wall - white	Rm 0-17 Elevation ~21'
7-22-AF-284A		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-284B		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-284C		Spray applied cementitious coating on foundation	Rm 0-18 Elevation 31'
7-22-AF-285A		Window glazing compound in door window - black	Rm 0-18 Elevation 31'
7-23-AF-285B		Window glazing compound in door window - black	Rm 2-30 Elevation 57'
7-22-AF-286A		Door frame caulk - beige	Rm 0-18 Elevation 31'
7-23-AF-286B		Door frame caulk - beige	Rm 2-30 Elevation 57'
7-22-AF-287A		Styrofoam between interior and exterior panneling	Rm 0-18 Elevation 31'
7-22-AF-287B		Styrofoam between interior and exterior panneling	Rm 0-18 Elevation 31'
7-22-AF-288A		Sealant around rubber gasket - red	Rm 0-19 Elevation 31'
7-22-AF-288B		Sealant around rubber gasket - red	Rm 0-19 Elevation 31'
7-22-AF-289A		Expansion seam caulk at CMU / brick junction - white	Rm 0-19 Elevation 31'
7-22-AF-289B		Expansion seam caulk at CMU / brick junction - white	Rm 0-19 Elevation 31'
7-22-AF-290A		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-290B		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-290C		Refractory block at 6 H.P. heater - white	Rm 0-18 Elevation 31'
7-22-AF-291A		Caulk at foundation floor junction - white	Rm 0-20
7-22-AF-291A		Caulk at foundation floor junction - white	Rm 0-20
7-22-AF-292A		Caulk at abandoned window surround - gray	Rm 0-22
7-22-AF-292B		Caulk at abandoned window surround - gray	Rm 0-22
7-22-AF-293A		Window glazing compound in office partition windows - white	Rm 0-23

Relinquished By

Received By

10059151

7-22-AF-293B		Window glazing compound in office partition windows - white	Rm 0-23
7-23-AF-294A		Electrical wire coating on >.25" lines - yellow	Rm 0-17 Elevation -21'
7-31-AF-294B		Electrical wire coating on >.25" lines - yellow	Rm 00-59 Elevation 11'
7-23-AF-295A		Electrical wire coating on >.25" lines - white	Rm 0-17 Elevation -21'
7-31-AF-295B		Electrical wire coating on >.25" lines - white	Rm 00-56 Elevation 11'
7-23-AF-296A		Caulk at original building / addition junction - beige	Rm 1-26 Elevation 45'
7-23-AF-296B		Caulk at original building / addition junction - beige	Rm 1-26 Elevation 45'
7-23-AF-297A		Tar like verticle expansion board at original building / addition junction - black	Rm 1-26 Elevation 45'
7-23-AF-297B		Tar like verticle expansion board at original building / addition junction - black	Rm 1-26 Elevation 45'
7-23-AF-298A		Vapor paper behind brick - black	Rm 1-26 Elevation 45'
7-23-AF-298B		Vapor paper behind brick - black	Rm 1-26 Elevation 45'
7-23-AF-299A		Damp proofing (behind brick) - black	Rm 1-26 Elevation 45'
7-23-AF-299B		Damp proofing (on foundation) - black	Rm 0-18 Elevation 31'
7-23-AF-300A		Tar at original brick at Dwall floor junction - black	Rm 1-26 Elevation 45'
7-23-AF-300B		Tar at original brick at Dwall floor junction - black	Rm 1-26 Elevation 45'
7-23-AF-301A		Mortar over lintell at window - gray	Rm 2-27 Elevation 57'
7-23-AF-301B		Mortar over lintell at window - gray	Rm 2-27 Elevation 57'
7-23-AF-302A		Tar on lintell under windows - black	Rm 2-27 Elevation 57'
7-23-AF-302B		Tar on lintell under windows - black	Rm 2-27 Elevation 57'
7-23-AF-303A		Electrical wire coating on <.25" lines - white	Rm 2-27 Elevation 57'
7-31-AF-303B		Electrical wire coating on <.25" lines - white	Rm 00-56 Elevation 11'
7-31-AF-303C		Electrical wire coating on <.25" lines - white (at G.E. rheo stat)	Rm 00-59 Elevation 25'
7-23-AF-304A		Transite pannel	Rm 2-29 Elevation 57'
7-25-AF-304B		Transite pannel (in fume hood)	Rm 2-38 Elevation 55'
7-23-AF-305A		Window glazing compound in office windows - beige	Rm 2-29 Elevation 57'
7-23-AF-305B		Window glazing compound in office windows - beige	Rm 2-29 Elevation 57'
7-23-AF-306A		Tar at column ceiling junction - black	Rm 2-29 Elevation 57'
7-23-AF-306B		Tar at column ceiling junction - black	Rm 2-29 Elevation 57'
7-23-AF-307A		Expansion board between slabs - black	Rm 2-30 Elevation 57'
7-23-AF-307B		Expansion board between slabs - black	Rm 2-30 Elevation 57'
7-23-AF-308A		Flooring leveler - white	Rm 2-30 Elevation 57'
7-23-AF-308B		Flooring leveler - white	Rm 2-30 Elevation 57'
7-23-AF-309A		Floor tile mastic - yellow	Rm 2-30 Elevation 57'
7-23-AF-309B		Floor tile mastic - yellow	Rm 2-33 Elevation 57'
7-23-AF-310A		12"x12" vinyl floor tile - blue gray specs	Rm 2-30 Elevation 57'
7-23-AF-310B		12"x12" vinyl floor tile - blue gray specs	Rm 2-33 Elevation 57'

Relinquished By

Received By

10059151

7-31-AF-310C		12"x12" vinyl floor tile - blue gray specs	Rm 1-66
7-23-AF-311A		4" vinyl cove base adhesive - yellow	Rm 2-30 Elevation 57'
7-23-AF-311B		4" vinyl cove base adhesive - yellow	Rm 2-33 Elevation 57'
8-1-AF-311C		4" vinyl cove base adhesive - yellow	Rm 1-66
7-23-AF-312A		4" vinyl cove base - brown	Rm 2-30 Elevation 57'
7-23-AF-312B		4" vinyl cove base - brown	Rm 2-33 Elevation 57'
7-23-AF-313A		Gypsum board (wall)	Rm 2-30 Elevation 57'
7-23-AF-313B		Gypsum board (wall)	Rm 2-30 Elevation 57'
7-23-AF-314A		Joint compound associated with gypsum - white	Rm 2-30 Elevation 57'
7-23-AF-314B		Joint compound associated with gypsum - white	Rm 2-33 Elevation 57'
7-23-AF-315A		Laminant 2'x4' ceiling tile - white	Rm 2-30 Elevation 57'
7-23-AF-315B		Laminant 2'x4' ceiling tile - white	Rm 2-33 Elevation 57'
7-23-AF-316A		Glue daubs on brick behind foam - white	Rm 2-32 Elevation 57'
7-23-AF-316B		Glue daubs on brick behind foam - white	Rm 2-32 Elevation 57'
7-23-AF-317A		Floor tile mastic - black	Rm 2-33 Elevation 57'
7-23-AF-317B		Floor tile mastic - black	Rm 2-31 Elevation 57'
7-31-AF-317C		Floor tile mastic - black	Rm 1-66
7-23-AF-318A		12"x12" vinyl floor tile - gray	Rm 2-33 Elevation 57'
7-23-AF-318B		12"x12" vinyl floor tile - gray	Rm 2-33 Elevation 57'
7-23-AF-319A		Sealent at duct seams - gray	Rm 2-33 Elevation 57'
7-23-AF-319B		Sealent at duct seams - gray	Rm 2-33 Elevation 57'
7-25-AF-322A		12"x12" vinyl floor tile - white	Rm 2-37 Elevation 55'
7-25-AF-322B		12"x12" vinyl floor tile - white	Rm 2-38 Elevation 55'
7-25-AF-323A		Ebony lab table tops	Rm 2-38 Elevation 55'
7-25-AF-323B		Ebony lab table tops	Rm 2-38 Elevation 55'
7-25-AF-324A		Adhesive at counter mounted sinks - black	Rm 2-38 Elevation 55'
7-25-AF-324B		Adhesive at counter mounted sinks - black	Rm 2-38 Elevation 55'
7-25-AF-325A		2'x4' acoustical ceiling tile - worm hole pattern	Rm 2-38 Elevation 55'
7-25-AF-325B		2'x4' acoustical ceiling tile - worm hole pattern	Rm 2-38 Elevation 55'
7-25-AF-326A		Stored fire hose	Rm 3-39 Elevation 64'
7-25-AF-326B		Stored fire hose	Rm 3-39 Elevation 64'
7-25-AF-327A		Residual flashing cement at cement cap - black	Rm 3-39 Elevation 64'
7-25-AF-327B		Residual flashing cement at cement cap - black	Rm 3-39 Elevation 64'
7-25-AF-328A		8"x6" Glass block mortar - gray	Rm 3-39 Elevation 64'
7-25-AF-328B		8"x6" Glass block mortar - gray	Rm 3-39 Elevation 64'
7-25-AF-329A		1'x1' Acoustical ceiling tile - ridge pattern	Rm 5-42 Elevation 89'
7-25-AF-329B		1'x1' Acoustical ceiling tile - ridge pattern	Rm 5-42 Elevation 89'
7-25-AF-330A		Adhesive under rubber roof membrane over CEM shack - yellow	Rm 5-42 Elevation 89'

Relinquished By

Received By

10059151

7-25-AF-330B		Adhesive under rubber roof membrane over CEM shack - yellow	Rm 5-42 Elevation 89'
7-25-AF-331A		Coating on column caps - black	Rm 7-45 Elevation 114'
7-25-AF-331B		Coating on columns cap - black	Rm 7-45 Elevation 114'
7-25-AF-332A		Tar felt paper on column cap - black	Rm 7-45 Elevation 114'
7-25-AF-332B		Tar felt paper on column cap - black	Rm 7-45 Elevation 114'
7-25-AF-333A		Fiberous cement board	Rm 7-47 Elevation 114'
7-25-AF-333B		Fiberous cement board	Rm 7-47 Elevation 114'
7-29-AF-217D		Soft pack pipe insulation - gray	Rm 6-54 Elevation 84'
7-29-AF-217E		Soft pack pipe insulation - gray (at tank)	Rm 6-54 Elevation 84'
7-29-AF-217F		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217G		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217H		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217I		Soft pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-30-AF-217J		Soft pack pipe insulation - gray	Rm 00-62 Elevation 31'
7-29-AF-334A		Packing at fiberglass end caps - gray	Rm 6-54 Elevation 84'
7-29-AF-334B		Packing at fiberglass end caps - gray	Rm 6-54 Elevation 84'
7-29-AF-335A		1'x1' Fire block - white (above coal hopper)	Rm 8-55
7-29-AF-335B		1'x1' Fire block - white (above coal hopper)	Rm 8-55
7-29-AF-336A		1'x1' Fire block mortar - gray	Rm 8-55
7-29-AF-336B		1'x1' Fire block mortar - gray	Rm 8-55
7-29-AF-337A		Window glazing compound associated with windows above coal hopper - white	Rm 8-55
7-29-AF-337B		Window glazing compound associated with windows above coal hopper - white	Rm 8-55
7-29-AF-338A		Skim coat at abanded pipe conduit through wall - white	Rm 00-56 Elevation 11'
7-29-AF-338B		Skim coat at abanded pipe conduit through wall - white	Rm 00-56 Elevation 11'
7-29-AF-339A		Mudset associated with 6" ceramic boarder tile - light gray	Rm 00-56 Elevation 11'
7-31-AF-339B		Mudset associated with 6" ceramic boarder tile - light gray	Rm 00-56 Elevation 11'
7-29-AF-340A		Grout associated with 6" ceramic boarder tile - gray	Rm 00-56 Elevation 11'
7-31-AF-340B		Grout associated with 6" ceramic boarder tile - gray	Rm 00-56 Elevation 11'
7-29-AF-341A		Tar wire coating - black	Rm 00-56 Elevation 11'
7-29-AF-341B		Tar wire coating - black	Rm 00-56 Elevation 11'
7-29-AF-342A		Vermiculite pipe wrap on thin tar	Rm 00-56 Elevation 11'
7-30-AF-342B		Vermiculite pipe wrap on thin tar	Rm 00-56 Elevation 11'
7-30-AF-342C		Vermiculite pipe wrap on thin tar	Rm 00-56 Elevation 11'
7-30-AF-193 B		Damp proofing in interior turbine shaft - black	Rm 00-56 Elevation 11'
7-30-AF-343A		Window glazing compound in turbine shaft window - white	Rm 00-56 Elevation 11'
7-31-AF-343B		Window glazing compound in turbine shaft window - white	Rm 00-56 Elevation 11'

Relinquished By

Received By

10059151

7-30-AF-344A		Sealent between turbine shaft window frame access pannel - gray	Rm 00-56 Elevation 11'
7-31-AF-344B		Sealent between turbine shaft window frame access pannel - gray	Rm 00-56 Elevation 11'
7-30-AF-345A		Glazed 1920's brick	Rm 00-56 Elevation 11'
7-31-AF-345B		Glazed 1920's brick	Rm 00-56 Elevation 11'
7-30-AF-346A		Glazed 1920's brick mortar	Rm 00-56 Elevation 11'
7-31-AF-346B		Glazed 1920's brick mortar	Rm 00-56 Elevation 11'
7-30-AF-347A		Typical gasket for area on distribution lines - black	Rm 00-56 Elevation 11'
7-30-AF-347B		Typical gasket for area on distribution lines - black	Rm 00-56 Elevation 11'
7-30-AF-348A		Not sent	
7-30-AF-349A		Mineral wool jacket on stored turbine part	Rm 00-56 Elevation 11'
7-30-AF-349B		Mineral wool jacket on stored turbine part	Rm 00-56 Elevation 11'
7-30-AF-350A		Hard caulk at brick column junction - black	Rm 00-56 Elevation 11'
7-30-AF-350B		Hard caulk at brick column junction - black	Rm 00-56 Elevation 11'
7-30-AF-351A		Tar felt paper at column behind brick - black	Rm 00-56 Elevation 11'
7-30-AF-351B		Tar felt paper at column behind brick - black	Rm 00-56 Elevation 11'
7-30-AF-352A		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-352B		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-352C		Pipe insulation at saddles - white	Rm 00-56 Elevation 11'
7-30-AF-353A		Tar in large pipe conduit through wall - black	Rm 00-56 Elevation 11'
7-30-AF-353B		Tar in large pipe conduit through wall - black	Rm 00-56 Elevation 11'
7-30-AF-354A		Tar coating on turbine #5 - black	Rm 00-56 Elevation 11'
7-30-AF-354B		Tar coating on turbine #5 - black	Rm 00-56 Elevation 11'
7-30-AF-354C		Tar coating on turbine #5 - black (valve)	Rm 00-56 Elevation 11'
7-30-AF-355A		Debris under turbine #5 - white	Rm 00-56 Elevation 11'
7-30-AF-355B		Debris under turbine #5 - white	Rm 00-56 Elevation 11'
7-30-AF-356A		Coating on large cooling lines to turbines - gray	Rm 00-56 Elevation 11'
7-30-AF-356B		Coating on large cooling lines to turbines - gray	Rm 00-56 Elevation 11'
7-30-AF-357A		Vermiculite insulation on large cooling lines to turbines	Rm 00-56 Elevation 11'
7-30-AF-357B		Vermiculite insulation on large cooling lines to turbines	Rm 00-56 Elevation 11'
7-30-AF-358A		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358B		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358C		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-358D		Debris on pipe under fiber glass - white	Rm 00-56 Elevation 11'
7-30-AF-359A		Sealent at large cooling line / turbine junction - beige	Rm 00-56 Elevation 11'
7-30-AF-359B		Sealent at large cooling line / turbine junction - beige	Rm 00-56 Elevation 11'
7-30-AF-360A		Cloth wrap at large cooling line / turbine junction under sealent - white	Rm 00-56 Elevation 11'

Relinquished By

Received By

10059151

7-30-AF-360B		Cloth wrap at large cooling line / turbine junction under sealent - white	Rm 00-56 Elevation 11'
7-31-AF-361A		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361B		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361C		Hard pack pipe insulation under cloth wrap - white	Rm 00-56 Elevation 11'
7-31-AF-361D		Hard pack pipe insulation under cloth wrap - white	Rm 00-62 Elevation 31'
7-31-AF-361E		Hard pack pipe insulation under cloth wrap - white	Rm 1-63 Elevation 63'
7-31-AF-362A		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-362B		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-362C		Mudded fitting insulation associated with hard pack pipe insulation - gray	Rm 00-56 Elevation 11'
7-31-AF-363A		Spacer on ceramic insulator studs - black	Rm 00-56 Elevation 11'
7-31-AF-363B		Spacer on ceramic insulator studs - black	Rm 00-56 Elevation 11'
7-31-AF-364A		Ebony backer board for electrical monitors - black	Rm 00-56 Elevation 11'
7-31-AF-364B		Ebony backer board for electrical monitors - black	Rm 00-56 Elevation 11'
7-31-AF-365A		Hard conduit insulator through concrete - black	Rm 00-58 Elevation 25'
7-31-AF-365B		Hard conduit insulator through concrete - black	Rm 00-58 Elevation 25'
7-31-AF-366A		Tar coating at penetration sleeve through floor - black	Rm 00-59 Elevation 25'
7-31-AF-366B		Tar coating at penetration sleeve through floor - black	Rm 00-59 Elevation 25'
7-31-AF-367A		Mud set associated with glazed 1920's brick	Rm 00-6- Elevation 25'
7-31-AF-367B		Mud set associated with glazed 1920's brick	Rm 00-6- Elevation 25'
7-31-AF-368A		Door frame caulk to stairwell - white	Rm 1-63 Elevation 63'
7-31-AF-368B		Door frame caulk to stairwell - white	Rm 1-63 Elevation 63'
7-31-AF-369A		Cloth jacket around pipes inside trubine shell	Rm 1-63 Elevation 63'
7-31-AF-369B		Cloth jacket around pipes inside trubine shell	Rm 1-63 Elevation 63'
7-31-AF-370A		Gasket at turbine acess hatch - black	Rm 1-63 Elevation 65'
7-31-AF-370B		Gasket at turbine acess hatch - black	Rm 1-63 Elevation 65'
7-31-AF-371A		Door frame caulk - off white	Rm 1-64
7-31-AF-371B		Door frame caulk - off white	Rm 1-64
7-31-AF-372A		Expansion joint caulk at 20's / 70's construction junction - off white	Rm 1-64
7-31-AF-372B		Expansion joint caulk at 20's / 70's construction junction - off white	Rm 1-64
7-31-AF-373A		Vinyl flex connector - black	Rm 1-65
7-31-AF-373B		Vinyl flex connector - black	Rm 1-65
8-1-AF-374A		Window glazing compound in office partition window - light gray	Rm 1-66

Relinquished By

Received By

10059151

8-1-AF-374B		Window glazing compound in office partition window - light gray	Rm 1-66
8-1-AF-375A		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 1-67
8-1-AF-375B		2'x4' acoustical ceiling tile - pin hole & fissure pattern	Rm 1-70
8-1-AF-376A		Tar at roof drain - black	Rm 1-66
8-1-AF-376B		Tar at roof drain - black	Rm 1-66
8-1-AF-X376A		Building dust on floor	Rm 0-01 Elevation 31'
8-1-AF-X376B		Building dust on floor	Rm 00-56 Elevation 11'

>>

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Interiors, additional samples

Lab Order ID: **10060446**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-578B	Paper insulation over fiber glass on pipes - white / silver	**None Detected**	**75% Cellulose** **15% Fiber Glass**	**10% Other**	Beige Fibrous Homogeneous
10060446_0001					Teased, Ashed
8-15-AF-578C	Paper insulation over fiber glass on pipes - white / silver	**None Detected**	**75% Cellulose** **15% Fiber Glass**	**10% Other**	Beige Fibrous Homogeneous
10060446_0002					Ashed, Teased
8-15-AF-578D	Paper insulation over fiber glass on pipes - white / silver	**None Detected**	**75% Cellulose** **15% Fiber Glass**	**10% Other**	Beige Fibrous Homogeneous
10060446_0003					Ashed, Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (3)
Analyst

Approved Signatory

10060446

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Power Block Facility - Interiors, additional samples	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	8/19/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-15-AF-578B		Paper insulation over fiber glass on pipes - white / silver	Rm 00-056 Elevation 11'
8-15-AF-578C		Paper insulation over fiber glass on pipes - white / silver	Rm 0-01 Elevation 31'
8-15-AF-578D		Paper insulation over fiber glass on pipes - white / silver	Rm 2-29 Elevation 57'

Accepted ☑

Rejected ☐

Relinquished By

8/20
10:20

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Exteriors

Lab Order ID: **10059566**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-8-AF-458B	Exterior window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059566_0001					Ashed
8-8-AF-457B	Exterior window glazing compound in reinforced chicken wire windows - white	**3% Chrysotile**		**97% Other**	Red, White Non-Fibrous Heterogeneous
10059566_0002					Dissolved, Crushed
8-8-AF-459B	Exterior door frame caulk - cream	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10059566_0003					Dissolved
8-8-AF-467A	Caulk around mechanical box - hard / brittle / gray	**8% Chrysotile**		**92% Other**	Gray Non-Fibrous Homogeneous
10059566_0004					Dissolved, Teased
8-8-AF-467B	Caulk around mechanical box - hard / brittle / gray	**Not Analyzed**			
10059566_0005					
8-8-AF-468A	Verticle expansion joint seam caulk between brick - beige / soft	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059566_0006					Ashed
8-8-AF-468B	Verticle expansion joint seam caulk between brick - beige / soft	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10059566_0007					Ashed
8-8-AF-469A	Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10059566_0008					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (30)
Analyst

Nathaniel Durham
Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Exteriors

Lab Order ID: **10059566**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-8-AF-469B	Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10059566_0009					Dissolved
8-8-AF-470A	Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059566_0010					Ashed
8-8-AF-470B	Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059566_0011					Ashed
8-8-AF-471A	Horizontal caulk at base of wall panels - black / rubbery	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059566_0012					Ashed
8-8-AF-471B	Horizontal caulk at base of wall panels - black / rubbery	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10059566_0013					Ashed
8-8-AF-472A	Flashing cement on brick wall - black (residual)	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059566_0014					Teased
8-8-AF-472B	Flashing cement on brick wall - black (residual)	**Not Analyzed**			
10059566_0015					
8-8-AF-460B	Caulk at concrete foundation birck wall junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059566_0016					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (30)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block
Facility Exteriors

Lab Order ID: **10059566**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-8-AF-473A	Window glazing compound in plain sash windows - white	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10059566_0017					Dissolved
8-8-AF-473B	Window glazing compound in plain sash windows - white	**Not Analyzed**			
10059566_0018					
8-8-AF-474A	Caulk at lintell terracotta block junction - red	**None Detected**		**100% Other**	Gray, Red Non-Fibrous Heterogeneous
10059566_0019					Ashed
8-8-AF-474B	Caulk at lintell terracotta block junction - red	**None Detected**		**100% Other**	Red, Gray Non-Fibrous Heterogeneous
10059566_0020					Ashed
8-8-AF-474C	Caulk at lintell terracotta block junction - red	**None Detected**		**100% Other**	Red, Gray Non-Fibrous Heterogeneous
10059566_0021					Ashed
8-8-AF-475A	Flashing cement over terracotta block - black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10059566_0022					Dissolved
8-8-AF-475B	Flashing cement over terracotta block - black	**Not Analyzed**			
10059566_0023					
8-8-AF-475C	Flashing cement over terracotta block - black	**Not Analyzed**			
10059566_0024					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (30)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility Exteriors

Lab Order ID: **10059566**
Analysis: PLM
Date Received: 08/12/2024
Date Reported: 08/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-8-AF-476A	Exterior brick mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059566_0025					Crushed
8-8-AF-476B	Exterior brick mortar - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10059566_0026					Crushed
8-8-AF-477A	Expansion seam caulk - gray	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10059566_0027					Ashed
8-8-AF-477B	Expansion seam caulk - gray	**Not Analyzed**			
10059566_0028					
8-8-AF-478A	Verticle Expansion board - black	**8% Chrysotile**		**92% Other**	Black Non-Fibrous Homogeneous
10059566_0029					Dissolved
8-8-AF-478B	Verticle Expansion board - black	**Not Analyzed**			
10059566_0030					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (30)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

100595U6

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility Exteriors
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	8/9/24
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-8-AF-458B		Exterior window frame caulk - gray	Façade A
8-8-AF-457B		Exterior window glazing compound in reinforced chicken wire windows - white	Façade A
8-8-AF-459B		Exterior door frame caulk - cream	Façade A
8-8-AF-467A		Caulk around mechanical box - hard / brittle / gray	Façade A
8-8-AF-467B		Caulk around mechanical box - hard / brittle / gray	Façade A
8-8-AF-468A		Verticle expansion joint seam caulk between brick - beige / soft	Façade A
8-8-AF-468B		Verticle expansion joint seam caulk between brick - beige / soft	Façade A
8-8-AF-469A		Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	Façade A
8-8-AF-469B		Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	Façade A
8-8-AF-470A		Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	Façade A
8-8-AF-470B		Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	Façade A

Accepted ☑

Rejected ☐

Relinquished By

Received By

8/12 6:20

100595766

8-8-AF-471A		Horizontal caulk at base of wall panels - black / rubbery	Façade A
8-8-AF-471B		Horizontal caulk at base of wall panels - black / rubbery	Façade A
8-8-AF-472A		Flashing cement on brick wall - black (residual)	Façade B elevation 135'
8-8-AF-472B		Flashing cement on brick wall - black (residual)	Façade B elevation 135'
8-8-AF-460B		Caulk at concrete foundation birck wall junction - white	Façade B ground level
8-8-AF-473A		Window glazing compound in plain sash windows - white	Façade C
8-8-AF-473B		Window glazing compound in plain sash windows - white	Façade C
8-8-AF-474A		Caulk at lintell terracotta block junction - red	Façade C
8-8-AF-474B		Caulk at lintell terracotta block junction - red	Façade C
8-8-AF-474C		Caulk at lintell terracotta block junction - red	Façade D
8-8-AF-475A		Flashing cement over terracotta block - black	Façade C
8-8-AF-475B		Flashing cement over terracotta block - black	Façade C
8-8-AF-475C		Flashing cement over terracotta block - black	Façade D
8-8-AF-476A		Exterior brick mortar - gray	Façade C
8-8-AF-476B		Exterior brick mortar - gray	Façade C
8-8-AF-477A		Expansion seam caulk - gray	Façade C
8-8-AF-477B		Expansion seam caulk - gray	Façade C
8-8-AF-478A		Verticle Expansion board - black	Façade C
8-8-AF-478B		Verticle Expansion board - black	Façade C
>>			

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block Facility Exteriors

Lab Order ID: **10059566**
Analysis: TBS
Date Received: 08/19/2024
Date Reported: 08/21/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-8-AF-458B *10059566_0001*	**Exterior window frame caulk - gray**	**84%**	**0%**	None Detected	
8-8-AF-468A *10059566_0006*	**Verticle expansion joint seam caulk between brick - beige / soft**	**86%**	**0%**	None Detected	
8-8-AF-474A *10059566_0019*	**Caulk at lintell terracotta block junction - red**	**33%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (3)
Analyst

Approved Signatory

10059526

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility Exteriors
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #:	24-138.10T1
Date Submitted:	5/9/24
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-8-AF-456B		Exterior window frame caulk - gray	Façade A
8-8-AF-457B		Exterior window glazing compound in reinforced chicken wire windows - white	Façade A
8-8-AF-459B		Exterior door frame caulk - cream	Façade A
8-8-AF-467A		Caulk around mechanical box - hard / brittle / gray	Façade A
8-8-AF-467B		Caulk around mechanical box - hard / brittle / gray	Façade A
8-8-AF-468A		Verticle expansion joint seam caulk between brick - beige / soft	Façade A
8-8-AF-468B		Verticle expansion joint seam caulk between brick - beige / soft	Façade A
8-8-AF-469A		Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	Façade A
8-8-AF-469B		Verticle caulk at metal panel / brick façade junction - pink / hard / brittle	Façade A
8-8-AF-470A		Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	Façade A
8-8-AF-470B		Verticle caulk at metal panel / brick façade junction over pink caulk - black / rubbery	Façade A

Accepted ☑

Rejected ☐

Relinquished By

Received By

5/12 6:20

100595766

8-8-AF-471A		Horizontal caulk at base of wall panels - black / rubbery	Façade A
8-8-AF-471B		Horizontal caulk at base of wall panels - black / rubbery	Façade A
8-8-AF-472A		Flashing cement on brick wall - black (residual)	Façade B elevation 135'
8-8-AF-472B		Flashing cement on brick wall - black (residual)	Façade B elevation 135'
8-8-AF-460B		Caulk at concrete foundation brick wall junction - white	Façade B ground level
8-8-AF-473A		Window glazing compound in plain sash windows - white	Façade C
8-8-AF-473B		Window glazing compound in plain sash windows - white	Façade C
8-8-AF-474A		Caulk at lintell terracotta block junction - red	Façade C
8-8-AF-474B		Caulk at lintell terracotta block junction - red	Façade C
8-8-AF-474C		Caulk at lintell terracotta block junction - red	Façade D
8-8-AF-475A		Flashing cement over terracotta block - black	Façade C
8-8-AF-475B		Flashing cement over terracotta block - black	Façade C
8-8-AF-475C		Flashing cement over terracotta block - black	Façade D
8-8-AF-476A		Exterior brick mortar - gray	Façade C
8-8-AF-476B		Exterior brick mortar - gray	Façade C
8-8-AF-477A		Expansion seam caulk - gray	Façade C
8-8-AF-477B		Expansion seam caulk - gray	Façade C
8-8-AF-478A		Verticle Expansion board - black	Façade C
8-8-AF-478B		Verticle Expansion board - black	Façade C
>>			

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-621A	Mop down tar on concrete roof deck-black	None Detected	20% Cellulose	80% Other	Black Fibrous Homogeneous
10061623_0001					Dissolved
8-28-AF-621B	Mop down tar on concrete roof deck-black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10061623_0002					Dissolved
8-28-AF-621C	Mop down tar on concrete roof deck-black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10061623_0003					Dissolved
8-28-AF-622A	Tar paper on metal skylights-black	None Detected	20% Fiber Glass	80% Other	Black Fibrous Homogeneous
10061623_0004					Dissolved
8-28-AF-622B	Tar paper on metal skylights-black	None Detected	5% Fiber Glass	95% Other	Black Fibrous Homogeneous
10061623_0005					Dissolved
8-28-AF-602E	Skim coat/over coat on coping	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061623_0006					Dissolved
8-28-AF-601C	Caulk in coping seams-grey/rubbery	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061623_0007					Dissolved
8-28-AF-603D	Original caulk at base of coping on parapet - gray / hard	None Detected		100% Other	White Non-Fibrous Homogeneous
10061623_0008					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-623A	Tar coating on small, medium and large vent stacks-black	**3% Chrysotile**	**2% Cellulose**	**95% Other**	Black Non-Fibrous Homogeneous
10061623_0009					Dissolved
8-28-AF-623B	Tar coating on small, medium and large vent stacks-black	**Not Analyzed**			
10061623_0010					
8-28-AF-624A	Perimeter flashing cement at roof/façade junction-black	**5% Chrysotile**		**95% Other**	Black Fibrous Homogeneous
10061623_0011					Dissolved
8-28-AF-624B	Perimeter flashing cement at roof/façade junction-black	**Not Analyzed**			
10061623_0012					
8-28-AF-625A	Newer caulk over perimeter flashing-white	**2% Chrysotile**		**98% Other**	Gray Non-Fibrous Homogeneous
10061623_0013					Dissolved
8-28-AF-625B	Newer caulk over perimeter flashing-white	**Not Analyzed**			
10061623_0014					
8-28-AF-626A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0015					Ashed
8-28-AF-626B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-627A	Caulk in coping seams at south end parapet-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0017					Dissolved
8-28-AF-627B	Caulk in coping seams at south end parapet-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0018					Dissolved
8-28-AF-628A	Caulk at access hatch to large vents-brown	**2% Chrysotile**		**98% Other**	Brown Non-Fibrous Homogeneous
10061623_0019					Dissolved
8-28-AF-628B	Caulk at access hatch to large vents-brown	**Not Analyzed**			
10061623_0020					
8-28-AF-629A	Mop down tar on concrete roof deck-black	**4% Chrysotile**		**96% Other**	Black Non-Fibrous Homogeneous
10061623_0021					Dissolved
8-28-AF-629B	Mop down tar on concrete roof deck-black	**Not Analyzed**			
10061623_0022					
8-28-AF-630A	Perimeter flashing cement on parapet walls-black	**4% Chrysotile**		**96% Other**	Black Non-Fibrous Homogeneous
10061623_0023					Dissolved
8-28-AF-630B	Perimeter flashing cement on parapet walls-black	**Not Analyzed**			
10061623_0024					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-631A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0025					Ashed
8-28-AF-631B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0026					Ashed
8-28-AF-632A	Tar on pitched metal corrugated roof deck -black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0027					Dissolved
8-28-AF-632B	Tar on pitched metal corrugated roof deck -black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10061623_0028					Dissolved
8-28-AF-602F	Skim coat/over coat on coping	**None Detected**	**2% Cellulose**	**98% Other**	Gray Non-Fibrous Homogeneous
10061623_0029					Dissolved
8-28-AF-633A	Caulk at breathing vents-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10061623_0030					Dissolved
8-28-AF-633B	Caulk at breathing vents-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10061623_0031					Dissolved
8-28-AF-634A	Tar coating over vent caps-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-634B	Tar coating over vent caps-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0033					Dissolved
8-28-AF-635A	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0034					Dissolved
8-28-AF-635B	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0035					Dissolved
8-28-AF-635C	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0036					Dissolved
8-28-AF-603E	Original caulk at base of coping on parapet - gray / hard	**2% Chrysotile**		**98% Other**	Gray Non-Fibrous Homogeneous
10061623_0037					Dissolved
8-28-AF-X636A	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0038					Dissolved
8-28-AF-X636B	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0039					Dissolved
8-28-AF-X636C	Thin tar on concrete roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0040					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-637A	Felt paper over foam under membrane-brown	**None Detected**	**5% Cellulose** **5% Fiber Glass**	**90% Other**	Brown Fibrous Homogeneous
10061623_0041					Teased
8-28-AF-637B	Felt paper over foam under membrane-brown	**None Detected**	**5% Fiber Glass** **5% Cellulose**	**90% Other**	Brown Fibrous Homogeneous
10061623_0042					Teased
8-28-AF-638A	Tar like caulk at aluminum flashing on tar coating-black	**10% Chrysotile**		**90% Other**	Black Non-Fibrous Homogeneous
10061623_0043					Dissolved
8-28-AF-638B	Tar like caulk at aluminum flashing on tar coating-black	**Not Submitted**			
10061623_0044					
8-28-AF-639A	Caulk at aluminum flashing below black caulk-grey	**3% Chrysotile**		**97% Other**	Gray Non-Fibrous Homogeneous
10061623_0045					Dissolved
8-28-AF-639		**Not Analyzed**			
10061623_0064	*not on COC*				
8-28-AF-640A	Adhesive under membrane on parapet-yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061623_0046					Dissolved
8-28-AF-640B	Adhesive under membrane on parapet-yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10061623_0047					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-641A	Bottom layer felt paper	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Yellow Fibrous Homogeneous
10061623_0048					Ashed
8-28-AF-641B	Bottom layer felt paper	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Yellow Fibrous Homogeneous
10061623_0049					Ashed
8-28-AF-642A	Tar and felt paper roofing-black	**None Detected**	**20% Fiber Glass**	**80% Other**	Black Fibrous Homogeneous
10061623_0050					Dissolved
8-28-AF-642B	Tar and felt paper roofing-black	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Fibrous Homogeneous
10061623_0051					Dissolved
8-28-AF-643A	Thick tar at curb-black	**5% Chrysotile**	**5% Fiber Glass**	**90% Other**	Black Fibrous Homogeneous
10061623_0052					Dissolved
8-28-AF-643B	Thick tar at curb-black	**Not Analyzed**			
10061623_0053					
8-28-AF-644A	Sealent at bolted flanges on ductwork - gray	**2% Chrysotile**		**98% Other**	Gray Non-Fibrous Homogeneous
10061623_0054					Dissolved
8-28-AF-644B	Sealent at bolted flanges on ductwork - gray	**Not Analyzed**			
10061623_0055					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-645A	Flashing cement-black	**5% Chrysotile**	**5% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10061623_0056					Dissolved
8-28-AF-645B	Flashing cement-black	**Not Analyzed**			
10061623_0057					
8-28-AF-646A	Felt paper on metal corrugated roof deck	**None Detected**	**40% Cellulose**	**60% Other**	Yellow Fibrous Homogeneous
10061623_0058					Ashed
8-28-AF-646B	Felt paper on metal corrugated roof deck	**None Detected**	**40% Cellulose**	**60% Other**	Yellow Fibrous Homogeneous
10061623_0059					Ashed
8-28-AF-647A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0060					Ashed
8-28-AF-647B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061623_0061					Ashed
8-28-AF-648A	Caulk at breathing vents-white/rubbery	**Not Submitted**			
10061623_0062					
8-28-AF-648B	Caulk at breathing vents-white/rubbery	**Not Submitted**			
10061623_0063					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (64)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

9/6/2024

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson- MIRA-Power Block Facility Roofs	***Enter samples between "<<" and ">>"*** ***Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
Client Notes:	Please stop on first positive in set Please do not split samples	
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	9/3/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-28-AF-621A		Mop down tar on concrete roof deck-black	Roof #1
8-28-AF-621B		Mop down tar on concrete roof deck-black	Roof #1
8-28-AF-621C		Mop down tar on concrete roof deck-black	Roof #1
8-28-AF-622A		Tar paper on metal skylights-black	Roof #1
8-28-AF-622B		Tar paper on metal skylights-black	Roof #1
8-28-AF-602E		Skim coat/over coat on coping	Roof #1
8-28-AF-601C		Caulk in coping seams-grey/rubbery	Roof #1
8-28-AF-603D		Original caulk at base of coping on parapet - gray / hard	Roof #1
8-28-AF-623A		Tar coating on small, medium and large vent stacks-black	Roof #1
8-28-AF-623B		Tar coating on small, medium and large vent stacks-black	Roof #1
8-28-AF-624A		Perimeter flashing cement at roof/façade junction-black	Roof #1
8-28-AF-624B		Perimeter flashing cement at roof/façade junction-black	Roof #1
8-28-AF-625A		Newer caulk over perimeter flashing-white	Roof #1
8-28-AF-625B		Newer caulk over perimeter flashing-white	Roof #1
8-28-AF-626A		Reglet caulk-black	Roof #1
8-28-AF-626B		Reglet caulk-black	Roof #1
8-28-AF-627A		Caulk in coping seams at south end parapet-black	Roof #1
8-28-AF-627B		Caulk in coping seams at south end parapet-black	Roof #1
8-28-AF-628A		Caulk at access hatch to large vents-brown	Roof #1
8-28-AF-628B		Caulk at access hatch to large vents-brown	Roof #1

Accepted ☑

Rejected ☐

Relinquished By

Received By

10/6/2023

8-28-AF-629A		Mop down tar on concrete roof deck-black	Roof #2
8-28-AF-629B		Mop down tar on concrete roof deck-black	Roof #2
8-28-AF-630A		Perimeter flashing cement on parapet walls-black	Roof #2
8-28-AF-630B		Perimeter flashing cement on parapet walls-black	Roof #2
8-28-AF-631A		Reglet caulk-black	Roof #2
8-28-AF-631B		Reglet caulk-black	Roof #2
8-28-AF-632A		Tar on pitched metal corrugated roof deck -black	Roof #2
8-28-AF-632B		Tar on pitched metal corrugated roof deck -black	Roof #2
8-28-AF-602F		Skim coat/over coat on coping	Roof #2
8-28-AF-633A		Caulk at breathing vents-white	Roof #2
8-28-AF-633B		Caulk at breathing vents-white	Roof #2
8-28-AF-634A		Tar coating over vent caps-black	Roof #2
8-28-AF-634B		Tar coating over vent caps-black	Roof #2
8-28-AF-635A		Thin tar on concrete roof deck-black	Roof #3
8-28-AF-635B		Thin tar on concrete roof deck-black	Roof #4
8-28-AF-635C		Thin tar on concrete roof deck-black	Roof #5
8-28-AF-603E		Original caulk at base of coping on parapet - gray / hard	Roof #4
8-28-AF-X636A		Thin tar on concrete roof deck-black	Roof #6
8-28-AF-X636B		Thin tar on concrete roof deck-black	Roof #7
8-28-AF-X636C		Thin tar on concrete roof deck-black	Roof #8
8-28-AF-637A		Felt paper over foam under membrane-brown	Roof #6
8-28-AF-637B		Felt paper over foam under membrane-brown	Roof #7
8-28-AF-638A		Tar like caulk at aluminum flashing on tar coating-black	Roof #6
8-28-AF-638B		Tar like caulk at aluminum flashing on tar coating-black	Roof #6
8-28-AF-639A		Caulk at aluminum flashing below black caulk-grey	Roof #6
8-28-AF-640A		Adhesive under membrane on parapet-yellow	Roof #7
8-28-AF-640B		Adhesive under membrane on parapet-yellow	Roof #7
8-28-AF-641A		Bottom layer felt paper	Roof #9
8-28-AF-641B		Bottom layer felt paper	Roof #10
8-28-AF-642A		Tar and felt paper roofing-black	Roof #9
8-28-AF-642B		Tar and felt paper roofing-black	Roof #10
8-28-AF-643A		Thick tar at curb-black	Roof #9
8-28-AF-643B		Thick tar at curb-black	Roof #10
8-28-AF-644A		Sealent at bolted flanges on ductwork - gray	Roof #9
8-28-AF-644B		Sealent at bolted flanges on ductwork - gray	Roof #9
8-28-AF-645A		Flashing cement-black	Roof #9
8-28-AF-645B		Flashing cement-black	Roof #10
8-28-AF-646A		Felt paper on metal corrugated roof deck	Roof #11
8-28-AF-646B		Felt paper on metal corrugated roof deck	Roof #11
8-28-AF-647A		Reglet caulk-black	Roof #11

Relinquished By

Received By

10061623

8-28-AF-647B		Reglet caulk-black	Roof #11
8-28-AF-648A		Caulk at breathing vents-white/rubbery	Roof #11
8-28-AF-648B		Caulk at breathing vents-white/rubbery	Roof #11

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: TBS
Date Received: 10/07/2024
Date Reported: 10/08/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)		LCL-UCL (Wt. %)
8-28-AF-621A	**Mop down tar on concrete roof deck-black**	**98%**	**0%**	None Detected		
10061623_0001						
8-28-AF-622A	**Tar paper on metal skylights-black**	**94%**	**0%**	None Detected		
10061623_0004						
8-28-AF-603D	**Original caulk at base of coping on parapet - gray / hard**	**75%**	**0%**	None Detected		
10061623_0008						
8-28-AF-626A	**Reglet caulk-black**	**63%**	**0%**	None Detected		
10061623_0015						
8-28-AF-627A	**Caulk in coping seams at south end parapet-black**	**52%**	**0%**	None Detected		
10061623_0017						
8-28-AF-631A	**Reglet caulk-black**	**58%**	**0%**	None Detected		
10061623_0025						
8-28-AF-633A	**Caulk at breathing vents -white**	**52%**	**0%**	None Detected		
10061623_0030						
8-28-AF-634A	**Tar coating over vent caps-black**	**76%**	**0%**	**0.012%**	**Anthophyllite**	**0.011 - 0.013%**
10061623_0032						

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (12)
Analyst

Approved Signatory

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson- MIRA- Power Block Facility Roofs

Lab Order ID: **10061623**
Analysis: TBS
Date Received: 10/07/2024
Date Reported: 10/08/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
8-28-AF-635A *10061623_0034*	**Thin tar on concrete roof deck-black**	**99%**	**0%**	None Detected	
8-28-AF-X636A *10061623_0038*	**Thin tar on concrete roof deck-black**	**76%**	**0%**	None Detected	
8-28-AF-647A *10061623_0060*	**Reglet caulk-black**	**55%**	**0%**	None Detected	
8-28-AF-648A *10061623_0062*	**Caulk at breathing vents -white/rubbery**	-	-	Not Submitted	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (12)
Analyst

Approved Signatory

100616237EM
10/4/24
4:02 pm
CK.

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson- MIRA-Power Block Facility Roofs	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in set Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	9/3/2024 0:00	
Analysis:	TEM: Chatfield	
TurnAroundTime:	24 Hour	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<

8-28-AF-621A		Mop down tar on concrete roof deck-black	Roof #1
8-28-AF-622A		Tar paper on metal skylights-black	Roof #1
8-28-AF-603D		Original caulk at base of coping on parapet - gray / hard	Roof #1
8-28-AF-626A		Reglet caulk-black	Roof #1
8-28-AF-627A		Caulk in coping seams at south end parapet-black	Roof #1
8-28-AF-631A		Reglet caulk-black	Roof #2
8-28-AF-633A		Caulk at breathing vents-white	Roof #2
8-28-AF-634A		Tar coating over vent caps-black	Roof #2
8-28-AF-635A		Thin tar on concrete roof deck-black	Roof #3
8-28-AF-X636A		Thin tar on concrete roof deck-black	Roof #6
8-28-AF-647A		Reglet caulk-black	Roof #11
8-28-AF-648A		Caulk at breathing vents-white/rubbery	Roof #11

>>

Accepted ☐

Rejected ☐

Relinquished By

Received By

PBF

SCREEN HOUSES

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Screen Houses

Lab Order ID: **10060435**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-561A	Tar coating on large diameter pipe - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060435_0001					Dissolved
8-15-AF-561B	Tar coating on large diameter pipe - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060435_0002					Dissolved
8-15-AF-562A	Mop down tar on wood roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Heterogeneous
10060435_0003					Dissolved, Crushed
8-15-AF-562B	Mop down tar on wood roof deck - black	**None Detected**		**100% Other**	Black Non-Fibrous Heterogeneous
10060435_0004					Crushed, Dissolved
8-15-AF-563A	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060435_0005					Ashed
8-15-AF-563B	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060435_0006					Ashed
8-15-AF-564A	Flashing cement - black	**8% Chrysotile**		**92% Other**	Black Non-Fibrous Homogeneous
10060435_0007					Dissolved
8-15-AF-564B	Flashing cement - black	**Not Analyzed**			
10060435_0008					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (17)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Screen Houses

Lab Order ID: **10060435**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-15-AF-565A	Adhesive under top layer rubber membrane on parapet - yellow	**None Detected**		**100% Other**	Tan, Yellow Non-Fibrous Homogeneous
10060435_0009					Dissolved, Ashed
8-15-AF-565B	Adhesive under top layer rubber membrane on parapet - yellow	**None Detected**		**100% Other**	Yellow, Tan Non-Fibrous Homogeneous
10060435_0010					Dissolved, Ashed
8-15-AF-566A	Sealent between window frame and casing - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060435_0011					Ashed
8-15-AF-566B	Sealent between window frame and casing - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060435_0012					Ashed
8-15-AF-567A	Paper insulation over fiberglass on pipes - white / silver	**None Detected**	**80% Cellulose** **5% Fiber Glass**	**15% Other**	Brown, Beige Fibrous Homogeneous
10060435_0013					Teased, Ashed
8-15-AF-567B	Paper insulation over fiberglass on pipes - white / silver	**None Detected**	**80% Cellulose** **5% Fiber Glass**	**15% Other**	Silver, Beige Fibrous Homogeneous
10060435_0014					Ashed, Teased
8-15-AF-567C	Paper insulation over fiberglass on pipes - white / silver	**None Detected**	**80% Cellulose** **5% Fiber Glass**	**15% Other**	Silver, Beige Fibrous Homogeneous
10060435_0015					Ashed, Teased
8-15-AF-568A	Mastic under paper insulation on plastic elbow covering - brown	**None Detected**	**10% Fiber Glass**	**90% Other**	Beige Non-Fibrous Homogeneous
10060435_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (17)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Screen Houses

Lab Order ID: **10060435**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-568B	Mastic under paper insulation on plastic elbow covering - brown	**None Detected**	**10% Fiber Glass**	**90% Other**	Beige Non-Fibrous Homogeneous
10060435_0017					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (17)
Analyst

Approved Signatory

10060435

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Screen Houses
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	8/19/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-15-AF-561A		Tar coating on large diameter pipe - black	Screen house #1 rm 0-01
8-15-AF-561B		Tar coating on large diameter pipe - black	Screen house #1 rm 0-01
8-15-AF-562A		Mop down tar on wood roof deck - black	Screen house #1 roof
8-15-AF-562B		Mop down tar on wood roof deck - black	Screen house #3 LL roof
8-15-AF-563A		Reglet caulk - black	Screen house #1 roof
8-15-AF-563B		Reglet caulk - black	Screen house #3 LL roof
8-15-AF-564A		Flashing cement - black	Screen house #1 roof
8-15-AF-564B		Flashing cement - black	Screen house #1 roof
8-15-AF-565A		Adhesive under top layer rubber membrane on parapet - yellow	Screen house #1 roof
8-15-AF-565B		Adhesive under top layer rubber membrane on parapet - yellow	Screen house #3 LL roof
8-15-AF-566A		Sealent between window frame and casing - gray	Screen house #1 façade A
8-15-AF-566B		Sealent between window frame and casing - gray	Screen house #3 Façade C
8-15-AF-567A		Paper insulation over fiberglass on pipes - white / silver	Screen house #3 rm 0-01
8-15-AF-567B		Paper insulation over fiberglass on pipes - white / silver	Screen house #3 rm 0-01
8-15-AF-567C		Paper insulation over fiberglass on pipes - white / silver	Screen house #3 rm 0-01

Relinquished By

Accepted ☑

Rejected ☐

8/20 Received By
10:20

8-15-AF-568A		Mastic under paper insulation on plastic elbow covering - brown	Screen house #3 rm 0-01
8-15-AF-568B		Mastic under paper insulation on plastic elbow covering - brown	Screen house #3 rm 0-01

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston and Sampson - MIRA, Power Block Facility - Screen Houses

Lab Order ID: **10060435**
Analysis: TBS
Date Received: 09/12/2024
Date Reported: 09/13/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)		LCL-UCL (Wt. %)
8-15-AF-561A / *10060435_0001*	**Tar coating on large diameter pipe - black**	**80.%**	**0%**	None Detected		
8-15-AF-562A / *10060435_0003*	**Mop down tar on wood roof deck - black**	**36%**	**0%**	**0.64%**	**Chrysotile**	**0.57 - 0.70%**
8-15-AF-563A / *10060435_0005*	**Reglet caulk - black**	**47%**	**0%**	None Detected		
8-15-AF-568A / *10060435_0016*	**Mastic under paper insulation on plastic elbow covering - brown**	**46%**	**0%**	None Detected		

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (4)
Analyst

Approved Signatory

1006043 5 TEM
9/12/24
7:43 AM
CK.

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Screen Houses
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	8/19/2024 0:00
Analysis:	TEM: Chatfield
TurnAroundTime:	24 Hour

Instructions:

Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

<<

8-15-AF-561A		Tar coating on large diameter pipe - black	Screen house #1 rm 0-01
8-15-AF-562A		Mop down tar on wood roof deck - black	Screen house #1 roof
8-15-AF-563A		Reglet caulk - black	Screen house #1 roof
8-15-AF-568A		Mastic under paper insulation on plastic elbow covering - brown	Screen house #3 rm 0-01

>>

Accepted ☑
Rejected ☐

Relinquished By

Received By

PBF

SCRUBBER CONTROL BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Scrubber Control Building

Lab Order ID: **10060444**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-570A	Thinset associated with 6"x6" red quary tile - white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10060444_0001					Dissolved, Crushed
8-15-AF-570B	Thinset associated with 6"x6" red quary tile - white	**None Detected**		**100% Other**	White Non-Fibrous Heterogeneous
10060444_0002					Crushed, Dissolved
8-15-AF-571A	Grout associated with 6"x6" red quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10060444_0003					Crushed, Dissolved
8-15-AF-571A	Grout associated with 6"x6" red quary tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10060444_0004					Dissolved, Crushed
8-15-AF-572A	Sheet rock (wall)	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0005					Crushed
8-15-AF-572B	Sheet rock (wall)	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0006					Crushed
8-15-AF-573A	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0007					Crushed
8-15-AF-573B	Joint compound associated with sheet rock wall - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0008					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (20)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Scrubber Control Building

Lab Order ID: **10060444**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-574A	4" vinyl cove base adhesive - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0009					Ashed
8-15-AF-574B	4" vinyl cove base adhesive - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0010					Ashed
8-15-AF-575A	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060444_0011					Ashed
8-15-AF-575B	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060444_0012					Ashed
8-15-AF-576A	Window frame caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060444_0013					Ashed
8-15-AF-576B	Window frame caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060444_0014					Ashed
8-15-AF-X575A	Adhesive associated with 4"x4" wall tile - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060444_0015					Dissolved
8-15-AF-X575B	Adhesive associated with 4"x4" wall tile - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10060444_0016					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (20)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Scrubber Control Building

Lab Order ID: **10060444**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-X576A	Caulk at base of wall pannels - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0017					Ashed
8-15-AF-X576B	Caulk at base of wall pannels - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0018					Ashed
8-15-AF-577A	Sealent at duct seams - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0019					Ashed
8-15-AF-577B	Sealent at duct seams - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060444_0020					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (20)
Analyst

Approved Signatory

10060444

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Power Block Facility - Scrubber Control Building	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	8/19/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-15-AF-570A		Thinset associated with 6"x6" red quary tile - white	Rm 1-01
8-15-AF-570B		Thinset associated with 6"x6" red quary tile - white	Rm 1-01
8-15-AF-571A		Grout associated with 6"x6" red quary tile - gray	Rm 1-01
8-15-AF-571A		Grout associated with 6"x6" red quary tile - gray	Rm 1-01
8-15-AF-572A		Sheet rock (wall)	Rm 1-01
8-15-AF-572B		Sheet rock (wall)	Rm 1-01
8-15-AF-573A		Joint compound associated with sheet rock wall - white	Rm 1-01
8-15-AF-573B		Joint compound associated with sheet rock wall - white	Rm 1-01
8-15-AF-574A		4" vinyl cove base adhesive - white	Rm 1-01
8-15-AF-574B		4" vinyl cove base adhesive - white	Rm 1-01
8-15-AF-575A		4" vinyl cove base - gray	Rm 1-01
8-15-AF-575B		4" vinyl cove base - gray	Rm 1-01
8-15-AF-576A		Window frame caulk - black	Rm 1-01
8-15-AF-576B		Window frame caulk - black	Rm 1-01
8-15-AF-X575A		Adhesive associated with 4"x4" wall tile - yellow	Rm 1-03
8-15-AF-X575B		Adhesive associated with 4"x4" wall tile - yellow	Rm 1-03

Accepted ☑

Rejected ☐

Relinquished By

Received By 8/20 10:00

5441

8-15-AF-X576A		Caulk at base of wall pannels - white	Façade A
8-15-AF-X576B		Caulk at base of wall pannels - white	Façade A
8-15-AF-577A		Sealent at duct seams - white	Façade B
8-15-AF-577B		Sealent at duct seams - white	Façade B

Relinquished By

Received By

PBF

WAREHOUSE ROOFS

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Ware House Exteriors

Lab Order ID: **10060448**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-13-AF-X524A	Window glazing compound - white	**5% Chrysotile**		**95% Other**	Tan, White Non-Fibrous Homogeneous
10060448_0001					Crushed
8-13-AF-X524A	Window glazing compound - white	**Not Analyzed**			
10060448_0002					
8-13-AF-525A	Window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060448_0003					Ashed
8-13-AF-525B	Window frame caulk - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060448_0004					Ashed
8-13-AF-526A	Caulk at brick corner junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060448_0005					Ashed
8-13-AF-526B	Caulk at brick corner junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10060448_0006					Ashed
8-13-AF-527A	Caulk at window sash frame junction - gray / hard / brittle	**8% Chrysotile**		**92% Other**	Gray Non-Fibrous Homogeneous
10060448_0007					Crushed, Dissolved
8-13-AF-527B	Caulk at window sash frame junction - gray / hard / brittle	**Not Analyzed**			
10060448_0008					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (8)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

1006044B

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Ware House Exteriors
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	8/19/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-13-AF-X524A		Window glazing compound - white	Façade A
8-13-AF-X524A		Window glazing compound - white	Façade A
8-13-AF-525A		Window frame caulk - gray	Façade A
8-13-AF-525B		Window frame caulk - gray	Façade D
8-13-AF-526A		Caulk at brick corner junction - white	Façade D
8-13-AF-526B		Caulk at brick corner junction - white	Façade D
8-13-AF-527A		Caulk at window sash frame junction - gray / hard / brittle	Façade D
8-13-AF-527B		Caulk at window sash frame junction - gray / hard / brittle	Façade D

Accepted ☒

Relected ☐

Relinquished By

8/20 10:30

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Ware House Roofs

Lab Order ID: **10061622**
Analysis: PLM
Date Received: 09/04/2024
Date Reported: 09/11/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
8-28-AF-649A	Felt paper over tar on roof deck-brown	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10061622_0001					Ashed
8-28-AF-649B	Felt paper over tar on roof deck-brown	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10061622_0002					Ashed
8-28-AF-650A	Tar on metal corrugated roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061622_0003					Ashed
8-28-AF-650B	Tar on metal corrugated roof deck-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061622_0004					Ashed
8-28-AF-651A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061622_0005					Ashed
8-28-AF-651B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10061622_0006					Ashed
8-28-AF-652A	Vertical caulk at metal/brick junction-beige	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061622_0007					Ashed
8-28-AF-652B	Vertical caulk at metal/brick junction-beige	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10061622_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (8)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10/6/22

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Ware House Roofs
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/3/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-28-AF-649A		Felt paper over tar on roof deck-brown	Roof #1
8-28-AF-649B		Felt paper over tar on roof deck-brown	Roof #2
8-28-AF-650A		Tar on metal corrugated roof deck-black	Roof #1
8-28-AF-650B		Tar on metal corrugated roof deck-black	Roof #2
8-28-AF-651A		Reglet caulk-black	Roof #1
8-28-AF-651B		Reglet caulk-black	Roof #2
8-28-AF-652A		Vertical caulk at metal/brick junction-beige	Roof #3
8-28-AF-652B		Vertical caulk at metal/brick junction-beige	Roof #3

Accepted ☑

Rejected ☐

Relinquished By

Received By 9/4 10:30 am

PBF

WHEEL WASH BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Wheel Wash Building & adjacent garage

Lab Order ID: **10060441**
Analysis: PLM
Date Received: 08/20/2024
Date Reported: 08/27/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-15-AF-579A	Caulk under wall panel at base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060441_0001					Ashed
8-15-AF-579A	Caulk under wall panel at base - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060441_0002					Ashed
8-15-AF-580A	Caulk at concrete floor / wall junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060441_0003					Ashed
8-15-AF-580B	Caulk at concrete floor / wall junction - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10060441_0004					Ashed
8-15-AF-581A	Window glazing compound - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060441_0005					Ashed
8-15-AF-581B	Window glazing compound - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10060441_0006					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Katelyn Stewart (6)
Analyst

Approved Signatory

10060441

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Power Block Facility - Wheel Wash Building & adjacent garage	***Enter samples between "<<" and ">>"*** ***Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:	8/19/2024 0:00	
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-15-AF-579A		Caulk under wall panel at base - white	Facade B
8-15-AF-579A		Caulk under wall panel at base - white	Facade B
8-15-AF-580A		Caulk at concrete floor / wall junction - white	Rm 1-01
8-15-AF-580B		Caulk at concrete floor / wall junction - white	Rm 1-01
8-15-AF-581A		Window glazing compound - black	Adjacent garage to wheel wash Rm 1-03
8-15-AF-581B		Window glazing compound - black	Adjacent garage to wheel wash Rm 1-03

Accepted ☑

Rejected ☐ 8/20 10:30

Relinquished By

Received By

WPF

ADMIN BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-5-AF-38C	Paper insulation over fiberglass on water lines	None Detected	45% Mineral Wool 45% Cellulose	10% Other	Beige Fibrous Homogeneous
10056867_0001					Teased
7-5-AF-71A	Carpet square adhesive-yellow	None Detected		100% Other	Tan, Transparent Non-Fibrous Homogeneous
10056867_0002					Ashed
7-5-AF-72A	4" vinyl cove base adhesive-grey	None Detected		100% Other	Beige Non-Fibrous Homogeneous
10056867_0003					Ashed
7-5-AF-73A	4" vinyl cove base-grey	None Detected		100% Other	Brown Non-Fibrous Homogeneous
10056867_0004					Ashed
7-5-AF-73B	4" vinyl cove base-grey	None Detected		100% Other	Off-white Non-Fibrous Homogeneous
10056867_0005	*sheetrock; no covebase*				Crushed
7-5-AF-74A	Sheet rock-wall	None Detected		100% Other	Off-white Non-Fibrous Homogeneous
10056867_0006					Crushed
7-5-AF-74B	Sheet rock-wall	None Detected		100% Other	Off-white Non-Fibrous Homogeneous
10056867_0007					Crushed
7-5-AF-75A	Joint compound associated with sheet rock-white	None Detected		100% Other	White Non-Fibrous Homogeneous
10056867_0008					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-5-AF-75B	Joint compound associated with sheet rock-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056867_0009					Crushed
7-5-AF-76A	Window glazing compound to exterior windows-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0010					Ashed
7-5-AF-77A	Window glazing compound in interior divider windows-grey	**8% Chrysotile**		**92% Other**	Gray Non-Fibrous Homogeneous
10056867_0011					Ashed
7-5-AF-77B	Window glazing compound in interior divider windows-grey	**Not Analyzed**			
10056867_0012					
7-5-AF-78A	Carpet adhesive-yellow	**None Detected**		**100% Other**	Tan, Yellow Non-Fibrous Homogeneous
10056867_0013					Crushed, Ashed
7-5-AF-79A	2' x 2' smooth face acoustic ceiling tile	**None Detected**	**45% Cellulose** **45% Mineral Wool**	**10% Other**	Beige Fibrous Homogeneous
10056867_0014					Teased
7-5-AF-79B	2' x 2' smooth face acoustic ceiling tile	**None Detected**	**45% Cellulose** **45% Mineral Wool**	**10% Other**	Beige Fibrous Homogeneous
10056867_0015					Teased
7-5-AF-80A	2' x 2' Rough face acoustic ceiling tile	**None Detected**	**85% Mineral Wool**	**15% Other**	Gray Fibrous Homogeneous
10056867_0016					Teased, Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-5-AF-80B	2' x 2' Rough face acoustic ceiling tile	**None Detected**	**85% Mineral Wool**	**15% Other**	Gray Fibrous Homogeneous
10056867_0017					Crushed, Teased
7-5-AF-81A	Floor tile mastic associated with white vinyl floor tile-transparent	**None Detected**		**100% Other**	Transparent Non-Fibrous Homogeneous
10056867_0018					Ashed
7-5-AF-81B	Floor tile mastic associated with white vinyl floor tile-transparent	**None Detected**		**100% Other**	Transparent Non-Fibrous Homogeneous
10056867_0019					Ashed
7-5-AF-82A	12" x 12" vinyl floor tile-white with grey specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056867_0020					Crushed
7-5-AF-82B	12" x 12" vinyl floor tile-white with grey specs	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056867_0021					Crushed
7-5-AF-47C	12" x 12" vinyl floor tile-beige with grey specs	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0022					Crushed
7-5-AF-65B	Flooring mastic on concrete-black	**None Detected**		**100% Other**	Brown, Black Non-Fibrous Homogeneous
10056867_0023					Dissolved
7-5-AF-39C	Panel adhesive under fiberglass in unti ventilator-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0024					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-5-AF-83A	Mastic on foil wrap over duct work-yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056867_0025					Dissolved, Crushed
7-5-AF-83B	Mastic on foil wrap over duct work-yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056867_0026					Dissolved, Crushed
7-5-AF-84A	Thinset associated with ceramic wall tile-white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0027					Crushed
7-5-AF-84B	Thinset associated with ceramic wall tile-white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0028					Crushed
7-5-AF-85A	Grout associated with wall tile-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10056867_0029					Crushed
7-5-AF-85B	Grout associated with wall tile-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10056867_0030					Crushed
7-5-AF-86A	Backer to bat insulation	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Black Non-Fibrous Homogeneous
10056867_0031					Dissolved
7-5-AF-86B	Backer to bat insulation	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Black Non-Fibrous Homogeneous
10056867_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-5-AF-87A	Thinset associated with ceramic floor tile-grey	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0033					Crushed
7-5-AF-87B	Thinset associated with ceramic floor tile-grey	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0034					Crushed
7-5-AF-88A	Sink undercoating-white	**None Detected**	**15% Cellulose**	**85% Other**	Beige Non-Fibrous Homogeneous
10056867_0035					Dissolved, Ashed
7-5-AF-88B	Sink undercoating-white	**None Detected**	**15% Cellulose**	**85% Other**	Beige Non-Fibrous Homogeneous
10056867_0036					Dissolved, Ashed
7-5-AF-89A	Caulk at sink spout-white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0037					Ashed
7-5-AF-89B	Caulk at sink spout-white	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056867_0038					Ashed
7-10-AF-164C	Door frame caulk-grey	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056867_0039					Ashed
7-10-AF-173A	Window glazing at entry doors-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0040					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-10-AF-173B	Window glazing at entry doors-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0041					Ashed
7-10-AF-165C	Sealent between metal wall panels-white	**5% Chrysotile**		**95% Other**	Gray, Beige Non-Fibrous Homogeneous
10056867_0042					Ashed, Dissolved
5-10-AF-174A	Expansion board at concrete wall junction-brown	**None Detected**	**98% Cellulose**	**2% Other**	Brown Fibrous Homogeneous
10056867_0043					Teased
5-10-AF-174B	Expansion board at concrete wall junction-brown	**None Detected**	**98% Cellulose**	**2% Other**	Brown Fibrous Homogeneous
10056867_0044					Teased
5-10-AF-175A	Felt paper-black	**None Detected**	**98% Cellulose**	**2% Other**	Brown Fibrous Homogeneous
10056867_0045					Teased
5-10-AF-175B	Felt paper-black	**None Detected**	**98% Cellulose**	**2% Other**	Brown Fibrous Homogeneous
10056867_0046					Teased
5-10-AF-176A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0047					Dissolved, Ashed
5-10-AF-176B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0048					Ashed, Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
5-10-AF-177A	Gypsum roof deck	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056867_0049					Crushed
5-10-AF-177B	Gypsum roof deck	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056867_0050					Crushed
5-10-AF-178A	Joint compound associated with gypsum roof deck-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056867_0051					Crushed
5-10-AF-178B	Joint compound associated with gypsum roof deck-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056867_0052					Crushed
5-10-AF-179A	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0053					Crushed, Dissolved
5-10-AF-179B	Reglet caulk-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056867_0054					Dissolved, Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Lachlan Krenz (54)
Analyst

Approved Signatory

10056867

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-5-AF-38C		Paper insulation over fiberglass on water lines	Rm 1-01
7-5-AF-71A		Carpet square adhesive-yellow	Rm 1-01
7-5-AF-72A		4" vinyl cove base adhesive-grey	Rm 1-01
7-5-AF-73A		4" vinyl cove base-grey	Rm 1-01
7-5-AF-73B		4" vinyl cove base-grey	Rm 1-01
7-5-AF-74A		Sheet rock-wall	Rm 1-01
7-5-AF-74B		Sheet rock-wall	Rm 1-06
7-5-AF-75A		Joint compound associated with sheet rock-white	Rm 1-01
7-5-AF-75B		Joint compound associated with sheet rock-white	Rm 1-06
7-5-AF-76A		Window glazing compound to exterior windows-black	Rm 1-01
7-5-AF-77A		Window glazing compound in interior divider windows-grey	Rm 1-01
7-5-AF-77B		Window glazing compound in interior divider windows-grey	Rm 1-06
7-5-AF-78A		Carpet adhesive-yellow	Rm 1-02
7-5-AF-79A		2' x 2' smooth face acoustic ceiling tile	Rm 1-02
7-5-AF-79B		2' x 2' smooth face acoustic ceiling tile	Rm 1-02
7-5-AF-80A		2' x 2' Rough face acoustic ceiling tile	Rm 1-02
7-5-AF-80B		2' x 2' Rough face acoustic ceiling tile	Rm 1-02

Accepted ☐

Rejected ☐

Relinquished By

Received By 7/15 10:30

7-5-AF-81A		Floor tile mastic associated with white vinyl floor tile-transparent	Rm 1-03
7-5-AF-81B		Floor tile mastic associated with white vinyl floor tile-transparent	Rm 1-03
7-5-AF-82A		12" x 12" vinyl floor tile-white with grey specs	Rm 1-03
7-5-AF-82B		12" x 12" vinyl floor tile-white with grey specs	Rm 1-03
7-5-AF-47C		12" x 12" vinyl floor tile-beige with grey specs	Rm 1-04
7-5-AF-65B		Flooring mastic on concrete-black	Rm 1-04
7-5-AF-39C		Panel adhesive under fiberglass in unti ventilator-black	Rm 1-06
7-5-AF-83A		Mastic on foil wrap over duct work-yellow	Rm 1-06
7-5-AF-83B		Mastic on foil wrap over duct work-yellow	Rm 1-06
7-5-AF-84A		Thinset associated with ceramic wall tile-white	Rm 1-07
7-5-AF-84B		Thinset associated with ceramic wall tile-white	Rm 1-07
7-5-AF-85A		Grout associated with wall tile-grey	Rm 1-07
7-5-AF-85B		Grout associated with wall tile-grey	Rm 1-07
7-5-AF-86A		Backer to bat insulation	Rm 1-11
7-5-AF-86B		Backer to bat insulation	Rm 1-11
7-5-AF-87A		Thinset associated with ceramic floor tile-grey	Rm 1-16
7-5-AF-87B		Thinset associated with ceramic floor tile-grey	Rm 1-16
7-5-AF-88A		Sink undercoating-white	Rm 1-18
7-5-AF-88B		Sink undercoating-white	Rm 1-18
7-5-AF-89A		Caulk at sink spout-white	Rm 1-18
7-5-AF-89B		Caulk at sink spout-white	Rm 1-18
7-10-AF-164C		Door frame caulk-grey	Façade A
7-10-AF-173A		Window glazing at entry doors-black	Façade B
7-10-AF-173B		Window glazing at entry doors-black	Façade B
7-10-AF-165C		Sealent between metal wall panels-white	Façade B
5-10-AF-174A		Expansion board at concrete wall junction-brown	Façade C
5-10-AF-174B		Expansion board at concrete wall junction-brown	Façade C
5-10-AF-175A		Felt paper-black	Roof 1
5-10-AF-175B		Felt paper-black	Roof 1
5-10-AF-176A		Reglet caulk-black	Roof 1
5-10-AF-176B		Reglet caulk-black	Roof 1
5-10-AF-177A		Gypsum roof deck	Roof 2
5-10-AF-177B		Gypsum roof deck	Roof 2
5-10-AF-178A		Joint compound associated with gypsum roof deck-white	Roof 2
5-10-AF-178B		Joint compound associated with gypsum roof deck-white	Roof 2
5-10-AF-179A		Reglet caulk-black	Roof 2
5-10-AF-179B		Reglet caulk-black	Roof 2

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building

Lab Order ID: **10056867**
Analysis: TBS
Date Received: 08/19/2024
Date Reported: 08/21/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
7-5-AF-65B	**Flooring mastic on concrete-black**	**43%**	**0%**	None Detected	
10056867_0023					

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (1)
Analyst

Approved Signatory

10056047

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenvirp.com bashe@eagleenvirp.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Admin Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #:	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-5-AF-38C		Paper insulation over fiberglass on water lines	Rm 1-01
7-5-AF-71A		Carpet square adhesive-yellow	Rm 1-01
7-5-AF-72A		4" vinyl cove base adhesive-grey	Rm 1-01
7-5-AF-73A		4" vinyl cove base-grey	Rm 1-01
7-5-AF-73B		4" vinyl cove base-grey	Rm 1-01
7-5-AF-74A		Sheet rock-wall	Rm 1-01
7-5-AF-74B		Sheet rock-wall	Rm 1-06
7-5-AF-75A		Joint compound associated with sheet rock-white	Rm 1-01
7-5-AF-75B		Joint compound associated with sheet rock-white	Rm 1-06
7-5-AF-76A		Window glazing compound to exterior windows-black	Rm 1-01
7-5-AF-77A		Window glazing compound in interior divider windows-grey	Rm 1-01
7-5-AF-77B		Window glazing compound in interior divider windows-grey	Rm 1-06
7-5-AF-78A		Carpet adhesive-yellow	Rm 1-02
7-5-AF-79A		2' x 2' smooth face acoustic ceiling tile	Rm 1-02
7-5-AF-79B		2' x 2' smooth face acoustic ceiling tile	Rm 1-02
7-5-AF-80A		2' x 2' Rough face acoustic ceiling tile	Rm 1-02
7-5-AF-80B		2' x 2' Rough face acoustic ceiling tile	Rm 1-02

Accepted ☐

Rejected ☐

Relinquished By

Received By 7/15 10:30

7-5-AF-81A		Floor tile mastic associated with white vinyl floor tile-transparent	Rm 1-03
7-5-AF-81B		Floor tile mastic associated with white vinyl floor tile-transparent	Rm 1-03
7-5-AF-82A		12" x 12" vinyl floor tile-white with grey specs	Rm 1-03
7-5-AF-82B		12" x 12" vinyl floor tile-white with grey specs	Rm 1-03
7-5-AF-47C		12" x 12" vinyl floor tile-beige with grey specs	Rm 1-04
7-5-AF-65B		Flooring mastic on concrete-black	Rm 1-04
7-5-AF-39C		Panel adhesive under fiberglass in unit ventilator-black	Rm 1-06
7-5-AF-83A		Mastic on foil wrap over duct work-yellow	Rm 1-06
7-5-AF-83B		Mastic on foil wrap over duct work-yellow	Rm 1-06
7-5-AF-84A		Thinset associated with ceramic wall tile-white	Rm 1-07
7-5-AF-84B		Thinset associated with ceramic wall tile-white	Rm 1-07
7-5-AF-85A		Grout associated with wall tile-grey	Rm 1-07
7-5-AF-85B		Grout associated with wall tile-grey	Rm 1-07
7-5-AF-86A		Backer to bat insulation	Rm 1-11
7-5-AF-86B		Backer to bat insulation	Rm 1-11
7-5-AF-87A		Thinset associated with ceramic floor tile-grey	Rm 1-16
7-5-AF-87B		Thinset associated with ceramic floor tile-grey	Rm 1-16
7-5-AF-88A		Sink undercoating-white	Rm 1-18
7-5-AF-88B		Sink undercoating-white	Rm 1-18
7-5-AF-89A		Caulk at sink spout-white	Rm 1-18
7-5-AF-89B		Caulk at sink spout-white	Rm 1-18
7-10-AF-164C		Door frame caulk-grey	Façade A
7-10-AF-173A		Window glazing at entry doors-black	Façade B
7-10-AF-173B		Window glazing at entry doors-black	Façade B
7-10-AF-165C		Sealent between metal wall panels-white	Façade B
5-10-AF-174A		Expansion board at concrete wall junction-brown	Façade C
5-10-AF-174B		Expansion board at concrete wall junction-brown	Façade C
5-10-AF-175A		Felt paper-black	Roof 1
5-10-AF-175B		Felt paper-black	Roof 1
5-10-AF-176A		Reglet caulk-black	Roof 1
5-10-AF-176B		Reglet caulk-black	Roof 1
5-10-AF-177A		Gypsum roof deck	Roof 2
5-10-AF-177B		Gypsum roof deck	Roof 2
5-10-AF-178A		Joint compound associated with gypsum roof deck-white	Roof 2
5-10-AF-178B		Joint compound associated with gypsum roof deck-white	Roof 2
5-10-AF-179A		Reglet caulk-black	Roof 2
5-10-AF-179B		Reglet caulk-black	Roof 2

>>

Relinquished By

Received By

OrderID: 062410776

EMSL ANALYTICAL, INC.

Chain of Custody

EMSL Order Number (Lab Use Only): 062410776

Additional Analysis Request EMSL Order Number

☒ EMSL CT	☐ EMSL NYC	☐ EMSL Corporate
29 N. Plains Hwy, # 4	307 West 38th Street	200 Route 130 North
Wallingford, CT 06492	New York, NY 10018	Cinnaminson, NJ 08077
Phone: 203-284-5948	Phone: 212-290-0051	Phone: 800-220-3675

Eagle Environmental, Inc. EMSL Acct # EEVM50	Project Manager:Chris Liberti Proj #:24-138
8 South Main Street, Suite 3, Terryville. CT 06786	Project:Weston & Sampson MIRA Admin Building 24-138.10T1
Report To: Victoria Farkas Phone: 860-589-8257	US State Collected:CT CT Samples: ☒ Commercial/Taxable ☐ Residential/Tax Exempt
Email All Results to: ☒ bashe@eagleenviro.com ☒ vfarkas@eagleenviro.com	Samples Collected by (Name):Angelo Folino Signature: Date(s) Collected: August 5, 2024
Additional Contacts to Receive Email Results:	
☐ Verbal Results: Contact Name and Phone #:	

Turnaround Time (TAT) Options - Please Check Box Below *<24 HR TAT's Call Ahead to Confirm Lab Availability.*
Not all TAT options are valid for every test (7402, PLM NOB & 400 PC w/Gravimetric Reduction, TEM NOB, Culturable Fungi)

☐ 3 Hour	☐ 6 Hour	☐ 24 Hour	☐ 48 Hour	☐ 72 Hour	☒ 96 Hour	☐ 1 Week	☐ 2 Week

Based on the turnaround time selected above, it is our belief that results are due on or before this Date & Time:

Asbestos	Lead (Pb) Flame Atomic Absorption	Microbiology
TEM: Air ☐ 4 - 4.5 Hour Turnaround Time (AHERA ONLY)	☐ Air: NIOSH 7082 RL: 4µg/filter	Air Samples
☐ AHERA 40 CFR, Part 763, Sub E ☐ NIOSH 7402 ☐ EPA Level II	☐ Soil: SW846-7000B RL: 40 mg/kg (ppm)	☐ Fungi (Spore Trap) Allergenco-D Test: M032
PLM: Bulk ☒ 600/R-93/116 ☐ PLM NOB w/Gravimetric Reduction	Chips: SW846-7000B RL: 0.01%	☐ Fungi Culturable Genus Level ID Test: M005
☐ 400 Point Count ☐ 400 Point Count w/Gravimetric Reduction	☐ % by weight ☐ mg/cm² ☐ ppm	Swab, Tape Lift, Bulk Samples
TEM: Bulk ☐ TEM EPA NOB	Wipe: SW846-7000B RL: 10 µg/wipe	☐ Mold & Fungi Direct Exam Test: M041
TEM: Dust ☐ ASTM Microvac ☐ ASTM Wipe ☐ Qualitative	☐ ASTM ☐ non ASTM Assumed non ASTM if no box is checked	☐ Fungi Culturable Test: M007 (No Tape Lifts)
Other:	Other:	Other:

Eagle Lab Instructions/Comments:
Asbestos: Air - *Do Not Analyze Outsides or Blanks Unless Authorized by Eagle* Bulk - *Please Stop on First Positive Within Sets and Do Not Split samples*
Lead:
Microbiology:

Sample #	I/O HA#	Sample Description	Sample Location	Volume (L) Area Sampled	Date/Time Sampled
8-5-AF-416A		Gasket behind screws-grey/beige	Admin Building- Façade A		8-05-2024
8-5-AF-416B		Gasket behind screws-grey/beige	Admin Building- Façade B		8-05-2024

RECEIVED EMSL ANALYTICAL, INC. CARLE PL, NY 2024 AUG -7 A 10:32

FEDEX

Client Sample #'s –		Total # of Samples: 2	
Relinquished (Client):		Date: 8/6/2024	Time:
Received (Lab):	GS	Date: 8/7/24	Time: 10:32AM
Relinquished:		Date:	Time:
Received:		Date:	Time:

8/11/24

EMSL Analytical, Inc.
528 Mineola Avenue Carle Place, NY 11514
Tel/Fax: (516) 997-7251 / (516) 997-7528
http://www.EMSL.com / carleplacelab@emsl.com

EMSL Order: 062410776
Customer ID: EEVM50
Customer PO:
Project ID:

Attention: B. Ashe
Eagle Environmental, Inc. - CT
8 South Main Street
Suite 3
Terryville, CT 06786

Phone: (860) 589-8257
Fax: (860) 585-7034
Received Date: 08/07/2024 10:32 AM
Analysis Date: 08/11/2024
Collected Date: 08/05/2024

Project: Proj. #: 24-138, Weston & Sampson MIRA Admin. Building / 24-138.10T1

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
8-5-AF-416A *062410776-0001*	Admin. Building - Façade A - Gasket behind Screws - Gray/Beige	Gray/Blue/Beige Non-Fibrous Heterogeneous	3% Cellulose	44% Matrix 53.0% Non-fibrous (Other)	**None Detected**
8-5-AF-416B *062410776-0002*	Admin. Building - Façade B - Gasket behind Screws - Gray/Beige	Gray/Blue/Beige Non-Fibrous Heterogeneous	3% Cellulose	46% Matrix 51.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Carle Place, NY NVLAP Lab Code 101048-10, CA ELAP 2339

Initial report from: 08/12/2024 11:33:36

EMSL Analytical, Inc.
528 Mineola Avenue Carle Place, NY 11514
Tel/Fax: (516) 997-7251 / (516) 997-7528
http://www.EMSL.com / carleplacelab@emsl.com

EMSL Order:	062410776
Customer ID:	EEVM50
Customer PO:	
Project ID:	

Attention:	B. Ashe Eagle Environmental, Inc. - CT 8 South Main Street Suite 3 Terryville, CT 06786	**Phone:**	(860) 589-8257
		Fax:	(860) 585-7034
		Received Date:	08/07/2024 10:32 AM
		Analysis Date:	08/11/2024
		Collected Date:	08/05/2024
Project:	Proj. #: 24-138, Weston & Sampson MIRA Admin. Building / 24-138.10T1		

The samples in this report were submitted to EMSL for analysis by Asbestos Analysis of Bulk materials via EPA/600 (0513) Method using Polarized Light Microscopy. The reference number for these samples is the EMSL Order ID above. Please use this reference number when calling about these samples.

Report Comments:

Sample Receipt Date:	08/07/2024	Sample Receipt Time:	10:32 AM
Analysis Completed Date:	08/11/2024	Analysis Completed Time:	10:50 AM

Analyst(s):



Anthony Miraglia PLM (2)

Samples Reviewed and approved by:

Daniel Clarke, Asbestos Laboratory Manager
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Carle Place, NY NVLAP Lab Code 101048-10, CA ELAP 2339

Initial report from: 08/12/2024 11:33:36

WPF

COAL BARGE UNLOADING BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Coal barge unloading building

Lab Order ID: **10056874**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-10-AF-162A	Gasket at motor for hopper - red	**None Detected**		**100% Other**	Tan, Black Non-Fibrous Heterogeneous
10056874_0001					Crushed
7-10-AF-162B	Gasket at motor for hopper - red	**None Detected**		**100% Other**	Tan, Red Non-Fibrous Heterogeneous
10056874_0002					Crushed
7-10-AF-163A	Caulk at hatch door gray	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056874_0003					Ashed
7-10-AF-163B	Caulk at hatch door gray	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056874_0004					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (4)
Analyst

Approved Signatory

100526074

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Coal barge unloading building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:

Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-10-AF-162A		Gasket at motor for hopper - red	Level 4
7-10-AF-162B		Gasket at motor for hopper - red	Level 4
7-10-AF-163A		Caulk at hatch door gray	Level 9
7-10-AF-163B		Caulk at hatch door gray	Level 9
>>			

Accepted ☑

Rejected ☐

Relinquished By

7/15 Received By 10:20

WPF

CONVEYORS

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Conveyors

Lab Order ID: **10056871**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-113A	Exterior caulk at flex connector - white	**None Detected**		**100% Other**	Brown, White Non-Fibrous Homogeneous
10056871_0001					Ashed
7-8-AF-113B	Exterior caulk at flex connector - white	**None Detected**		**100% Other**	Brown, White Non-Fibrous Homogeneous
10056871_0002					Ashed
7-8-AF-114A	Flex connector at building / conveyor junction - black	**None Detected**	**20% Synthetic Fibers**	**80% Other**	Black Non-Fibrous Homogeneous
10056871_0003					Ashed
7-8-AF-114B	Flex connector at building / conveyor junction - black	**None Detected**	**20% Synthetic Fibers**	**80% Other**	Black Non-Fibrous Homogeneous
10056871_0004					Ashed
7-8-AF-115A	Foam like caulk at metal wall pannel base in corrugated vallies - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056871_0005					Ashed
7-8-AF-115B	Foam like caulk at metal wall pannel base in corrugated vallies - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056871_0006					Ashed
7-9-AF-155A	Caulk at steel frame beam junctions above conveyor belt - black	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056871_0007					Ashed
7-9-AF-155B	Caulk at steel frame beam junctions above conveyor belt - black	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056871_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (11)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Conveyors

Lab Order ID: **10056871**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-9-AF-155C	Caulk at steel frame beam junctions above conveyor belt - black	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056871_0009					Ashed
7-9-AF-156A	Spray foam at ceiling ridge between metal panels - yellow	**None Detected**		**100% Other**	Black, Yellow Non-Fibrous Heterogeneous
10056871_0010					Dissolved
7-9-AF-156B	Spray foam at ceiling ridge between metal panels - yellow	**None Detected**		**100% Other**	Black, Yellow Non-Fibrous Heterogeneous
10056871_0011					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (11)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

100569871

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Conveyors	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample and end with a ">>" below the last sample.***
Client Notes:	Please stop on first positive in set Please do not split samples	*Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:		
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-8-AF-113A		Exterior caulk at flex connector - white	Refuse derived fuel conveyor
7-8-AF-113B		Exterior caulk at flex connector - white	Refuse derived fuel conveyor
7-8-AF-114A		Flex connector at building / conveyor junction - black	Refuse derived fuel conveyor
7-8-AF-114B		Flex connector at building / conveyor junction - black	Refuse derived fuel conveyor
7-8-AF-115A		Foam like caulk at metal wall pannel base in corrugated vallies - gray	Refuse derived fuel conveyor
7-8-AF-115B		Foam like caulk at metal wall pannel base in corrugated vallies - gray	Refuse derived fuel conveyor
7-9-AF-155A		Caulk at steel frame beam junctions above conveyor belt - black	Refuse derived fuel conveyor
7-9-AF-155B		Caulk at steel frame beam junctions above conveyor belt - black	Coal supply conveyor
7-9-AF-155C		Caulk at steel frame beam junctions above conveyor belt - black	Coal supply conveyor
7-9-AF-156A		Spray foam at ceiling ridge between metal panels - yellow	Coal return conveyor
7-9-AF-156B		Spray foam at ceiling ridge between metal panels - yellow	Coal return conveyor

Relinquished By

Accepted ☑

Rejected ☐

Received By

7/15 10:30

WPF

ODOR CONTROL EQUIPMENT

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment

Lab Order ID: **10056873**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-96A	Flooring mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10056873_0001					Dissolved
7-8-AF-96B	Flooring mastic - yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10056873_0002					Dissolved
7-8-AF-97A	12"x12" vinyl floor tile - gray	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056873_0003					Dissolved
7-8-AF-97B	12"x12" vinyl floor tile - gray	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056873_0004					Dissolved
7-8-AF-98A	Stored cell like cement	**None Detected**	**10% Cellulose**	**90% Other**	Gray Fibrous Homogeneous
10056873_0005					Dissolved
7-8-AF-98B	Stored cell like cement	**None Detected**	**10% Cellulose**	**90% Other**	Gray Fibrous Homogeneous
10056873_0006					Dissolved
7-8-AF-99A	Window glazing compound in entry door - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0007					Ashed
7-8-AF-99B	Window glazing compound in entry door - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (34)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment

Lab Order ID: **10056873**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-100A	Door frame caulk - off white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0009					Ashed
7-8-AF-100B	Door frame caulk - off white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0010					Crushed
7-8-AF-101A	Gasket at electrical box - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056873_0011					Ashed
7-8-AF-101B	Gasket at electrical box - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056873_0012					Ashed
7-8-AF-102A	Gasket at re-therm blower - gray	**None Detected**	**60% Cellulose**	**40% Other**	Gray Fibrous Homogeneous
10056873_0013					Dissolved, Ashed
7-8-AF-102B	Gasket at re-therm blower - gray	**None Detected**	**60% Cellulose**	**40% Other**	Gray Fibrous Homogeneous
10056873_0014					Ashed, Dissolved
7-8-AF-103A	Pipe dope at yellow natural gas lines - gray	**<1% Chrysotile**	**10% Cellulose**	**90% Other**	Gray Fibrous Homogeneous
10056873_0015					Ashed
7-8-AF-103B	Pipe dope at yellow natural gas lines - gray	**<1% Chrysotile**	**10% Cellulose**	**90% Other**	Gray Fibrous Homogeneous
10056873_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (34)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment

Lab Order ID: **10056873**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/19/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-104A	Flex connector at compressed air line - pink	None Detected	40% Fiber Glass	60% Other	Red Fibrous Heterogeneous
10056873_0017					Ashed
7-8-AF-104B	Flex connector at compressed air line - pink	None Detected	40% Fiber Glass	60% Other	Red Fibrous Heterogeneous
10056873_0018					Ashed
7-8-AF-105A	Gasket at water line tank junction - black	None Detected	10% Cellulose	90% Other	Black Fibrous Homogeneous
10056873_0019					Ashed
7-8-AF-105B	Gasket at water line tank junction - black	None Detected	10% Cellulose	90% Other	Black Fibrous Homogeneous
10056873_0020					Ashed
7-8-AF-106A	Gasket at tank inlet	None Detected	10% Cellulose	90% Other	Black Fibrous Homogeneous
10056873_0021					Ashed
7-8-AF-106B	Gasket at tank inlet	None Detected	10% Cellulose	90% Other	Black Fibrous Homogeneous
10056873_0022					Ashed
7-8-AF-107A	Flex connector between damper and stack	None Detected	70% Fiber Glass	30% Other	Black Non-Fibrous Homogeneous
10056873_0023					Ashed
7-8-AF-107B	Flex connector between damper and stack	None Detected	70% Fiber Glass	30% Other	Black Non-Fibrous Homogeneous
10056873_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (34)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment

Lab Order ID: **10056873**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-108A	Rope gasket at flex connector	**None Detected**	**99% Fiber Glass**	**1% Other**	Tan Fibrous Homogeneous
10056873_0025					Teased
7-8-AF-108B	Rope gasket at flex connector	**None Detected**	**99% Fiber Glass**	**1% Other**	Tan Fibrous Homogeneous
10056873_0026					Teased
7-8-AF-109A	Rope gasket at flex connector	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Fibrous Homogeneous
10056873_0027					Ashed
7-8-AF-109B	Rope gasket at flex connector	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Fibrous Homogeneous
10056873_0028					Ashed
7-8-AF-110A	Caulk at 4160 volt odor control system main circut braker - grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0029					Ashed
7-8-AF-110B	Caulk at 4160 volt odor control system main circut braker - grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056873_0030					Ashed
7-8-AF-111A	Flex connector at cylindrical duct - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056873_0031					Ashed
7-8-AF-111B	Flex connector at cylindrical duct - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056873_0032					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (34)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment

Lab Order ID: **10056873**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/19/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-112A	Door packing material - black	**None Detected**	**15% Cellulose**	**85% Other**	Black Fibrous Homogeneous
10056873_0033					Dissolved
7-8-AF-112B	Door packing material - black	**None Detected**	**15% Cellulose**	**85% Other**	Black Fibrous Homogeneous
10056873_0034					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (34)
Analyst

Approved Signatory

10056873

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Odor Control Equipment
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:

Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-8-AF-96A		Flooring mastic - yellow	RTO #2
7-8-AF-96B		Flooring mastic - yellow	RTO #1
7-8-AF-97A		12"x12" vinyl floor tile - gray	RTO #2
7-8-AF-97B		12"x12" vinyl floor tile - gray	RTO #1
7-8-AF-98A		Stored cell like cement	RTO #2
7-8-AF-98B		Stored cell like cement	RTO #2
7-8-AF-99A		Window glazing compound in entry door - gray	RTO #1 - façade A
7-8-AF-99B		Window glazing compound in entry door - gray	RTO #2 - façade A
7-8-AF-100A		Door frame caulk - off white	RTO #1 - façade A
7-8-AF-100B		Door frame caulk - off white	RTO #2 - façade A
7-8-AF-101A		Gasket at electrical box - black	Re-therm system
7-8-AF-101B		Gasket at electrical box - black	Re-therm system
7-8-AF-102A		Gasket at re-therm blower - gray	Re-therm system
7-8-AF-102B		Gasket at re-therm blower - gray	Re-therm system
7-8-AF-103A		Pipe dope at yellow natural gas lines - gray	Re-therm system
7-8-AF-103B		Pipe dope at yellow natural gas lines - gray	Re-therm system
7-8-AF-104A		Flex connector at compressed air line - pink	Re-therm system
7-8-AF-104B		Flex connector at compressed air line - pink	Re-therm system

Relinquished By

Accepted ☑

Rejected ☐

Received By 7/15 10:20

4473

7-8-AF-105A		Gasket at water line tank junction - black	Re-therm system
7-8-AF-105B		Gasket at water line tank junction - black	Re-therm system
7-8-AF-106A		Gasket at tank inlet	Re-therm system
7-8-AF-106B		Gasket at tank inlet	Re-therm system
7-8-AF-107A		Flex connector between damper and stack	Re-therm unit
7-8-AF-107B		Flex connector between damper and stack	Re-therm unit
7-8-AF-108A		Rope gasket at flex connector	Re-therm unit
7-8-AF-108B		Rope gasket at flex connector	Re-therm unit
7-8-AF-109A		Rope gasket at flex connector	Re-therm unit
7-8-AF-109B		Rope gasket at flex connector	Re-therm unit
7-8-AF-110A		Caulk at 4160 volt odor control system main circut braker - grey	Odor control system
7-8-AF-110B		Caulk at 4160 volt odor control system main circut braker - grey	Odor control system
7-8-AF-111A		Flex connector at cylindrical duct - red	Odor control duct work
7-8-AF-111B		Flex connector at cylindrical duct - red	Odor control duct work
7-8-AF-112A		Door packing material - black	Ram clean unit
7-8-AF-112B		Door packing material - black	Ram clean unit

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Waste Processing Facility - Odor Control Equipment

Lab Order ID: **10064374**
Analysis: TBS
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
10-2-AF-103C *10064374_0001*	**Pipe dope at yellow natural gas lines- gray**	**43%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Russell Shelton (1)
Analyst

Approved Signatory

100643?4

Client:	Eagle Environmental, Inc.	***Instructions:**
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston and Sampson - MIRA, Waste Processing Facility - Odor Control Equipment	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	
Date Submitted:	10/3/2024 0:00	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Analysis:	TEM: Chatfield	
TurnAroundTime:	24 Hour	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-2-AF-103C		Pipe dope at yellow natural gas lines - gray	Re-therm system

Accepted ☑

Rejected ☐

Relinquished By

Received By

10/4 10:30am

WPF

SCALE HOUSES

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Scale Houses

Lab Order ID: **10056869**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-9-AF-139A	2'x4' imitation ceiling tile	**None Detected**	**5% Fiber Glass** **5% Cellulose**	**90% Other**	White, Tan Fibrous Homogeneous
10056869_0001					Dissolved
7-9-AF-139B	2'x4' imitation ceiling tile	**None Detected**	**5% Mineral Wool** **5% Cellulose**	**90% Other**	White, Tan Fibrous Homogeneous
10056869_0002					Dissolved
7-9-AF-140A	Caulk at window / door surrounds - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0003					Ashed
7-9-AF-140B	Caulk at window / door surrounds - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0004					Ashed
7-9-AF-141A	Bottom layer roofing felt paper - black (layer 1)	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10056869_0005					Ashed
7-9-AF-141B	Bottom layer roofing felt paper - black (layer 1)	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10056869_0006					Ashed
7-9-AF-142A	Toper layer roofing felt paper - black (layer 2)	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10056869_0007					Ashed
7-9-AF-142B	Toper layer roofing felt paper - black (layer 2)	**None Detected**	**10% Cellulose**	**90% Other**	Black Fibrous Homogeneous
10056869_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (18)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Scale Houses

Lab Order ID: **10056869**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-9-AF-143A	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056869_0009					Ashed
7-9-AF-143B	Reglet caulk - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056869_0010					Ashed
7-9-AF-144A	Caulking on duct work to roof top unit - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0011					Ashed
7-9-AF-144B	Caulking on duct work to roof top unit - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0012					Ashed
7-9-AF-145A	Caulking on duct work to roof top unit - vibrant white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056869_0013					Ashed
7-9-AF-145B	Caulking on duct work to roof top unit - vibrant white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056869_0014					Ashed
7-9-AF-146A	Caulk at window sash and frame - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0015					Ashed
7-9-AF-146B	Caulk at window sash and frame - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056869_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (18)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Scale Houses

Lab Order ID: **10056869**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-9-AF-147A	Caulk at A/C unit - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056869_0017					Ashed
7-9-AF-147B	Caulk at A/C unit - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056869_0018					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (18)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

100526049

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston & Sampson / MIRA - 300 Maxim Road, Hartford - Scale Houses	***Enter samples between "<<" and ">>" Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Date Submitted:		
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sallab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-9-AF-139A		2'x4' imitation ceiling tile	Scale house #1 interior
7-9-AF-139B		2'x4' imitation ceiling tile	Scale house #1 interior
7-9-AF-140A		Caulk at window / door surrounds - gray	Scale house #1 exterior - façade B
7-9-AF-140B		Caulk at window / door surrounds - gray	Scale house #1 exterior - façade C
7-9-AF-141A		Bottom layer roofing felt paper - black (layer 1)	Scale house #1 roof
7-9-AF-141B		Bottom layer roofing felt paper - black (layer 1)	Scale house #1 roof
7-9-AF-142A		Toper layer roofing felt paper - black (layer 2)	Scale house #1 roof
7-9-AF-142B		Toper layer roofing felt paper - black (layer 2)	Scale house #1 roof
7-9-AF-143A		Reglet caulk - black	Scale house #1 roof
7-9-AF-143B		Reglet caulk - black	Scale house #1 roof
7-9-AF-144A		Caulking on duct work to roof top unit - gray	Scale house #1 roof
7-9-AF-144B		Caulking on duct work to roof top unit - gray	Scale house #1 roof
7-9-AF-145A		Caulking on duct work to roof top unit - vibrant white	Scale house #1 roof
7-9-AF-145B		Caulking on duct work to roof top unit - vibrant white	Scale house #1 roof
7-9-AF-146A		Caulk at window sash and frame - gray	Scale house #2 interior
7-9-AF-146B		Caulk at window sash and frame - gray	Scale house #2 interior
7-9-AF-147A		Caulk at A/C unit - white	Scale house #2 Exterior
7-9-AF-147B		Caulk at A/C unit - white	Scale house #2 Exterior
>>			

Accepted ☒

Rejected ☐

Relinquished By

7/15 10:30

Received By

WPF

TOOL STORAGE

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-116A	Spray applied fire proofing	None Detected	50% Cellulose	50% Other	Gray Non-Fibrous Homogeneous
10056864_0001					Dissolved, Teased
7-8-AF-116B	Spray applied fire proofing	None Detected	50% Cellulose	50% Other	Gray, Beige Non-Fibrous Homogeneous
10056864_0002					Teased, Dissolved
7-8-AF-116C	Spray applied fire proofing	None Detected	50% Cellulose	50% Other	Gray Non-Fibrous Homogeneous
10056864_0003					Teased, Dissolved
7-8-AF-116D	Spray applied fire proofing	None Detected	50% Cellulose	50% Other	Gray Non-Fibrous Homogeneous
10056864_0004					Teased, Dissolved
7-8-AF-116E	Spray applied fire proofing	None Detected	50% Cellulose	50% Other	Gray Non-Fibrous Homogeneous
10056864_0005					Teased, Dissolved
7-8-AF-117A	Soft fitting cement at roof drains and penetrations	None Detected	30% Mineral Wool	70% Other	Gray Fibrous Homogeneous
10056864_0006					Dissolved
7-8-AF-117B	Soft fitting cement at roof drains and penetrations	None Detected	30% Mineral Wool	70% Other	Gray Fibrous Homogeneous
10056864_0007					Dissolved
7-8-AF-117C	Soft fitting cement at roof drains and penetrations	None Detected	30% Mineral Wool	70% Other	Gray Fibrous Homogeneous
10056864_0008					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-118A	Sealent between duct frame and wall - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10056864_0009					Dissolved
7-8-AF-118B	Sealent between duct frame and wall - black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10056864_0010					Dissolved
7-8-AF-119A	Caulk at CMU / metal wall panel junction - gray	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10056864_0011					Ashed
7-8-AF-119B	Caulk at CMU / metal wall panel junction - gray	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10056864_0012					Ashed
7-8-AF-120A	Window glazing compound in partition windows - off white	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10056864_0013					Dissolved
7-8-AF-120B	Window glazing compound in partition windows - off white	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10056864_0014					Dissolved
7-8-AF-121A	Rubber square adhesive - yellow	None Detected		100% Other	Green, Tan Non-Fibrous Homogeneous
10056864_0015					Dissolved
7-8-AF-121B	Rubber square adhesive - yellow	None Detected		100% Other	Green, Tan Non-Fibrous Homogeneous
10056864_0016					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-8-AF-122A	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0017					Ashed
7-8-AF-122B	4" vinyl cove base - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0018					Ashed
7-8-AF-123A	Gypsum ceiling backer	**None Detected**	**5% Cellulose**	**95% Other**	White Non-Fibrous Homogeneous
10056864_0019					Dissolved
7-8-AF-123B	Gypsum ceiling backer	**None Detected**	**5% Cellulose**	**95% Other**	White Non-Fibrous Homogeneous
10056864_0020					Dissolved
7-8-AF-124A	Pin tab adhesive on gypsum ceiling - olive	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0021					Ashed
7-8-AF-124B	Pin tab adhesive on gypsum ceiling - olive	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0022					Ashed
7-8-AF-125A	2'x4' acoustical ceiling tile - pinhole & fissure	**None Detected**	**60% Cellulose**	**30% Other** **10% Quartz**	Beige Fibrous Homogeneous
10056864_0023					Ashed
7-8-AF-125B	2'x4' acoustical ceiling tile - pinhole & fissure	**None Detected**	**60% Cellulose**	**30% Other** **10% Perlite**	Beige Fibrous Homogeneous
10056864_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-126A	Panel adhesive on unit ventilator - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056864_0025					Ashed
7-8-AF-126B	Panel adhesive on unit ventilator - red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056864_0026					Ashed
7-8-AF-127A	Caulk at metal cove base / wall panel junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0027					Dissolved
7-8-AF-127B	Caulk at metal cove base / wall panel junction - white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0028					Dissolved
7-8-AF-128A	Fire door core insulation - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0029					Dissolved
7-8-AF-128B	Fire door core insulation - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0030					Dissolved
7-8-AF-46D	Flooring mastic - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056864_0031					Dissolved
7-8-AF-47D	12" x 12" vinyl floor tile-beige with grey specs	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056864_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-29D	Foil insulation	**None Detected**	**25% Cellulose** **15% Fiber Glass**	**60% Other**	Silver, Tan Non-Fibrous Homogeneous
10056864_0033					Ashed
7-8-AF-30C	Sheet rock	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10056864_0034					Dissolved
7-8-AF-31C	Joint compound-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0035					Dissolved
7-8-AF-25C	Pipe dope- white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0036					Dissolved
7-8-AF-129A	Mud base associated with gray ceramic floor tile	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0037					Dissolved
7-8-AF-129B	Mud base associated with gray ceramic floor tile	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0038					Dissolved
7-8-AF-130A	Grout associated with gray ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0039					Dissolved
7-8-AF-130B	Grout associated with gray ceramic floor tile - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0040					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-131A	Adhesive associated with gray Ceramic floor tile over mud base - yellow	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056864_0041					Ashed
7-8-AF-131B	Adhesive associated with gray Ceramic floor tile over mud base - yellow	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056864_0042					Ashed
7-8-AF-132A	Adhesive associated with ceramic wall tile - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056864_0043					Ashed
7-8-AF-132B	Adhesive associated with ceramic wall tile - yellow	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056864_0044					Ashed
7-8-AF-133A	Grout associated with ceramic wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0045					Dissolved
7-8-AF-133B	Grout associated with ceramic wall tile - gray	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0046					Dissolved
7-8-AF-134A	12"x12" vinyl floor tile - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0047					Ashed
7-8-AF-134B	12"x12" vinyl floor tile - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0048					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-8-AF-135A	Canvas wrap on sheetrock	**None Detected**	**30% Cellulose**	**70% Other**	Beige Non-Fibrous Homogeneous
10056864_0049					Ashed
7-8-AF-135B	Canvas wrap on sheetrock	**None Detected**	**30% Cellulose**	**70% Other**	Beige Non-Fibrous Homogeneous
10056864_0050					Ashed
7-8-AF-136A	Sink undercoating - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0051					Dissolved
7-8-AF-136B	Sink undercoating - blue	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0052					Dissolved
7-8-AF-137A	Caulk at sink surround - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0053					Ashed
7-8-AF-137B	Caulk at sink surround - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056864_0054					Ashed
7-10-AF-180A	Caulk at roof top unit - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0055					Ashed
7-10-AF-180B	Caulk at roof top unit - gray	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056864_0056					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-10-AF-181A	Caulking at roof penetrations - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0057					Ashed
7-10-AF-181B	Caulking at roof penetrations - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0058					Ashed
7-10-AF-182A	Flashing cement - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0059					Ashed
7-10-AF-182B	Flashing cement - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056864_0060					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (60)
Analyst

Approved Signatory

100568664

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:

Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-8-AF-116A		Spray applied fire proofing	Rm 1-01
7-8-AF-116B		Spray applied fire proofing	Rm 1-01
7-8-AF-116C		Spray applied fire proofing	Rm 1-01
7-8-AF-116D		Spray applied fire proofing	Rm 1-01
7-8-AF-116E		Spray applied fire proofing	Rm 1-01
7-8-AF-117A		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-117B		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-117C		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-118A		Sealent between duct frame and wall - black	Rm 1-01
7-8-AF-118B		Sealent between duct frame and wall - black	Rm 1-01
7-8-AF-119A		Caulk at CMU / metal wall panel junction - gray	Rm 1-01
7-8-AF-119B		Caulk at CMU / metal wall panel junction - gray	Rm 1-01
7-8-AF-120A		Window glazing compound in partition windows - off white	Rm 1-02
7-8-AF-120B		Window glazing compound in partition windows - off white	Rm 1-02
7-8-AF-121A		Rubber square adhesive - yellow	Rm 1-02
7-8-AF-121B		Rubber square adhesive - yellow	Rm 1-02
7-8-AF-122A		4" vinyl cove base - gray	Rm 1-02
7-8-AF-122B		4" vinyl cove base - gray	Rm 1-02

Accepted ☑

Rejected ☐

Relinquished By

Received By 7/15 10:30

7-8-AF-123A		Gypsum ceiling backer	Rm 1-02
7-8-AF-123B		Gypsum ceiling backer	Rm 1-02
7-8-AF-124A		Pin tab adhesive on gypsum ceiling - olive	Rm 1-02
7-8-AF-124B		Pin tab adhesive on gypsum ceiling - olive	Rm 1-02
7-8-AF-125A		2'x4' acoustical ceiling tile - pinhole & fissure	Rm 1-02
7-8-AF-125B		2'x4' acoustical ceiling tile - pinhole & fissure	Rm 1-02
7-8-AF-126A		Panel adhesive on unit ventilator - red	Rm 2-03
7-8-AF-126B		Panel adhesive on unit ventilator - red	Rm 2-03
7-8-AF-127A		Caulk at metal cove base / wall panel junction - white	Rm 2-03
7-8-AF-127B		Caulk at metal cove base / wall panel junction - white	Rm 2-03
7-8-AF-128A		Fire door core insulation - white	Rm 2-05
7-8-AF-128B		Fire door core insulation - white	Rm 2-05
7-8-AF-46D		Flooring mastic - yellow	Rm 2-05
7-8-AF-47D		12" x 12" vinyl floor tile-beige with grey specs	Rm 2-05
7-8-AF-29D		Foil insulation	Rm 2-05
7-8-AF-30C		Sheet rock	Rm 2-05
7-8-AF-31C		Joint compound-white	Rm 2-05
7-8-AF-25C		Pipe dope- white	Rm 2-05
7-8-AF-129A		Mud base associated with gray ceramic floor tile	Rm 2-06
7-8-AF-129B		Mud base associated with gray ceramic floor tile	Rm 2-06
7-8-AF-130A		Grout associated with gray ceramic floor tile - gray	Rm 2-06
7-8-AF-130B		Grout associated with gray ceramic floor tile - gray	Rm 2-06
7-8-AF-131A		Adhesive associated with gray Ceramic floor tile over mud base - yellow	Rm 2-06
7-8-AF-131B		Adhesive associated with gray Ceramic floor tile over mud base - yellow	Rm 2-06
7-8-AF-132A		Adhesive associated with ceramic wall tile - yellow	Rm 2-06
7-8-AF-132B		Adhesive associated with ceramic wall tile - yellow	Rm 2-06
7-8-AF-133A		Grout associated with ceramic wall tile - gray	Rm 2-06
7-8-AF-133B		Grout associated with ceramic wall tile - gray	Rm 2-06
7-8-AF-134A		12"x12" vinyl floor tile - black	Rm 2-10
7-8-AF-134B		12"x12" vinyl floor tile - black	Rm 2-10
7-8-AF-135A		Canvas wrap on sheetrock	Rm 2-11
7-8-AF-135B		Canvas wrap on sheetrock	Rm 2-11
7-8-AF-136A		Sink undercoating - blue	Rm 2-11
7-8-AF-136B		Sink undercoating - blue	Rm 2-11
7-8-AF-137A		Caulk at sink surround - white	Rm 2-11
7-8-AF-137B		Caulk at sink surround - white	Rm 2-11
7-10-AF-180A		Caulk at roof top unit - gray	Roof
7-10-AF-180B		Caulk at roof top unit - gray	Roof

Relinquished By

Received By

6861

7-10-AF-181A		Caulking at roof penetrations - black	Roof
7-10-AF-181B		Caulking at roof penetrations - black	Roof
7-10-AF-182A		Flashing cement - black	Roof
7-10-AF-182B		Flashing cement - black	Roof

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building

Lab Order ID: **10056864**
Analysis: TBS
Date Received: 08/19/2024
Date Reported: 08/21/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
7-10-AF-180A *10056864_0055*	**Caulk at roof top unit - gray**	**41%**	**0%**	None Detected	
7-10-AF-182A *10056864_0059*	**Flashing cement - black**	**75%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (2)
Analyst

Approved Signatory

100568604

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Tool Storage Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #:	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-8-AF-116A		Spray applied fire proofing	Rm 1-01
7-8-AF-116B		Spray applied fire proofing	Rm 1-01
7-8-AF-116C		Spray applied fire proofing	Rm 1-01
7-8-AF-116D		Spray applied fire proofing	Rm 1-01
7-8-AF-116E		Spray applied fire proofing	Rm 1-01
7-8-AF-117A		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-117B		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-117C		Soft fitting cement at roof drains and penetrations	Rm 1-01
7-8-AF-118A		Sealent between duct frame and wall - black	Rm 1-01
7-8-AF-118B		Sealent between duct frame and wall - black	Rm 1-01
7-8-AF-119A		Caulk at CMU / metal wall panel junction - gray	Rm 1-01
7-8-AF-119B		Caulk at CMU / metal wall panel junction - gray	Rm 1-01
7-8-AF-120A		Window glazing compound in partition windows - off white	Rm 1-02
7-8-AF-120B		Window glazing compound in partition windows - off white	Rm 1-02
7-8-AF-121A		Rubber square adhesive - yellow	Rm 1-02
7-8-AF-121B		Rubber square adhesive - yellow	Rm 1-02
7-8-AF-122A		4" vinyl cove base - gray	Rm 1-02
7-8-AF-122B		4" vinyl cove base - gray	Rm 1-02

Accepted ☑

Rejected ☐

Relinquished By

Received By 7/15 10:30

7-8-AF-123A		Gypsum ceiling backer	Rm 1-02
7-8-AF-123B		Gypsum ceiling backer	Rm 1-02
7-8-AF-124A		Pin tab adhesive on gypsum ceiling - olive	Rm 1-02
7-8-AF-124B		Pin tab adhesive on gypsum ceiling - olive	Rm 1-02
7-8-AF-125A		2'x4' acoustical ceiling tile - pinhole & fissure	Rm 1-02
7-8-AF-125B		2'x4' acoustical ceiling tile - pinhole & fissure	Rm 1-02
7-8-AF-126A		Panel adhesive on unit ventilator - red	Rm 2-03
7-8-AF-126B		Panel adhesive on unit ventilator - red	Rm 2-03
7-8-AF-127A		Caulk at metal cove base / wall panel junction - white	Rm 2-03
7-8-AF-127B		Caulk at metal cove base / wall panel junction - white	Rm 2-03
7-8-AF-128A		Fire door core insulation - white	Rm 2-05
7-8-AF-128B		Fire door core insulation - white	Rm 2-05
7-8-AF-46D		Flooring mastic - yellow	Rm 2-05
7-8-AF-47D		12" x 12" vinyl floor tile-beige with grey specs	Rm 2-05
7-8-AF-29D		Foil insulation	Rm 2-05
7-8-AF-30C		Sheet rock	Rm 2-05
7-8-AF-31C		Joint compound-white	Rm 2-05
7-8-AF-25C		Pipe dope- white	Rm 2-05
7-8-AF-129A		Mud base associated with gray ceramic floor tile	Rm 2-06
7-8-AF-129B		Mud base associated with gray ceramic floor tile	Rm 2-06
7-8-AF-130A		Grout associated with gray ceramic floor tile - gray	Rm 2-06
7-8-AF-130B		Grout associated with gray ceramic floor tile - gray	Rm 2-06
7-8-AF-131A		Adhesive associated with gray Ceramic floor tile over mud base - yellow	Rm 2-06
7-8-AF-131B		Adhesive associated with gray Ceramic floor tile over mud base - yellow	Rm 2-06
7-8-AF-132A		Adhesive associated with ceramic wall tile - yellow	Rm 2-06
7-8-AF-132B		Adhesive associated with ceramic wall tile - yellow	Rm 2-06
7-8-AF-133A		Grout associated with ceramic wall tile - gray	Rm 2-06
7-8-AF-133B		Grout associated with ceramic wall tile - gray	Rm 2-06
7-8-AF-134A		12"x12" vinyl floor tile - black	Rm 2-10
7-8-AF-134B		12"x12" vinyl floor tile - black	Rm 2-10
7-8-AF-135A		Canvas wrap on sheetrock	Rm 2-11
7-8-AF-135B		Canvas wrap on sheetrock	Rm 2-11
7-8-AF-136A		Sink undercoating - blue	Rm 2-11
7-8-AF-136B		Sink undercoating - blue	Rm 2-11
7-8-AF-137A		Caulk at sink surround - white	Rm 2-11
7-8-AF-137B		Caulk at sink surround - white	Rm 2-11
7-10-AF-180A		Caulk at roof top unit - gray	Roof
7-10-AF-180B		Caulk at roof top unit - gray	Roof

Relinquished By

Received By

7-10-AF-181A		Caulking at roof penetrations - black	Roof
7-10-AF-181B		Caulking at roof penetrations - black	Roof
7-10-AF-182A		Flashing cement - black	Roof
7-10-AF-182B		Flashing cement - black	Roof

>>

Relinquished By

Received By

WPF

TRANSFER BUILDING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Transfer Building

Lab Order ID: **10056868**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-9-AF-148A	Fire stop caulk-beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056868_0001					Ashed
7-9-AF-148B	Fire stop caulk-beige	**None Detected**		**100% Other**	Beige Non-Fibrous Homogeneous
10056868_0002					Ashed
7-9-AF-149A	Skim coat at electrical conduits-metalic	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056868_0003					Dissolved
7-9-AF-149B	Skim coat at electrical conduits-metalic	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056868_0004					Dissolved
7-9-AF-149C	Skim coat at electrical conduits-metalic	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056868_0005					Dissolved
7-9-AF-30D	Sheet rock	**None Detected**	**10% Cellulose**	**90% Other**	Gray Non-Fibrous Homogeneous
10056868_0006					Crushed
7-9-AF-31D	Joint compound associated with sheet rock - white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056868_0007					Crushed
7-9-AF-150A	Precast calcium silicate insulation pipe wrap-white	**None Detected**	**20% Cellulose**	**80% Other**	White Fibrous Homogeneous
10056868_0008					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (27)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Transfer Building

Lab Order ID: **10056868**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-9-AF-150B	Precast calcium silicate insulation pipe wrap-white	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10056868_0009					Teased
7-9-AF-151A	Precast calcium silicate insulation bloack-white	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10056868_0010					Teased
7-9-AF-151B	Precast calcium silicate insulation bloack-white	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10056868_0011					Teased
7-9-AF-152A	Gasket at roof drain-orange	None Detected		100% Other	Orange Non-Fibrous Homogeneous
10056868_0012					Ashed
7-9-AF-152B	Gasket at roof drain-orange	None Detected		100% Other	Orange Non-Fibrous Homogeneous
10056868_0013					Ashed
7-9-AF-153A	Silicone caulk over aluminum jacket on pipes-transparent	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10056868_0014					Ashed
7-9-AF-153B	Silicone caulk over aluminum jacket on pipes-transparent	None Detected		100% Other	Transparent Non-Fibrous Homogeneous
10056868_0015					Ashed
7-9-AF-154A	Woven gasket at belt cleaner unit access door-white	None Detected		100% Other	Brown Non-Fibrous Homogeneous
10056868_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (27)
Analyst

Nathaniel Durham
Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Transfer Building

Lab Order ID: **10056868**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-9-AF-154B	Woven gasket at belt cleaner unit access door-white	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056868_0017					Ashed
7-9-AF-157A	Bottom layer tar paper at roof deck-corrugated	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056868_0018					Dissolved
7-9-AF-157B	Bottom layer tar paper at roof deck-corrugated	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056868_0019					Dissolved
7-9-AF-158A	Roof tar and felts-black	**None Detected**	**40% Cellulose** **10% Fiber Glass**	**50% Other**	Brown, Black Fibrous Heterogeneous
10056868_0020					Dissolved
7-9-AF-158B	Roof tar and felts-black	**None Detected**	**40% Cellulose** **10% Fiber Glass**	**50% Other**	Brown, Black Fibrous Heterogeneous
10056868_0021					Dissolved
7-9-AF-159A	Flashing cement-black	**15% Chrysotile**		**85% Other**	Black Fibrous Homogeneous
10056868_0022					Dissolved
7-9-AF-159B	Flashing cement-black	**Not Analyzed**			
10056868_0023					
7-9-AF-160A	Louver caulk-cream	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056868_0024					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (27)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Transfer Building

Lab Order ID: **10056868**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-9-AF-160B	Louver caulk-cream	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056868_0025					Dissolved
7-9-AF-161A	Door frame caulk-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056868_0026					Ashed
7-9-AF-161B	Door frame caulk-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056868_0027					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (27)
Analyst

Approved Signatory

1005698605

Client:	Eagle Environmental, Inc.	***Instructions:***
Contact:	Victoria Farkas, Breigh Ashe	*Use Column "B" for your contact info*
Address:	8 South Main Street, Terryville, CT	
Phone:	860-589-8257	*To See an Example Click the bottom Example Tab.*
Fax:	860-585-7034	
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com	
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Transfer Building	***Enter samples between "<<" and ">>"*** ***Begin Samples with a "<< "above the first sample***
Client Notes:	Please stop on first positive in set Please do not split samples	***and end with a ">>" below the last sample.*** *Only Enter your data on the first sheet "Sheet1"*
P.O. #.	24-138.10T1	
Date Submitted:		*Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.*
Analysis:	PLM EPA 600R - 93/116	
TurnAroundTime:	5 Day	

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-9-AF-148A		Fire stop caulk-beige	Rm 1-01
7-9-AF-148B		Fire stop caulk-beige	Rm 2-05
7-9-AF-149A		Skim coat at electrical conduits-metalic	Rm 1-02
7-9-AF-149B		Skim coat at electrical conduits-metalic	Rm 1-02
7-9-AF-149C		Skim coat at electrical conduits-metalic	Rm 1-02
7-9-AF-30D		Sheet rock	Rm 1-02
7-9-AF-31D		Joint compound associated with sheet rock - white	Rm 1-02
7-9-AF-150A		Precast calcium silicate insulation pipe wrap-white	Rm 1-04
7-9-AF-150B		Precast calcium silicate insulation pipe wrap-white	Rm 1-04
7-9-AF-151A		Precast calcium silicate insulation bloack-white	Rm 1-04
7-9-AF-151B		Precast calcium silicate insulation bloack-white	Rm 1-04
7-9-AF-152A		Gasket at roof drain-orange	Rm 2-05
7-9-AF-152B		Gasket at roof drain-orange	Rm 2-05
7-9-AF-153A		Silicone caulk over aluminum jacket on pipes-transparent	Rm 3-09
7-9-AF-153B		Silicone caulk over aluminum jacket on pipes-transparent	Rm 3-09
7-9-AF-154A		Woven gasket at belt cleaner unit access door-white	Rm 4-10
7-9-AF-154B		Woven gasket at belt cleaner unit access door-white	Rm 4-10
7-9-AF-157A		Bottom layer tar paper at roof deck-corrugated	Rm 5-11

Accepted ☑

Rejected ☐

Relinquished By

Received By

7/15 10.20

4868

7-9-AF-157B		Bottom layer tar paper at roof deck-corrugated	Rm 5-11
7-9-AF-158A		Roof tar and felts-black	Rm 5-11
7-9-AF-158B		Roof tar and felts-black	Rm 5-11
7-9-AF-159A		Flashing cement-black	Rm 5-11
7-9-AF-159B		Flashing cement-black	Rm 5-11
7-9-AF-160A		Louver caulk-cream	Rm 5-11
7-9-AF-160B		Louver caulk-cream	Rm 5-11
7-9-AF-161A		Door frame caulk-grey	Façade B
7-9-AF-161B		Door frame caulk-grey	Façade B

>>

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Waste Processing Facility - Transfer Building Main Roof

Lab Order ID: **10062112**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
8-30-AF-655A	Tar at perimeter curb - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10062112_0001					Dissolved
8-30-AF-655B	Tar at perimeter curb - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10062112_0002					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (2)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10/02/12

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Waste Processing Facility - Transfer Building Main Roof
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/6/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-30-AF-655A		Tar at perimeter curb - black	Main roof
8-30-AF-655B		Tar at perimeter curb - black	Main roof

Accepted ☒

Rejected ☐

Relinquished By

Received By

9/9 10:30am

WPF

WASTE PROCESSING

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-01A	Concrete slab	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0001					Crushed
7-3-AF-01B	Concrete slab	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0002					Crushed
7-5-AF-01C	Concrete slab	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0003					Crushed
7-2-AF-02A	Roll up door membrane-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0004					Ashed
7-3-AF-02B	Roll up door membrane-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0005					Ashed
7-5-AF-02C	Roll up door membrane-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0006					Ashed
7-2-AF-03A	Interior door fram caulk-white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0007					Ashed
7-2-AF-03B	Interior door frame caulk-white	**None Detected**	**15% Fiber Glass**	**85% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0008					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-03C	Interior door frame caulk-white	**None Detected**		**100% Other**	Red, White Non-Fibrous Heterogeneous
10056860_0009					Ashed
7-2-AF-04A	Paint on metal panneling-metalic	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10056860_0010					Dissolved
7-2-AF-04B	Paint on metal panneling-metalic	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Heterogeneous
10056860_0011					Dissolved
7-3-AF-04C	Paint on metal panneling-metalic	**None Detected**		**100% Other**	Tan, Gray Non-Fibrous Heterogeneous
10056860_0012					Dissolved
7-2-AF-05A	Window glazing compound-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0013					Ashed
7-2-AF-05B	Window glazing compound-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0014					Ashed
7-2-AF-06A	Woven window curtain-white	**None Detected**	**40% Synthetic Fibers**	**60% Other**	Black, Cream Fibrous Heterogeneous
10056860_0015					Ashed
7-2-AF-06B	Woven window curtain-white	**None Detected**	**40% Synthetic Fibers**	**60% Other**	Black, Cream Fibrous Heterogeneous
10056860_0016					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-07A	High visibility paint - yellow	**None Detected**		**100% Other**	Brown, Yellow Non-Fibrous Heterogeneous
10056860_0017					Ashed
7-2-AF-07B	High visibility paint - yellow	**None Detected**		**100% Other**	Gray, Yellow Non-Fibrous Heterogeneous
10056860_0018					Ashed
7-2-AF-07C	High visibility paint - yellow	**None Detected**		**100% Other**	Yellow, Gray Non-Fibrous Heterogeneous
10056860_0019					Ashed
7-2-AF-08A	Pin tab adhesive on columns-maroon	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056860_0020					Dissolved
7-2-AF-08B	Pin tab adhesive on columns-maroon	**None Detected**		**100% Other**	Brown Non-Fibrous Homogeneous
10056860_0021					Dissolved
7-2-AF-09A	Door frame caulk-brown	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10056860_0022					Ashed
7-2-AF-09B	Door frame caulk-brown	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10056860_0023					Ashed
7-2-AF-10A	Window glazing compound in interior doors - black	**2% Chrysotile**		**98% Other**	White, Black Non-Fibrous Heterogeneous
10056860_0024					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-10B	Window glazing compound in interior doors - black	**Not Analyzed**			
10056860_0025					
7-3-AF-10C	Window glazing compound in interior doors - black	**Not Analyzed**			
10056860_0026					
7-2-AF-11A	Flex connector at duct-black	**None Detected**	**30% Fiber Glass**	**70% Other**	Black, White Non-Fibrous Heterogeneous
10056860_0027					Ashed
7-2-AF-12A	Sealent at duct slips at smaller diameter duct-brown	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0028					Ashed
7-2-AF-12B	Sealent at duct slips at smaller diameter duct-brown	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0029					Ashed
7-2-AF-13A	Bottom layer felt paper on concrete roof deck (layer 1)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0030					Dissolved
7-2-AF-13B	Bottom layer felt paper on concrete roof deck (layer 1)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0031					Dissolved
7-2-AF-14A	Middle layer felt paper-black (layer 2)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0032					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-14B	Middle layer felt paper-black (layer 2)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0033					Dissolved
7-2-AF-15A	Top layer felt paper-black (layer 3)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0034					Dissolved
7-2-AF-15B	Top layer felt paper-black (layer 3)	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Homogeneous
10056860_0035					Dissolved
7-2-AF-16A	Sealent at roof membrane/metal wall pannel junction-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0036					Ashed
7-2-AF-16B	Sealent at roof membrane/metal wall pannel junction-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0037					Ashed
7-2-AF-17A	Fire hose-white	**None Detected**	**85% Synthetic Fibers** **5% Cellulose**	**10% Other**	Gray, White Fibrous Heterogeneous
10056860_0038					Teased
7-2-AF-17B	Fire hose-white	**None Detected**	**85% Synthetic Fibers** **5% Cellulose**	**10% Other**	White Fibrous Heterogeneous
10056860_0039					Teased
7-2-AF-18A	Window glazing compound in grapple office windows-brown	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10056860_0040					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-2-AF-18B	Window glazing compound in grapple office windows-brown	**Not Analyzed**			
10056860_0041					
7-2-AF-19A	Conveyor belt (non-processible waste conveyor)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Black, Cream Non-Fibrous Homogeneous
10056860_0042					Ashed
7-3-AF-19B	Conveyor belt (secondary shredder)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Black, Cream Non-Fibrous Homogeneous
10056860_0043					Ashed
7-3-AF-19C	Conveyor belt (ferrous shuttle conveyor)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Cream, Black Non-Fibrous Homogeneous
10056860_0044					Ashed
7-2-AF-20A	Not sent	**Not Submitted**			
10056860_0045					
7-2-AF-21A	Shrapnel guard above conveyor - black / rubbery (non-processible waste conveyor)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Black Non-Fibrous Homogeneous
10056860_0046					Ashed
7-3-AF-21B	Shrapnel guard above conveyor - black / rubbery (secondary shredder)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Black Non-Fibrous Homogeneous
10056860_0047					Ashed
7-3-AF-21C	Shrapnel guard above conveyor - black / rubbery (ferrous shuttle conveyor)	**None Detected**	**30% Synthetic Fibers**	**70% Other**	Black Non-Fibrous Homogeneous
10056860_0048					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-22A	Paper insulation over fiberglass on water lines	None Detected	60% Cellulose	40% Other	Off-white, Silver Fibrous Heterogeneous
10056860_0049					Ashed
7-2-AF-22B	Paper insulation over fiberglass on water lines	None Detected	60% Cellulose	40% Other	Silver, Off-white Fibrous Heterogeneous
10056860_0050					Ashed
7-2-AF-22C	Paper insulation over fiberglass on water lines	None Detected	60% Cellulose	40% Other	Off-white, Silver Fibrous Heterogeneous
10056860_0051					Ashed
7-2-AF-23A	Woven gasket at burner gun-white	None Detected	95% Fiber Glass	5% Other	Gray, White Fibrous Heterogeneous
10056860_0052					Teased
7-2-AF-23B	Woven gasket at burner gun-white	None Detected	95% Fiber Glass	5% Other	Gray, White Fibrous Heterogeneous
10056860_0053					Teased
7-2-AF-24A	Sealent from boiler base to concrete pad-black	None Detected		100% Other	Black, Brown Non-Fibrous Heterogeneous
10056860_0054					Ashed
7-2-AF-24B	Sealent from boiler base to concrete pad-black	None Detected		100% Other	Black, Brown Non-Fibrous Heterogeneous
10056860_0055					Ashed
7-2-AF-25A	Pipe dope- white	None Detected		100% Other	Gray, Off-white Non-Fibrous Heterogeneous
10056860_0056					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-2-AF-25B	Pipe dope- white	**None Detected**		**100% Other**	Off-white, Gray Non-Fibrous Heterogeneous
10056860_0057					Ashed
7-2-AF-26A	Rope gasket at boiler ribs-gold	**None Detected**	**95% Fiber Glass**	**5% Other**	Gold, Brown Fibrous Heterogeneous
10056860_0058					Teased
7-2-AF-26B	Rope gasket at boiler ribs-gold	**None Detected**	**95% Fiber Glass**	**5% Other**	Brown, Gold Fibrous Heterogeneous
10056860_0059					Teased
7-2-AF-27A	Sealent over rope gasket-red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056860_0060					Ashed
7-2-AF-27B	Sealent over rope gasket-red	**None Detected**		**100% Other**	Red Non-Fibrous Homogeneous
10056860_0061					Ashed
7-2-AF-28A	Mastic at water supply line/boiler junction-white	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0062					Ashed
7-2-AF-28B	Mastic at water supply line/boiler junction-white	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0063					Ashed
7-2-AF-29A	Foil insulation	**None Detected**	**40% Fiber Glass** **30% Cellulose**	**30% Other**	Silver, White Fibrous Heterogeneous
10056860_0064					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-2-AF-29B	Foil insulation	**None Detected**	**40% Fiber Glass** **30% Cellulose**	**30% Other**	Yellow, White Fibrous Heterogeneous
10056860_0065					Ashed
7-2-AF-29C	Foil insulation	**None Detected**	**40% Fiber Glass** **30% Cellulose**	**30% Other**	Silver, White Fibrous Heterogeneous
10056860_0066					Ashed
7-2-AF-30A	Sheet rock	**None Detected**	**5% Cellulose**	**95% Other**	Gray, Tan Non-Fibrous Homogeneous
10056860_0067					Crushed
7-3-AF-30B	Sheet rock	**None Detected**	**5% Cellulose**	**95% Other**	Tan, Gray Non-Fibrous Homogeneous
10056860_0068					Crushed
7-2-AF-31A	Joint compound-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056860_0069					Crushed
7-3-AF-31B	Joint compound-white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056860_0070					Crushed
7-2-AF-32A	Spacer board between column and CMU-black	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Heterogeneous
10056860_0071					Dissolved
7-2-AF-32B	Spacer board between column and CMU-black	**None Detected**	**70% Cellulose**	**30% Other**	Black Fibrous Heterogeneous
10056860_0072					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-3-AF-33A	Thinset associated with 6" x 6" quary tile-white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0073					Crushed
7-3-AF-33B	Thinset associated with 6" x 6" quary tile-white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0074					Crushed
7-3-AF-34A	Grout associated with 6" x 6" quary tile-black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0075					Crushed
7-3-AF-34B	Grout associated with 6" x 6" quary tile-black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0076					Crushed
7-3-AF-35A	Thinset associated with 2" x 2" ceramic wall tile-beige	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0077					Crushed
7-3-AF-35B	Thinset associated with 2" x 2" ceramic wall tile-beige	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0078					Crushed
7-3-AF-36A	Grout associated with 2" x 2" ceramic wall tile-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0079					Crushed
7-3-AF-36B	Grout associated with 2" x 2" ceramic wall tile-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0080					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-3-AF-37A	Applience caulk-transparent	**None Detected**		**100% Other**	Transparent, Tan Non-Fibrous Homogeneous
10056860_0081					Ashed
7-3-AF-37B	Applience caulk-transparent	**None Detected**		**100% Other**	Transparent, Tan Non-Fibrous Homogeneous
10056860_0082					Ashed
7-3-AF-38A	2' x 2' Acoustic ceiling tile-pin hole and crater	**None Detected**	**70% Cellulose** **10% Fiber Glass**	**10% Other** **10% Perlite**	Gray, White Fibrous Heterogeneous
10056860_0083					Teased
7-3-AF-38B	2' x 2' Acoustic ceiling tile-pin hole and crater	**None Detected**	**70% Cellulose** **10% Fiber Glass**	**10% Other** **10% Perlite**	Gray, White Fibrous Heterogeneous
10056860_0084					Teased
7-3-AF-39A	Panel adhesive under fiberglass in unti ventilator-black	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Non-Fibrous Homogeneous
10056860_0085					Dissolved
7-3-AF-39B	Panel adhesive under fiberglass in unti ventilator-black	**None Detected**	**10% Fiber Glass**	**90% Other**	Black Non-Fibrous Homogeneous
10056860_0086					Dissolved
7-3-AF-40A	Poured epoxy flooring-grey with blue accents	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10056860_0087					Ashed
7-3-AF-40B	Poured epoxy flooring-grey with blue accents	**None Detected**		**100% Other**	Gray, Black Non-Fibrous Heterogeneous
10056860_0088					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-3-AF-41A	4" Vinyl cove base adhesive-cream	**None Detected**		**100% Other**	Cream Non-Fibrous Homogeneous
10056860_0089					Dissolved
7-3-AF-41B	4" Vinyl cove base adhesive-cream	**None Detected**		**100% Other**	Cream Non-Fibrous Homogeneous
10056860_0090					Dissolved
7-3-AF-42A	4" Vinyl cove base-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0091					Ashed
7-3-AF-42B	4" Vinyl cove base-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0092					Ashed
7-3-AF-43A	Sealent between slab relief cuts-white	**None Detected**		**100% Other**	Gray Non-Fibrous Heterogeneous
10056860_0093					Ashed
7-3-AF-43B	Sealent between slab relief cuts-white	**None Detected**		**100% Other**	Yellow, Gray Non-Fibrous Heterogeneous
10056860_0094					Ashed
7-3-AF-44A	Expansion seam caulk between concrete walls-white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10056860_0095					Ashed
7-3-AF-44B	Expansion seam caulk between concrete walls-white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10056860_0096					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-3-AF-45A	Flooring leveler - gray (first layer)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0097					Crushed
7-3-AF-45B	Flooring leveler - gray (first layer)	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0098					Crushed
7-3-AF-46A	Flooring mastic - yellow (second layer)	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10056860_0099					Dissolved
7-3-AF-47A	12" x 12" vinyl floor tile-beige with grey specs (third layer)	**None Detected**		**100% Other**	Tan, Off-white Non-Fibrous Homogeneous
10056860_0100					Dissolved
7-3-AF-48A	4" Vinyl cove base-cream	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056860_0101					Ashed
7-3-AF-48B	4" Vinyl cove base-cream	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10056860_0102					Ashed
7-3-AF-49A	Original sheet rock behind newer sheet rock	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10056860_0103					Crushed
7-3-AF-49B	Original sheet rock behind newer sheet rock- at columns	**None Detected**	**5% Cellulose**	**95% Other**	Gray Non-Fibrous Homogeneous
10056860_0104					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-3-AF-50A	Original joint compound behind newer joint compound -white	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056860_0105					Crushed
7-3-AF-50B	Original joint compound behind newer joint compound -white-at columns	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10056860_0106					Crushed
7-3-AF-51A	Gasket at compressed air receiver tank-grey	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0107					Ashed
7-3-AF-51B	Gasket at compressed air receiver tank-grey	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0108					Ashed
7-3-AF-52A	Adhesive under rubber roof membrane on concrete-yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10056860_0109					Dissolved
7-3-AF-52B	Adhesive under rubber roof membrane on concrete-yellow	**None Detected**		**100% Other**	Yellow Non-Fibrous Homogeneous
10056860_0110					Dissolved
7-3-AF-53A	Tar under rubber membrane on steel wwalls and beams-black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0111					Ashed
7-3-AF-53B	Tar under rubber membrane on steel wwalls and beams-black	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0112					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-3-AF-54A	Reglet caulk-black	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0113					Ashed
7-3-AF-54B	Reglet caulk-black	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0114					Ashed
7-3-AF-55A	Felt paper at access hatch to ferris conveyor junction-black	None Detected	75% Cellulose	25% Other	Black Fibrous Homogeneous
10056860_0115					Dissolved
7-3-AF-55B	Felt paper at access hatch to ferris conveyor junction-black	None Detected	75% Cellulose	25% Other	Black Fibrous Homogeneous
10056860_0116					Dissolved
7-3-AF-56A	Caulk at interior access hatch to ferris conveyor-black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10056860_0117					Crushed
7-3-AF-56B	Caulk at interior access hatch to ferris conveyor-black	None Detected		100% Other	Black Non-Fibrous Homogeneous
10056860_0118					Crushed
7-3-AF-57A	Poured epoxy flooring-white	None Detected		100% Other	Gray, Off-white Non-Fibrous Heterogeneous
10056860_0119					Ashed
7-3-AF-57B	Poured epoxy flooring-white	None Detected		100% Other	Gray, Off-white Non-Fibrous Heterogeneous
10056860_0120					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-3-AF-58A	Sealent at air compressor ductwork-grey	**None Detected**		**100% Other**	Gray, Silver Non-Fibrous Homogeneous
10056860_0121					Ashed
7-3-AF-58B	Sealent at air compressor ductwork-grey	**None Detected**		**100% Other**	Silver, Gray Non-Fibrous Homogeneous
10056860_0122					Ashed
7-3-AF-59A	Fire stop caulk-red	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Gray, Red Non-Fibrous Heterogeneous
10056860_0123					Ashed
7-3-AF-59B	Fire stop caulk-red	**None Detected**	**10% Cellulose** **5% Fiber Glass**	**85% Other**	Red, Gray Non-Fibrous Heterogeneous
10056860_0124					Ashed
7-3-AF-60A	Gasket at cylindrical cyclone access hatch-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0125					Ashed
7-3-AF-60B	Gasket at cylindrical cyclone access hatch-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0126					Ashed
7-3-AF-61A	Gasket at electrical conduit at fan unit between small and large duct work-grey	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0127					Ashed
7-3-AF-61B	Gasket at electrical conduit at fan unit between small and large duct work-grey	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0128					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-3-AF-62A	Gasket at smaller diameter shute off large fan unit to cyclone-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0129					Ashed
7-3-AF-62B	Gasket at smaller diameter shute off large fan unit to cyclone-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0130					Ashed
7-3-AF-63A	Vinyl stair tread adhesive - brown	**None Detected**		**100% Other**	White, Brown Non-Fibrous Heterogeneous
10056860_0131					Dissolved
7-3-AF-63B	Vinyl stair tread adhesive - brown	**None Detected**		**100% Other**	White, Brown Non-Fibrous Heterogeneous
10056860_0132					Dissolved
7-3-AF-64A	Vinyl stair tread-brown	**None Detected**		**100% Other**	Brown, Black Non-Fibrous Homogeneous
10056860_0133					Ashed
7-3-AF-64B	Vinyl stair tread-brown	**None Detected**		**100% Other**	Brown, Black Non-Fibrous Homogeneous
10056860_0134					Ashed
7-3-AF-65A	Flooring mastic on concrete-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0135					Ashed
7-3-AF-65B	Flooring mastic on concrete-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0136					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-3-AF-65C	Flooring mastic on concrete-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0137					Ashed
7-3-AF-66A	12" x 12" vinyl floor tile-blue	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0138					Dissolved
7-3-AF-66B	12" x 12" vinyl floor tile-blue	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0139					Dissolved
7-3-AF-67A	4" vinyl cove base-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0140					Ashed
7-3-AF-67B	4" vinyl cove base-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0141					Ashed
7-3-AF-68A	Sealent at sheetrock/metal wall panel junction-transparent	**None Detected**	**15% Cellulose**	**85% Other**	Black, Gray Non-Fibrous Heterogeneous
10056860_0142					Teased
7-3-AF-68B	Sealent at sheetrock/metal wall panel junction-transparent	**None Detected**	**15% Cellulose**	**85% Other**	Gray, Black Non-Fibrous Heterogeneous
10056860_0143					Ashed
7-3-AF-69A	12" x 12" vinyl floor tile-white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10056860_0144	*bag labeled 70a*				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-3-AF-69B	12" x 12" vinyl floor tile-white	None Detected		100% Other	White, Gray Non-Fibrous Homogeneous
10056860_0145	*bag labeled 70b*				Dissolved
7-3-AF-70A	Cellulose insolation in wall cavity	None Detected	90% Cellulose	10% Other	Brown, Tan Fibrous Heterogeneous
10056860_0146	*bag labeled 69a*				Teased
7-3-AF-70B	Cellulose insolation in wall cavity	None Detected	90% Cellulose	10% Other	Brown, Tan Fibrous Heterogeneous
10056860_0147	*bag labeled 69b*				Teased
7-3-AF-67Ax	Mastic on fiberglass end caps -white	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0148					Ashed
7-3-AF-67Bx	Mastic on fiberglass end caps -white	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0149					Ashed
7-5-AF-90A	Mastic at cylindrical duct work-grey	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0150					Ashed
7-5-AF-90B	Mastic at cylindrical duct work-grey	None Detected		100% Other	Black, Gray Non-Fibrous Homogeneous
10056860_0151					Ashed
7-5-AF-91A	Vinyl flex connector-black	None Detected	25% Fiber Glass	75% Other	Black, White Non-Fibrous Heterogeneous
10056860_0152					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-5-AF-91B	Vinyl flex connector-black	**None Detected**	**25% Fiber Glass**	**75% Other**	White, Black Non-Fibrous Heterogeneous
10056860_0153					Ashed
7-5-AF-92A	Sealent at window surround-white	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10056860_0154					Ashed
7-5-AF-92B	Sealent at window surround-white	**None Detected**		**100% Other**	Gray, White Non-Fibrous Homogeneous
10056860_0155					Ashed
7-5-AF-93A	Caulk at concrete slab/perimeter wall junction-black	**None Detected**		**100% Other**	Black, Brown Non-Fibrous Homogeneous
10056860_0156					Ashed
7-5-AF-93B	Caulk at concrete slab/perimeter wall junction-black	**None Detected**		**100% Other**	Black, Brown Non-Fibrous Homogeneous
10056860_0157					Ashed
7-5-AF-94A	Skim coat at columns-brown	**None Detected**		**100% Other**	Black, Brown Non-Fibrous Homogeneous
10056860_0158					Crushed
7-5-AF-94B	Skim coat at columns-brown	**None Detected**		**100% Other**	Black, Brown Non-Fibrous Homogeneous
10056860_0159					Crushed
7-5-AF-94C	Skim coat at columns-brown	**None Detected**		**100% Other**	Black, Brown Non-Fibrous Homogeneous
10056860_0160					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-5-AF-95A	Caulk at column/metal wall panel junction-white	**None Detected**	**15% Cellulose**	**85% Other**	Gray, Black Non-Fibrous Homogeneous
10056860_0161					Ashed
7-5-AF-95B	Caulk at column/metal wall panel junction-white	**None Detected**	**15% Cellulose**	**85% Other**	Gray, Black Non-Fibrous Homogeneous
10056860_0162					Ashed
7-10-AF-164A	Door frame caulk-grey	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10056860_0163					Ashed
7-10-AF-164B	Door frame caulk-grey	**None Detected**		**100% Other**	Brown, Gray Non-Fibrous Homogeneous
10056860_0164					Ashed
7-10-AF-165A	Sealent between metal wall panels-white	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0165					Ashed
7-10-AF-165B	Sealent between metal wall panels-white	**None Detected**		**100% Other**	Black, Gray Non-Fibrous Homogeneous
10056860_0166					Ashed
7-10-AF-166A	Skim coat on foundation	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0167					Crushed
7-10-AF-166B	Skim coat on foundation	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0168					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-10-AF-166C	Skim coat on foundation	**None Detected**		**100% Other**	Off-white Non-Fibrous Homogeneous
10056860_0169					Crushed
7-10-AF-167A	Mastic at metal covered downspout-clear	**None Detected**		**100% Other**	Transparent, Gray Non-Fibrous Homogeneous
10056860_0170					Ashed
7-10-AF-167B	Mastic at metal covered downspout-clear	**None Detected**		**100% Other**	Transparent, Gray Non-Fibrous Homogeneous
10056860_0171					Ashed
7-10-AF-168A	Caulk at louvers-beige	**None Detected**		**100% Other**	Tan, Black Non-Fibrous Homogeneous
10056860_0172					Ashed
7-10-AF-168B	Caulk at louvers-beige	**None Detected**		**100% Other**	Tan, Black Non-Fibrous Homogeneous
10056860_0173					Ashed
7-10-AF-169A	Gaskets at natural gas main	**None Detected**	**20% Cellulose**	**80% Other**	Green Non-Fibrous Homogeneous
10056860_0174					Ashed
7-10-AF-169A	Gaskets at natural gas main	**None Detected**	**20% Cellulose**	**80% Other**	Green Non-Fibrous Homogeneous
10056860_0175					Ashed
7-10-AF-170A	Putty at electrical conduits-grey	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0176					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID / *Lab Sample ID*	Description / *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes / Treatment
7-10-AF-170B	Putty at electrical conduits-grey	**None Detected**		**100% Other**	Red, Black Non-Fibrous Homogeneous
10056860_0177					Ashed
7-10-AF-171A	Caulk at window base junction-white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0178					Ashed
7-10-AF-171B	Caulk at window base junction-white	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0179					Ashed
7-10-AF-172A	Membrane at façade junction-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0180					Ashed
7-10-AF-172B	Membrane at façade junction-black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10056860_0181					Ashed
7-10-AF-173A	Caulk at duct work seam-grey	**None Detected**		**100% Other**	Tan, Gray Non-Fibrous Homogeneous
10056860_0182					Ashed
7-10-AF-173B	Caulk at duct work seam-grey	**None Detected**		**100% Other**	Tan, Gray Non-Fibrous Homogeneous
10056860_0183					Ashed
7-10-AF-183A	Caulk at structural beam under odor control duct-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0184					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-10-AF-183B	Caulk at structural beam under odor control duct-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0185					Ashed
7-10-AF-184A	Caulk at cylindrical duct work penetration through roof-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0186					Ashed
7-10-AF-184B	Caulk at cylindrical duct work penetration through roof-grey	**None Detected**		**100% Other**	Gray Non-Fibrous Homogeneous
10056860_0187					Ashed
7-10-AF-185A	Flashing cement-black	**5% Chrysotile**		**95% Other**	Black Non-Fibrous Homogeneous
10056860_0188					Ashed
7-10-AF-185B	Flashing cement-black	**Not Analyzed**			
10056860_0189					
7-10-AF-186A	Cementitious skim coat on stack above bag house and shredders	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10056860_0190					Crushed
7-10-AF-186B	Cementitious skim coat on stack above bag house and shredders	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10056860_0191					Crushed
7-10-AF-186C	Cementitious skim coat on stack above bag house and shredders	**None Detected**		**100% Other**	White, Gray Non-Fibrous Homogeneous
10056860_0192					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: PLM
Date Received: 07/15/2024
Date Reported: 07/22/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-10-AF-187A	Blow-off roof canvas	**None Detected**	**50% Synthetic Fibers**	**50% Other**	Gray, White Fibrous Heterogeneous
10056860_0193					Ashed
7-10-AF-187B	Blow-off roof canvas	**None Detected**	**50% Synthetic Fibers**	**50% Other**	White, Gray Fibrous Heterogeneous
10056860_0194					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (194)
Analyst

Approved Signatory

100548160

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-2-AF-01A		Concrete slab	Rm 1-01
7-3-AF-01B		Concrete slab	Rm 1-17
7-5-AF-01C		Concrete slab	Rm 1-32
7-2-AF-02A		Roll up door membrane-black	Rm 1-01
7-3-AF-02B		Roll up door membrane-black	Rm 1-17
7-5-AF-02C		Roll up door membrane-black	Rm 1-53
7-2-AF-03A		Interior door fram caulk-white	Rm 1-01
7-2-AF-03B		Interior door frame caulk-white	Rm 1-01
7-2-AF-03C		Interior door frame caulk-white	Rm 1-10
7-2-AF-04A		Paint on metal panneling-metalic	Rm 1-01
7-2-AF-04B		Paint on metal panneling-metalic	Rm-1-10
7-3-AF-04C		Paint on metal panneling-metalic	Rm 1-17
7-2-AF-05A		Window glazing compound-black	Rm 1-02
7-2-AF-05B		Window glazing compound-black	Rm 1-02
7-2-AF-06A		Woven window curtain-white	Rm 1-02
7-2-AF-06B		Woven window curtain-white	Rm 1-02
7-2-AF-07A		High visibility paint - yellow	Rm 1-01
7-2-AF-07B		High visibility paint - yellow	Rm 1-01
7-2-AF-07C		High visibility paint - yellow	Rm 1-01
7-2-AF-08A		Pin tab adhesive on columns-maroon	Rm 1-01

Accepted ☒

Rejected ☐

Relinquished By

7/15 10:30 Received By

4646

7-2-AF-08B		Pin tab adhesive on columns-maroon	Rm 1-01
7-2-AF-09A		Door frame caulk-brown	Rm 1-01
7-2-AF-09B		Door frame caulk-brown	Rm 1-01
7-2-AF-10A		Window glazing compound in interior doors - black	Rm 1-04
7-2-AF-10B		Window glazing compound in interior doors - black	Rm 1-04
7-3-AF-10C		Window glazing compound in interior doors - black	Rm 1-14
7-2-AF-11A		Flex connector at duct-black	Rm 1-04
7-2-AF-12A		Sealent at duct slips at smaller diameter duct-brown	Rm 1-04
7-2-AF-12B		Sealent at duct slips at smaller diameter duct-brown	Rm 1-04
7-2-AF-13A		Bottom layer felt paper on concrete roof deck (layer 1)	Rm 1-04
7-2-AF-13B		Bottom layer felt paper on concrete roof deck (layer 1)	Rm 1-04
7-2-AF-14A		Middle layer felt paper-black (layer 2)	Rm 1-04
7-2-AF-14B		Middle layer felt paper-black (layer 2)	Rm 1-04
7-2-AF-15A		Top layer felt paper-black (layer 3)	Rm 1-04
7-2-AF-15B		Top layer felt paper-black (layer 3)	Rm 1-04
7-2-AF-16A		Sealent at roof membrane/metal wall pannel junction-black	Rm 1-04
7-2-AF-16B		Sealent at roof membrane/metal wall pannel junction-black	Rm 1-04
7-2-AF-17A		Fire hose-white	Rm 1-05
7-2-AF-17B		Fire hose-white	Rm 1-05
7-2-AF-18A		Window glazing compound in grapple office windows-brown	Rm 1-05
7-2-AF-18B		Window glazing compound in grapple office windows-brown	Rm 1-05
7-2-AF-19A		Conveyor belt (non-processible waste conveyor)	Rm 1-07
7-3-AF-19B		Conveyor belt (secondary shredder)	Rm 1-17
7-3-AF-19C		Conveyor belt (ferrous shuttle conveyor)	Rm 1-20
7-2-AF-20A		Not sent	Rm 1-07
7-2-AF-21A		Shrapnel guard above conveyor - black / rubbery (non-processible waste conveyor)	Rm 1-07
7-3-AF-21B		Shrapnel guard above conveyor - black / rubbery (secondary shredder)	Rm 1-17
7-3-AF-21C		Shrapnel guard above conveyor - black / rubbery (ferrous shuttle conveyor)	Rm 1-20
7-2-AF-22A		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-22B		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-22C		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-23A		Woven gasket at burner gun-white	Rm 1-10
7-2-AF-23B		Woven gasket at burner gun-white	Rm 1-10
7-2-AF-24A		Sealent from boiler base to concrete pad-black	Rm 1-10
7-2-AF-24B		Sealent from boiler base to concrete pad-black	Rm 1-10
7-2-AF-25A		Pipe dope- white	Rm 1-10
7-2-AF-25B		Pipe dope- white	Rm 1-10
7-2-AF-26A		Rope gasket at boiler ribs-gold	Rm 1-10
7-2-AF-26B		Rope gasket at boiler ribs-gold	Rm 1-10
7-2-AF-27A		Sealent over rope gasket-red	Rm 1-10
7-2-AF-27B		Sealent over rope gasket-red	Rm 1-10

Relinquished By

Received By

4866

7-2-AF-28A		Mastic at water supply line/boiler junction-white	Rm 1-10
7-2-AF-28B		Mastic at water supply line/boiler junction-white	Rm 1-10
7-2-AF-29A		Foil insulation	Rm 1-10
7-2-AF-29B		Foil insulation	Rm 1-10
7-2-AF-29C		Foil insulation	Rm 1-10
7-2-AF-30A		Sheet rock	Rm 1-10
7-3-AF-30B		Sheet rock	Rm 1-12
7-2-AF-31A		Joint compound-white	Rm 1-10
7-3-AF-31B		Joint compound-white	Rm 1-12
7-2-AF-32A		Spacer board between column and CMU-black	Rm 1-10
7-2-AF-32B		Spacer board between column and CMU-black	Rm 1-10
7-3-AF-33A		Thinset associated with 6" x 6" quary tile-white	Rm 1-12
7-3-AF-33B		Thinset associated with 6" x 6" quary tile-white	Rm 1-12
7-3-AF-34A		Grout associated with 6" x 6" quary tile-black	Rm 1-12
7-3-AF-34B		Grout associated with 6" x 6" quary tile-black	Rm 1-12
7-3-AF-35A		Thinset associated with 2" x 2" ceramic wall tile-beige	Rm 1-12
7-3-AF-35B		Thinset associated with 2" x 2" ceramic wall tile-beige	Rm 1-12
7-3-AF-36A		Grout associated with 2" x 2" ceramic wall tile-grey	Rm 1-12
7-3-AF-36B		Grout associated with 2" x 2" ceramic wall tile-grey	Rm 1-12
7-3-AF-37A		Applience caulk-transparent	Rm 1-12
7-3-AF-37B		Applience caulk-transparent	Rm 1-12
7-3-AF-38A		2' x 2' Acoustic ceiling tile-pin hole and crater	Rm 1-13
7-3-AF-38B		2' x 2' Acoustic ceiling tile-pin hole and crater	Rm 1-13
7-3-AF-39A		Panel adhesive under fiberglass in unti ventilator-black	Rm 1-12
7-3-AF-39B		Panel adhesive under fiberglass in unti ventilator-black	Rm 1-12
7-3-AF-40A		Poured epoxy flooring-grey with blue accents	Rm 1-13
7-3-AF-40B		Poured epoxy flooring-grey with blue accents	Rm 1-13
7-3-AF-41A		4" Vinyl cove base adhesive-cream	Rm 1-13
7-3-AF-41B		4" Vinyl cove base adhesive-cream	Rm 1-13
7-3-AF-42A		4" Vinyl cove base-grey	Rm 1-13
7-3-AF-42B		4" Vinyl cove base-grey	Rm 1-13
7-3-AF-43A		Sealent between slab relief cuts-white	Rm 1-13
7-3-AF-43B		Sealent between slab relief cuts-white	Rm 1-17
7-3-AF-44A		Expansion seam caulk between concrete walls-white	Rm 1-13
7-3-AF-44B		Expansion seam caulk between concrete walls-white	Rm 1-13
7-3-AF-45A		Flooring leveler - gray (first layer)	Rm 1-15
7-3-AF-45B		Flooring leveler - gray (first layer)	
7-3-AF-46A		Flooring mastic - yellow (second layer)	Rm 1-15

Relinquished By

Received By

7-3-AF-47A		12" x 12" vinyl floor tile-beige with grey specs (third layer)	Rm 1-15
7-3-AF-48A		4" Vinyl cove base-cream	Rm 1-15
7-3-AF-48B		4" Vinyl cove base-cream	Rm 1-15
7-3-AF-49A		Original sheet rock behind newer sheet rock	Rm 1-15
7-3-AF-49B		Original sheet rock behind newer sheet rock- at columns	Rm 1-16
7-3-AF-50A		Original joint compound behind newer joint compound-white	Rm 1-15
7-3-AF-50B		Original joint compound behind newer joint compound-white-at columns	Rm 1-16
7-3-AF-51A		Gasket at compressed air receiver tank-grey	Rm 1-17
7-3-AF-51B		Gasket at compressed air receiver tank-grey	Rm 1-17
7-3-AF-52A		Adhesive under rubber roof membrane on concrete-yellow	Rm 1-17
7-3-AF-52B		Adhesive under rubber roof membrane on concrete-yellow	Rm 1-17
7-3-AF-53A		Tar under rubber membrane on steel wwalls and beams-black	Rm 1-17
7-3-AF-53B		Tar under rubber membrane on steel wwalls and beams-black	Rm 1-17
7-3-AF-54A		Reglet caulk-black	Rm 1-17
7-3-AF-54B		Reglet caulk-black	Rm 1-17
7-3-AF-55A		Felt paper at access hatch to ferris conveyor junction-black	Rm 1-17
7-3-AF-55B		Felt paper at access hatch to ferris conveyor junction-black	Rm 1-17
7-3-AF-56A		Caulk at interior access hatch to ferris conveyor-black	Rm 1-17
7-3-AF-56B		Caulk at interior access hatch to ferris conveyor-black	Rm 1-17
7-3-AF-57A		Poured epoxy flooring-white	Rm 1-18
7-3-AF-57B		Poured epoxy flooring-white	Rm 1-18
7-3-AF-58A		Sealent at air compressor ductwork-grey	Rm 1-18
7-3-AF-58B		Sealent at air compressor ductwork-grey	Rm 1-18
7-3-AF-59A		Fire stop caulk-red	Rm 1-18
7-3-AF-59B		Fire stop caulk-red	Rm 1-18
7-3-AF-60A		Gasket at cylindrical cyclone access hatch-black	Rm 1-20
7-3-AF-60B		Gasket at cylindrical cyclone access hatch-black	Rm 1-20
7-3-AF-61A		Gasket at electrical conduit at fan unit between small and large duct work-grey	Rm 1-20
7-3-AF-61B		Gasket at electrical conduit at fan unit between small and large duct work-grey	Rm 1-20
7-3-AF-62A		Gasket at smaller diameter shute off large fan unit to cyclone-black	Rm 1-20
7-3-AF-62B		Gasket at smaller diameter shute off large fan unit to cyclone-black	Rm 1-20
7-3-AF-63A		Vinyl stair tread adhesive -brown	Rm 2-22
7-3-AF-63B		Vinyl stair tread adhesive -brown	Rm 2-22
7-3-AF-64A		Vinyl stair tread-brown	Rm 2-22
7-3-AF-64B		Vinyl stair tread-brown	Rm 2-22
7-3-AF-65A		Flooring mastic on concrete-black	Rm 2-23
7-3-AF-65B		Flooring mastic on concrete-black	Rm 1-26
7-3-AF-65C		Flooring mastic on concrete-black	Rm 2-29
7-3-AF-66A		12" x 12" vinyl floor tile-blue	Rm 2-23
7-3-AF-66B		12" x 12" vinyl floor tile-blue	Rm 1-26

Relinquished By

Received By

6 8 6 C

7-3-AF-67A		4" vinyl cove base-black	Rm 2-23
7-3-AF-67B		4" vinyl cove base-black	Rm 2-23
7-3-AF-68A		Sealent at sheetrock/metal wall panel junction-transparent	Rm 2-23
7-3-AF-68B		Sealent at sheetrock/metal wall panel junction-transparent	Rm 2-23
7-3-AF-69A		12" x 12" vinyl floor tile-white	Rm 2-24
7-3-AF-69B		12" x 12" vinyl floor tile-white	Rm 2-24
7-3-AF-70A		Cellulose insolation in wall cavity	Rm 2-24
7-3-AF-70B		Cellulose insolation in wall cavity	Rm 2-24
7-3-AF-67Ax		Mastic on fiberglass end caps-white	Rm 2-28
7-3-AF-67Bx		Mastic on fiberglass end caps-white	Rm 2-28
7-5-AF-90A		Mastic at cylindrical duct work-grey	Rm 2-28
7-5-AF-90B		Mastic at cylindrical duct work-grey	Rm 2-28
7-5-AF-91A		Vinyl flex connector-black	Rm 2-28
7-5-AF-91B		Vinyl flex connector-black	Rm 2-28
7-5-AF-92A		Sealent at window surround-white	Rm 2-29
7-5-AF-92B		Sealent at window surround-white	Rm 2-29
7-5-AF-93A		Caulk at concrete slab/perimeter wall junction-black	Rm 1-53
7-5-AF-93B		Caulk at concrete slab/perimeter wall junction-black	Rm 1-53
7-5-AF-94A		Skim coat at columns-brown	Rm 1-53
7-5-AF-94B		Skim coat at columns-brown	Rm 1-53
7-5-AF-94C		Skim coat at columns-brown	Rm 1-53
7-5-AF-95A		Caulk at column/metal wall panel junction-white	Rm 1-53
7-5-AF-95B		Caulk at column/metal wall panel junction-white	Rm 1-53
7-10-AF-164A		Door frame caulk-grey	Façade C
7-10-AF-164B		Door frame caulk-grey	Façade A
7-10-AF-165A		Sealent between metal wall panels-white	Façade C
7-10-AF-165B		Sealent between metal wall panels-white	Façade A
7-10-AF-166A		Skim coat on foundation	Façade C
7-10-AF-166B		Skim coat on foundation	Façade A
7-10-AF-166C		Skim coat on foundation	Façade A
7-10-AF-167A		Mastic at metal covered downspout-clear	Façade B
7-10-AF-167B		Mastic at metal covered downspout-clear	Façade D
7-10-AF-168A		Caulk at louvers-beige	Façade B
7-10-AF-168B		Caulk at louvers-beige	Façade C
7-10-AF-169A		Gaskets at natural gas main	Façade C
7-10-AF-169A		Gaskets at natural gas main	Façade C
7-10-AF-170A		Putty at electrical conduits-grey	Façade B
7-10-AF-170B		Putty at electrical conduits-grey	Façade B
7-10-AF-171A		Caulk at window base junction-white	Façade A
7-10-AF-171B		Caulk at window base junction-white	Façade A
7-10-AF-172A		Membrane at façade junction-black	Façade A
7-10-AF-172B		Membrane at façade junction-black	Façade A
7-10-AF-173A		Caulk at duct work seam-grey	Façade D
7-10-AF-173B		Caulk at duct work seam-grey	Façade D

Relinquished By

Received By

6 of 6

7-10-AF-183A		Caulk at structural beam under odor control duct-grey	Roof
7-10-AF-183B		Caulk at structural beam under odor control duct-grey	Roof
7-10-AF-184A		Caulk at cylindrical duct work penetration through roof-grey	Roof
7-10-AF-184B		Caulk at cylindrical duct work penetration through roof-grey	Roof
7-10-AF-185A		Flashing cement-black	Roof
7-10-AF-185B		Flashing cement-black	Roof
7-10-AF-186A		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-186B		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-186C		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-187A		Blow-off roof canvas	Roof
7-10-AF-187B		Blow-off roof canvas	Roof

>>

Relinquished By

Received By

Bulk Asbestos Analysis
by Transmission Electron Microscopy

Semi-Quantitative
Chatfield SOP 1988-02 Rev. 1

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10056860**
Analysis: TBS
Date Received: 08/19/2024
Date Reported: 08/21/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Organic (Wt %)	Acid Soluble (Wt. %)	Asbestos (Wt %)	LCL-UCL (Wt. %)
7-2-AF-08A *10056860_0020*	**Pin tab adhesive on columns-maroon**	**71%**	**0%**	None Detected	
7-3-AF-56A *10056860_0117*	**Caulk at interior access hatch to ferris conveyor-black**	**62%**	**0%**	None Detected	

Disclaimer: This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government.

Daniel Schwartz (2)
Analyst

Approved Signatory

100548860

Client:	Eagle Environmental, Inc
Contact:	Victoria Farkas, Breigh Ashe
Address:	9 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenvirp.com bashe@eagleenvirp.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #:	24-138.10T1
Date Submitted:	
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Date 1 and Date 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your delegation of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Date 1	Sample Description	Date 2
<<			
7-2-AF-01A		Concrete slab	Rm 1-01
7-3-AF-01B		Concrete slab	Rm 1-17
7-5-AF-01C		Concrete slab	Rm 1-32
7-2-AF-02A		Roll up door membrane-black	Rm 1-01
7-3-AF-02B		Roll up door membrane-black	Rm 1-17
7-5-AF-02C		Roll up door membrane-black	Rm 1-53
7-2-AF-03A		Interior door fram caulk-white	Rm 1-01
7-2-AF-03B		Interior door frame caulk-white	Rm 1-01
7-2-AF-03C		Interior door frame caulk-white	Rm 1-10
7-2-AF-04A		Paint on metal panneling-metalic	Rm 1-01
7-2-AF-04B		Paint on metal panneling-metalic	Rm-1-10
7-3-AF-04C		Paint on metal panneling-metalic	Rm 1-17
7-2-AF-05A		Window glazing compound-black	Rm 1-02
7-2-AF-05B		Window glazing compound-black	Rm 1-02
7-2-AF-06A		Woven window curtain-white	Rm 1-02
7-2-AF-06B		Woven window curtain-white	Rm 1-02
7-2-AF-07A		High visibility paint - yellow	Rm 1-01
7-2-AF-07B		High visibility paint - yellow	Rm 1-01
7-2-AF-07C		High visibility paint - yellow	Rm 1-01
7-2-AF-08A		Pin tab adhesive on columns-maroon	Rm 1-01

Accepted ☑

Rejected ☐

Relinquished By

7/15 1030 Received By

4646

7-2-AF-08B		Pin tab adhesive on columns-maroon	Rm 1-01
7-2-AF-09A		Door frame caulk-brown	Rm 1-01
7-2-AF-09B		Door frame caulk-brown	Rm 1-01
7-2-AF-10A		Window glazing compound in interior doors - black	Rm 1-04
7-2-AF-10B		Window glazing compound in interior doors - black	Rm 1-04
7-3-AF-10C		Window glazing compound in interior doors - black	Rm 1-14
7-2-AF-11A		Flex connector at duct-black	Rm 1-04
7-2-AF-12A		Sealant at duct slips at smaller diameter duct-brown	Rm 1-04
7-2-AF-12B		Sealant at duct slips at smaller diameter duct-brown	Rm 1-04
7-2-AF-13A		Bottom layer felt paper on concrete roof deck (layer 1)	Rm 1-04
7-2-AF-13B		Bottom layer felt paper on concrete roof deck (layer 1)	Rm 1-04
7-2-AF-14A		Middle layer felt paper-black (layer 2)	Rm 1-04
7-2-AF-14B		Middle layer felt paper-black (layer 2)	Rm 1-04
7-2-AF-15A		Top layer felt paper-black (layer 3)	Rm 1-04
7-2-AF-15B		Top layer felt paper-black (layer 3)	Rm 1-04
7-2-AF-16A		Sealant at roof membrane/metal wall pannel junctico-black	Rm 1-04
7-2-AF-16B		Sealant at roof membrane/metal wall pannel junction-black	Rm 1-04
7-2-AF-17A		Fire hose-white	Rm 1-05
7-2-AF-17B		Fire hose-white	Rm 1-05
7-2-AF-18A		Window glazing compound in grapple office wndows-brown	Rm 1-05
7-2-AF-18B		Window glazing compound in grapple office windows-brown	Rm 1-05
7-2-AF-19A		Conveyor belt (non-processible waste conveyor)	Rm 1-07
7-3-AF-19B		Conveyor belt (secondary shredder)	Rm 1-17
7-3-AF-19C		Conveyor belt (ferrous shuttle conveyor)	Rm 1-20
7-2-AF-20A		Not sent	Rm 1-07
7-2-AF-21A		Shrapnel guard above conveyor - black / rubbery (non-processible waste conveyor)	Rm 1-07
7-3-AF-21B		Shrapnel guard above conveyor - black / rubbery (secondary shredder)	Rm 1-17
7-3-AF-21C		Shrapnel guard above conveyor - black / rubbery (ferrous shuttle conveyor)	Rm 1-20
7-2-AF-22A		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-22B		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-22C		Paper insulation over fiberglass on water lines	Rm 1-10
7-2-AF-23A		Woven gasket at burner gun-white	Rm 1-10
7-2-AF-23B		Woven gasket at burner gun-white	Rm 1-10
7-2-AF-24A		Sealant from boiler base to concrete pad-black	Rm 1-10
7-2-AF-24B		Sealant from boiler base to concrete pad-black	Rm 1-10
7-2-AF-25A		Pipe dope- white	Rm 1-10
7-2-AF-25B		Pipe dope- white	Rm 1-10
7-2-AF-26A		Rope gasket at boiler ribs-gold	Rm 1-10
7-2-AF-26B		Rope gasket at boiler ribs-gold	Rm 1-10
7-2-AF-27A		Sealant over rope gasket-red	Rm 1-10
7-2-AF-27B		Sealant over rope gasket-red	Rm 1-10

Relinquished By

Received By

GBLC

7-2-AF-28A		Mastic at water supply line/boiler junction-white	Rm 1-10
7-2-AF-28B		Mastic at water supply line/boiler junction-white	Rm 1-10
7-2-AF-29A		Foil insulation	Rm 1-10
7-2-AF-29B		Foil insulation	Rm 1-10
7-2-AF-29C		Foil insulation	Rm 1-10
7-2-AF-30A		Sheet rock	Rm 1-10
7-3-AF-30B		Sheet rock	Rm 1-12
7-2-AF-31A		Joint compound-white	Rm 1-10
7-3-AF-31B		Joint compound-white	Rm 1-12
7-2-AF-32A		Spacer board between column and CMU-black	Rm 1-10
7-2-AF-32B		Spacer board between column and CMU-black	Rm 1-10
7-3-AF-33A		Thinset associated with 6" x 6" quary tile-white	Rm 1-12
7-3-AF-33B		Thinset associated with 6" x 6" quary tile-white	Rm 1-12
7-3-AF-34A		Grout associated with 6" x 6" quary tile-black	Rm 1-12
7-3-AF-34B		Grout associated with 6" x 6" quary tile-black	Rm 1-12
7-3-AF-35A		Thinset associated with 2" x 2" ceramic wall tile-beige	Rm 1-12
7-3-AF-35B		Thinset associated with 2" x 2" ceramic wall tile-beige	Rm 1-12
7-3-AF-36A		Grout associated with 2" x 2" ceramic wall tile-grey	Rm 1-12
7-3-AF-36B		Grout associated with 2" x 2" ceramic wall tile-grey	Rm 1-12
7-3-AF-37A		Applience caulk-transparent	Rm 1-12
7-3-AF-37B		Applience caulk-transparent	Rm 1-12
7-3-AF-38A		2' x 2' Acoustic ceiling tile-pin hole and crater	Rm 1-13
7-3-AF-38B		2' x 2' Acoustic ceiling tile-pin hole and crater	Rm 1-13
7-3-AF-39A		Panel adhesive under fiberglass in unti ventilator-black	Rm 1-12
7-3-AF-39B		Panel adhesive under fiberglass in unti ventilator-black	Rm 1-12
7-3-AF-40A		Poured epoxy flooring-grey with blue accents	Rm 1-13
7-3-AF-40B		Poured epoxy flooring-grey with blue accents	Rm 1-13
7-3-AF-41A		4" Vinyl cove base adhesive-cream	Rm 1-13
7-3-AF-41B		4" Vinyl cove base adhesive-cream	Rm 1-13
7-3-AF-42A		4" Vinyl cove base-grey	Rm 1-13
7-3-AF-42B		4" Vinyl cove base-grey	Rm 1-13
7-3-AF-43A		Sealant between slab relief cuts-white	Rm 1-13
7-3-AF-43B		Sealant between slab relief cuts-white	Rm 1-17
7-3-AF-44A		Expansion seam caulk between concrete walls-white	Rm 1-13
7-3-AF-44B		Expansion seam caulk between concrete walls-white	Rm 1-13
7-3-AF-45A		Flooring leveler - gray (first layer)	Rm 1-15
7-3-AF-45B		Flooring leveler - gray (first layer)	
7-3-AF-46A		Flooring mastic - yellow (second layer)	Rm 1-15

Relinquished By

Received By

7-3-AF-47A		12" x 12" vinyl floor tile-beige with grey specs (third layer)	Rm 1-15
7-3-AF-48A		4" Vinyl cove base-cream	Rm 1-15
7-3-AF-48B		4" Vinyl cove base-cream	Rm 1-15
7-3-AF-49A		Original sheet rock behind newer sheet rock	Rm 1-15
7-3-AF-49B		Original sheet rock behind newer sheet rock- at columns	Rm 1-16
7-3-AF-50A		Original joint compound behind newer joint compound-white	Rm 1-15
7-3-AF-50B		Original joint compound behind newer joint compound-white-at columns	Rm 1-16
7-3-AF-51A		Gasket at compressed air receiver tank-grey	Rm 1-17
7-3-AF-51B		Gasket at compressed air receiver tank-grey	Rm 1-17
7-3-AF-52A		Adhesive under rubber roof membrane on concrete-yellow	Rm 1-17
7-3-AF-52B		Adhesive under rubber roof membrane on concrete-yellow	Rm 1-17
7-3-AF-53A		Tar under rubber membrane on steel wwalls and beams-black	Rm 1-17
7-3-AF-53B		Tar under rubber membrane on steel wwalls and beams-black	Rm 1-17
7-3-AF-54A		Reglet caulk-black	Rm 1-17
7-3-AF-54B		Reglet caulk-black	Rm 1-17
7-3-AF-55A		Felt paper at access hatch to ferris conveyor junction-black	Rm 1-17
7-3-AF-55B		Felt paper at access hatch to ferris conveyor junction-black	Rm 1-17
7-3-AF-56A		Caulk at interior access hatch to ferris conveyor-black	Rm 1-17
7-3-AF-56B		Caulk at interior access hatch to ferris conveyor-black	Rm 1-17
7-3-AF-57A		Poured epoxy flooring-white	Rm 1-18
7-3-AF-57B		Poured epoxy flooring-white	Rm 1-18
7-3-AF-58A		Sealent at air compressor ductwork-grey	Rm 1-18
7-3-AF-58B		Sealent at air compressor ductwork-grey	Rm 1-18
7-3-AF-59A		Fire stop caulk-red	Rm 1-18
7-3-AF-59B		Fire stop caulk-red	Rm 1-18
7-3-AF-60A		Gasket at cylindrical cyclone access hatch-black	Rm 1-20
7-3-AF-60B		Gasket at cylindrical cyclone access hatch-black	Rm 1-20
7-3-AF-61A		Gasket at electrical conduit at fan unit between small and large duct work-grey	Rm 1-20
7-3-AF-61B		Gasket at electrical conduit at fan unit between small and large duct work-grey	Rm 1-20
7-3-AF-62A		Gasket at smaller diameter shute off large fan unit to cyclone-black	Rm 1-20
7-3-AF-62B		Gasket at smaller diameter shute off large fan unit to cyclone-black	Rm 1-20
7-3-AF-63A		Vinyl stair tread adhesive -brown	Rm 2-22
7-3-AF-63B		Vinyl stair tread adhesive -brown	Rm 2-22
7-3-AF-64A		Vinyl stair tread-brown	Rm 2-22
7-3-AF-64B		Vinyl stair tread-brown	Rm 2-22
7-3-AF-65A		Flooring mastic on concrete-black	Rm 2-23
7-3-AF-65B		Flooring mastic on concrete-black	Rm 1-26
7-3-AF-65C		Flooring mastic on concrete-black	Rm 2-29
7-3-AF-66A		12" x 12" vinyl floor tile-blue	Rm 2-23
7-3-AF-66B		12" x 12" vinyl floor tile-blue	Rm 1-26

Relinquished By

Received By

6860

7-3-AF-87A		4" vinyl cove base-black	Rm 2-23
7-3-AF-87B		4" vinyl cove base-black	Rm 2-23
7-3-AF-88A		Sealant at sheetrock/metal wall panel junction-transparent	Rm 2-23
7-3-AF-88B		Sealant at sheetrock/metal wall panel junction-transparent	Rm 2-23
7-3-AF-89A		12" x 12" vinyl floor tile-white	Rm 2-24
7-3-AF-89B		12" x 12" vinyl floor tile-white	Rm 2-24
7-3-AF-70A		Cellulose insolation in wall cavity	Rm 2-24
7-3-AF-70B		Cellulose insolation in wall cavity	Rm 2-24
7-3-AF-87Ax		Mastic on fiberglass end caps-white	Rm 2-28
7-3-AF-87Bx		Mastic on fiberglass end caps-white	Rm 2-28
7-5-AF-90A		Mastic at cylindrical duct work-grey	Rm 2-28
7-5-AF-90B		Mastic at cylindrical duct work-grey	Rm 2-28
7-5-AF-91A		Vinyl flex connector-black	Rm 2-28
7-5-AF-91B		Vinyl flex connector-black	Rm 2-28
7-5-AF-92A		Sealant at window surround-white	Rm 2-29
7-5-AF-92B		Sealant at window surround-white	Rm 2-29
7-5-AF-93A		Caulk at concrete slab/perimeter wall junction-black	Rm 1-53
7-5-AF-93B		Caulk at concrete slab/perimeter wall junction-black	Rm 1-53
7-5-AF-94A		Skim coat at columns-brown	Rm 1-53
7-5-AF-94B		Skim coat at columns-brown	Rm 1-53
7-5-AF-94C		Skim coat at columns-brown	Rm 1-53
7-5-AF-95A		Caulk at column/metal wall panel junction-white	Rm 1-53
7-5-AF-95B		Caulk at column/metal wall panel junction-white	Rm 1-53
7-10-AF-164A		Door frame caulk-grey	Façade C
7-10-AF-164B		Door frame caulk-grey	Façade A
7-10-AF-165A		Sealant between metal wall panels-white	Façade C
7-10-AF-165B		Sealant between metal wall panels-white	Façade A
7-10-AF-166A		Skim coat on foundation	Façade C
7-10-AF-166B		Skim coat on foundation	Façade A
7-10-AF-166C		Skim coat on foundation	Façade A
7-10-AF-167A		Mastic at metal covered downspout-clear	Façade B
7-10-AF-167B		Mastic at metal covered downspout-clear	Façade D
7-10-AF-168A		Caulk at louvers-beige	Façade B
7-10-AF-168B		Caulk at louvers-beige	Façade C
7-10-AF-169A		Gaskets at natural gas main	Façade C
7-10-AF-169A		Gaskets at natural gas main	Façade C
7-10-AF-170A		Putty at electrical conduits-grey	Façade B
7-10-AF-170B		Putty at electrical conduits-grey	Façade B
7-10-AF-171A		Caulk at window base junction-white	Façade A
7-10-AF-171B		Caulk at window base junction-white	Façade A
7-10-AF-172A		Membrane at façade junction-black	Façade A
7-10-AF-172B		Membrane at façade junction-black	Façade A
7-10-AF-173A		Caulk at duct work seam-grey	Façade D
7-10-AF-173B		Caulk at duct work seam-grey	Façade D

Relinquished By

Received By

6866

7-10-AF-183A		Caulk at structural beam under odor control duct-grey	Roof
7-10-AF-183B		Caulk at structural beam under odor control duct-grey	Roof
7-10-AF-184A		Caulk at cylindrical duct work penetration through roof-grey	Roof
7-10-AF-184B		Caulk at cylindrical duct work penetration through roof-grey	Roof
7-10-AF-185A		Flashing cement-black	Roof
7-10-AF-185B		Flashing cement-black	Roof
7-10-AF-186A		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-186B		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-186C		Cementitious skim coat on stack above bag house and shredders	Roof
7-10-AF-187A		Blow-off roof canvas	Roof
7-10-AF-187B		Blow-off roof canvas	Roof

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building

Lab Order ID: **10058041**
Analysis: PLM
Date Received: 07/26/2024
Date Reported: 08/02/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
7-23-AF-320A	Gasket at screws through metal panneling - gray / black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10058041_0001					Ashed
7-23-AF-320B	Gasket at screws through metal panneling - gray / black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10058041_0002					Ashed
7-23-AF-321A	Verticle sealent between metal pannels - gray	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10058041_0003					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (3)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10058041

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston & Sampson - MIRA - 300 Maxim Road, Hartford - Waste Processing Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	7/25/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
7-23-AF-320A		Gasket at screws through metal panneling - gray / black	Façade A
7-23-AF-320B		Gasket at screws through metal panneling - gray / black	Façade A
7-23-AF-321A		Verticle sealent between metal pannels - gray	Façade A
>>			

Accepted ☒

Rejected ☐

Relinquished By

7/26 10:30

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Power Block Facility - Lime Slurry and Stack

Lab Order ID: **10062047**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
8-29-AF-653A	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0001					Dissolved, Ashed
8-29-AF-653B	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0002					Ashed, Dissolved
8-29-AF-653C	Paper insulation over fiberglass on pipes	**None Detected**		**100% Other**	White Non-Fibrous Homogeneous
10062047_0003					Ashed, Dissolved
8-29-AF-654A	Residual door frame caulk	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10062047_0004					Ashed
8-29-AF-654B	Residual door frame caulk	**None Detected**		**100% Other**	Tan Non-Fibrous Homogeneous
10062047_0005					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Patrick Yarnell (5)
Analyst

Approved Signatory

10062047

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Power Block Facility - Lime Slurry and Stack
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/6/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-29-AF-653A		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-653B		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-653C		Paper insulation over fiberglass on pipes	Lime Slurry interior
8-29-AF-654A		Residual door frame caulk	Stack
8-29-AF-654B		Residual door frame caulk	Stack

Accepted ☒

Rejected ☐

Relinquished By

9/9 10.2

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Waste Processing Facility - Transfer Building Main Roof

Lab Order ID: **10062112**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
8-30-AF-655A	Tar at perimeter curb - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10062112_0001					Dissolved
8-30-AF-655B	Tar at perimeter curb - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10062112_0002					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Byron Stroble (2)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10/02/12

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Waste Processing Facility - Transfer Building Main Roof
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/6/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-30-AF-655A		Tar at perimeter curb - black	Main roof
8-30-AF-655B		Tar at perimeter curb - black	Main roof

Accepted ☒

Rejected ☐

Relinquished By

Received By

9/9 10:30am

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Waste Processing Facility

Lab Order ID: **10062117**
Analysis: PLM
Date Received: 09/09/2024
Date Reported: 09/16/2024

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	*Lab Notes*				Treatment
8-30-AF-656A	Caulk at louver - beige	**4% Chrysotile**		**96% Other**	Tan, Black Non-Fibrous Heterogeneous
10062117_0001					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Heather Boykin (1)
Analyst

Approved Signatory

Scientific Analytical Institute, Inc. 4604 Dundas Dr. Greensboro, NC 27407 (336) 292-3888

10062117

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Waste Processing Facility
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	9/6/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	5 Day

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
8-30-AF-656A		Caulk at louver - beige	Façade A

9/9 10:20am

Accepted ☑

Rejected ☐

Relinquished By

Received By

Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E

NVLAP LAB CODE 200664-0

Lab ID # 173190

Customer: Eagle Environmental, Inc
8 South Main Street Suite 3
Terryville, CT 06786

Attn: Victoria Farkas
Breigh Ashe

Project: Weston and Sampson - MIRA, Waste Processing Facility - Waste Processing Building

Lab Order ID: **10064369**
Analysis: PLM
Date Received: 10/04/2024
Date Reported: 10/07/2024

Sample ID *Lab Sample ID*	Description *Lab Notes*	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes Treatment
10-2-AF-707A	Coating on metal ceiling panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10064369_0001					Dissolved
10-2-AF-707B	Coating on metal ceiling panels - black	**None Detected**		**100% Other**	Black Non-Fibrous Homogeneous
10064369_0002					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Jalen Moore (2)
Analyst

Approved Signatory

1506043209

Client:	Eagle Environmental, Inc.
Contact:	Victoria Farkas, Breigh Ashe
Address:	8 South Main Street, Terryville, CT
Phone:	860-589-8257
Fax:	860-585-7034
Email:	vfarkas@eagleenviro.com bashe@eagleenviro.com
Project:	Weston and Sampson - MIRA, Waste Processing Facility - Waste Processing Building
Client Notes:	Please stop on first positive in set Please do not split samples
P.O. #.	24-138.10T1
Date Submitted:	10/3/2024 0:00
Analysis:	PLM EPA 600R - 93/116
TurnAroundTime:	24 Hour

Instructions:
Use Column "B" for your contact info

To See an Example Click the bottom Example Tab.

Enter samples between "<<" and ">>"
Begin Samples with a "<< "above the first sample

and end with a ">>" below the last sample.
Only Enter your data on the first sheet "Sheet1"

Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.

Scientific Analytical Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Data 1	Sample Description	Data 2
<<			
10-2-AF-707A		Coating on metal ceiling panels - black	Rm 1-05
10-2-AF-707B		Coating on metal ceiling panels - black	Rm 1-05

Accepted ☑

Rejected ☐

Relinquished By

Received By

10/4 10:30am

APPENDIX D

XRF LEAD-BASED PAINT INSPECTION REPORTS

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/02/24 14:13

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Waste Processing Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/02/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Waste Processing Facility Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/02/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/02/24 14:13	Hartford, CT
Total Readings:	135 Actionable: 0	
Job Started:	07/02/24 14:13	
Job Finished:	07/05/24 09:43	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/02/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/02/24 14:13	Hartford, CT
Total Readings:	135	
Job Started:	07/02/24 14:13	
Job Finished:	07/05/24 09:43	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-10									
004	A	wall	-		I	Steel	grey	0.2	QM
006	C	wall	-		I	CMU	grey	-0.2	QM
005	C	Column	-		I	Steel	grey	-0.4	QM
Interior Room 002 1-11									
013	C	Door	Lft	-	I	Steel	red	-0.1	QM
014	C	Door	Lft	Rgt casing	I	Steel	red	0.1	QM
Interior Room 003 1-12									
016	-	Floor	-		I	Ceramic	tan	-0.4	QM
017	A	Wall	- -		I	Ceramic	white	-0.4	QM
015	C	wall	-		I	CMU	grey	-0.2	QM
Interior Room 004 1-13									
019	A	Wall	- -		I	Concrete	grey	0.1	QM
020	C	Radiator	-		I	Steel	tan	0.1	QM
021	C	Sink	-	Frame	I	Wood	grey	-0.3	QM
018	C	Wall	- -		I	Dry wall	grey	-0.2	QM
022	C	Door	-	-	I	Steel	tan	-0.1	QM
023	C	Door	-	Rgt casing	I	Steel	grey	-0.2	QM
Interior Room 005 1-14									
026	A	Door	-	-	I	Steel	tan	-0.7	QM
027	A	Door	-	Lft casing	I	Steel	grey	-0.2	QM
024	C	wall	-		I	Dry wall	grey	-0.4	QM
025	D	wall	-		I	Dry wall	grey	-0.5	QM
Interior Room 006 1-15									
030	B	wall	-		I	Dry wall	grey	-0.1	QM
031	B	Door	-	-	I	Steel	Brown	-1.2	QM
032	B	Door	-	Rgt casing	I	Steel	grey	-0.2	QM
029	C	wall	-		I	Dry wall	grey	-0.3	QM
028	C	Door	-	-	I	Steel	tan	-0.1	QM
033	D	Radiator	-		I	Steel	grey	-0.5	QM
034	D	Window	-	Lft casing	I	Wood	grey	-0.6	QM
035	D	Door	-	-	I	Steel	grey	-0.3	QM
036	D	Door	-	Lft casing	I	Wood	grey	-0.5	QM
Interior Room 007 1-17									
041	-	Column	-		D	Steel	Yellow	-0.6	QM
044	A	Catwalk	-	Railing	I	Steel	Yellow	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
045	A	Ferrous Load	-	Conveyor	D	Steel	tan	-0.5	QM
042	A	Door	-	-	I	Steel	red	-0.3	QM
043	A	Door	-	Rgt casing	I	Steel	red	-0.2	QM
040	B	Overhead Doo	-	Casing	D	Steel	orange	-0.4	QM
037	C	wall	-		I	Steel	grey	0.1	QM
046	C	Catwalk Stai	-		I	Steel	grey	-0.6	QM
047	C	Air Compress	-	Tank	D	Steel	grey	-0.4	QM
038	C	Door	-	-	I	Steel	grey	-0.2	QM
039	C	Door	-	Rgt casing	I	Steel	grey	-0.2	QM
Interior Room 008 1-18									
051	-	Floor	-		D	Concrete	white	-0.2	QM
052	A	Door	-	-	I	Steel	grey	0.0	QM
053	A	Door	-	Rgt casing	I	Steel	grey	0.1	QM
048	B	wall	-		I	CMU	grey	-0.1	QM
049	C	Overhead Doo	-		I	Steel	black	0.0	QM
050	D	Wall	-	-	I	CMU	grey	-0.1	QM
Interior Room 009 1-20									
065	-	Hopper 235	-		I	Steel	tan	-0.1	QM
068	-	Conveyor 223	-	Hopper	I	Steel	grey	-0.5	QM
069	-	Conveyor 224	-	framework	D	Steel	Yellow	-0.3	QM
076	-	Unit 111	-	case	I	Steel	Brown	-0.5	QM
077	-	Unit 136	-	Hopper	D	Steel	Brown	-0.5	QM
078	A	Unit 134	-	Railing	D	Steel	black	0.3	QM
054	A	Wall	U	-	D	CMU	Yellow	-0.3	QM
055	A	Wall	L	-	D	Steel	Yellow	-0.2	QM
067	A	Column	-		I	Steel	Yellow	-0.4	QM
057	B	Bollard	-		D	Steel	Yellow	-0.3	QM
058	B	Catwalk	-	Railing	D	Steel	Yellow	-0.5	QM
061	B	Overhead Doo	-	Casing	D	Steel	Yellow	-0.5	QM
066	B	Conveyor 120	-	Ladder	I	Steel	blue	-0.3	QM
059	B	Door	-	-	D	Steel	red	-0.2	QM
060	B	Door	-	Rgt casing	D	Steel	red	-0.2	QM
056	B	Column	-		D	Steel	Yellow	-0.4	QM
063	C	Conveyor 138	-	framework	D	Steel	tan	-0.4	QM
064	C	Conveyor 138	-	Ladder	D	Steel	Yellow	-0.5	QM
062	C	Wall	-	-	D	Concrete	Yellow	-0.2	QM
072	D	Overhead Doo	-	Casing	D	Steel	orange	-0.4	QM
074	D	Catwalk Stai	-	Stringer	D	Steel	Yellow	-0.6	QM
075	D	Catwalk Stai	-	Railing	D	Steel	Yellow	-0.2	QM
070	D	Door	-	-	I	Steel	red	-0.1	QM
071	D	Door	-	Rgt casing	I	Steel	red	-0.7	QM
073	D	Column	-		D	Steel	Yellow	-0.4	QM
Interior Room 010 1-19									
079	B	Wall	-	-	I	CMU	grey	-0.2	QM
080	C	Overhead Doo	-	Casing	I	Steel	black	-0.4	QM
081	C	Door	-	-	I	Steel	grey	-0.3	QM

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
082	C	Door	-	Rgt casing	I	Steel	grey	0.2	QM
Interior Room 011 1-16									
087	A	Wall	- -		I	CMU	blue	-0.2	QM
084	A	Door	-	-	D	Steel	red	-0.1	QM
085	A	Door	-	Rgt casing	D	Steel	red	-0.2	QM
083	C	Wall	- -		I	CMU	grey	0.0	QM
086	D	Bollard	-		D	Steel	Yellow	-0.5	QM
088	D	Overhead Doo	-	Casing	I	Steel	grey	-0.3	QM
Interior Room 012 2-22									
133								0.7	TC
134								0.7	TC
135								0.6	TC
093	B	Wall	- -		I	Dry wall	white	-0.2	QM
089	D	Wall	- -		I	Dry wall	white	-0.2	QM
091	D	Door	-	-	I	Steel	red	-0.3	QM
092	D	Door	-	Lft casing	I	Steel	red	-0.4	QM
090	D	Stairs	-	Stringers	I	Steel	red	-0.2	QM
Interior Room 013 2-23									
094	A	Wall	- -		I	Steel	white	0.0	QM
095	B	Wall	- -		I	Dry wall	white	-0.4	QM
Interior Room 014 2-24									
096	A	Wall	- -		I	Dry wall	white	0.0	QM
098	A	Door	-	-	I	Steel	grey	0.0	QM
099	A	Door	-	Rgt casing	I	Steel	grey	-0.1	QM
097	B	Wall	- -		I	Dry wall	white	-0.2	QM
Interior Room 015 2-26									
100	A	Wall	- -		I	Steel	white	-0.2	QM
104	A	Door	-	-	I	Steel	grey	-0.4	QM
105	A	Door	-	Rgt casing	I	Steel	grey	-0.4	QM
103	B	Wall	- -		I	Dry wall	white	-0.6	QM
102	C	Wall	- -		I	Steel	white	-0.1	QM
107	C	Wall	L -		I	Vinyl	white	-0.3	QM
106	C	Window	-	Casing	I	Steel	grey	-0.5	QM
108	C	Column	-		I	Steel	grey	-0.7	QM
101	D	Wall	- -		I	Dry wall	white	-0.1	QM
Interior Room 016 2-27									
109	A	wall	-		I	Concrete	white	-0.1	QM
110	D	wall	-		I	Dry wall	white	-0.3	QM
Interior Room 017 2-28									
112								0.7	TC
113								0.8	TC
114								0.7	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
115								0.7	TC
116								0.6	TC
118	A	Wall	- -		D	Dry wall	white	-0.4	QM
119	A	Door	-	-	I	Steel	red	-0.3	QM
120	A	Door	-	Rgt casing	I	Steel	red	-0.2	QM
117	B	Electric Pan	-	Back Board	I	Wood	black	-0.1	QM
Interior Room 018 2-29									
121	A	Wall	- -		I	Steel	white	-0.2	QM
122	B	Wall	- -		I	Dry wall	white	-0.3	QM
123	C	Wall	- -		I	Steel	white	-0.2	QM
125	C	Window	-	Casing	I	Steel	grey	-0.4	QM
126	C	Column	-		I	Steel	grey	-0.6	QM
124	D	Wall	- -		I	Dry wall	white	-0.2	QM
Interior Room 019 2-30									
131	-	Stairs	-	Railing	I	Steel	grey	-0.4	QM
132	-	Stairs	-	Stringers	I	Steel	grey	-0.5	QM
127	A	Wall	- -		I	Steel	white	0.0	QM
128	B	Wall	- -		I	Dry wall	white	-0.3	QM
130	C	Wall	- -		I	CMU	white	-0.1	QM
129	D	Wall	- -		I	Dry wall	white	-0.4	QM
Calibration Readings									
001								0.7	TC
002								0.8	TC
003								0.7	TC
007								0.7	TC
008								0.7	TC
009								0.6	TC
010								0.7	TC
011								0.6	TC
012								0.7	TC
111								0.7	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/10/24 10:21

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Waste Processing Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/10/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Waste Processing Facility Exteriors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 10:21	Hartford, CT
Total Readings:	26 Actionable: 0	
Job Started:	07/10/24 10:21	
Job Finished:	07/10/24 12:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
----- End of Readings -----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 10:21	Hartford, CT
Total Readings:	26	
Job Started:	07/10/24 10:21	
Job Finished:	07/10/24 12:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 VH-03									
004	A	Wall	-		I	Wood	Yellow	-0.4	QM
005	B	Sprinkler	-	Pipe	I	Steel	red	-0.5	QM
Exterior Room 002 Facade C									
006	-	Siding	-		I	Steel	grey	0.0	QM
007	-	Bollard	-		D	Steel	Yellow	-0.5	QM
008	-	Downspout	-		I	Steel	red	0.0	QM
009	-	Door	Lft	-	I	Steel	red	-0.2	QM
010	-	Door	Lft	Rgt casing	I	Steel	red	-0.1	QM
Exterior Room 003 Facade B									
011	-	Siding	-		I	Steel	grey	-0.1	QM
Exterior Room 004 Fuel Rm									
012	C	Siding	-		I	Aluminum	white	-0.4	QM
013	C	Cornerboard	-		I	Aluminum	red	0.0	QM
Exterior Room 005 Facade A									
015	-	siding	-		I	Steel	grey	-0.2	QM
017	-	Roof Access	-	Column	D	Steel	tan	-0.5	QM
016	-	Cornerboard	-		I	Steel	grey	0.1	QM
014	-	Door	-	-	I	Steel	grey	-0.2	QM
Exterior Room 006 Facade D									
018	-	Siding	-		I	Steel	grey	0.0	QM
019	-	Overhead Doo	-	Support	D	Steel	white	-0.6	QM
020	-	Bollard	-		D	Steel	Yellow	-0.6	QM
023	-	HVAC Unit	-	Support	D	Steel	white	-0.7	QM
021	-	Door	-	-	D	Steel	white	-0.1	QM
022	-	Door	-	-	I	Steel	red	-0.2	QM
Calibration Readings									
001								1.0	TC
002								1.0	TC
003								1.1	TC
024								1.0	TC
025								1.0	TC
026								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/10/24 14:37

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Waste Processing Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/10/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Waste Processing Facility Roof

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 14:37	Hartford, CT
Total Readings:	9 Actionable: 0	
Job Started:	07/10/24 14:37	
Job Finished:	07/10/24 15:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 14:37	Hartford, CT
Total Readings:	9	
Job Started:	07/10/24 14:37	
Job Finished:	07/10/24 15:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 WPF									
004	-	Roof	-		I	Steel	white	-0.2	QM
005	-	Roof	-		I	Steel	silver	-0.4	QM
006	-	Vent Stack	-	Casing	D	Steel	white	-0.5	QM
Calibration Readings									
001								0.8	TC
002								0.7	TC
003								0.9	TC
007								1.0	TC
008								1.0	TC
009								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/02/24 08:43

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Waste Processing Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/02/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Maneuvering Hall and MSW Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/02/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/02/24 08:43	Hartford, CT
Total Readings:	47 Actionable: 2	
Job Started:	07/02/24 08:43	
Job Finished:	07/02/24 14:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 004 1-04									
030	D	Catwalk	-	Railing	D	Steel	black	1.5	Std
Interior Room 005 1-05									
027	A	Catwalk	-	Railing	D	Steel	black	3.8	QM
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/02/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/02/24 08:43	Hartford, CT
Total Readings:	47	
Job Started:	07/02/24 08:43	
Job Finished:	07/02/24 14:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-01									
011	A	Stair	-		D	Steel	Yellow	-0.3	QM
016	A	Overhead Doo	-	Casing	D	Steel	red	-0.5	QM
017	A	Bollard	-		D	Steel	orange	-0.4	QM
018	A	Column Suppo	-		D	Concrete	Yellow	-0.4	QM
002	A	Window	Lft	Header	P	N/A	N/A	0.7	TC
019	A	Column	-		D	Steel	grey	-0.4	QM
004	B	Overhead Doo	-		D	Steel	orange	-0.2	QM
005	B	Bollard	-		D	Steel	red	0.0	QM
009	B	Door	-	-	D	Steel	red	-0.2	QM
010	B	Door	-	Lft casing	D	Steel	red	-0.2	QM
008	B	Column	-		I	Steel	white	-0.2	QM
006	C	Door	-	-	D	Steel	red	-0.1	QM
007	C	Door	-	Lft casing	D	Steel	red	-0.4	QM
Interior Room 002 1-02									
014	-	Ceiling	-		I	Steel	white	-0.2	QM
015	A	wall	-		D	Steel	white	-0.2	QM
012	C	Door	-	-	D	Steel	grey	-0.2	QM
013	C	Door	-	Lft casing	D	Steel	grey	-0.1	QM
Interior Room 003 1-03									
020	-	Column	Ctr		D	Steel	Brown	-0.1	QM
021	D	Overhead Doo	-	Casing	D	Steel	orange	-0.3	QM
022	D	Door	-	-	D	Steel	white	-0.2	QM
023	D	Door	-	Lft casing	D	Steel	white	-0.2	QM
024	D	Column	-		D	Steel	Brown	0.0	QM
Interior Room 004 1-04									
031	-	Catwalk	-	Floor	D	Steel	black	-0.2	QM
033	-	Duct	-		I	Steel	black	-0.2	QM
032	B	wall	-		I	Steel	black	-0.2	QM
028	D	Catwalk	-	Railing	D	Steel	black	-0.2	QM
030	D	Catwalk	-	Railing	D	Steel	black	1.5	Std
025	D	Door	-	-	D	Steel	black	-0.1	QM
026	D	Door	-	Rgt casing	D	Steel	black	-0.2	QM
Interior Room 005 1-05									
034	-	Conveyor Fra	-		I	Steel	black	-0.3	QM
035	-	Catwalk Stai	-	Stringer	D	Steel	black	0.4	QM
027	A	Catwalk	-	Railing	D	Steel	black	3.8	QM
029	B	Catwalk	-	Railing	D	Steel	black	0.8	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
036	C	Catwalk	-	Railing	D	Steel	Yellow	-0.2	QM
Interior Room 006 1-06									
037	C	Blast Door	-		D	Steel	Yellow	-0.2	QM
038	C	Blast Door	Rgt	Casing	D	Steel	Yellow	-0.1	QM
Interior Room 007 1-07									
043	-	Crusher Door	-		D	Steel	black	-0.5	QM
044	-	Catwalk	-	Railing	D	Steel	Yellow	-0.2	QM
040	C	Blast Door	-		D	Steel	Yellow	-0.4	QM
041	C	Blast Door	-	Casing	D	Steel	Yellow	-0.2	QM
039	D	Catwalk	-	Stair	D	Steel	Yellow	-0.2	QM
042	D	Column	-		D	Steel	Yellow	0.2	QM
Calibration Readings									
001								0.7	TC
003								0.6	TC
045								0.8	TC
046								0.7	TC
047								0.7	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/05/24 14:34

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Refuse Derived Fuel Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/05/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Refuse Derived Fuel Facility Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/05/24	MIRA
Report Date:	7/11/2024	Refuse Derived Fuel Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/05/24 14:34	Hartford, CT
Total Readings:	16 Actionable: 0	
Job Started:	07/05/24 14:34	
Job Finished:	07/05/24 15:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/05/24	MIRA
Report Date:	7/11/2024	Refuse Derived Fuel Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/05/24 14:34	Hartford, CT
Total Readings:	16	
Job Started:	07/05/24 14:34	
Job Finished:	07/05/24 15:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-31									
014								0.7	TC
015								0.7	TC
016								0.6	TC
005	B	Overhead Doo	-	Casing	I	Steel	orange	-0.3	QM
006	B	Bollard	-		D	Steel	Yellow	-0.4	QM
004	B	Door	-	-	D	Steel	white	-0.3	QM
007	C	Conveyor	-	Framework	D	Steel	white	-0.5	QM
013	C	Conveyor	Lft	Wall	D	Steel	white	-0.2	QM
010	D	Overhead Doo	-	Casing	D	Steel	orange	-0.4	QM
011	D	Bollard	-		D	Steel	Yellow	-0.5	QM
008	D	Door	-	-	D	Steel	red	-0.3	QM
009	D	Door	-	Rgt casing	D	Steel	red	-0.2	QM
012	D	Stairs	-	Railing	D	Steel	Yellow	-0.1	QM
Calibration Readings									
001								0.7	TC
002								0.7	TC
003								0.6	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/09/24 11:14

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Transfer Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/09/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Transfer Building Interiors and Exteriors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/09/24	MIRA
Report Date:	7/11/2024	Transfer Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/09/24 11:14	Hartford, CT
Total Readings:	41 Actionable: 0	
Job Started:	07/09/24 11:14	
Job Finished:	07/09/24 16:14	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/09/24	MIRA
Report Date:	7/11/2024	Transfer Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/09/24 11:14	Hartford, CT
Total Readings:	41	
Job Started:	07/09/24 11:14	
Job Finished:	07/09/24 16:14	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade B									
032	-	Siding	-		I	Steel	red	0.1	QM
033	-	Ductwork	-		D	Steel	tan	-0.4	QM
036	-	Siding	-		D	Steel	red	-0.2	QM
Exterior Room 002 Facade D									
034	-	Siding	-		I	Steel	tan	-0.2	QM
037	-	Overhead Doo	-		D	Steel	grey	0.0	QM
035	-	Door	-	-	D	Steel	red	-0.2	QM
Exterior Room 004 Facade C									
038	-	Siding	-		I	Steel	red	-0.1	QM
Interior Room 001 1-01									
003								0.6	TC
004	B	Door	-	-	I	Steel	grey	-0.1	QM
006	B	Stairs	-	Railings	D	Steel	Yellow	-0.4	QM
005	B	Column	-		I	Steel	grey	-0.6	QM
Interior Room 002 1-02									
007	A	Wall	-		I	Dry wall	white	-0.2	QM
Interior Room 003 1-04									
009	C	Column	-		I	Steel	grey	-0.2	QM
008	D	Wall	-		D	Steel	Brown	-0.1	QM
Interior Room 004 2-05									
013	A	Door	-	-	I	Steel	grey	0.1	QM
010	B	Door	-	Header	D	Steel	Yellow	0.0	QM
011	C	Column	-		I	Steel	red	-0.3	QM
012	D	Wall	-		D	Steel	red	-0.2	QM
Interior Room 005 2-06									
014	A	Wall	-		D	Dry wall	tan	-0.5	QM
015	A	Window	-	Sill	D	Steel	tan	-0.4	QM
016	D	Door	-	Header	I	Steel	grey	-0.1	QM
Interior Room 006 2-08									
017	A	Wall	-		I	Dry wall	tan	-0.5	QM
Interior Room 007 3-09									
018	-	Conveyor	-	Column	I	Steel	grey	-0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
020	-	Conveyor	-	Guard	D	Steel	Yellow	-0.4	QM
019	A	Wall	-		I	Steel	white	-0.2	QM
Interior Room 008 4-10									
021	-	Belt Cleaner	-	Casing	D	Steel	red	-0.3	QM
022	-	Belt Cleaner	-	Framework	I	Steel	white	-0.3	QM
023	-	Conveyor	-	Framework	I	Steel	white	-0.6	QM
024	-	Column	-		I	Steel	grey	-0.3	QM
025	D	Door	-	-	D	Steel	grey	-0.1	QM
Interior Room 009 PBF Conveyr									
026	-	Conveyor	-	Framework	D	Steel	white	-0.2	QM
027	-	Ceiling	-	I Beam	I	Steel	grey	-0.3	QM
Interior Room 010 5-11									
029	-	CBMF Fan	-	Casing	I	Steel	red	-0.3	QM
030	-	CBMF DCO	-	Casing	I	Steel	red	-0.4	QM
028	D	Door	-	-	D	Steel	red	0.1	QM
Interior Room 011 6-12									
031	-	Coal Conveyo	-	Casing	I	Steel	grey	-0.3	QM
Calibration Readings									
001								0.6	TC
002								0.7	TC
039								0.6	TC
040								0.7	TC
041								0.6	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/10/24 08:32

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Coal Barge Unloading Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/10/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Coal Barge Unloading Building Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Coal Barge Unloading Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 08:32	Hartford, CT
Total Readings:	26 Actionable: 4	
Job Started:	07/10/24 08:32	
Job Finished:	07/10/24 10:21	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 LVL-01									
004	-	Fuel Line	-	Casing	D	Steel	blue	>9.9	QM
Interior Room 002 LVL-02									
007	C	Container	-	Shell	D	Steel	tan	>9.9	QM
Interior Room 004 LVL-04									
012	-	Electric Mot	-	Framework	D	Steel	orange	3.5	QM
Interior Room 005 LVL-05									
017	-	Winch Gearbo	-	Casing	D	Steel	orange	1.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Coal Barge Unloading Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 08:32	Hartford, CT
Total Readings:	26	
Job Started:	07/10/24 08:32	
Job Finished:	07/10/24 10:21	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 LVL-01									
004	-	Fuel Line	-	Casing	D	Steel	blue	>9.9	QM
005	-	Catwalk	-	Framework	D	Steel	Yellow	0.0	QM
Interior Room 002 LVL-02									
009	A	Railing	-	-	D	Steel	Yellow	-0.3	QM
007	C	Container	-	Shell	D	Steel	tan	>9.9	QM
006	C	Column	-		I	Steel	Cream	-0.5	QM
008	D	Cabinet	-	Shell	D	Steel	Yellow	-0.2	QM
Interior Room 003 LVL-03									
010	-	Conveyor	-	Framework	I	Steel	Cream	-0.3	QM
011	B	Conveyor	-	Siding	I	Steel	red	-0.2	QM
Interior Room 004 LVL-04									
012	-	Electric Mot	-	Framework	D	Steel	orange	3.5	QM
013	-	Hopper	-	Casing	I	Steel	Cream	-0.2	QM
Interior Room 005 LVL-05									
014	-	Winch	-	Drum	I	Steel	Yellow	-0.3	QM
015	-	Winch Motor	-	Casing	I	Steel	orange	0.2	QM
017	-	Winch Gearbo	-	Casing	D	Steel	orange	1.9	QM
018	-	Door	-	-	I	Steel	red	0.1	QM
019	-	Door	-	Rgt casing	I	Steel	red	0.0	QM
016	C	Wall	-		I	Steel	white	-0.2	QM
Interior Room 006 LVL-06									
020	C	Mag-Pac	-	Door	D	Steel	blue	-0.4	QM
Interior Room 007 LVL-09									
023	-	Block & Tack	-	Casing	D	Steel	Yellow	-0.4	QM
021	D	Door	-	-	D	Steel	Brown	0.1	QM
022	D	Door	-	Rgt casing	D	Steel	Brown	0.1	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.0	TC
024								1.2	TC
025								1.1	TC
026								1.2	TC

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm^2)	Mode

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/09/24 08:19

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Scale House #1, #2, #3
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/09/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Scale House #1, #2, #3 Interiors and Exteriors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/09/24	MIRA
Report Date:	7/11/2024	Scale House #1, #2, #3
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/09/24 08:19	Hartford, CT
Total Readings:	45 Actionable: 0	
Job Started:	07/09/24 08:19	
Job Finished:	07/09/24 11:11	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm^2)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/09/24	MIRA
Report Date:	7/11/2024	Scale House #1, #2, #3
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/09/24 08:19	Hartford, CT
Total Readings:	45	
Job Started:	07/09/24 08:19	
Job Finished:	07/09/24 11:11	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 SH-1									
013	-	Facade A	-		I	Steel	tan	-0.1	QM
014	-	Facade B	-		I	Steel	tan	-0.3	QM
015	-	Facade C	-		I	Steel	tan	-0.1	QM
016	-	Facade D	-		I	Steel	tan	-0.6	QM
019	C	Scale	-	Framework	D	Steel	Yellow	-0.5	QM
017	C	Window	-	Lft casing	I	Steel	black	-1.1	QM
018	C	Railing	-	-	D	Steel	Yellow	-0.4	QM
Exterior Room 002 SH-2									
026	-	Facade A	-		I	Steel	white	-0.2	QM
027	-	Facade B	-		I	Steel	white	-0.4	QM
028	-	Facade C	-		I	Steel	white	-0.2	QM
029	-	Facade D	-		I	Steel	white	-0.2	QM
030	-	Facade D	-	Soffit	D	Steel	red	-0.2	QM
Exterior Room 003 SH-3									
038	-	Facade A	-		I	Steel	blue	-0.2	QM
039	-	Facade D	-		I	Steel	blue	-0.2	QM
040	-	Facade D	-	Bollard	I	Steel	Yellow	-0.5	QM
041	-	Roof	-	-	D	Steel	silver	-0.3	QM
042	B	Scale	-	Framework	D	Steel	Yellow	-0.7	QM
Interior Room 001 SH-1									
004	A	Wall	-		I	Vinyl	white	-0.4	QM
008	A	Window	-	Lft casing	I	Steel	black	-0.5	QM
005	B	Wall	-		I	Vinyl	white	-0.5	QM
009	B	Door	-	-	I	Steel	black	-0.9	QM
010	B	Door	-	Lft casing	I	Steel	black	-0.8	QM
006	C	Wall	-		I	Vinyl	white	-0.6	QM
011	C	Door	-	-	I	Steel	grey	-0.2	QM
012	C	Door	-	Rgt casing	I	Steel	grey	-0.4	QM
007	D	Wall	-		I	Vinyl	white	-0.4	QM
Interior Room 002 SH-2									
031	-	Ceiling	-		I	Steel	white	-0.3	QM
020	A	Wall	-		I	Steel	white	-0.1	QM
021	B	Wall	-		I	Steel	white	-0.2	QM
022	C	Wall	-		I	Steel	white	-0.2	QM
023	D	Wall	-		I	Steel	white	-0.4	QM
024	D	Door	-	-	I	Steel	white	-0.2	QM
025	D	Door	-	Lft casing	I	Steel	white	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 003 SH-3									
036	-	Ceiling	-		I	Steel	blue	-0.3	QM
037	-	Door	-	-	I	Steel	blue	-0.2	QM
032	A	Wall	-		I	Steel	blue	0.0	QM
033	B	Wall	-		I	Steel	blue	-0.2	QM
034	C	Wall	-		I	Steel	blue	-0.1	QM
035	D	Wall	-		I	Steel	blue	-0.3	QM
Calibration Readings									
001								0.8	TC
002								0.6	TC
003								0.7	TC
043								0.6	TC
044								0.6	TC
045								0.8	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/08/24 08:55

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Waste Processing Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/08/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Waste Processing Facility Odor Control System

SIGNED: _____ Date: 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/08/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/08/24 08:55	Hartford, CT
Total Readings:	23 Actionable: 0	
Job Started:	07/08/24 08:55	
Job Finished:	07/08/24 12:02	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/08/24	MIRA
Report Date:	7/11/2024	Waste Processing Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/08/24 08:55	Hartford, CT
Total Readings:	23	
Job Started:	07/08/24 08:55	
Job Finished:	07/08/24 12:02	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Odor Ctr									
004	A	Ventilation	-	Shaft	I	Steel	N/A	-0.6	QM
005	A	Ventilation	-	Support	I	Steel	tan	-0.8	QM
006	A	Ventilation	-	Bollard	D	Steel	Yellow	-0.4	QM
007	A	Ventilation	-	Column	I	Steel	tan	-0.8	QM
008	A	Ram Clean	-	Wall	I	Steel	N/A	-0.4	QM
012	A	Re Therm Sys	-	Casing	I	Steel	tan	-0.3	QM
013	A	Re Therm Sys	-	Column	I	Steel	tan	-0.4	QM
009	B	Damper Asmbl	-	Casing	D	Steel	tan	-0.3	QM
010	B	Damper Asmbl	-	Casing	D	Steel	black	-0.3	QM
011	B	Damper Asmbl	-	Ladder	I	Steel	tan	-0.7	QM
Exterior Room 002 RTO #2									
015	-	Facade A	-		I	Steel	tan	-0.1	QM
016	-	Facade C	-	Ladder	I	Steel	Yellow	-0.5	QM
014	A	Door	-	-	I	Steel	tan	-0.3	QM
Interior Room 003 Conveyor Rm									
018	B	Conveyor	-	Framework	D	Steel	red	-0.3	QM
019	B	Conveyor	-	Framework	D	Steel	white	-0.2	QM
020	B	Conveyor	-	Ladder	D	Steel	Yellow	-0.2	QM
017	B	Door	-	-	D	Steel	red	-0.4	QM
Calibration Readings									
001								1.2	TC
002								0.6	TC
003								0.7	TC
021								0.5	TC
022								0.6	TC
023								0.7	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/10/24 12:17

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Administrative Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/10/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Administrative Building Exteriors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Administrative Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 12:17	Hartford, CT
Total Readings:	15 Actionable: 0	
Job Started:	07/10/24 12:17	
Job Finished:	07/10/24 12:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Administrative Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 12:17	Hartford, CT
Total Readings:	15	
Job Started:	07/10/24 12:17	
Job Finished:	07/10/24 12:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
004	-	Siding	-		I	Steel	silver	-0.2	QM
005	-	Ceiling	-		I	Steel	white	-0.1	QM
012	-	Boxbeam	-		I	Steel	white	0.0	QM
Exterior Room 002 Facade B									
006	-	Siding	-		I	Steel	grey	-0.1	QM
007	-	Door	-	-	I	Steel	red	-0.3	QM
Exterior Room 003 Facade D									
008	-	Siding	-		I	Steel	grey	0.0	QM
009	-	Window	-	Rgt casing	I	Steel	Brown	-1.4	QM
Exterior Room 004 Facade C									
010	-	Siding	-		I	Steel	grey	-0.1	QM
011	-	Door	-	-	I	Steel	red	-0.4	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.1	TC
013								1.1	TC
014								1.3	TC
015								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/05/24 09:45

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Administrative Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/05/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Administrative Building Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/05/24	MIRA
Report Date:	7/11/2024	Administrative Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/05/24 09:45	Hartford, CT
Total Readings:	98 Actionable: 0	
Job Started:	07/05/24 09:45	
Job Finished:	07/05/24 14:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm^2)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/05/24	MIRA
Report Date:	7/11/2024	Administrative Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/05/24 09:45	Hartford, CT
Total Readings:	98	
Job Started:	07/05/24 09:45	
Job Finished:	07/05/24 14:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-01									
011	A	Radiator	-		I	Steel	tan	0.1	QM
004	A	Wall	- -		I	Dry wall	white	-0.2	QM
010	A	Window	-	Casing	I	Steel	black	-1.1	QM
005	B	Wall	- -		I	Dry wall	white	-0.7	QM
006	C	Wall	- -		I	Dry wall	white	-0.9	QM
008	C	Door	-	-	I	Steel	red	-0.3	QM
009	C	Door	-	Lft casing	I	Steel	red	-0.4	QM
007	D	Wall	- -		I	Dry wall	white	0.0	QM
Interior Room 002 1-02									
012	A	Wall	- -		I	Dry wall	white	-0.1	QM
013	B	Wall	- -		I	Dry wall	white	-0.3	QM
014	B	Door	-	-	I	Steel	red	-0.2	QM
015	B	Door	-	Lft casing	I	Steel	red	-0.2	QM
Interior Room 003 1-04									
016	A	Wall	- -		I	Dry wall	white	-0.6	QM
021	A	Door	-	-	I	Steel	red	-0.2	QM
017	C	Wall	- -		I	Dry wall	white	-0.3	QM
020	C	Wall	- -		I	Dry wall	white	-0.2	QM
018	C	Door	-	-	I	Steel	red	-0.3	QM
019	C	Door	-	Rgt casing	I	Steel	red	-0.3	QM
Interior Room 004 1-05									
022	B	Wall	- -		D	Dry wall	white	-0.1	QM
Interior Room 005 1-06									
023	A	Wall	- -		I	Dry wall	white	-0.3	QM
027	A	Door	Lft	-	I	Steel	red	-0.3	QM
028	A	Door	Lft	Rgt casing	I	Steel	red	-0.3	QM
024	B	Wall	- -		I	Dry wall	white	-0.1	QM
029	B	Door	Ctr	-	I	Steel	red	0.0	QM
030	B	Door	Ctr	Rgt casing	I	Steel	red	-0.1	QM
025	C	Wall	- -		I	Dry wall	white	-0.2	QM
026	D	Wall	- -		I	Dry wall	white	-0.1	QM
Interior Room 006 1-09									
031	-	Ceiling	-		I	Steel	white	-0.1	QM
032	D	Wall	- -		I	Steel	tan	-0.2	QM
Interior Room 007 1-07									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
033	A	Wall	- -		I	Dry wall	white	-0.3	QM
037	B	Radiator	-		I	Steel	tan	-0.2	QM
034	B	Wall	- -		I	Dry wall	white	-0.3	QM
038	B	Door	-	-	I	Steel	red	-0.3	QM
039	B	Door	-	Rgt casing	I	Steel	red	-0.2	QM
035	C	Wall	- -		I	Dry wall	white	-0.3	QM
036	D	Wall	- -		I	Dry wall	white	-0.3	QM
Interior Room 008 1-08									
040	A	Wall	- -		I	Dry wall	white	-0.6	QM
041	B	Wall	- -		I	Dry wall	white	-0.6	QM
044	B	Door	-	-	I	Steel	red	-0.4	QM
045	B	Door	-	Rgt casing	I	Steel	red	-0.4	QM
042	C	Wall	- -		I	Dry wall	white	-0.4	QM
043	D	Wall	- -		I	Dry wall	white	-0.3	QM
Interior Room 009 1-10									
046	A	Wall	- -		I	Dry wall	white	-0.6	QM
050	A	Window	-	Rgt casing	I	Steel	black	-1.1	QM
047	B	Wall	- -		I	Dry wall	white	-0.4	QM
048	C	Wall	- -		I	Dry wall	white	-0.5	QM
049	D	Wall	- -		I	Dry wall	white	-0.4	QM
Interior Room 010 1-11									
051	A	Wall	- -		I	Dry wall	white	-0.4	QM
052	C	Wall	- -		I	Dry wall	white	-0.7	QM
054	C	Window	-	Sill	I	Steel	blue	-0.3	QM
053	C	Window	-	Lft casing	I	Steel	black	-0.8	QM
Interior Room 011 1-12									
055	B	Wall	- -		I	Dry wall	white	-0.3	QM
056	D	Wall	- -		I	Dry wall	white	-0.3	QM
Interior Room 012 1-13									
057	B	Wall	- -		I	Dry wall	white	-0.4	QM
059	B	Window	-	Casing	I	Steel	red	-0.6	QM
058	D	Wall	- -		I	Dry wall	white	-0.4	QM
Interior Room 013 1-14									
060	A	Wall	- -		I	Dry wall	white	-0.2	QM
061	B	Wall	- -		I	Dry wall	white	-0.1	QM
062	B	Door	-	-	I	Steel	red	0.0	QM
063	B	Door	-	Lft casing	I	Steel	red	-0.4	QM
Interior Room 014 1-15									
064	A	Wall	- -		I	Dry wall	white	-0.2	QM
066	C	Window	-	Casing	I	Steel	black	-1.0	QM
065	D	Wall	- -		I	Dry wall	white	-0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 015 1-16									
067	A	Wall	- -		I	Dry wall	white	-0.3	QM
071	A	Door	-	-	I	Steel	red	-0.2	QM
072	A	Door	-	Lft casing	I	Steel	red	-0.2	QM
068	B	Wall	- -		I	Dry wall	white	-0.6	QM
069	C	Wall	- -		I	Dry wall	white	-0.4	QM
073	D	Radiator	-		I	Steel	red	-0.1	QM
070	D	Wall	- -		I	Dry wall	white	-0.5	QM
Interior Room 016 1-17									
074	A	Wall	- -		I	Dry wall	white	-0.4	QM
075	B	Wall	- -		I	Dry wall	white	-0.2	QM
076	C	Wall	- -		I	Dry wall	white	-0.3	QM
077	C	Door	-	-	I	Steel	red	-0.3	QM
Interior Room 017 1-18									
078	A	Wall	- -		I	Dry wall	white	-0.2	QM
079	B	Wall	- -		I	Dry wall	white	-0.4	QM
080	C	Wall	- -		I	Dry wall	white	-0.1	QM
082	C	Door	-	-	I	Steel	red	-0.1	QM
083	C	Door	-	Lft casing	I	Steel	red	-0.2	QM
081	D	Wall	- -		I	Dry wall	white	-0.5	QM
Interior Room 018 1-19									
096								0.8	TC
097								0.6	TC
098								0.6	TC
095	-	Ceiling	-	I-Beam	I	Steel	red	0.5	QM
084	A	Wall	- -		I	Dry wall	white	-0.5	QM
085	B	Wall	- -		I	Dry wall	white	-0.3	QM
086	C	Wall	- -		I	Dry wall	white	-0.2	QM
088	C	Door	-	-	I	Steel	red	-0.1	QM
089	C	Door	-	Rgt casing	I	Steel	red	-0.2	QM
087	D	Wall	- -		I	Dry wall	white	-0.3	QM
Interior Room 019 1-20									
090	A	Wall	- -		I	Dry wall	white	-0.5	QM
091	B	Wall	- -		I	Dry wall	white	0.0	QM
092	C	Wall	- -		I	Dry wall	white	-0.4	QM
093	C	Door	-	-	I	Steel	red	-0.1	QM
094	C	Door	-	Rgt casing	I	Steel	red	0.1	QM
Calibration Readings									
001								0.7	TC
002								0.7	TC
003								0.7	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/10/24 12:55

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Tool Storage Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/10/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Tool Storage Building Exteriors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Tool Storage Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 12:55	Hartford, CT
Total Readings:	14 Actionable: 0	
Job Started:	07/10/24 12:55	
Job Finished:	07/10/24 14:35	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/10/24	MIRA
Report Date:	7/11/2024	Tool Storage Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/10/24 12:55	Hartford, CT
Total Readings:	14	
Job Started:	07/10/24 12:55	
Job Finished:	07/10/24 14:35	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
004	-	Siding	-		I	Steel	grey	-0.2	QM
Exterior Room 002 Facade B									
005	-	Siding	-		I	Steel	grey	-0.3	QM
Exterior Room 003 Facade C									
006	-	Siding	-		I	Steel	grey	-0.1	QM
007	-	Door	-	Header	D	Steel	grey	-0.2	QM
Exterior Room 004 Facade D									
008	-	Siding	-		I	Steel	grey	-0.2	QM
Exterior Room 005 Elv Rm									
009	A	Wall	-		I	CMU	white	-0.3	QM
011	B	Door	-	-	I	Steel	grey	-0.5	QM
010	C	Wall	-		I	Dry wall	white	-0.2	QM
Calibration Readings									
001								1.3	TC
002								1.2	TC
003								1.3	TC
012								1.3	TC
013								1.2	TC
014								1.3	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/08/24 12:03

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Tool Storage Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/08/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Tool Storage Building Interiors

SIGNED: _____ **Date:** 7/11/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/08/24	MIRA
Report Date:	7/11/2024	Tool Storage Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/08/24 12:03	Hartford, CT
Total Readings:	70 Actionable: 0	
Job Started:	07/08/24 12:03	
Job Finished:	07/08/24 16:24	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/08/24	MIRA
Report Date:	7/11/2024	Tool Storage Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/08/24 12:03	Hartford, CT
Total Readings:	70	
Job Started:	07/08/24 12:03	
Job Finished:	07/08/24 16:24	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-56									
023	-	Parts Loft	-	Column	I	Steel	blue	-0.5	QM
004	-	Ceiling	-	Water Line	I	Steel	red	-0.1	QM
013	A	Overhead Doo	-	Casing	D	Steel	black	-0.3	QM
014	A	Overhead Doo	-	-	I	Steel	tan	0.1	QM
015	A	Bollard	-		I	Steel	Yellow	-0.6	QM
017	A	Shelving	-	Post	I	Steel	Yellow	-0.4	QM
024	A	Parts Loft	-	Framework	I	Steel	blue	-0.4	QM
010	A	Wall	-		I	Steel	white	-0.1	QM
011	A	Door	-	-	D	Steel	red	-0.1	QM
012	A	Door	-	Rgt casing	D	Steel	red	-0.2	QM
005	B	Wall	-		I	Steel	white	-0.2	QM
008	B	Stairs	-	Stringers	D	Steel	blue	-0.5	QM
009	B	Stairs	-	Railings	I	Steel	blue	-0.3	QM
007	B	Stairs	-	Treads	D	Steel	blue	-0.2	QM
020	C	Bollard	-		I	Steel	Yellow	-0.4	QM
021	C	Overhead Doo	-	Casing	I	Steel	grey	-0.6	QM
022	C	Overhead Doo	-	-	I	Steel	grey	-0.1	QM
006	C	Wall	-		I	Steel	white	-0.2	QM
018	C	Door	-	-	I	Steel	grey	-0.2	QM
019	C	Door	-	Lft casing	I	Steel	grey	-0.4	QM
016	D	Wall	-		I	Steel	white	-0.1	QM
Interior Room 002 1-57									
025	A	Wall	-		I	Steel	white	0.0	QM
026	B	Wall	-		I	Steel	white	-0.1	QM
027	C	Wall	-		I	Dry wall	white	-0.4	QM
028	D	Wall	-		I	Dry wall	white	-0.4	QM
029	D	Window	-	Rgt casing	I	Steel	red	-0.4	QM
030	D	Door	-	-	I	Steel	red	-0.3	QM
031	D	Door	-	Rgt casing	I	Steel	red	-0.2	QM
Interior Room 003 1-58									
032	A	Wall	-		I	Steel	white	-0.1	QM
033	B	Wall	-		I	Steel	white	-0.1	QM
039	B	Floor	-		D	Concrete	grey	-0.6	QM
038	B	Stairs	-	Stringers	D	Steel	blue	-0.4	QM
036	B	Stairs	-	Treads	D	Concrete	grey	-0.5	QM
037	B	Stairs	-	Risers	D	Steel	blue	-0.2	QM
035	C	Wall	-		I	CMU	white	-0.4	QM
034	D	Wall	-		I	Steel	white	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 004 1-60									
040	A	Wall	-		I	Dry wall	white	0.1	QM
041	B	Wall	-		I	Dry wall	white	-0.3	QM
042	C	Wall	-		I	Dry wall	white	-0.5	QM
043	D	Wall	-		I	Dry wall	white	-0.1	QM
Interior Room 005 1-61									
044	A	Wall	-		I	Dry wall	white	-0.2	QM
Interior Room 006 1-62									
045	C	Door	-	-	I	Wood	Varnish	-0.2	QM
046	C	Door	-	Rgt casing	I	Steel	white	0.0	QM
Interior Room 007 1-63									
047	A	Wall	-		I	Dry wall	white	-0.2	QM
053	A	Door	-	-	I	Wood	Varnish	-0.3	QM
054	A	Door	-	Rgt casing	I	Steel	white	-0.2	QM
048	B	Wall	-		I	Dry wall	white	-0.3	QM
049	C	Wall	-		I	Dry wall	white	-0.2	QM
052	C	Window	-	Rgt casing	I	Wood	Varnish	0.0	QM
051	C	Window	-	Sill	I	Wood	Varnish	0.0	QM
050	D	Wall	-		I	Dry wall	white	-0.8	QM
Interior Room 008 1-64									
055	A	Wall	-		I	Dry wall	white	-0.1	QM
056	C	Column	-		I	Steel	red	-0.4	QM
Interior Room 009 1-65									
063	-	Ceiling	-		I	Dry wall	white	-0.7	QM
057	A	Wall	-		I	Dry wall	white	-0.1	QM
062	A	Window	-	Rgt casing	I	Wood	Varnish	-0.2	QM
061	A	Window	-	Sill	I	Wood	Varnish	-0.2	QM
058	B	Wall	-		I	Dry wall	white	-0.4	QM
059	C	Wall	-		I	Dry wall	white	-0.4	QM
060	D	Wall	-		I	Dry wall	white	-0.2	QM
Interior Room 010 1-66									
064	A	Wall	-		I	Dry wall	white	-0.2	QM
065	B	Wall	-		I	Dry wall	white	-0.1	QM
066	C	Wall	-		I	Dry wall	white	-0.2	QM
067	D	Wall	-		I	Dry wall	white	-0.5	QM
Calibration Readings									
001								0.7	TC
002								0.7	TC
003								0.7	TC
068								0.8	TC
069								0.7	TC
070								0.6	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/22/24 08:47

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/22/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Ash Alley

SIGNED: _____ **Date:** 7/24/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/22/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/22/24 08:47	Hartford, CT
Total Readings:	219 Actionable: 59	
Job Started:	07/22/24 08:47	
Job Finished:	07/22/24 16:48	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 0-01									
013	A	Pipe	-		D	Steel	green	>9.9	QM
026	A	Stairs	Rgt	Railing	I	Steel	Yellow	>9.9	QM
008	B	Freight Door	-		D	Wood	green	>9.9	QM
020	B	Fuel Line	-		D	Steel	orange	2.1	QM
021	C	Fuel Line	-		D	Steel	orange	8.5	QM
022	C	Breeching	-	Interior	D	Steel	black	7.7	QM
015	C	Door	-	Rgt casing	D	Steel	grey	6.5	QM
025	D	Wall	L wer		D	Brick	green	3.8	QM
Interior Room 002 0-02									
036	B	Door	-	Rgt casing	D	Steel	tan	1.8	QM
032	C	Window	-	Sill	D	Steel	black	9.3	QM
031	C	Window	-	Lft casing	D	Steel	tan	6.5	QM
030	D	Wall	- -		D	Plaster	tan	3.2	QM
Interior Room 003 0-03									
038	B	Wall	- -		D	Plaster	white	2.2	QM
041	C	Window	-	Sill	D	Steel	black	7.6	QM
043	C	Door	-	Lft casing	D	Steel	white	2.1	QM
040	D	Wall	- -		D	Plaster	white	4.0	QM
Interior Room 004 0-04									
055	B	Door	-	Lft casing	D	Steel	Gold	2.4	QM
047	C	Window	Rgt	Rgt casing	D	Steel	white	7.9	QM
049	C	Door	-	Lft casing	D	Steel	tan	>9.9	QM
056	C	Column	-		D	Steel	white	3.2	QM
Interior Room 005 0-04C									
052	B	Door	-	-	D	Wood	green	>9.9	QM
Interior Room 007 0-06B									
065	A	Door	-	Lft casing	D	Steel	green	2.4	QM
061	B	Wall	- -		D	Terracotta	green	2.0	QM
Interior Room 008 0-07									
073	-	Column	-		D	Concrete	black	2.0	QM
081	C	Freight Door	-		D	Steel	black	>9.9	QM
067	C	Wall	- -		D	Brick	black	2.2	QM
079	C	Stairs	-	Stringers	D	Steel	Silver	8.9	QM
080	C	Stairs	-	Railings	D	Steel	Yellow	3.6	QM

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 009 0-08									
083	B	Door	-	Lft casing	D	Steel	Cream	>9.9	QM
090	D	Door	-	Rgt casing	D	Steel	Cream	>9.9	QM
Interior Room 012 1-09									
105	B	Door	-	Rgt casing	D	Concrete	green	>9.9	QM
Interior Room 013 1-10									
112	C	Window	Rgt	Sill	D	Cement	black	>9.9	QM
Interior Room 014 0-11									
114	A	Wall	L wer		D	Brick	green	1.9	QM
116	B	Wall	L wer		D	Brick	green	2.3	QM
124	B	Door	-	Lft casing	D	Steel	Silver	4.1	QM
118	C	Wall	L wer		D	Brick	green	1.9	QM
Interior Room 015 0-12 EL-36									
133	-	Vertical Pip	-		D	Steel	Silver	7.0	QM
125	A	Wall	- -		D	Brick	Silver	2.1	QM
135	B	Catwalk	-	Support	D	Steel	Silver	7.1	QM
127	B	Wall	L wer		D	Brick	green	1.7	QM
134	B	Door	-	Top Casing	D	Steel	green	>9.9	QM
Interior Room 016 0-13									
147	B	Door	-	-	D	Wood	green	2.5	QM
139	C	Stairs	-	Stringers	D	Steel	grey	9.8	QM
140	C	Stairs	-	Railings	D	Steel	Yellow	8.7	QM
142	D	Door	Upper	-	D	Steel	green	>9.9	QM
143	D	Door	Upper	Lft casing	D	Steel	green	>9.9	QM
Interior Room 017 0-14									
156	A	Column	-		D	Steel	Silver	2.1	QM
Interior Room 018 0-15									
161	B	Door	-	-	D	Steel	grey	8.2	QM
162	B	Door	-	Lft casing	D	Steel	grey	7.0	QM
Interior Room 020 ST-01									
171	-	Stairs	-	Stringers	D	Steel	tan	2.5	QM
173	-	Stairs	-	Railings	D	Steel	Yellow	3.7	QM
172	-	Stairs	-	Risers	D	Steel	Yellow	3.1	QM
Interior Room 021 0-17									
182	-	I Beam	-		D	Steel	black	3.1	QM
176	A	Wall	Lower		D	Concrete	green	3.6	QM
186	A	Closet	-	Door	D	Wood	green	1.7	QM
188	A	Closet	-	Wall	D	Wood	white	5.6	QM
178	B	Wall	Lower		D	Brick	green	2.3	QM

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
179	C	Wall	-		D	Concrete	green	3.9	QM
181	D	Wall	Lower		D	Brick	green	2.8	QM

Calibration Readings

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/22/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/22/24 08:47	Hartford, CT
Total Readings:	219	
Job Started:	07/22/24 08:47	
Job Finished:	07/22/24 16:48	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 0-01									
013	A	Pipe	-		D	Steel	green	>9.9	QM
004	A	Wall	U per		I	Brick	Silver	-0.1	QM
005	A	Wall	L wer		I	Brick	green	-0.2	QM
026	A	Stairs	Rgt	Railing	I	Steel	Yellow	>9.9	QM
008	B	Freight Door	-		D	Wood	green	>9.9	QM
020	B	Fuel Line	-		D	Steel	orange	2.1	QM
006	B	Wall	U per		I	Brick	Silver	-0.5	QM
007	B	Wall	L wer		I	Brick	green	-0.3	QM
012	C	Pipe	-		D	Steel	green	-0.1	QM
016	C	Tank	-	Casing	D	Steel	grey	-0.3	QM
017	C	Tank	-	Support Leg	D	Steel	grey	-0.4	QM
018	C	Tank	-	Dyke	D	Concrete	green	0.4	QM
021	C	Fuel Line	-		D	Steel	orange	8.5	QM
022	C	Breeching	-	Interior	D	Steel	black	7.7	QM
023	C	Breeching	-	Exterior	D	Steel	Silver	0.1	QM
009	C	Wall	U per		I	Terracotta	Silver	-0.1	QM
010	C	Wall	L wer		I	Terracotta	green	-0.3	QM
014	C	Door	-	-	I	Steel	grey	-0.3	QM
015	C	Door	-	Rgt casing	D	Steel	grey	6.5	QM
011	C	Column	-		I	Concrete	Silver	-0.3	QM
019	C	Column	-		D	Steel	Gold	0.0	QM
024	D	Wall	U per		D	Brick	Silver	-0.3	QM
025	D	Wall	L wer		D	Brick	green	3.8	QM
Interior Room 002 0-02									
027	A	Wall	- -		D	Plaster	tan	0.3	QM
028	B	Wall	- -		D	Plaster	tan	-0.1	QM
036	B	Door	-	Rgt casing	D	Steel	tan	1.8	QM
035	C	pipe	-		D	Steel	tan	0.0	QM
029	C	Wall	- -		D	Plaster	tan	-0.7	QM
032	C	Window	-	Sill	D	Steel	black	9.3	QM
031	C	Window	-	Lft casing	D	Steel	tan	6.5	QM
033	C	Door	-	-	D	Steel	tan	-0.4	QM
034	C	Door	-	Rgt casing	D	Steel	tan	-0.1	QM
030	D	Wall	- -		D	Plaster	tan	3.2	QM
Interior Room 003 0-03									
037	A	Wall	- -		D	Plaster	white	-0.3	QM
038	B	Wall	- -		D	Plaster	white	2.2	QM
039	C	Wall	- -		D	Plaster	white	-0.3	QM
041	C	Window	-	Sill	D	Steel	black	7.6	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
042	C	Door	-	-	D	Steel	blue	0.2	QM
043	C	Door	-	Lft casing	D	Steel	white	2.1	QM
040	D	Wall	- -		D	Plaster	white	4.0	QM
Interior Room 004 0-04									
044	A	Wall	- -		D	Concrete	Gold	-0.1	QM
045	B	Wall	- -		D	Concrete	Gold	-0.2	QM
054	B	Door	-	-	D	Steel	grey	-0.1	QM
055	B	Door	-	Lft casing	D	Steel	Gold	2.4	QM
047	C	Window	Rgt	Rgt casing	D	Steel	white	7.9	QM
048	C	Door	-	-	D	Steel	grey	-0.2	QM
049	C	Door	-	Lft casing	D	Steel	tan	>9.9	QM
056	C	Column	-		D	Steel	white	3.2	QM
046	D	Wall	- -		D	Concrete	Gold	-0.3	QM
Interior Room 005 0-04C									
051	A	Wall	- -		D	Terracotta	Silver	-0.3	QM
052	B	Door	-	-	D	Wood	green	>9.9	QM
053	B	Door	-	Lft casing	D	Steel	green	0.0	QM
050	D	Wall	- -		I	CMU	Silver	-0.1	QM
Interior Room 006 0-05									
057	A	Wall	- -		I	Terracotta	Cream	-0.2	QM
058	B	Wall	- -		D	Terracotta	white	-0.4	QM
059	C	Column	-		D	Concrete	Cream	0.0	QM
Interior Room 007 0-06B									
064	A	Door	-	-	D	Steel	green	-0.4	QM
065	A	Door	-	Lft casing	D	Steel	green	2.4	QM
061	B	Wall	- -		D	Terracotta	green	2.0	QM
060	C	Wall	- -		D	Terracotta	green	-0.3	QM
062	D	Wall	- -		D	Terracotta	Silver	0.0	QM
063	D	Window	Lft	Lft casing	D	Steel	green	0.0	QM
Interior Room 008 0-07									
074	-	Elevator	-	Framework	I	Steel	Yellow	-0.5	QM
075	-	Breeching	-	Exterior	D	Steel	black	0.0	QM
077	-	Equipment	-	Casing	D	Steel	black	-0.4	QM
073	-	Column	-		D	Concrete	black	2.0	QM
076	A	Equipment	-	Support	D	Steel	green	-0.3	QM
066	A	Wall	- -		D	Terracotta	Cream	-0.6	QM
069	B	Overhead Doo	-		I	Steel	grey	-0.1	QM
072	B	Wall	- -		I	Steel	white	-0.2	QM
070	B	Door	-	-	I	Steel	grey	0.0	QM
071	B	Door	-	Rgt casing	I	Steel	grey	-0.1	QM
081	C	Freight Door	-		D	Steel	black	>9.9	QM
067	C	Wall	- -		D	Brick	black	2.2	QM
079	C	Stairs	-	Stringers	D	Steel	Silver	8.9	QM
080	C	Stairs	-	Railings	D	Steel	Yellow	3.6	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
068	D	Wall	- -		D	Terracotta	grey	-0.2	QM
078	D	Door	-	-	D	Steel	Cream	-0.3	QM
Interior Room 009 0-08									
091	-	Column	Ctr		I	CMU	Cream	-0.2	QM
084	A	Wall	- -		I	CMU	Cream	-0.4	QM
085	B	Wall	- -		I	Terracotta	Cream	-0.2	QM
082	B	Door	-	-	D	Steel	Cream	0.3	QM
083	B	Door	-	Lft casing	D	Steel	Cream	>9.9	QM
086	C	Wall	- -		I	Concrete	Cream	-0.2	QM
088	C	Window	-	Casing	I	Steel	Brown	-0.2	QM
087	D	Wall	- -		I	Brick	Cream	0.0	QM
089	D	Door	-	-	D	Steel	grey	-0.2	QM
090	D	Door	-	Rgt casing	D	Steel	Cream	>9.9	QM
Interior Room 010 0-08B									
092	A	Wall	- -		I	Brick	Cream	-0.2	QM
093	B	Wall	- -		I	Dry wall	Cream	-0.1	QM
094	B	Window	-	Casing	I	Steel	Cream	-0.3	QM
095	C	Door	-	-	I	Steel	Cream	-0.5	QM
096	C	Door	-	Lft casing	I	Steel	Cream	-0.3	QM
Interior Room 011 0-08A									
097	A	Wall	- -		I	CMU	Cream	-0.2	QM
099	C	Door	-	-	I	Steel	grey	-0.3	QM
100	C	Door	-	Rgt casing	I	Steel	grey	0.0	QM
098	D	Wall	- -		I	Brick	Cream	-0.1	QM
Interior Room 012 1-09									
101	A	Wall	- -		D	CMU	green	-0.5	QM
102	B	Wall	- -		D	Brick	green	-0.2	QM
104	B	Door	-	-	I	Steel	grey	-0.2	QM
105	B	Door	-	Rgt casing	D	Concrete	green	>9.9	QM
103	C	Wall	- -		D	Brick	white	-0.2	QM
106	C	Window	-	Sill	D	Concrete	black	-0.5	QM
Interior Room 013 1-10									
109	A	Wall	- -		I	CMU	green	-0.3	QM
107	B	Door	-	-	I	Steel	grey	-0.2	QM
108	B	Door	-	Rgt casing	I	Steel	N/A	0.0	QM
110	C	Wall	- -		D	Brick	green	0.1	QM
112	C	Window	Rgt	Sill	D	Cement	black	>9.9	QM
111	D	Wall	- -		D	Brick	Cream	-0.5	QM
Interior Room 014 0-11									
113	A	Wall	U per		D	Brick	Silver	0.4	QM
114	A	Wall	L wer		D	Brick	green	1.9	QM
115	B	Wall	U per		D	Brick	Silver	0.3	QM
116	B	Wall	L wer		D	Brick	green	2.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
122	B	Door	-	Enclosure	D	Steel	Silver	-0.3	QM
123	B	Door	-	-	D	Steel	green	-0.2	QM
124	B	Door	-	Lft casing	D	Steel	Silver	4.1	QM
120	C	Air Compress	-	Casing	D	Steel	green	-0.1	QM
121	C	Air Compress	-	Pipe	D	Steel	green	-0.4	QM
117	C	Wall	U per		D	Brick	Silver	-0.1	QM
118	C	Wall	L wer		D	Brick	green	1.9	QM
119	D	Wall	U per		D	Brick	Silver	-0.4	QM
Interior Room 015 0-12 EL-36									
132	-	Guage Cluste	-	Back Panel	D	Steel	black	-0.5	QM
133	-	Vertical Pip	-		D	Steel	Silver	7.0	QM
125	A	Wall	- -		D	Brick	Silver	2.1	QM
135	B	Catwalk	-	Support	D	Steel	Silver	7.1	QM
126	B	Wall	U per		D	Brick	Silver	0.1	QM
127	B	Wall	L wer		D	Brick	green	1.7	QM
134	B	Door	-	Top Casing	D	Steel	green	>9.9	QM
130	C	Conduit	-		D	Steel	Silver	-0.1	QM
128	C	Wall	- -		D	Concrete	white	0.0	QM
129	C	Column	-		I	Concrete	Silver	-0.1	QM
131	C	Column	-		D	Steel	Silver	-0.1	QM
Interior Room 016 0-13									
138	A	Electric Pan	-	Casing	D	Steel	green	-0.4	QM
146	A	Verticle Pip	-		D	Steel	grey	-0.2	QM
136	A	Wall	- -		I	Brick	Glazed	0.0	QM
137	B	Wall	- -		D	Brick	white	0.7	TC
147	B	Door	-	-	D	Wood	green	2.5	QM
141	C	Beam	-		D	Steel	green	-0.3	QM
139	C	Stairs	-	Stringers	D	Steel	grey	9.8	QM
140	C	Stairs	-	Railings	D	Steel	Yellow	8.7	QM
144	D	Tank	-		I	Aluminum	N/A	-0.2	QM
145	D	Tank	-	Support	D	Aluminum	grey	0.8	TC
142	D	Door	Upper	-	D	Steel	green	>9.9	QM
143	D	Door	Upper	Lft casing	D	Steel	green	>9.9	QM
Interior Room 017 0-14									
155	A	Vertical Pip	Lft		D	Steel	Silver	0.1	QM
151	A	Wall	-		D	Brick	Silver	0.2	QM
156	A	Column	-		D	Steel	Silver	2.1	QM
154	B	Vertical Pip	-		D	Steel	Silver	-0.4	QM
153	C	Column	-		D	Concrete	white	-0.3	QM
152	D	Wall	-		D	Brick	Silver	-0.3	QM
Interior Room 018 0-15									
157	A	Wall	-		D	Brick	grey	0.0	QM
158	B	Wall	-		D	Brick	grey	-0.1	QM
161	B	Door	-	-	D	Steel	grey	8.2	QM
162	B	Door	-	Lft casing	D	Steel	grey	7.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
159	C	Wall	-		D	Concrete	grey	-0.2	QM
160	C	Column	-		D	Concrete	grey	0.2	QM
Interior Room 019 0-16									
163	A	Wall	-		I	Brick	Glazed	-0.2	QM
165	A	Door	-	-	I	Steel	grey	-0.3	QM
166	A	Door	-	Lft casing	I	Steel	grey	-0.3	QM
164	D	Cabinet	-	Door	I	Steel	red	-0.1	QM
Interior Room 020 ST-01									
171	-	Stairs	-	Stringers	D	Steel	tan	2.5	QM
173	-	Stairs	-	Railings	D	Steel	Yellow	3.7	QM
172	-	Stairs	-	Risers	D	Steel	Yellow	3.1	QM
174	A	Vertical Pip	-		I	Steel	red	-0.5	QM
167	A	Wall	-		D	Concrete	tan	-0.4	QM
168	B	Wall	-		D	Concrete	tan	0.0	QM
169	C	Wall	-		D	Brick	tan	-0.4	QM
170	D	Wall	-		D	Brick	tan	-0.1	QM
Interior Room 021 0-17									
182	-	I Beam	-		D	Steel	black	3.1	QM
189	-	Steam Main	-	Outer Case	D	Steel	Silver	-0.4	QM
185	A	Cabinet	-	Casing	D	Wood	Silver	-0.4	QM
175	A	Wall	Upper		D	Concrete	Silver	0.3	QM
176	A	Wall	Lower		D	Concrete	green	3.6	QM
186	A	Closet	-	Door	D	Wood	green	1.7	QM
188	A	Closet	-	Wall	D	Wood	white	5.6	QM
187	A	Closet	-	Shelf Sup.	D	Wood	white	-0.6	QM
177	B	Wall	Upper		D	Brick	Silver	0.1	QM
178	B	Wall	Lower		D	Brick	green	2.3	QM
183	C	Overhead Pip	-		D	Steel	green	-0.1	QM
184	C	Vertical Pip	-		D	Steel	Silver	-0.1	QM
179	C	Wall	-		D	Concrete	green	3.9	QM
180	D	Wall	Upper		D	Brick	Silver	0.3	QM
181	D	Wall	Lower		D	Brick	green	2.8	QM
Interior Room 022 0-18 EL-31									
197	-	Door	-	-	D	Steel	grey	0.0	QM
198	-	Door	-	Lft casing	D	Steel	grey	-0.2	QM
196	-	Column	-		D	Steel	white	-0.6	QM
199	A	I Beam	-		I	Steel	tan	-0.3	QM
190	A	Wall	-		D	Concrete	white	0.0	QM
191	B	Wall	-		D	Concrete	white	0.0	QM
194	C	Overhead Doo	-		D	Steel	grey	-0.4	QM
195	C	Overhead Doo	-	Casing	D	Steel	black	-0.4	QM
192	C	Wall	-		D	Concrete	white	-0.2	QM
201	C	Stairs	-	Stringers	D	Steel	Cream	-0.2	QM
202	C	Stairs	-	Stringers	D	Steel	Cream	-0.4	QM
200	D	Overhead Pip	-		D	Steel	white	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
193	D	Wall	-		D	CMU	white	0.1	QM
Interior Room 023 0-18 E									
208	A	Electric Mot	-	Casing	I	Steel	blue	-0.2	QM
205	B	Wall	-		I	Steel	white	-0.3	QM
206	C	Wall	-		I	Steel	white	-0.1	QM
203	C	Door	-	Header	D	Steel	Cream	-0.3	QM
204	C	Door	-	Rgt casing	D	Steel	Cream	-0.2	QM
207	D	Wall	-		I	Steel	white	0.0	QM
Interior Room 024 0-18 EL-36									
209	A	Wall	-		I	Brick	Cream	0.1	QM
210	D	Wall	-		I	Brick	Cream	0.1	QM
Interior Room 025 0-19									
216	-	Cation Tank	-		D	Steel	green	-0.3	QM
211	A	Wall	-		I	CMU	white	-0.1	QM
213	A	Door	-	-	D	Steel	grey	-0.2	QM
214	A	Door	-	Lft casing	D	Steel	grey	0.1	QM
212	B	Wall	-		I	CMU	white	-0.1	QM
215	D	Wall	-		I	Concrete	green	0.1	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.1	TC
148								1.0	TC
149								1.1	TC
150								1.1	TC
217								1.2	TC
218								1.1	TC
219								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/15/24 12:24

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Ash Loadout
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/15/24

INSTRUMENT TYPE: RMD
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility - Ash Loadout
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 12:24	Hartford, CT
Total Readings:	19 Actionable: 0	
Job Started:	08/15/24 12:24	
Job Finished:	08/15/24 14:35	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility - Ash Loadout
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 12:24	Hartford, CT
Total Readings:	19	
Job Started:	08/15/24 12:24	
Job Finished:	08/15/24 14:35	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
005	-	Bollard	-		D	Steel	Yellow	-0.2	QM
006	-	Blower	-	Casing	D	Steel	Silver	-0.3	QM
007	-	Blower	-	Support	D	Steel	Silver	-0.3	QM
008	-	Ladder	-		D	Steel	white	-0.4	QM
009	-	N/A	-		I	Steel	Silver	-0.6	QM
Exterior Room 002 Facade D									
004	-	Door	-	Lft casing	D	Steel	Silver	0.2	QM
Exterior Room 003 Conveyor									
011	-	Vent Fan	-	Casing	D	Steel	Silver	-0.5	QM
012	-	Vent Fan	-	Casing	D	Steel	blue	-0.3	QM
013	-	Electric Mot	-	Casing	D	Steel	green	-0.4	QM
014	-	Odor Control	-	Support	D	Steel	Yellow	-0.5	QM
016	-	Facade D	-		I	Steel	red	-0.3	QM
010	A	Catwalk	-	Support	D	Steel	Yellow	-0.4	QM
015	D	Door	-	-	D	Steel	grey	-0.2	QM
Calibration Readings									
001								1.0	TC
002								1.1	TC
003								1.1	TC
017								1.1	TC
018								1.1	TC
019								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/15/24 09:39

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/15/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Bag Houses and Dry Scrubbers

SIGNED: _____ **Date:** 7/24/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/15/24	MIRA
Report Date:	7/24/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/15/24 09:39	Hartford, CT
Total Readings:	22 Actionable: 0	
Job Started:	07/15/24 09:39	
Job Finished:	07/15/24 13:27	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/15/24	MIRA
Report Date:	7/24/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/15/24 09:39	Hartford, CT
Total Readings:	22	
Job Started:	07/15/24 09:39	
Job Finished:	07/15/24 13:27	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Bag HS 1									
011	-	Roof Motor	-	Casing	D	Steel	Yellow	-0.1	QM
013	-	Ventilation	-	Shaft	D	Steel	tan	-0.4	QM
007	A	Bollard	-		D	Steel	red	-0.6	QM
006	B	Conveyor	-	Casing	D	Steel	grey	-0.5	QM
005	B	Catwalk	Lft	Ladder	I	Steel	Yellow	-0.4	QM
008	B	Catwalk	Rgt	Ladder	D	Steel	tan	-0.5	QM
004	B	Column	-		D	Steel	tan	-0.3	QM
010	D	Outer Shell	-		I	Steel	grey	-0.1	QM
012	D	Inner Shell	-	Casing	D	Steel	red	-0.3	QM
009	D	Door	Rgt	-	D	Steel	grey	-0.4	QM
Exterior Room 002 Bag HS 2									
016	A	Conveyor	-	Framework	D	Steel	tan	-0.4	QM
017	A	Slurry Rm	-	Door	D	Steel	grey	-0.1	QM
015	B	Hopper	-	Casing	I	Steel	grey	-0.1	QM
014	B	Column	-		D	Steel	grey	-0.4	QM
Exterior Room 003 Scrub 1									
019	A	Intake Fan	-	Motor	I	Steel	green	-0.5	QM
018	C	Column	-		I	Steel	tan	-0.4	QM
Calibration Readings									
001								1.3	TC
002								1.2	TC
003								1.2	TC
020								0.8	TC
021								0.8	TC
022								0.9	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 10/01/24 12:29

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 10/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 2753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Coal Pond Pump House

SIGNED: _____ **Date:** 10/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 12:29	Hartford, CT
Total Readings:	20 Actionable: 0	
Job Started:	10/01/24 12:29	
Job Finished:	10/01/24 13:28	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 12:29	Hartford, CT
Total Readings:	20	
Job Started:	10/01/24 12:29	
Job Finished:	10/01/24 13:28	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade C									
013	-	Wall	U -		D	Metal	tan	-0.1	QM
016	-	Wall	L -		I	N/A	tan	-0.1	QM
015	-	Door	-	Casing	I	Metal	blue	-0.4	QM
014	-	Door	-	Header	I	Metal	blue	-0.3	QM
Interior Room 001 1-01									
010	-	Pipe	-		I	Steel	grey	-0.1	QM
011	-	Door	-	-	D	Steel	grey	-0.1	QM
012	-	Door	-	Rgt casing	D	Steel	Brown	-0.1	QM
004	A	Wall	-		D	Steel	white	-0.1	QM
005	B	Wall	-		D	Steel	white	0.0	QM
006	B	Baseboard	-		D	Steel	red	-0.4	QM
007	C	Wall	-		D	Steel	white	-0.1	QM
008	D	Wall	-		D	Steel	white	-0.1	QM
009	D	Window	-	Lft casing	D	Steel	white	0.2	QM
Calibration Readings									
001								1.2	TC
002								1.3	TC
003								1.1	TC
017								-0.1	QM
018								1.1	TC
019								1.1	TC
020								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/17/24 08:29

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/17/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Boilers 9 & 10

SIGNED: _____ **Date:** 7/24/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/17/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/17/24 08:29	Hartford, CT
Total Readings:	48 Actionable: 25	
Job Started:	07/17/24 08:29	
Job Finished:	07/17/24 16:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Boiler 9-L2									
003								1.1	TC
004	B	Outer Casing	-		I	Steel	Silver	4.1	QM
021	B	Outer Casing	Lft		I	Steel	silver	3.8	QM
040	C	Fuel Supply	-	Pipes	D	Steel	orange	2.9	QM
Interior Room 002 Boiler 9-L1									
001								1.0	TC
002								1.0	TC
006	B	Outer Casing	-	Cornerboard	D	Steel	Silver	5.7	QM
011	B	Boiler Openi	-	Casing	D	Steel	Silver	4.2	QM
019	B	Column	Lft		D	Steel	green	3.0	QM
020	B	Column	Rgt		D	Steel	green	1.8	QM
027	C	Catwalk	-	Support Leg	D	Steel	green	4.9	QM
009	D	Outer Casing	-	Cornerboard	D	Steel	Silver	4.0	QM
016	D	Column	Lft		D	Steel	green	9.3	QM
018	D	Column	Ctr	Cross Beam	D	Steel	green	1.8	QM
017	D	Column	Rgt		D	Steel	green	3.2	QM
Interior Room 003 Boiler 9-L3									
024	D	Outer Casing	Rgt		D	Steel	silver	3.1	QM
Interior Room 005 Boiler10-L1									
028								1.0	TC
029								1.0	TC
030								1.0	TC
036	B	Boiler Openi	-	Casing	I	Steel	Silver	2.0	QM
045	B	Fuel Line	-	Pipe	D	Steel	orange	7.0	QM
035	D	Boiler Openi	-	Casing	I	Steel	Silver	3.0	QM
Interior Room 006 Boiler10-L2									
042	B	Outer Casing	Lft		I	Steel	silver	5.2	QM
043	B	Fuel Supply	Lft	Pipes	D	Steel	orange	3.3	QM
039	C	Fuel Supply	-	Pipes	D	Steel	orange	2.4	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/17/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/17/24 08:29	Hartford, CT
Total Readings:	48	
Job Started:	07/17/24 08:29	
Job Finished:	07/17/24 16:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 Boiler 9-L2									
003								1.1	TC
004	B	Outer Casing	-		I	Steel	Silver	4.1	QM
021	B	Outer Casing	Lft		I	Steel	silver	3.8	QM
040	C	Fuel Supply	-	Pipes	D	Steel	orange	2.9	QM
Interior Room 002 Boiler 9-L1									
001								1.0	TC
002								1.0	TC
008	A	Outer Casing	-		D	Steel	Silver	-0.2	QM
006	B	Outer Casing	-	Cornerboard	D	Steel	Silver	5.7	QM
007	B	Outer Casing	-		D	Steel	Silver	-0.2	QM
011	B	Boiler Openi	-	Casing	D	Steel	Silver	4.2	QM
012	B	Catwalk	-	Framework	D	Steel	green	-0.4	QM
013	B	Steam Lines	-	Casing	I	Aluminum	Silver	-0.5	QM
019	B	Column	Lft		D	Steel	green	3.0	QM
020	B	Column	Rgt		D	Steel	green	1.8	QM
005	C	Outer Casing	-		D	Steel	Silver	-0.2	QM
014	C	Gauge Cluste	-		D	Steel	black	-0.4	QM
027	C	Catwalk	-	Support Leg	D	Steel	green	4.9	QM
009	D	Outer Casing	-	Cornerboard	D	Steel	Silver	4.0	QM
010	D	Outer Casing	-		D	Steel	Silver	-0.3	QM
015	D	Boiler Openi	-	Casing	D	Steel	silver	-0.1	QM
016	D	Column	Lft		D	Steel	green	9.3	QM
018	D	Column	Ctr	Cross Beam	D	Steel	green	1.8	QM
017	D	Column	Rgt		D	Steel	green	3.2	QM
Interior Room 003 Boiler 9-L3									
023	C	Outer Casing	Lft		D	Steel	silver	-0.3	QM
022	C	Outer Casing	Rgt		D	Steel	silver	-0.5	QM
025	D	Outer Casing	Ctr	Horz. I-Bm	D	Steel	silver	-0.5	QM
024	D	Outer Casing	Rgt		D	Steel	silver	3.1	QM
Interior Room 004 Boiler 9-L4									
026	D	Outer Casing	Lft		D	Steel	silver	-0.2	QM
Interior Room 005 Boiler10-L1									
028								1.0	TC
029								1.0	TC
030								1.0	TC
033	A	Outer Casing	-		I	Steel	Silver	-0.5	QM
032	B	Outer Casing	-	Cornerboard	I	Steel	Silver	0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
036	B	Boiler Openi	-	Casing	I	Steel	Silver	2.0	QM
045	B	Fuel Line	-	Pipe	D	Steel	orange	7.0	QM
031	C	Outer Casing	-		I	Steel	Silver	-0.2	QM
037	C	Gauge Cluste	-	Panel	D	Steel	black	-0.7	QM
034	D	Outer Casing	-		I	Steel	Silver	-0.4	QM
035	D	Boiler Openi	-	Casing	I	Steel	Silver	3.0	QM
Interior Room 006 Boiler10-L2									
042	B	Outer Casing	Lft		I	Steel	silver	5.2	QM
043	B	Fuel Supply	Lft	Pipes	D	Steel	orange	3.3	QM
044	B	Outer Casing	Ctr		I	Steel	silver	-0.1	QM
038	C	Outer Casing	-		D	Steel	silver	-0.3	QM
039	C	Fuel Supply	-	Pipes	D	Steel	orange	2.4	QM
041	D	Outer Casing	-		I	Steel	silver	-0.2	QM
Calibration Readings									
046								1.0	TC
047								1.1	TC
048								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 07/23/24 08:31

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/23/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Boiler Area and Building Interiors at
Combustion Units 11, 12, & 13

SIGNED: _____ **Date:** 7/24/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/23/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/23/24 08:31	Hartford, CT
Total Readings:	88 Actionable: 25	
Job Started:	07/23/24 08:31	
Job Finished:	07/23/24 16:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 004 0-21									
033	D	Door	-	Lft casing	D	Steel	grey	5.3	QM
Interior Room 006 2-27 EL-57									
042	A	Wall	-		I	Brick	Silver	2.0	QM
053	A	Door	Rgt	Header	D	Steel	green	>9.9	QM
054	A	Door	Rgt	Lft casing	D	Steel	green	6.1	QM
052	A	Column	-		D	Steel	green	8.0	QM
055	A	Column	Upper		D	Steel	Silver	3.0	QM
045	B	Wall	Upper		D	Brick	Silver	3.2	QM
044	B	Wall	Lower		D	Brick	green	4.4	QM
047	B	Window	-	Rgt casing	D	Steel	green	3.5	QM
043	B	Column	-		D	Steel	green	2.0	QM
049	C	Freight Door	-		D	Wood	green	6.2	QM
048	C	Wall	Lower		D	Terracotta	green	1.5	QM
050	C	Column	-		D	Steel	green	4.6	QM
Interior Room 007 2-28									
057	A	Wall	-		D	Plaster	green	3.9	QM
058	B	Wall	-		D	Brick	green	4.1	QM
059	D	Wall	-		D	Plaster	green	4.6	QM
Interior Room 008 2-29									
067	-	Column	Ctr		D	Steel	green	2.8	QM
063	A	Wall	-		D	Steel	green	4.3	QM
072	A	Wall	E -		D	Steel	Silver	2.7	QM
064	B	Wall	-		D	Steel	green	4.4	QM
065	C	Wall	-		D	Steel	green	5.5	QM
073	C	Wall	E -		D	Steel	Silver	4.9	QM
069	C	Window	-	Lft casing	D	Steel	green	1.8	QM
070	C	Door	-	Lft casing	D	Steel	green	4.7	QM
066	D	Wall	-		D	Steel	green	5.6	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/23/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/23/24 08:31	Hartford, CT
Total Readings:	88	
Job Started:	07/23/24 08:31	
Job Finished:	07/23/24 16:08	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 0-20									
004	A	Wall	Upper		I	Brick	Cream	-0.3	QM
005	A	Wall	Lower		I	Concrete	green	-0.2	QM
010	A	Door	-	-	I	Steel	grey	-0.3	QM
011	A	Door	-	Lft casing	I	Steel	grey	-0.1	QM
006	B	Wall	Upper		I	Brick	Cream	-0.3	QM
007	B	Wall	Lower		I	Concrete	green	0.0	QM
008	C	Wall	Upper		I	CMU	Cream	0.1	QM
009	C	Wall	Lower		I	CMU	green	0.0	QM
Interior Room 002 0-22									
017	-	Ceiling	-	I Beam	I	Steel	Cream	-0.2	QM
018	-	Ceiling	-	Roof Deck	I	Steel	Cream	-0.2	QM
019	-	Column	Ctr		I	Steel	Cream	0.3	QM
012	A	Wall	-		I	CMU	Cream	-0.5	QM
013	B	Wall	-		I	CMU	Cream	-0.2	QM
016	C	Shelving	-	Structure	I	Steel	green	-0.3	QM
025	C	Overhead Doo	-		I	Steel	white	0.1	QM
014	C	Wall	-		I	CMU	Cream	0.0	QM
015	D	Wall	-		I	CMU	Cream	-0.2	QM
Interior Room 003 0-23									
022	-	Floor	-		D	Concrete	grey	-0.7	QM
020	A	Wall	-		I	Panel	white	-0.2	QM
021	B	Wall	-		I	CMU	white	-0.2	QM
023	D	Door	-	-	I	Steel	tan	0.0	QM
024	D	Door	-	Lft casing	I	Steel	tan	0.0	QM
Interior Room 004 0-21									
026	A	Wall	-		D	CMU	Cream	0.1	QM
027	B	Wall	-		D	CMU	Cream	-0.1	QM
028	D	Wall	-		D	Brick	Cream	-0.3	QM
030	D	Window	-	Rgt casing	D	Steel	Cream	-0.2	QM
031	D	Window	-	Sash	D	Steel	Cream	-0.4	QM
029	D	Window	-	Sill	D	Cement	Cream	-0.5	QM
032	D	Door	-	-	D	Steel	grey	-0.1	QM
033	D	Door	-	Lft casing	D	Steel	grey	5.3	QM
Interior Room 005 1-26 EL-45									
040	-	Ceiling	-	CCCW Pipe	D	Steel	blue	-0.2	QM
036	A	Wall	-		I	Brick	Cream	-0.1	QM
035	A	Column	-		I	Steel	Cream	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
037	B	Elevator	-	Door	D	Steel	Cream	-0.5	QM
038	B	Elevator	-	Door Casing	D	Steel	grey	-0.2	QM
039	B	Elevator	-	Siding	I	Steel	red	-0.5	QM
041	C	Railing	-	-	D	Steel	Yellow	-0.2	QM
034	C	Column	-		D	Steel	grey	0.0	QM
Interior Room 006 2-27 EL-57									
051	A	Steam Main	-	Outer Case	D	Steel	Silver	0.0	QM
056	A	Vertical Pip	-		D	Steel	Silver	0.0	QM
042	A	Wall	-		I	Brick	Silver	2.0	QM
053	A	Door	Rgt	Header	D	Steel	green	>9.9	QM
054	A	Door	Rgt	Lft casing	D	Steel	green	6.1	QM
052	A	Column	-		D	Steel	green	8.0	QM
055	A	Column	Upper		D	Steel	Silver	3.0	QM
045	B	Wall	Upper		D	Brick	Silver	3.2	QM
044	B	Wall	Lower		D	Brick	green	4.4	QM
047	B	Window	-	Rgt casing	D	Steel	green	3.5	QM
046	B	Window	-	Sill	D	Cement	black	0.2	QM
043	B	Column	-		D	Steel	green	2.0	QM
049	C	Freight Door	-		D	Wood	green	6.2	QM
048	C	Wall	Lower		D	Terracotta	green	1.5	QM
050	C	Column	-		D	Steel	green	4.6	QM
Interior Room 007 2-28									
057	A	Wall	-		D	Plaster	green	3.9	QM
058	B	Wall	-		D	Brick	green	4.1	QM
059	D	Wall	-		D	Plaster	green	4.6	QM
Interior Room 008 2-29									
067	-	Column	Ctr		D	Steel	green	2.8	QM
068	A	Chemical Tan	-	Outer Case	D	Steel	Silver	-0.3	QM
063	A	Wall	-		D	Steel	green	4.3	QM
072	A	Wall	E	-	D	Steel	Silver	2.7	QM
064	B	Wall	-		D	Steel	green	4.4	QM
065	C	Wall	-		D	Steel	green	5.5	QM
073	C	Wall	E	-	D	Steel	Silver	4.9	QM
069	C	Window	-	Lft casing	D	Steel	green	1.8	QM
070	C	Door	-	Lft casing	D	Steel	green	4.7	QM
066	D	Wall	-		D	Steel	green	5.6	QM
071	D	Wall	E	-	D	Steel	black	-0.5	QM
Interior Room 009 2-33									
074	A	Wall	-		I	Dry wall	white	-0.2	QM
078	A	Door	-	-	I	Steel	grey	-0.1	QM
079	A	Door	-	Rgt casing	I	Steel	white	-0.2	QM
075	B	Wall	-		I	Dry wall	white	-0.3	QM
077	C	Window	-	Rgt casing	I	Steel	white	-0.5	QM
076	D	Wall	-		I	Dry wall	white	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 010 2-31									
080	A	Wall	-		I	Dry wall	grey	-0.5	QM
084	A	Door	-	-	I	Steel	grey	-0.2	QM
085	A	Door	-	Rgt casing	I	Steel	grey	-0.4	QM
081	B	Wall	-		I	Dry wall	grey	-0.1	QM
082	C	Wall	-		I	Dry wall	grey	-0.4	QM
083	D	Wall	-		I	Dry wall	grey	-0.4	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.1	TC
060								1.1	TC
061								1.0	TC
062								1.1	TC
086								1.2	TC
087								1.2	TC
088								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 07/25/24 08:24

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/25/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Building Interiors at Combustion Units 11, 12, & 13

SIGNED: _____ **Date:** 7/28/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/25/24	MIRA
Report Date:	7/28/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/25/24 08:24	Hartford, CT
Total Readings:	59 Actionable: 6	
Job Started:	07/25/24 08:24	
Job Finished:	07/25/24 16:14	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 2-35									
004	A	Column	-		D	Steel	green	5.4	QM
005	C	Column	-		D	Steel	green	>9.9	QM
Interior Room 011 7-45									
055	A	Door	-	Rgt casing	D	Steel	green	>9.9	QM
053	C	Window	-	Rgt casing	D	Steel	green	7.9	QM
052	C	Column	-		D	Steel	green	>9.9	QM
Interior Room 012 7-46									
051	A	Door	-	Rgt casing	D	CMU	green	>9.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/25/24	MIRA
Report Date:	7/28/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/25/24 08:24	Hartford, CT
Total Readings:	59	
Job Started:	07/25/24 08:24	
Job Finished:	07/25/24 16:14	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 2-35									
007	A	Railing	-	-	D	Steel	Yellow	-0.2	QM
004	A	Column	-		D	Steel	green	5.4	QM
006	C	Wall	-		D	CMU	Silver	-0.4	QM
005	C	Column	-		D	Steel	green	>9.9	QM
008	D	I Beam	-		I	Steel	Cream	-0.3	QM
Interior Room 002 2-36 EL-55									
013	A	Blower	-	Casing	D	Steel	Cream	-0.5	QM
014	A	Blower Motor	-	Casing	D	Steel	blue	-0.3	QM
009	A	Wall	-		I	Brick	Cream	0.2	QM
010	B	Wall	-		I	Brick	Cream	0.1	QM
011	C	Wall	-		D	Panel	Cream	-0.1	QM
012	D	Wall	-		D	Brick	Cream	-0.2	QM
Interior Room 003 2-37									
016	A	Door	-	-	I	Steel	Cream	-0.2	QM
017	A	Door	-	Rgt casing	I	Steel	Cream	-0.1	QM
015	D	Wall	-		I	CMU	Cream	-0.3	QM
Interior Room 004 2-38									
018	A	Wall	-		I	CMU	Cream	0.1	QM
019	B	Wall	-		I	CMU	Cream	0.0	QM
022	D	Cabinet	-	Door	I	Steel	Cream	-0.1	QM
020	D	Door	-	-	D	Steel	Cream	-0.1	QM
021	D	Door	-	Lft casing	D	Steel	Cream	-0.2	QM
Interior Room 005 3-39 EL-64									
024	A	Wall	-		D	Brick	Cream	0.2	QM
027	A	Column	-		D	Steel	Yellow	-0.3	QM
023	B	Column	-		I	Steel	Cream	-0.3	QM
028	C	Wall	-		D	Steel	red	-0.2	QM
025	D	Wall	-		D	Brick	Cream	0.2	QM
026	D	Stairs	-	Stringers	D	Steel	Cream	0.0	QM
Interior Room 006 4-40 EL-77									
030	-	Chute	Ctr	Casing	D	Steel	Cream	-0.6	QM
031	-	Column	Ctr		D	Steel	Cream	-0.3	QM
029	D	Wall	-		I	Panel	Cream	-0.3	QM
Interior Room 007 5-41 EL-89									
033	A	Catwalk	-	Support Leg	D	Steel	Cream	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
032	A	Wall	-		D	Brick	Cream	-0.2	QM
034	D	Window	-	Lft casing	D	Steel	Cream	-0.3	QM
Interior Room 008 5-42 EL-89									
035	C	Door	-	-	D	Steel	grey	-0.1	QM
036	C	Door	-	Rgt casing	D	Steel	grey	-0.1	QM
Interior Room 009 6-43									
037	C	Wall	-		D	Steel	black	0.0	QM
038	D	Wall	-		D	Brick	Cream	0.3	QM
Interior Room 010 6-44									
046	-	Auger Bin 12	-	Casing	D	Steel	red	-0.3	QM
047	-	Auger Bin 12	-	Motor Case	D	Steel	Yellow	-0.2	QM
048	-	Auger Bin 12	-	Framework	D	Steel	Cream	-0.4	QM
043	A	Wall	-		D	Steel	red	-0.3	QM
044	A	Door	-	-	D	Steel	Cream	-0.3	QM
045	A	Door	-	Rgt casing	D	Steel	grey	-0.3	QM
042	C	Wall	-		D	Panel	red	0.0	QM
Interior Room 011 7-45									
049	A	Wall	-		D	Brick	Silver	-0.1	QM
054	A	Door	-	-	D	Steel	green	-0.1	QM
055	A	Door	-	Rgt casing	D	Steel	green	>9.9	QM
053	C	Window	-	Rgt casing	D	Steel	green	7.9	QM
052	C	Column	-		D	Steel	green	>9.9	QM
056	D	Wall	-		D	CMU	Silver	-0.3	QM
Interior Room 012 7-46									
050	A	Wall	-		D	CMU	Silver	-0.1	QM
051	A	Door	-	Rgt casing	D	CMU	green	>9.9	QM
Calibration Readings									
001								1.1	TC
002								1.0	TC
003								1.0	TC
039								1.3	TC
040								1.0	TC
041								1.1	TC
057								1.2	TC
058								1.1	TC
059								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 07/15/24 13:29

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/15/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Combustion Units 11, 12, 13

SIGNED: _____ **Date:** 7/24/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/15/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/15/24 13:29	Hartford, CT
Total Readings:	51 Actionable: 2	
Job Started:	07/15/24 13:29	
Job Finished:	07/16/24 15:42	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 003 CU-11 EL-45									
014	D	MCC-421	-		D	Steel	Yellow	2.7	QM
Interior Room 007 CU-11 EL-77									
033	D	Electric Sca	-	Motor Case	I	Steel	orange	2.0	QM
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/15/24	MIRA
Report Date:	7/24/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/15/24 13:29	Hartford, CT
Total Readings:	51	
Job Started:	07/15/24 13:29	
Job Finished:	07/16/24 15:42	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 CU-11 EL-31									
007	A	Catwalk	-	Framework	D	Steel	tan	-0.4	QM
008	A	Expansion Ta	-	Hatch	D	Steel	red	-0.3	QM
004	B	Super Struct	-	Column	D	Steel	tan	-0.4	QM
006	B	Conveyor	-	Casing	D	Steel	grey	-0.3	QM
005	C	Conveyor	-	Casing	D	Steel	Yellow	-0.4	QM
Interior Room 002 CU-11 EL-36									
010	-	Pipe	-	Casing	I	Steel	black	-0.2	QM
011	-	Elevator	-	Door	I	Steel	white	-0.1	QM
009	A	Outer Shell	-	Casing	I	Steel	tan	-0.4	QM
012	A	Elevator	-	Wall	D	Steel	red	0.2	QM
Interior Room 003 CU-11 EL-45									
015	A	Stack	-	Hatch	D	Steel	tan	-0.3	QM
016	B	Electric Mot	-	Casing	D	Steel	grey	-0.1	QM
017	C	MCC-421	-	Oil Tank	D	Steel	green	-0.2	QM
013	D	Super Struct	-	I Beam	D	Steel	tan	-0.3	QM
014	D	MCC-421	-		D	Steel	Yellow	2.7	QM
018	D	Gearbox	-	Casing	I	Steel	blue	-0.1	QM
Interior Room 004 CU-11 EL-55									
019	B	Air Nozzle	-	Casing	D	Steel	silver	-0.2	QM
020	B	Column	-		I	Steel	tan	-0.5	QM
Interior Room 005 CU-11 EL-64									
027	A	Damper	-	Hatch Plate	D	Steel	grey	-0.4	QM
028	A	Fuel Chute	-	Support	D	Steel	grey	-0.8	QM
029	A	Fuel Chute	-	Casing	D	Steel	black	-0.5	QM
030	B	Column	-		I	Steel	tan	-0.4	QM
Interior Room 006 CU-11 EL-73									
031	C	Column	-		I	Steel	tan	-0.3	QM
Interior Room 007 CU-11 EL-77									
034	-	Verticle Duc	-	Casing	D	Steel	tan	-0.4	QM
035	B	Stairs	-	Wall	D	Steel	Yellow	-0.1	QM
032	C	Electric Sca	-	Casing	I	Steel	tan	-0.4	QM
033	D	Electric Sca	-	Motor Case	I	Steel	orange	2.0	QM
Interior Room 008 CU-11 EL-89									
037	B	Column	-		I	Steel	tan	-0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
036	C	Hopper	-	Casing	I	Steel	tan	-0.4	QM
038	C	I Beam	-		D	Steel	Yellow	0.0	QM
Interior Room 009 CU-11EL-104									
039	-	Piping	-		D	Steel	red	0.2	QM
040	C	Column	-		I	Steel	tan	-0.3	QM
Interior Room 010 CU-11EL-116									
041	C	Column	-		I	Steel	orange	-0.3	QM
Interior Room 011 CU-11EL-125									
042	B	Feedwater	-	Actuator	I	Steel	green	-0.4	QM
043	B	Column	-		D	Steel	Gold	-0.3	QM
Interior Room 012 CU-13 EL-45									
047	D	Ash Screw	-	Casing	I	Steel	green	-0.5	QM
048	D	Ash Screw	-	Motor Case	I	Steel	gold	-0.1	QM
Calibration Readings									
001								0.8	TC
002								0.9	TC
003								0.9	TC
021								1.0	TC
022								1.0	TC
023								1.0	TC
024								1.1	TC
025								1.1	TC
026								1.1	TC
044								0.9	TC
045								0.8	TC
046								0.8	TC
049								1.2	TC
050								1.1	TC
051								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 10/02/24 13:10

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 10/02/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 2753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
De-Mineralization Shack

SIGNED: _____ **Date:** 10/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/02/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/02/24 13:10	Hartford, CT
Total Readings:	14	
Job Started:	10/02/24 13:10	
Job Finished:	10/02/24 13:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
010	B	Door	-	-	I	Metal	red	-0.3	QM
011	B	Door	-	Rgt casing	I	Metal	red	-0.4	QM
Interior Room 001 1-01									
008	-	Ceiling	-		I	Wood	white	-0.5	QM
004	A	Wall	-		I	Wood	white	-0.1	QM
005	B	Wall	-		I	Wood	white	-0.5	QM
006	C	Wall	-		I	Wood	white	0.0	QM
009	C	Window	-	Rgt casing	I	Wood	white	-0.3	QM
007	D	Wall	-		I	Wood	white	-0.3	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.1	TC
012								1.0	TC
013								1.1	TC
014								1.1	TC

---- End of Readings ----

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/02/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/02/24 13:10	Hartford, CT
Total Readings:	14 Actionable: 0	
Job Started:	10/02/24 13:10	
Job Finished:	10/02/24 13:39	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 10/01/24 09:15

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Gate 40 Warehouse
300 Maxim Road
Hartford, CT

INSPECTION DATE: 10/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 2753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 10/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Gate 40 Warehouse
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 09:15	Hartford, CT
Total Readings:	50 Actionable: 0	
Job Started:	10/01/24 09:15	
Job Finished:	10/01/24 11:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Gate 40 Warehouse
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 09:15	Hartford, CT
Total Readings:	50	
Job Started:	10/01/24 09:15	
Job Finished:	10/01/24 11:16	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade D									
045	-	Wall	U -		D	Metal	tan	-0.4	QM
046	-	Wall	U -		D	Metal	tan	-0.3	QM
047	-	Wall	L -		D	Metal	tan	-0.3	QM
044	A	Wall	U -		D	Metal	tan	0.0	QM
Interior Room 001 1-01									
009	B	Wall	-		D	Steel	white	-0.1	QM
007	B	Column	-		I	Steel	red	-0.3	QM
010	C	Overhead Doo	-		D	Steel	grey	-0.3	QM
004	C	Door	-	-	I	Steel	grey	-0.1	QM
005	C	Door	-	Rgt casing	I	Steel	grey	-0.3	QM
006	C	Door	-	Lft jamb	D	Steel	Brown	-0.1	QM
008	D	Wall	-		D	Dry wall	white	-0.3	QM
Interior Room 002 1-02									
015	A	Wall	-		D	Steel	white	-0.1	QM
019	A	Window	-	Casing	D	Steel	black	-0.4	QM
016	B	Wall	-		D	Dry wall	white	-0.6	QM
013	C	Overhead Doo	-		I	Steel	grey	0.1	QM
014	C	Overhead Doo	-	Casing	D	Steel	grey	-0.6	QM
017	C	Wall	-		D	Steel	white	-0.3	QM
011	C	Door	-	-	I	Steel	grey	0.0	QM
012	C	Door	-	Rgt casing	I	Steel	Brown	-0.3	QM
020	C	Column	-		D	Steel	red	-0.5	QM
018	D	Wall	-		D	Dry wall	white	-0.2	QM
Interior Room 003 1-03									
021	B	Wall	-		D	Dry wall	white	-0.2	QM
024	C	Overhead Doo	-		D	Steel	grey	-0.1	QM
022	C	Wall	-		D	Steel	white	0.0	QM
025	C	Door	-	-	I	Steel	grey	-0.1	QM
026	C	Door	-	Rgt casing	I	Steel	Brown	-0.2	QM
023	C	Column	-		D	Steel	red	-0.3	QM
Interior Room 004 1-04									
030	-	Ceiling	-		D	Dry wall	white	-0.2	QM
027	A	Wall	-		D	Dry wall	white	-0.1	QM
028	B	Wall	-		D	Dry wall	white	-0.3	QM
031	B	Door	-	-	I	Wood	Varnish	-0.3	QM
032	B	Door	-	Rgt casing	D	Wood	Varnish	0.0	QM
029	D	Wall	-		D	Dry wall	white	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 005 1-06									
033	A	Wall	-		D	Dry wall	white	-0.5	QM
037	A	Door	-	-	D	Steel	grey	-0.2	QM
038	A	Door	-	Lft casing	D	Steel	grey	-0.3	QM
034	B	Wall	-		D	Dry wall	white	-0.1	QM
035	C	Wall	-		D	Dry wall	white	-0.7	QM
039	C	Door	-	-	D	Steel	grey	-0.1	QM
040	C	Door	-	Lft casing	D	Steel	grey	-0.1	QM
041	D	Drafting Tab	-		D	Wood	white	-0.2	QM
036	D	Wall	-		D	Dry wall	white	-0.4	QM
Interior Room 006 1-08									
042	-	Stall	-		D	Wood	white	-0.4	QM
043	A	Wall	-		D	Dry wall	white	-0.2	QM
Calibration Readings									
001								0.6	TC
002								1.2	TC
003								1.1	TC
048								1.1	TC
049								1.1	TC
050								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/27/24 09:46

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/27/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Main Exhaust Stack & Lime Silo

SIGNED: _____ Date: 8/28/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 09:46	Hartford, CT
Total Readings:	20 Actionable: 0	
Job Started:	08/27/24 09:46	
Job Finished:	08/27/24 11:19	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 09:46	Hartford, CT
Total Readings:	20	
Job Started:	08/27/24 09:46	
Job Finished:	08/27/24 11:19	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Stack									
005	-	Ladder	-		D	Steel	red	0.2	QM
006	-	Fan	-	Casing	D	Steel	tan	-0.4	QM
007	-	Fan Motor	-	Casing	D	Steel	green	-0.3	QM
004	-	Wall	-		D	Steel	red	-0.5	QM
Exterior Room 002 CaO Silo									
017	-	Slurry Tank	-	Casing	D	Steel	white	-0.4	QM
016	A	Ladder	-		D	Steel	Yellow	-0.4	QM
010	A	Wall	-		D	Steel	Silver	-0.4	QM
011	B	Wall	-		D	Steel	Silver	-0.1	QM
008	B	Stairs	-	Stringers	D	Steel	tan	-0.1	QM
009	B	Stairs	-	Railings	D	Steel	tan	0.0	QM
012	C	Wall	-		D	Steel	Silver	-0.5	QM
013	D	Wall	-		D	Steel	Silver	-0.2	QM
014	D	Door	-	-	D	Steel	grey	-0.6	QM
015	D	Door	-	Rgt casing	D	Steel	grey	-0.8	QM
Calibration Readings									
001								1.1	TC
002								1.2	TC
003								1.1	TC
018								1.0	QM
019								1.0	QM
020								1.0	QM

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 10/01/24 11:32

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 10/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 2753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Northwest Guard Shack

SIGNED: _____ **Date:** 10/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 11:32	Hartford, CT
Total Readings:	33 Actionable: 1	
Job Started:	10/01/24 11:32	
Job Finished:	10/01/24 12:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 002 1-02									
025	B	Door	-	Rgt casing	I	Steel	Cream	1.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 11:32	Hartford, CT
Total Readings:	33	
Job Started:	10/01/24 11:32	
Job Finished:	10/01/24 12:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade B									
029	-	Window	-	Part. bead	I	Steel	Brown	-0.2	QM
028	-	Window	-	Lft casing	I	Steel	Brown	0.0	QM
026	-	Door	-	-	I	Steel	Brown	-0.7	QM
027	-	Door	-	Rgt casing	I	Steel	Brown	-0.2	QM
Exterior Room 002 Facade C									
030	-	Soffit	-		I	Steel	Brown	-0.3	QM
Interior Room 001 1-01									
008	-	Ceiling	-		I	Plaster	white	-0.3	QM
009	-	Floor	-		D	Concrete	grey	-0.6	QM
004	A	Wall	-		I	Plaster	Cream	-0.2	QM
005	B	Wall	-		I	Plaster	Cream	0.0	QM
006	C	Wall	-		I	Plaster	Cream	-0.2	QM
013	C	Door	-	-	I	Steel	Cream	-0.6	QM
016	C	Door	-	Stop	D	Wood	Brown	-0.3	QM
014	C	Door	-	Lft casing	I	Wood	Cream	-0.1	QM
015	C	Door	-	Lft jamb	D	Steel	Cream	0.0	QM
017	D	Conduit	-		D	Steel	Cream	-0.1	QM
007	D	Wall	-		I	Plaster	Cream	0.1	QM
010	D	Window	-	Rgt casing	I	Wood	white	-0.2	QM
012	D	Window	-	Sash	I	Steel	Brown	-0.3	QM
011	D	Window	-	Sill	I	Wood	white	-0.1	QM
Interior Room 002 1-02									
018	A	Wall	-		I	Plaster	Cream	-0.3	QM
022	A	Window	-	Rgt casing	I	Wood	Cream	-0.6	QM
023	A	Window	-	Sill	I	Wood	Cream	-0.3	QM
019	B	Wall	-		I	Plaster	Cream	0.0	QM
024	B	Door	-	-	I	Wood	Cream	-0.2	QM
025	B	Door	-	Rgt casing	I	Steel	Cream	1.9	QM
020	C	Wall	-		I	Plaster	Cream	-0.2	QM
021	D	Wall	-		I	Plaster	Cream	-0.1	QM
Calibration Readings									
001								1.2	TC
002								1.2	TC
003								1.2	TC
031								1.2	TC
032								1.2	TC
033								1.1	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 08/12/24 08:42

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Admin Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/12/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Interiors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 103
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/12/24	MIRA
Report Date:	8/16/2024	NAES Admin Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/12/24 08:42	Hartford, CT
Total Readings:	162 Actionable: 22	
Job Started:	08/12/24 08:42	
Job Finished:	08/12/24 16:19	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 005 1-05									
036	A	Wall	-		I	Ceramic	red	>9.9	QM
037	B	Wall	-		I	Ceramic	red	>9.9	QM
038	C	Wall	-		I	Ceramic	red	>9.9	QM
039	D	Wall	-		I	Ceramic	red	>9.9	QM
Interior Room 006 ST-02									
049	-	Stairs	-	Stringers	I	Steel	Cream	1.8	QM
050	-	Stairs	-	Newel post	I	Steel	Cream	1.7	QM
Interior Room 010 1-04									
077	A	Wall	-		I	Ceramic	tan	>9.9	QM
078	B	Wall	-		I	Ceramic	tan	>9.9	QM
079	C	Wall	-		I	Ceramic	tan	>9.9	QM
080	D	Wall	-		I	Ceramic	tan	>9.9	QM
Interior Room 012 2-12									
095	A	Wall	-		I	Ceramic	Tan	>9.9	QM
096	A	Wall	-		I	Ceramic	Tan	>9.9	QM
097	C	Wall	-		I	Ceramic	Tan	>9.9	QM
098	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Interior Room 013 2-11									
102	A	Wall	-		I	Ceramic	Tan	>9.9	QM
103	B	Wall	-		I	Ceramic	Tan	>9.9	QM
104	C	Wall	-		I	Ceramic	Tan	>9.9	QM
105	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Interior Room 014 2-13									
109	A	Wall	-		I	Ceramic	white	>9.9	QM
110	B	Wall	-		I	Ceramic	Tan	>9.9	QM
111	C	Wall	-		I	Ceramic	Tan	>9.9	QM
112	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/12/24	MIRA
Report Date:	8/16/2024	NAES Admin Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/12/24 08:42	Hartford, CT
Total Readings:	162	
Job Started:	08/12/24 08:42	
Job Finished:	08/12/24 16:19	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-01									
004	A	Wall	-		I	Dry wall	white	-0.2	QM
005	B	Wall	-		I	Dry wall	white	-0.3	QM
010	C	Radiator	-		I	Steel	grey	-0.2	QM
006	C	Wall	-		I	Dry wall	white	-0.2	QM
007	D	Wall	-		I	Dry wall	white	-0.6	QM
009	D	Door	-	-	I	Steel	grey	0.1	QM
008	D	Door	-	Rgt casing	I	Steel	grey	-0.1	QM
Interior Room 002 1-02									
017	A	Radiator	-		I	Steel	grey	-0.4	QM
011	A	Wall	-		I	Dry wall	white	-0.3	QM
013	A	Door	-	-	I	Steel	grey	-0.1	QM
014	A	Door	-	Lft casing	I	Steel	grey	-0.1	QM
015	B	Door	-	-	I	Steel	grey	-0.2	QM
016	B	Door	-	Lft casing	I	Steel	grey	-0.3	QM
012	C	Wall	-		I	Dry wall	white	-0.1	QM
034	C	Window	-	Sash	I	Steel	black	-0.7	QM
035	C	Window	-	Lft casing	I	Steel	black	-0.3	QM
Interior Room 003 1-03									
018	A	Wall	-		I	Dry wall	Cream	-0.1	QM
023	A	Door	-	-	I	Steel	Cream	-0.2	QM
024	A	Door	-	Lft casing	I	Steel	Cream	-0.2	QM
019	B	Wall	-		I	Dry wall	Cream	-0.2	QM
020	C	Wall	-		I	CMU	Cream	-0.4	QM
022	D	Cased Openin	-		I	Steel	Cream	0.1	QM
021	D	Wall	-		I	CMU	Cream	-0.1	QM
Interior Room 004 ST-01									
085	-	Ceiling	-		I	Concrete	white	-0.3	QM
030	-	Stairs	-	Stringers	I	Steel	Cream	0.0	QM
032	-	Stairs	-	Railings	I	Steel	Brown	-0.3	QM
031	-	Stairs	-	Risers	I	Steel	Cream	-0.3	QM
029	-	Stairs	-	Newel post	I	Steel	Cream	-0.5	QM
025	A	Wall	-		I	Dry wall	Cream	-0.1	QM
026	B	Wall	-		I	Dry wall	Cream	-0.4	QM
027	C	Wall	-		I	CMU	Cream	-0.1	QM
033	D	Radiator	-		I	Steel	Cream	-0.2	QM
028	D	Wall	-		I	Dry wall	Cream	-0.3	QM
Interior Room 005 1-05									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
040	-	Floor	-		I	Ceramic	red	-0.7	QM
044	A	Radiator	Lft		I	Steel	Cream	-0.3	QM
036	A	Wall	-		I	Ceramic	red	>9.9	QM
043	A	Window	Lft	Lft casing	I	Steel	black	-0.3	QM
037	B	Wall	-		I	Ceramic	red	>9.9	QM
038	C	Wall	-		I	Ceramic	red	>9.9	QM
041	C	Door	-	-	I	Steel	Cream	-0.2	QM
042	C	Door	-	Lft casing	I	Steel	Cream	0.1	QM
039	D	Wall	-		I	Ceramic	red	>9.9	QM
Interior Room 006 ST-02									
086	-	Ceiling	-		I	Concrete	white	-0.2	QM
049	-	Stairs	-	Stringers	I	Steel	Cream	1.8	QM
052	-	Stairs	-	Railings	I	Steel	Brown	-0.2	QM
051	-	Stairs	-	Risers	I	Steel	Cream	0.1	QM
050	-	Stairs	-	Newel post	I	Steel	Cream	1.7	QM
045	A	Wall	-		I	Dry wall	Cream	0.0	QM
046	B	Wall	-		I	Dry wall	Cream	-0.2	QM
053	B	Door	-	-	I	Steel	black	-0.9	QM
054	B	Door	-	Rgt casing	I	Steel	black	-0.7	QM
047	C	Wall	-		I	Dry wall	Cream	-0.5	QM
048	D	Wall	-		I	Dry wall	Cream	-0.3	QM
Interior Room 007 1-06									
055	A	Wall	-		I	Dry wall	Cream	-0.3	QM
059	A	Window	-	Lft casing	I	Steel	black	-0.2	QM
056	B	Wall	-		I	Dry wall	Cream	-0.2	QM
057	C	Wall	-		I	Dry wall	Cream	-0.2	QM
058	D	Wall	-		I	Dry wall	Cream	-0.4	QM
060	D	Door	-	-	I	Steel	Cream	0.0	QM
061	D	Door	-	Lft casing	I	Steel	Cream	0.2	QM
Interior Room 008 1-07									
062	A	Wall	-		I	CMU	blue	-0.2	QM
063	B	Wall	-		I	Dry wall	blue	-0.3	QM
070	C	Radiator	-		I	Steel	blue	-0.3	QM
064	C	Wall	-		I	Dry wall	blue	-0.2	QM
066	C	Window	Rgt	Rgt casing	I	Steel	black	-0.2	QM
067	C	Window	Rgt	Sill	I	Dry wall	blue	-0.1	QM
065	D	Wall	-		I	Dry wall	blue	-0.3	QM
068	D	Door	-	-	I	Steel	blue	0.0	QM
069	D	Door	-	Rgt casing	I	Steel	blue	-0.2	QM
Interior Room 009 1-08									
084	-	Ceiling	-		D	Concrete	Cream	0.1	QM
071	A	Wall	-		I	CMU	Cream	-0.6	QM
075	A	Door	-	-	D	Steel	Cream	-0.3	QM
076	A	Door	-	Lft casing	D	Steel	Cream	-0.3	QM
072	B	Wall	-		D	Dry wall	Cream	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
073	C	Wall	-		D	Dry wall	Cream	-0.3	QM
074	D	Wall	-		D	Dry wall	Cream	-0.1	QM
Interior Room 010 1-04									
081	-	Floor	-		I	Ceramic	tan	-0.5	QM
082	-	Door	-	-	I	Steel	tan	-0.1	QM
083	-	Door	-	Rgt casing	I	Steel	tan	0.0	QM
077	A	Wall	-		I	Ceramic	tan	>9.9	QM
078	B	Wall	-		I	Ceramic	tan	>9.9	QM
079	C	Wall	-		I	Ceramic	tan	>9.9	QM
080	D	Wall	-		I	Ceramic	tan	>9.9	QM
Interior Room 011 2-09									
090	A	Wall	-		D	Dry wall	Cream	-0.4	QM
093	A	Door	-	-	I	Steel	Cream	0.0	QM
094	A	Door	-	Lft casing	I	Steel	Cream	0.2	QM
091	C	Wall	-		I	CMU	Cream	-0.2	QM
092	D	Wall	-		I	CMU	Cream	-0.1	QM
Interior Room 012 2-12									
101	-	Radiator	-		I	Steel	Tan	-0.2	QM
099	-	Floor	-		I	Ceramic	Tan	-0.5	QM
100	-	Window	-	Rgt casing	I	Steel	black	-0.6	QM
095	A	Wall	-		I	Ceramic	Tan	>9.9	QM
096	A	Wall	-		I	Ceramic	Tan	>9.9	QM
097	C	Wall	-		I	Ceramic	Tan	>9.9	QM
098	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Interior Room 013 2-11									
106	-	Floor	-		I	Ceramic	Tan	-0.8	QM
102	A	Wall	-		I	Ceramic	Tan	>9.9	QM
103	B	Wall	-		I	Ceramic	Tan	>9.9	QM
104	C	Wall	-		I	Ceramic	Tan	>9.9	QM
107	C	Door	-	-	I	Steel	Tan	-0.2	QM
108	C	Door	-	Rgt casing	I	Steel	Tan	-0.2	QM
105	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Interior Room 014 2-13									
114	-	Floor	-		I	Ceramic	Tan	-0.5	QM
109	A	Wall	-		I	Ceramic	white	>9.9	QM
110	B	Wall	-		I	Ceramic	Tan	>9.9	QM
113	C	Cased Openin	-		I	Steel	Tan	-0.2	QM
111	C	Wall	-		I	Ceramic	Tan	>9.9	QM
115	D	Shower	-	Stall	I	Steel	Tan	-0.4	QM
112	D	Wall	-		I	Ceramic	Tan	>9.9	QM
Interior Room 015 2-14									
120	-	Locker	Ctr		I	Steel	Brown	-0.1	QM
116	A	Wall	-		D	Dry wall	Tan	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
117	B	Wall	-		I	CMU	Tan	-0.4	QM
121	B	Door	-	-	I	Steel	Tan	-0.1	QM
122	B	Door	-	Rgt casing	I	Steel	Tan	-0.5	QM
118	C	Wall	-		D	Dry wall	Tan	-0.2	QM
119	D	Wall	-		D	Dry wall	Tan	-0.2	QM
Interior Room 016 2-15									
127	-	Ceiling	-		I	Plaster	white	-0.3	QM
123	A	Wall	-		I	Dry wall	Tan	-0.4	QM
128	A	Door	-	-	I	Steel	tan	-0.1	QM
129	A	Door	-	Rgt casing	I	Steel	tan	-0.3	QM
124	B	Wall	-		I	Dry wall	Tan	-0.3	QM
125	C	Wall	-		I	CMU	Tan	-0.3	QM
126	D	Wall	-		I	CMU	Tan	-0.1	QM
Interior Room 017 2-16									
130	A	Wall	-		I	Dry wall	blue	-0.3	QM
131	B	Wall	-		I	Dry wall	blue	0.0	QM
132	C	Wall	-		I	Dry wall	blue	-0.1	QM
133	D	Wall	-		I	Dry wall	blue	-0.3	QM
134	D	Door	-	-	I	Steel	blue	0.1	QM
135	D	Door	-	Rgt casing	I	Steel	blue	0.1	QM
Interior Room 018 2-17									
136	A	Wall	-		I	Dry wall	white	-0.1	QM
143	A	Window	-	Sill	I	Dry wall	white	-0.2	QM
142	A	Window	-	Lft casing	I	Steel	black	-0.4	QM
137	B	Wall	-		I	Dry wall	white	-0.2	QM
138	C	Wall	-		I	Dry wall	white	-0.2	QM
140	C	Door	-	-	I	Steel	blue	-0.3	QM
141	C	Door	-	Lft casing	I	Steel	blue	-0.1	QM
139	D	Wall	-		I	Dry wall	white	-0.4	QM
Interior Room 019 2-18									
144	A	Wall	-		I	Dry wall	white	-0.6	QM
145	B	Wall	-		I	Dry wall	white	-0.3	QM
146	C	Wall	-		I	Dry wall	white	-0.2	QM
147	D	Wall	-		I	Dry wall	white	-0.1	QM
148	D	Door	-	-	I	Steel	blue	-0.2	QM
149	D	Door	-	Lft casing	I	Steel	blue	-0.1	QM
Interior Room 020 2-19									
150	A	Wall	-		I	Dry wall	white	-0.2	QM
154	A	Door	-	-	I	Steel	blue	-0.2	QM
155	A	Door	-	Rgt casing	I	Steel	blue	-0.3	QM
151	B	Wall	-		I	Dry wall	white	-0.3	QM
152	C	Wall	-		I	Dry wall	white	-0.3	QM
153	D	Wall	-		I	Dry wall	white	-0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 021 2-21									
156	A	Wall	-		I	Dry wall	white	-0.4	QM
157	B	Wall	-		I	Dry wall	white	-0.2	QM
158	C	Wall	-		I	Dry wall	white	-0.2	QM
159	D	Wall	-		I	Dry wall	white	-0.2	QM
Calibration Readings									
001								0.8	TC
002								0.7	TC
003								0.7	TC
087								0.7	TC
088								0.7	TC
089								0.6	TC
160								1.2	TC
161								1.1	TC
162								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 08/13/24 08:34

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Admin Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/13/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/13/24	MIRA
Report Date:	8/16/2024	NAES Admin Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/13/24 08:34	Hartford, CT
Total Readings:	75 Actionable: 11	
Job Started:	08/13/24 08:34	
Job Finished:	08/13/24 12:26	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
061	-	Window	Lft	Lft casing	D	Steel	Brown	1.2	TC
Interior Room 006 3-28									
043	A	Wall	-		I	Ceramic	tan	>9.9	QM
044	B	Wall	-		I	Ceramic	tan	>9.9	QM
045	C	Wall	-		I	Ceramic	tan	>9.9	QM
047	C	Window	-	Sill	I	Ceramic	tan	>9.9	QM
046	D	Wall	-		I	Ceramic	tan	>9.9	QM
Interior Room 007 3-29									
051	A	Wall	-		I	Ceramic	red	>9.9	QM
052	B	Wall	-		I	Ceramic	red	>9.9	QM
053	C	Wall	-		I	Ceramic	red	>9.9	QM
054	D	Wall	-		I	Ceramic	red	>9.9	QM
055	D	Window	-	Sill	I	Ceramic	red	>9.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/13/24	MIRA
Report Date:	8/16/2024	NAES Admin Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/13/24 08:34	Hartford, CT
Total Readings:	75	
Job Started:	08/13/24 08:34	
Job Finished:	08/13/24 12:26	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
061	-	Window	Lft	Lft casing	D	Steel	Brown	1.2	TC
060	-	Window	Ctr	Rgt casing	I	Steel	black	-0.6	QM
Exterior Room 002 Facade B									
062	-	Door	-	-	I	Steel	black	-0.8	QM
063	-	Door	-	Rgt casing	I	Steel	black	-0.6	QM
Exterior Room 003 Facade C									
071	-	Louver	-		I	Steel	Silver	-0.9	QM
072	-	Bollard	-		D	Steel	red	0.0	QM
070	-	Window	-	Rgt casing	I	Steel	black	-1.1	QM
064	-	Door	-	-	D	Steel	grey	-0.1	QM
065	-	Stairs	-	Stringers	I	Steel	black	0.2	QM
068	-	Stairs	-	Railings	I	Steel	black	-0.3	QM
069	-	Stairs	-	Support Leg	I	Steel	black	0.3	QM
066	-	Stairs	-	Treads	I	Steel	black	0.0	QM
067	-	Stairs	-	Risers	I	Steel	black	-0.1	QM
Interior Room 001 3-21									
004	A	Wall	-		I	Dry wall	white	-0.3	QM
010	A	Door	Lft	-	I	Steel	blue	-0.2	QM
011	A	Door	Lft	Rgt casing	I	Steel	blue	-0.2	QM
008	A	Door	Rgt	-	I	Steel	blue	-0.2	QM
009	A	Door	Rgt	Rgt casing	I	Steel	blue	-0.2	QM
005	B	Wall	-		I	Dry wall	white	-0.3	QM
012	B	Closet	-	Door	I	Steel	blue	-0.3	QM
013	B	Closet	-	Door Casing	I	Steel	blue	-0.3	QM
014	B	Closet	-	Wall	I	Dry wall	tan	-0.1	QM
006	C	Wall	-		I	Dry wall	white	-0.2	QM
007	D	Wall	-		I	Dry wall	white	-0.3	QM
Interior Room 002 3-22									
021	A	Radiator	-		I	Steel	blue	-0.4	QM
015	A	Wall	-		I	Dry wall	white	-0.6	QM
019	A	Window	-	Rgt casing	I	Steel	black	-0.2	QM
020	A	Window	-	Sill	I	Dry wall	white	-0.1	QM
016	B	Wall	-		I	Dry wall	white	-0.3	QM
022	B	Door	-	-	I	Steel	blue	-0.3	QM
023	B	Door	-	Lft casing	I	Steel	blue	-0.1	QM
017	C	Wall	-		I	Dry wall	white	-0.2	QM
018	D	Wall	-		I	Dry wall	white	-0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 003 3-23									
024	A	Wall	-		I	Dry wall	white	-0.1	QM
025	B	Wall	-		I	Dry wall	white	-0.2	QM
026	C	Wall	-		I	Dry wall	white	-0.1	QM
028	C	Door	-	-	I	Steel	blue	-0.2	QM
029	C	Door	-	Rgt casing	I	Steel	blue	-0.3	QM
027	D	Wall	-		I	Dry wall	white	-0.2	QM
Interior Room 004 3-25									
030	A	Wall	-		I	Dry wall	white	-0.1	QM
037	A	Door	-	-	I	Steel	blue	0.0	QM
038	A	Door	-	Rgt casing	I	Steel	blue	-0.3	QM
031	B	Wall	-		I	Dry wall	white	-0.2	QM
032	C	Wall	-		I	Dry wall	white	-0.3	QM
034	C	Window	-	Rgt casing	I	Steel	black	-0.6	QM
035	C	Window	-	Sill	I	Dry wall	white	-0.2	QM
036	D	Radiator	-		I	Steel	blue	0.0	QM
033	D	Wall	-		I	Dry wall	white	-0.2	QM
Interior Room 005 3-26									
039	A	Wall	-		I	Dry wall	white	-0.3	QM
040	B	Wall	-		I	Dry wall	white	-0.2	QM
041	C	Wall	-		I	Dry wall	white	-0.3	QM
042	D	Wall	-		I	Dry wall	white	-0.3	QM
Interior Room 006 3-28									
050	-	Floor	-		I	Ceramic	tan	-0.4	QM
043	A	Wall	-		I	Ceramic	tan	>9.9	QM
048	A	Door	-	-	I	Steel	tan	-0.2	QM
049	A	Door	-	Lft casing	I	Steel	tan	-0.1	QM
044	B	Wall	-		I	Ceramic	tan	>9.9	QM
045	C	Wall	-		I	Ceramic	tan	>9.9	QM
047	C	Window	-	Sill	I	Ceramic	tan	>9.9	QM
046	D	Wall	-		I	Ceramic	tan	>9.9	QM
Interior Room 007 3-29									
056	-	Floor	-		I	Ceramic	red	-0.4	QM
051	A	Wall	-		I	Ceramic	red	>9.9	QM
058	A	Door	-	-	I	Steel	tan	-0.3	QM
059	A	Door	-	Rgt casing	I	Steel	tan	-0.1	QM
052	B	Wall	-		I	Ceramic	red	>9.9	QM
053	C	Wall	-		I	Ceramic	red	>9.9	QM
057	D	Radiator	-		I	Steel	tan	-0.2	QM
054	D	Wall	-		I	Ceramic	red	>9.9	QM
055	D	Window	-	Sill	I	Ceramic	red	>9.9	QM
Calibration Readings									
001								1.1	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
002								1.2	TC
003								1.0	TC
073								1.1	TC
074								1.1	TC
075								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 07/29/24 08:48

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/29/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Power Block Facility Boiler Area

SIGNED: _____ **Date:** 8/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/29/24	MIRA
Report Date:	8/2/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/29/24 08:48	Hartford, CT
Total Readings:	35 Actionable: 10	
Job Started:	07/29/24 08:48	
Job Finished:	07/29/24 13:44	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 005 7-53 EL-106									
020	-	Framework	-	I Beam	I	Steel	Green	3.6	QM
024	-	Tank	Rgt	Casing	D	Steel	Silver	>9.9	QM
025	-	Tank	Rgt	Support	D	Steel	green	>9.9	QM
018	A	Railing	-	-	D	Steel	Yellow	3.8	QM
023	C	Coal Hopper	-	Casing	D	Steel	Silver	6.0	QM
019	C	Column	-		I	Steel	Silver	1.8	QM
Interior Room 006 6-54 EL-84									
028	-	Column	Ctr		D	Plaster	Green	2.0	QM
029	B	Column	-		D	Steel	Silver	3.9	QM
Interior Room 007 8-55 Hopper									
032	A	Column	-		D	Steel	black	2.2	QM
031	D	Column	-		D	Steel	black	8.2	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/29/24	MIRA
Report Date:	8/2/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/29/24 08:48	Hartford, CT
Total Readings:	35	
Job Started:	07/29/24 08:48	
Job Finished:	07/29/24 13:44	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 7-48									
005	A	Wall	-		I	Panel	white	-0.1	QM
004	C	Wall	-		I	Steel	black	-0.2	QM
006	C	Column	-		I	Steel	Gold	-0.2	QM
Interior Room 002 8-49									
008	C	Wall	-		D	Steel	white	-0.1	QM
009	C	Door	-	-	D	Steel	tan	-0.1	QM
010	C	Door	-	Rgt casing	D	Steel	tan	-0.3	QM
007	D	CCCW Tank	-	Casing	D	Steel	Gold	-0.2	QM
Interior Room 003 8-50									
011	A	Wall	-		D	Steel	red	-0.1	QM
013	A	Column	-		D	Steel	tan	-0.3	QM
012	C	Conveyor	-		D	Steel	red	-0.5	QM
014	C	Railing	-	-	D	Steel	Yellow	-0.1	QM
Interior Room 005 7-53 EL-106									
020	-	Framework	-	I Beam	I	Steel	Green	3.6	QM
021	-	Breeching	-	Hatch	I	Steel	Silver	-0.4	QM
024	-	Tank	Rgt	Casing	D	Steel	Silver	>9.9	QM
025	-	Tank	Rgt	Support	D	Steel	green	>9.9	QM
026	-	Tank	Rgt	Pipe	D	Steel	Silver	-0.2	QM
015	A	Wall	-		I	Brick	Silver	0.2	QM
016	A	Door	-	-	I	Steel	grey	-0.1	QM
017	A	Door	-	Rgt casing	I	Steel	grey	-0.2	QM
018	A	Railing	-	-	D	Steel	Yellow	3.8	QM
023	C	Coal Hopper	-	Casing	D	Steel	Silver	6.0	QM
022	C	Blower	Lft	Casing	D	Steel	Silver	-0.3	QM
019	C	Column	-		I	Steel	Silver	1.8	QM
Interior Room 006 6-54 EL-84									
028	-	Column	Ctr		D	Plaster	Green	2.0	QM
027	A	Wall	-		D	Brick	Silver	0.3	QM
029	B	Column	-		D	Steel	Silver	3.9	QM
Interior Room 007 8-55 Hopper									
032	A	Column	-		D	Steel	black	2.2	QM
030	C	Column	-		D	Steel	red	-0.1	QM
031	D	Column	-		D	Steel	black	8.2	QM
Calibration Readings									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
001								1.1	TC
002								1.0	TC
003								1.1	TC
033								1.2	TC
034								1.2	TC
035								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/08/24 11:39

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Exteriors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/08/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ Date: 8/9/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/08/24	MIRA
Report Date:	8/9/2024	Power Block Facility Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/08/24 11:39	Hartford, CT
Total Readings:	37 Actionable: 7	
Job Started:	08/08/24 11:39	
Job Finished:	08/08/24 15:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
004	-	Stairs	-	Stringers	D	Steel	Yellow	2.9	QM
Exterior Room 002 Facade B									
015	-	Overhead Doo	Lft	Casing	D	Steel	grey	>9.9	QM
019	-	Freight Door	Lft		D	Wood	blue	>9.9	QM
017	-	Window	-	Sash	D	Steel	grey	7.9	QM
Exterior Room 003 Facade C									
026	-	Pipe	-		D	Steel	Yellow	3.7	QM
022	-	Window	-	Lft casing	D	Steel	red	>9.9	QM
030	-	Door	-	-	D	Steel	green	>9.9	QM

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/08/24	MIRA
Report Date:	8/9/2024	Power Block Facility Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/08/24 11:39	Hartford, CT
Total Readings:	37	
Job Started:	08/08/24 11:39	
Job Finished:	08/08/24 15:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
008	-	Flashing	-		I	Metal	N/A	0.2	QM
011	-	Stack	-		D	Steel	Silver	-0.5	QM
012	-	N/A	-		I	Steel	red	0.0	QM
013	-	Ladder	-	Support	D	Steel	grey	-0.2	QM
006	-	Window	-	Sash	D	Steel	grey	-0.2	QM
007	-	Window	-	Sill	D	Concrete	white	0.1	QM
009	-	Door	-	-	I	Steel	Yellow	-0.2	QM
010	-	Door	-	Lft casing	I	Steel	Yellow	0.1	QM
004	-	Stairs	-	Stringers	D	Steel	Yellow	2.9	QM
005	-	Stairs	-	Railings	D	Steel	Yellow	-0.1	QM
Exterior Room 002 Facade B									
014	-	Overhead Doo	-		I	Steel	grey	0.2	QM
016	-	Foundation	-		D	Concrete	white	0.0	QM
015	-	Overhead Doo	Lft	Casing	D	Steel	grey	>9.9	QM
019	-	Freight Door	Lft		D	Wood	blue	>9.9	QM
020	-	Freight Door	Lft	Casing	D	Steel	blue	-0.2	QM
017	-	Window	-	Sash	D	Steel	grey	7.9	QM
018	-	Window	-	Sill	D	Concrete	white	0.3	QM
Exterior Room 003 Facade C									
021	-	N/A	-		D	Terracotta	red	-0.2	QM
025	-	Beam	-		D	Steel	red	0.0	QM
026	-	Pipe	-		D	Steel	Yellow	3.7	QM
027	-	Enclosure	-	Wall	D	Steel	red	-0.4	QM
028	-	Downspout	-		D	Steel	red	-0.3	QM
029	-	N/A	-		I	Steel	red	-0.3	QM
022	-	Window	-	Lft casing	D	Steel	red	>9.9	QM
023	-	Door	-	-	D	Steel	grey	-0.2	QM
030	-	Door	-	-	D	Steel	green	>9.9	QM
024	-	Door	-	Lft casing	D	Steel	grey	-0.6	QM
031	-	Stairs	-	Stringers	D	Steel	Yellow	-0.3	QM
032	-	Stairs	-	Railings	D	Steel	Yellow	-0.3	QM
033	-	Stairs	-	Support	D	Steel	Yellow	-0.3	QM
Exterior Room 004 Facade D									
034	-	N/A	-		D	Terracotta	red	-0.1	QM
Calibration Readings									
001								0.8	TC
002								0.7	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
003								0.8	TC
035								0.9	TC
036								0.7	TC
037								0.7	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/27/24 14:12

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Roofs
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/27/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Power Block Facility Roofs 1 - 4

SIGNED: _____ Date: 8/28/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Power Block Facility Roofs
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 14:12	Hartford, CT
Total Readings:	22 Actionable: 1	
Job Started:	08/27/24 14:12	
Job Finished:	08/27/24 16:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 004 PBF RF-4									
019	A	Open Vent	-		D	Steel	blue	2.1	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Power Block Facility Roofs
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 14:12	Hartford, CT
Total Readings:	22	
Job Started:	08/27/24 14:12	
Job Finished:	08/27/24 16:06	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 PBF RF-1									
004	-	Vent Stack	Lft		D	Steel	Silver	-0.3	QM
005	-	Vent Stack	Rgt		D	Steel	Silver	-0.1	QM
006	A	Wall	P -		D	Concrete	grey	-0.1	QM
Exterior Room 002 PBF RF-2									
009	-	Vent	-		D	Steel	black	0.0	QM
010	-	Stack	-		I	Steel	tan	0.0	QM
011	-	Stack	-	Base	D	Steel	Silver	-0.2	QM
012	-	Railings	-		D	Steel	Yellow	-0.2	QM
013	-	Vent Pipe	-		D	Steel	black	-0.1	QM
007	-	Vent Stack	Lft		D	Steel	Brown	0.2	QM
008	-	Vent Stack	Rgt		D	Steel	Brown	0.1	QM
Exterior Room 003 PBF RF-3									
014	-	Vent Stack	-		D	Steel	Silver	-0.5	QM
015	-	Wall	P -		D	Concrete	white	0.3	QM
016	A	Ladder	-		D	Steel	white	-0.7	QM
Exterior Room 004 PBF RF-4									
017	-	Vent Cap	-		D	Steel	Silver	-0.5	QM
018	-	Radio Tower	-	Frame	D	Steel	blue	-0.3	QM
019	A	Open Vent	-		D	Steel	blue	2.1	QM
Calibration Readings									
001								1.2	TC
002								1.2	TC
003								1.1	TC
020								1.2	TC
021								1.2	TC
022								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 10/01/24 13:37

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 10/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 2753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Room 00-71 Elevation-21

SIGNED: _____ **Date:** 10/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 13:37	Hartford, CT
Total Readings:	13 Actionable: 1	
Job Started:	10/01/24 13:37	
Job Finished:	10/01/24 20:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-71 EL-22									
010	-	Cabinet	-	Casing	D	Wood	grey	1.6	QM

Calibration Readings

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	10/01/24	MIRA
Report Date:	10/2/2024	Power Block Facility Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	10/01/24 13:37	Hartford, CT
Total Readings:	13	
Job Started:	10/01/24 13:37	
Job Finished:	10/01/24 20:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-71 EL-22									
005	-	Cooling Pipe	-		D	Steel	white	-0.2	QM
006	-	Pipe	-		I	Steel	Yellow	-0.1	QM
007	-	Pipe	-		D	Steel	black	-0.3	QM
010	-	Cabinet	-	Casing	D	Wood	grey	1.6	QM
004	-	Column	-		D	Wood	black	0.0	QM
009	A	Vert. Pipe	-		I	Steel	black	-0.3	QM
008	C	Pipe	-		D	Steel	silver	-0.4	QM
Calibration Readings									
001								1.2	TC
002								1.2	TC
003								1.1	TC
011								1.1	TC
012								1.0	TC
013								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/15/24 08:30

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Screen Houses
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/15/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility - Screen Houses
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 08:30	Hartford, CT
Total Readings:	79 Actionable: 8	
Job Started:	08/15/24 08:30	
Job Finished:	08/15/24 12:21	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 002 SH1 1-02									
009	C	Stairs	-	Railings	D	Steel	grey	2.5	QM
Interior Room 003 SH1 2-03									
022	D	Stairs	-	Railings	D	Steel	grey	2.1	QM
Interior Room 009 SH3 1-04									
051	D	Stairs	-	Stringers	D	Steel	grey	6.4	QM
052	D	Stairs	-	Railings	D	Steel	grey	9.4	QM
Interior Room 010 SH3 2-06									
060	C	Ladder	-		D	Steel	grey	2.6	QM
059	C	Door	-	Lft casing	D	Steel	grey	>9.9	QM
Interior Room 011 SH3 3-08									
068	C	Door	-	Lft casing	D	Steel	grey	>9.9	QM
075	D	Door	-	Lft casing	D	Steel	grey	>9.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility - Screen Houses
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 08:30	Hartford, CT
Total Readings:	79	
Job Started:	08/15/24 08:30	
Job Finished:	08/15/24 12:21	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 SH1 0-01									
005	-	Intake Pipe	Lft		I	Steel	black	-0.3	QM
004	-	Intake Pipe	Rgt		I	Steel	blue	-0.3	QM
006	C	Wall	-		D	Concrete	white	-0.3	QM
007	D	Wall	-		D	Concrete	white	-0.5	QM
Interior Room 002 SH1 1-02									
014	A	Pipe	-		D	Steel	white	-0.3	QM
010	A	Wall	-		D	Concrete	white	-0.6	QM
011	B	Wall	-		D	Concrete	white	-0.2	QM
012	C	Wall	-		D	Concrete	white	-0.3	QM
008	C	Stairs	-	Stringers	D	Steel	grey	0.0	QM
009	C	Stairs	-	Railings	D	Steel	grey	2.5	QM
013	D	Wall	-		D	Concrete	white	-0.2	QM
Interior Room 003 SH1 2-03									
015	A	Wall	-		D	Concrete	white	-0.2	QM
019	A	Door	-	-	D	Steel	Brown	-0.1	QM
020	A	Door	-	Lft casing	D	Steel	green	-0.6	QM
016	B	Wall	-		D	Concrete	white	-0.1	QM
017	C	Wall	-		D	Concrete	white	-0.3	QM
018	D	Wall	-		D	Concrete	white	-0.5	QM
021	D	Stairs	-	Stringers	D	Steel	grey	-0.3	QM
022	D	Stairs	-	Railings	D	Steel	grey	2.1	QM
Interior Room 004 SH1 3-04									
023	A	Wall	-		D	Brick	tan	-0.3	QM
024	B	Wall	-		D	Brick	tan	-0.1	QM
025	C	Wall	-		D	Brick	tan	-0.1	QM
029	C	Door	-	-	D	Steel	grey	0.0	QM
030	C	Door	-	Lft casing	D	Steel	grey	-0.2	QM
026	D	Wall	-		D	Brick	tan	-0.2	QM
028	D	Window	-	Sill	D	Concrete	tan	-0.3	QM
027	D	Window	-	Lft casing	I	Steel	black	-0.7	QM
Interior Room 005 SH3 0-01									
033	-	Pump	Lft	Casing	I	Steel	grey	-0.4	QM
034	-	Pump	Rgt	Casing	I	Steel	grey	-0.5	QM
031	A	Wall	-		D	Concrete	white	-0.1	QM
032	C	Wall	-		D	Concrete	white	0.0	QM
Interior Room 006 SH3 1-03									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
037	A	Wall	-		D	Concrete	white	-0.2	QM
038	B	Wall	-		D	Concrete	white	-0.1	QM
035	B	Stairs	-	Stringers	D	Steel	grey	-0.1	QM
036	B	Stairs	-	Railings	D	Steel	grey	-0.1	QM
039	C	Wall	-		D	Concrete	white	-0.2	QM
040	D	Wall	-		D	Concrete	white	-0.5	QM
Interior Room 007 SH3 2-05									
041	A	Wall	-		D	Concrete	white	0.0	QM
042	B	Wall	-		D	Concrete	white	-0.1	QM
043	C	Wall	-		D	Concrete	white	-0.3	QM
045	C	Door	-	-	I	Steel	grey	-0.2	QM
046	C	Door	-	Lft casing	I	Steel	grey	-0.4	QM
044	D	Wall	-		D	Concrete	white	-0.6	QM
Interior Room 008 SH3 0-02									
047	-	Intake Pump	Rgt	Casing	I	Steel	green	-0.3	QM
Interior Room 009 SH3 1-04									
053	A	Valve	-	Casing	D	Steel	green	-0.1	QM
048	A	Wall	-		D	Concrete	white	-0.5	QM
049	C	Wall	-		D	Concrete	white	-0.2	QM
050	D	Wall	-		D	Concrete	white	-0.5	QM
051	D	Stairs	-	Stringers	D	Steel	grey	6.4	QM
052	D	Stairs	-	Railings	D	Steel	grey	9.4	QM
Interior Room 010 SH3 2-06									
054	A	Wall	-		D	Concrete	white	-0.3	QM
055	B	Wall	-		D	Concrete	white	-0.2	QM
060	C	Ladder	-		D	Steel	grey	2.6	QM
056	C	Wall	-		D	Concrete	white	-0.3	QM
058	C	Door	-	Header	D	Steel	grey	-0.1	QM
059	C	Door	-	Lft casing	D	Steel	grey	>9.9	QM
057	D	Wall	-		D	Concrete	white	-0.4	QM
Interior Room 011 SH3 3-08									
069	-	Screen	Ctr	Casing	D	Steel	grey	-0.7	QM
061	A	Wall	-		D	Brick	white	-0.2	QM
070	A	Wall	-		D	Brick	white	-0.5	QM
062	B	Wall	-		D	Brick	white	0.0	QM
073	B	Wall	-		D	Brick	white	-0.1	QM
063	C	Wall	-		D	Brick	white	-0.2	QM
072	C	Wall	-		D	Brick	white	-0.7	QM
067	C	Door	-	-	D	Steel	grey	-0.2	QM
068	C	Door	-	Lft casing	D	Steel	grey	>9.9	QM
076	D	Screen	-	Casing	D	Steel	black	-0.4	QM
064	D	Wall	-		D	Brick	white	-0.2	QM
071	D	Wall	-		D	Brick	white	-0.4	QM
065	D	Window	-	Rgt casing	I	Steel	black	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
066	D	Window	-	Sill	D	Concrete	white	0.0	QM
074	D	Door	-	-	D	Steel	grey	-0.2	QM
075	D	Door	-	Lft casing	D	Steel	grey	>9.9	QM
Calibration Readings									
001								1.0	TC
002								1.0	TC
003								1.0	TC
077								1.0	TC
078								1.2	TC
079								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/15/24 14:37

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/15/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Scrubber Control Room - Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 14:37	Hartford, CT
Total Readings:	33 Actionable: 0	
Job Started:	08/15/24 14:37	
Job Finished:	08/15/24 15:25	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/15/24 14:37	Hartford, CT
Total Readings:	33	
Job Started:	08/15/24 14:37	
Job Finished:	08/15/24 15:25	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
025	-	N/A	-		I	Steel	red	-0.1	QM
Exterior Room 002 Facade B									
026	-	N/A	-		I	Steel	red	-0.1	QM
Exterior Room 003 Facade D									
027	-	N/A	-		I	Steel	red	-0.3	QM
030	-	Window	-	Lft casing	D	Steel	black	-0.2	QM
028	-	Door	-	-	D	Steel	grey	-0.2	QM
029	-	Door	-	Lft casing	D	Steel	grey	-0.3	QM
Interior Room 001 1-01									
013	-	Control Pane	-	Casing	D	Steel	green	-0.3	QM
012	-	Floor	-		D	Ceramic	red	-0.2	QM
004	A	Wall	-		D	Dry wall	Cream	-0.1	QM
005	B	Wall	-		D	Panel	Cream	-0.2	QM
010	B	Door	-	-	D	Steel	Cream	-0.3	QM
011	B	Door	-	Rgt casing	D	Steel	Cream	-0.1	QM
014	B	Column	-		I	Steel	Cream	-0.6	QM
006	C	Wall	-		D	Dry wall	Cream	-0.3	QM
007	D	Wall	-		D	Dry wall	Cream	-0.1	QM
008	D	Window	-	Rgt casing	I	Steel	black	-0.7	QM
009	D	Window	-	Sill	I	Dry wall	Cream	-0.3	QM
Interior Room 002 1-02									
019	-	Floor	-		I	Ceramic	grey	-0.3	QM
015	A	Wall	-		I	Dry wall	white	-0.5	QM
020	A	Door	-	-	D	Steel	white	-0.1	QM
021	A	Door	-	Rgt casing	D	Steel	white	-0.2	QM
016	B	Wall	-		I	Panel	white	-0.1	QM
017	C	Wall	-		I	Panel	white	-0.1	QM
018	D	Wall	-		I	Panel	white	0.1	QM
Interior Room 003 1-03									
022	A	Wall	-		D	Dry wall	Cream	-0.3	QM
023	B	Door	-	-	D	Steel	Cream	-0.1	QM
024	B	Door	-	Lft casing	D	Steel	Cream	-0.2	QM
Calibration Readings									
001								1.1	TC
002								1.0	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
003								1.1	TC
031								1.3	TC
032								1.1	TC
033								1.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/13/24 13:54

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Warehouse Building Exteriors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/13/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/13/24	MIRA
Report Date:	8/16/2024	Warehouse Building Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/13/24 13:54	Hartford, CT
Total Readings:	18 Actionable: 2	
Job Started:	08/13/24 13:54	
Job Finished:	08/13/24 15:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade D									
011	-	Overhead Doo	Lft	Casing	D	Steel	orange	2.4	QM
Exterior Room 002 Facade A									
009	-	Overhead Doo	Lft	Casing	D	Steel	grey	2.2	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/13/24	MIRA
Report Date:	8/16/2024	Warehouse Building Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/13/24 13:54	Hartford, CT
Total Readings:	18	
Job Started:	08/13/24 13:54	
Job Finished:	08/13/24 15:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade D									
010	-	Overhead Doo	-		D	Steel	grey	0.0	QM
012	-	Bollard	-		D	Steel	Yellow	-0.3	QM
011	-	Overhead Doo	Lft	Casing	D	Steel	orange	2.4	QM
004	-	Stairs	-	Stringers	D	Steel	Yellow	-0.3	QM
006	-	Stairs	-	Railings	D	Steel	Yellow	-0.1	QM
007	-	Stairs	-	Support	D	Steel	Yellow	-0.3	QM
005	-	Stairs	-	Risers	D	Steel	Yellow	-0.5	QM
Exterior Room 002 Facade A									
008	-	Overhead Doo	-		D	Steel	grey	-0.1	QM
009	-	Overhead Doo	Lft	Casing	D	Steel	grey	2.2	QM
Exterior Room 003 Facade C									
014	-	Window	-	Lft casing	D	Steel	grey	-0.3	QM
015	-	Window	Rgt	Lft casing	D	Steel	grey	-0.2	QM
013	-	Door	-	-	D	Steel	grey	0.1	QM
Calibration Readings									
001								1.2	TC
002								1.2	TC
003								1.2	TC
016								1.2	TC
017								1.2	TC
018								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 08/15/24 15:26

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/15/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number:

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Wheel Wash Building and Storage Garage
Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	08/15/24 15:26	Hartford, CT
Total Readings:	35 Actionable: 0	
Job Started:	08/15/24 15:26	
Job Finished:	08/15/24 15:26	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/15/24	MIRA
Report Date:	8/16/2024	Power Block Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	08/15/24 15:26	Hartford, CT
Total Readings:	35	
Job Started:	08/15/24 15:26	
Job Finished:	08/15/24 15:26	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 WW Ext									
012	-	Facade A	-		I	Steel	grey	0.0	QM
013	-	Facade B	-		I	Steel	grey	0.0	QM
014	-	Facade C	-		I	Steel	grey	0.0	QM
Exterior Room 002 SG Ext									
027	-	Facade A	-		I	Steel	red	0.0	QM
028	-	Facade B	-		I	Steel	red	0.0	QM
029	-	Facade C	-		I	Steel	red	0.0	QM
031	B	Overhead Doo	-		I	Steel	grey	0.0	QM
032	B	Overhead Doo	Lft	Casing	D	Steel	tan	0.0	QM
030	C	Window	-	Rgt casing	I	Steel	black	0.0	QM
Interior Room 001 Wheel Wash									
004	A	Wall	-		D	Steel	white	0.0	QM
008	A	Column	-		D	Steel	Silver	0.0	QM
011	B	Overhead Doo	Rgt	Casing	D	Steel	grey	0.0	QM
005	B	Wall	-		D	Steel	white	0.0	QM
006	C	Wall	-		D	Steel	white	0.0	QM
009	C	Door	-	-	D	Steel	grey	0.0	QM
010	C	Door	-	Lft casing	D	Steel	grey	0.0	QM
007	D	Wall	-		D	Steel	white	0.0	QM
Interior Room 002 Pump Rm									
019	A	Electric Mot	-	Casing	I	Steel	blue	0.0	QM
015	A	Wall	-		I	Steel	grey	0.0	QM
016	C	Wall	-		I	Steel	grey	0.0	QM
017	D	Door	-	-	D	Steel	white	0.0	QM
018	D	Door	-	Rgt casing	D	Steel	white	0.0	QM
Interior Room 003 Garage									
020	A	Wall	-		I	Steel	white	0.0	QM
023	B	Overhead Doo	-		I	Steel	grey	0.0	QM
024	B	Overhead Doo	Rgt	Casing	I	Steel	grey	0.0	QM
021	C	Wall	-		I	Steel	white	0.0	QM
025	C	Door	Rgt	-	D	Steel	red	0.0	QM
026	C	Door	Rgt	Rgt casing	D	Steel	red	0.0	QM
022	D	Wall	-		I	Steel	white	0.0	QM
Calibration Readings									
001								0.0	TC
002								0.0	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
003								0.0	TC
033								0.0	TC
034								0.0	TC
035								0.0	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 07/30/24 08:27

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Turbine Hall
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/30/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Turbine Hall - Lower Level

SIGNED: _____ **Date:** 8/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
6 South Main Street, Suite 5
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/30/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/30/24 08:27	Hartford, CT
Total Readings:	55 Actionable: 14	
Job Started:	07/30/24 08:27	
Job Finished:	07/30/24 15:58	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-56 EL-11									
051	-	I Beam	-		D	Steel	green	5.2	QM
017	-	Ceiling	Rgt		D	Concrete	Silver	1.1	TC
034	-	Column	Rt-		D	Steel	Green	3.3	QM
011	A	Cased Openin	-		D	Steel	green	7.3	QM
006	A	Stairs	-	Railings	D	Steel	blue	4.8	QM
007	A	Stairs	-	Stringers	D	Steel	blue	9.6	QM
010	A	Stairs	-	Support Leg	D	Steel	blue	7.1	QM
005	A	Stairs	-	Newel post	D	Steel	blue	>9.9	QM
009	A	Column	-		D	Steel	green	2.5	QM
020	B	Stairs	-	Stringers	D	Steel	green	5.3	QM
021	B	Stairs	-	Railings	D	Steel	green	9.5	QM
023	C	Column-8	Lft		D	Concrete	green	2.2	QM
024	C	Equipment	Lft	Foundation	D	Concrete	black	2.4	QM
049	D	Turbine-6	-	Casing	D	Steel	black	7.5	QM
Calibration Readings									
---- End of Readings ----									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/30/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/30/24 08:27	Hartford, CT
Total Readings:	55	
Job Started:	07/30/24 08:27	
Job Finished:	07/30/24 15:58	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-56 EL-11									
037	-	Superchanger	-	Casing	D	Steel	blue	-0.3	QM
041	-	Turbine-5	-	Plate	I	Steel	black	0.0	QM
050		Lube Oil Tan			D	Steel	red	0.2	QM
051	-	I Beam	-		D	Steel	green	5.2	QM
025	-	Phone Booth	Ctr	Shell	D	Steel	orange	-0.1	QM
027	-	Air Tank	Ctr		I	Steel	green	-0.4	QM
040	-	H2 Tank	Ctr		D	Steel	red	-0.3	QM
052	-	Sump	Ctr	Pipe	I	Steel	blue	-0.3	QM
017	-	Ceiling	Rgt		D	Concrete	Silver	1.1	TC
030	-	Stairs	Ctr	Stringers	I	Steel	blue	-0.1	QM
031	-	Stairs	Ctr	Railings	I	Steel	blue	-0.3	QM
032	-	Stairs	Ctr	Newel post	I	Steel	blue	-0.3	QM
034	-	Column	Ctr		D	Steel	Cream	3.3	QM
011	A	Cased Openin	-		D	Steel	green	7.3	QM
047	A	Ventilation	-	Duct	D	Steel	grey	0.0	QM
012	A	Tank	Rgt		D	Steel	Silver	-0.3	QM
013	A	Tank	Rgt	Support	D	Steel	Silver	-0.3	QM
014	A	Catwalk	Rgt	Framework	D	Steel	green	-0.3	QM
015	A	Tank	R-U		D	Steel	Silver	-0.4	QM
016	A	Tank	R-U	Support	D	Steel	Silver	-0.3	QM
004	A	Wall	-		I	Brick	Glazed	-0.1	QM
006	A	Stairs	-	Railings	D	Steel	blue	4.8	QM
007	A	Stairs	-	Stringers	D	Steel	blue	9.6	QM
010	A	Stairs		Support Leg	D	Steel	blue	7.1	QM
008	A	Stairs	-	Risers	D	Steel	blue	-0.4	QM
005	A	Stairs	-	Newel post	D	Steel	blue	>9.9	QM
009	A	Column	-		D	Steel	green	2.5	QM
048	A	Column	-		D	Concrete	white	0.0	QM
018	B	Pipe	Upper		D	Steel	Silver	-0.1	QM
019	B	Tank	-		D	Steel	Silver	-0.1	QM
020	B	Stairs	-	Stringers	D	Steel	green	5.3	QM
021	B	Stairs	-	Railings	D	Steel	green	9.5	QM
022	C	Fire Line	-		I	Steel	red	-0.2	QM
026	C	Joy Compress	-	Casing	D	Steel	blue	-0.1	QM
028	C	Gauge Cluste	-	Panel	D	Steel	green	-0.1	QM
029	C	Hayward	-	Casing	D	Steel	blue	-0.2	QM
033	C	Column-31	-		D	Steel	green	0.0	QM
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
036	C	Elevator	-	Door	D	Steel	Cream	-0.1	QM
023	C	Column-8	Lft		D	Concrete	green	2.2	QM
024	C	Equipment	Lft	Foundation	D	Concrete	black	2.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
039	C	Stairs	Rgt	Railings	D	Steel	Yellow	-0.1	QM
038	C	Stairs	Rgt	Wall	I	Steel	Cream	0.0	QM
043	D	Gear Oil Tan	-		D	Steel	white	-0.4	QM
040	D	Turbine 2		Casing	D	Steel	Black	7.5	QM
042	D	Wall	-		D	Concrete	white	0.3	QM
Calibration Readings									
001								1.3	TC
002								1.2	TC
003								1.1	TC
044								1.1	TC
045								1.0	TC
046								1.3	TC
053								1.2	TC
054								1.1	TC
055								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 07/31/24 08:23

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Turbine Hall
300 Maxim Road
Hartford, CT

INSPECTION DATE: 07/31/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Turbine Hall - Lower and Upper Level

SIGNED: _____ **Date:** 8/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.

Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/31/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/31/24 08:23	Hartford, CT
Total Readings:	63 Actionable: 12	
Job Started:	07/31/24 08:23	
Job Finished:	07/31/24 15:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-57 EL-25									
005	B	Door	-	Rgt casing	I	Steel	grey	7.0	QM
Interior Room 002 00-58 EL-25									
010	C	Stairs	-	Railings	D	Steel	blue	5.4	QM
007	C	Stairs	-	Newel post	D	Steel	blue	8.0	QM
Interior Room 004 00-60 EL-25									
016	C	Railing	-	Balusters	D	Steel	black	>9.9	QM
017	D	Door	-	Rgt casing	D	Steel	green	2.2	QM
Interior Room 006 1-63									
031	A	Turbine-6	-	Casing	I	Steel	blue	3.7	QM
028	B	Railing	-	Balusters	I	Steel	blue	5.0	QM
029	C	Turbine-6	-	Casing	I	Steel	blue	3.7	QM
026	D	Railing	-	Balusters	I	Steel	blue	1.9	QM
Interior Room 007 1-64									
047	-	Column	-		D	Steel	Cream	2.6	QM
044	B	Wall	-		D	Brick	Cream	3.7	QM
Interior Room 008 1-65									
052	C	Wall	-		I	Brick	Cream	2.5	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	07/31/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 07/31/24 08:23	Hartford, CT
Total Readings:	63	
Job Started:	07/31/24 08:23	
Job Finished:	07/31/24 15:53	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-57 EL-25									
005	B	Door	-	Rgt casing	I	Steel	grey	7.0	QM
004	C	Wall	- -		D	Concrete	white	-0.3	QM
Interior Room 002 00-58 EL-25									
006	B	Wall	- -		D	Concrete	grey	0.1	QM
008	C	Stairs	-	Stringers	D	Steel	blue	0.0	QM
010	C	Stairs	-	Railings	D	Steel	blue	5.4	QM
009	C	Stairs	-	Risers	D	Steel	blue	-0.3	QM
007	C	Stairs	-	Newel post	D	Steel	blue	8.0	QM
Interior Room 003 00 59 EL 25									
011	A	Tank	-		D	Steel	Silver	-0.4	QM
013	C	Wall	- -		D	Plaster	white	0.3	QM
012	D	Tank	-		D	Steel	black	-0.1	QM
Interior Room 004 00-60 EL-25									
014	-	Column	-		I	Steel	green	-0.3	QM
015	A	Railing	-	Balusters	I	Steel	green	0.2	QM
016	C	Railing	-	Balusters	D	Steel	black	>9.9	QM
018	D	Ebony Board	-		I	Panel	black	-0.3	QM
017	D	Door	-	Rgt casing	D	Steel	green	2.2	QM
Interior Room 005 00-62 EL-31									
019	A	Duct	-		I	Steel	Grey	0.1	QM
020	D	Railing	-	Balusters	I	Steel	green	0.0	QM
021	D	Column	-		D	Steel	green	-0.2	QM
Interior Room 006 1-63									
031	A	Turbine-6	-	Casing	I	Steel	blue	3.7	QM
034	A	Turbine-5	-	Casing	I	Steel	blue	-0.4	QM
037	A	Door	-	-	I	Steel	grey	-0.3	QM
038	A	Door	-	Lft casing	I	Steel	grey	-0.1	QM
025	A	Railing	-	Balusters	I	Steel	blue	0.1	QM
030	B	Turbine-6	-	Casing	I	Steel	blue	0.0	QM
035	B	Turbine-5	-	Casing	I	Steel	blue	-0.3	QM
039	B	Overhead Doo	-		I	Steel	grey	-0.2	QM
040	B	Overhead Doo	-	Casing	I	Steel	black	-0.2	QM
028	B	Railing	-	Balusters	I	Steel	blue	5.0	QM
029	C	Turbine-6	-	Casing	I	Steel	blue	3.7	QM
036	C	Turbine-5	-	Casing	I	Steel	blue	-0.4	QM
027	C	Railing	-	Balusters	I	Steel	blue	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
032	D	Turbine-6	-	Casing	I	Steel	blue	-0.3	QM
033	D	Turbine-5	-	Casing	I	Steel	blue	-0.4	QM
026	D	Railing	-	Balusters	I	Steel	blue	1.9	QM
Interior Room 007 1-64									
047	-	Column	-		D	Steel	Cream	2.6	QM
043	A	Wall	-		D	Brick	Cream	0.3	QM
044	B	Wall	-		D	Brick	Cream	3.7	QM
041	B	Door	-	-	D	Steel	grey	-0.1	QM
042	B	Door	-	Lft casing	D	Steel	Cream	-0.1	QM
045	C	Wall	-		D	CMU	Cream	-0.2	QM
046	D	Wall	-		D	CMU	Cream	-0.4	QM
048	D	Door	-	-	D	Steel	grey	-0.1	QM
049	D	Door	-	Lft casing	D	Steel	grey	0.0	QM
Interior Room 008 1-65									
056	-	Floor	-		D	Concrete	grey	-0.3	QM
057	-	Column	-		I	Steel	Cream	-0.1	QM
050	A	Wall			I	Brick	Cream	0.2	QM
059	A	Door	-	Header	I	Steel	Cream	-0.2	QM
060	A	Door	-	Lft casing	I	Steel	Cream	-0.1	QM
051	B	Wall	-		I	CMU	Cream	-0.2	QM
058	B	Window	-	Lft jamb	I	Steel	Cream	-0.1	QM
052	C	Wall	-		I	Brick	Cream	2.5	QM
053	D	Wall	-		I	Brick	Cream	0.1	QM
054	D	Door	-	-	I	Steel	Cream	-0.2	QM
055	D	Door	-	Lft casing	I	Steel	Cream	-0.1	QM
Calibration Readings									
001								1.1	TC
002								1.2	TC
003								1.1	TC
022								1.2	TC
023								1.2	TC
024								1.2	TC
061								1.2	TC
062								1.1	TC
063								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/01/24 08:30

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Power Block Facility - Turbine Hall
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/01/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/01/24 08:30	Hartford, CT
Total Readings:	34 Actionable: 2	
Job Started:	08/01/24 08:30	
Job Finished:	08/01/24 10:18	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-66									
007	D	Wall	-		I	Brick	Cream	3.2	QM
Interior Room 005 1-70									
026	B	Wall	-		I	Brick	blue	2.7	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/01/24	MIRA
Report Date:	8/2/2024	Power Block Facility - Turbine Hall
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/01/24 08:30	Hartford, CT
Total Readings:	34	
Job Started:	08/01/24 08:30	
Job Finished:	08/01/24 10:18	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-66									
004	A	Wall	-		I	CMU	Cream	0.0	QM
005	B	Wall	-		I	CMU	Cream	-0.4	QM
008	B	Door	-	-	I	Steel	Cream	0.0	QM
009	B	Door	-	Rgt casing	I	Steel	Cream	-0.1	QM
006	C	Wall	-		I	CMU	Cream	0.0	QM
007	D	Wall	-		I	Brick	Cream	3.2	QM
Interior Room 002 1-67									
010	A	Wall	-		I	CMU	Cream	-0.2	QM
012	A	Door	-	-	I	Steel	Cream	-0.1	QM
013	A	Door	-	Lft casing	I	Steel	Cream	-0.2	QM
011	C	Wall	-		I	Dry wall	Cream	-0.4	QM
Interior Room 003 1-68									
014	A	Wall	-		I	CMU	grey	-0.1	QM
015	B	Wall	-		I	Dry wall	Cream	-0.1	QM
017	B	Door	-	-	I	Steel	Cream	0.0	QM
018	B	Door	-	Rgt casing	I	Steel	Cream	-0.2	QM
016	D	Wall	-		I	Brick	grey	0.1	QM
Interior Room 004 1-69									
019	A	Wall	-		I	Dry wall	grey	-0.3	QM
023	A	Door	-	-	I	Steel	Cream	-0.2	QM
024	A	Door	-	Lft casing	I	Steel	Cream	-0.3	QM
020	B	Wall	-		I	Dry wall	grey	-0.4	QM
021	C	Wall	-		I	Brick	grey	0.2	QM
022	D	Wall	-		I	Dry wall	grey	-0.5	QM
Interior Room 005 1-70									
025	A	Wall	-		I	CMU	blue	-0.1	QM
026	B	Wall	-		I	Brick	blue	2.7	QM
027	C	Wall	-		I	Brick	blue	0.1	QM
028	D	Wall	-		I	Dry wall	blue	-0.2	QM
029	D	Door	-	-	I	Steel	Cream	-0.2	QM
030	D	Door	-	Lft casing	I	Steel	Cream	-0.3	QM
Interior Room 006 1-65									
031	-	Duct	-		I	Steel	Cream	-0.1	QM
Calibration Readings									
001								1.2	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
002								1.1	TC
003								1.1	TC
032								1.2	TC
033								1.1	TC
034								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: 08/14/24 08:24

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Jet Shop and Jet Turbine Power PACs
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/14/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Interiors and Exteriors

SIGNED: _____ **Date:** 8/16/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/14/24	MIRA
Report Date:	8/16/2024	NAES Jet Turbine Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/14/24 08:24	Hartford, CT
Total Readings:	157 Actionable: 8	
Job Started:	08/14/24 08:24	
Job Finished:	08/14/24 15:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
130	C	Door	-	-	I	Steel	blue	2.1	QM
131	C	Door	-	Rgt casing	I	Steel	blue	1.9	QM
Exterior Room 009 JT-12									
146	-	Facade A	-		I	Steel	blue	2.4	TC
148	-	Facade C	-		I	Steel	blue	1.8	TC
Exterior Room 010 JTC-12									
149	-	Facade A	-		I	Steel	white	1.0	TC
151	-	Facade C	-		I	Steel	white	1.7	TC
Interior Room 005 1-05									
043	-	Floor	-		I	Ceramic	grey	1.9	QM
Interior Room 006 2-06									
050	-	Floor	-		I	Ceramic	grey	1.7	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/14/24	MIRA
Report Date:	8/16/2024	NAES Jet Turbine Facility
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/14/24 08:24	Hartford, CT
Total Readings:	157	
Job Started:	08/14/24 08:24	
Job Finished:	08/14/24 15:33	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
099	-	N/A	-		I	Steel	blue	-0.2	QM
103	-	Bollard	-		D	Steel	Yellow	-0.4	QM
129	-	Facade A	-		I	Steel	blue	0.1	QM
102	-	Window	-	Lft casing	I	Steel	black	-0.3	QM
100	-	Door	-	-	I	Steel	white	-0.1	QM
101	-	Door	-	Lft casing	I	Steel	white	-0.2	QM
130	C	Door	-	-	I	Steel	blue	2.1	QM
131	C	Door	-	Rgt casing	I	Steel	blue	1.9	QM
Exterior Room 002 Facade B									
104	-	N/A	-		I	Steel	blue	0.1	QM
105	-	Overhead Doo	-		I	Steel	white	-0.3	QM
106	-	Overhead Doo	-	Casing	I	Steel	white	-0.2	QM
Exterior Room 003 Facade C									
107	-	Wall	U -		I	Metal	blue	-0.5	QM
109	-	Window	-	Lft casing	I	Metal	black	-0.5	QM
108	-	Door	-	Rgt casing	I	Metal	Lt Grey	-0.3	QM
Exterior Room 004 Facade D									
110	-	N/A	-		I	Steel	blue	0.0	QM
111	-	Overhead Doo	-		I	Steel	white	0.0	QM
112	-	Overhead Doo	-	Casing	I	Steel	Brown	-0.5	QM
115	-	Window	Rgt	Lft casing	I	Steel	black	-0.5	QM
113	-	Door	Rgt	-	I	Steel	Brown	-0.2	QM
114	-	Door	Rgt	Rgt casing	I	Steel	Brown	-0.5	QM
Exterior Room 005 JT-14									
132	-	Facade D	-		I	Steel	blue	-0.5	QM
133	A	Door	-	-	I	Steel	blue	0.1	QM
Exterior Room 006 JTC-14									
134	-	Facade A	-		I	Steel	white	-0.3	QM
135	-	Facade B	-		I	Steel	white	-0.3	QM
136	-	Facade C	-		I	Steel	white	-0.6	QM
137	-	Facade D	-		I	Steel	white	-0.4	QM
138	A	Door	-	-	I	Steel	white	-0.1	QM
139	A	Column	-		I	Steel	Yellow	-0.7	QM
Exterior Room 007 AC 14/13									
140	A	Wall	E -		I	Steel	blue	-0.5	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
141	B	Wall	E -		I	Steel	blue	-0.4	QM
142	C	Wall	E -		I	Steel	blue	-0.4	QM
143	D	Wall	E -		I	Steel	blue	-0.2	QM
Exterior Room 008 Fuel Sys									
144	-	Pipe	-		I	Steel	blue	-0.1	QM
145	-	Tank	-		I	Steel	blue	-0.1	QM
Exterior Room 009 JT-12									
146	-	Facade A	-		I	Steel	blue	2.4	TC
147	-	Facade B	-		I	Steel	blue	0.9	TC
148	-	Facade C	-		I	Steel	blue	1.8	TC
Exterior Room 010 JTC-12									
149	-	Facade A	-		I	Steel	white	1.0	TC
150	-	Facase B	-		I	Steel	white	0.6	TC
151	-	Facade C	-		I	Steel	white	1.7	TC
Interior Room 001 1-01									
004	A	Wall	- -		I	Dry wall	white	-0.1	QM
005	B	Wall	- -		I	Dry wall	white	-0.3	QM
012	B	Column	-		I	Steel	white	-0.6	QM
015	C	Work Bench	-		I	Steel	blue	-0.4	QM
006	C	Wall	- -		I	Dry wall	white	-0.1	QM
016	C	Door	-	-	I	Steel	black	0.0	QM
017	C	Door	-	Rgt casing	I	Steel	black	-0.2	QM
010	D	Overhead Doo	-		I	Steel	white	-0.2	QM
007	D	Wall	- -		I	Dry wall	white	-0.1	QM
013	D	Window	-	Rgt casing	I	Steel	black	-0.3	QM
014	D	Window	-	Sill	I	Steel	black	-0.8	QM
008	D	Door	-	-	I	Steel	black	-0.2	QM
009	D	Door	-	Lft casing	I	Steel	black	-0.3	QM
011	D	Column	-		I	Steel	white	-0.5	QM
Interior Room 002 1-02									
018	A	Wall	- -		I	Dry wall	grey	-0.3	QM
019	B	Wall	- -		I	Dry wall	grey	-0.5	QM
022	B	Door	-	-	I	Steel	grey	-0.2	QM
023	B	Door	-	Rgt casing	I	Steel	grey	-0.3	QM
020	C	Wall	- -		I	Dry wall	grey	-0.3	QM
021	D	Wall	- -		I	Dry wall	grey	-0.5	QM
Interior Room 003 1-03									
024	A	Wall	- -		I	Dry wall	white	-0.2	QM
025	B	Wall	- -		I	Dry wall	white	0.0	QM
026	C	Wall	- -		I	Dry wall	white	-0.3	QM
027	D	Wall	- -		I	Dry wall	white	-0.4	QM
029	D	Window	-	Rgt casing	I	Steel	black	-0.2	QM
030	D	Door	-	-	I	Steel	grey	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
031	D	Door	-	Rgt casing	I	Steel	grey	-0.1	QM
028	D	Column	-		I	Steel	white	-0.5	QM
Interior Room 004 1-04									
032	A	Wall	- -		I	Dry wall	white	-0.8	QM
036	B	Overhead Doo	-		I	Steel	white	-0.3	QM
033	B	Wall	- -		I	Dry wall	white	-0.2	QM
034	C	Wall	- -		I	Dry wall	white	-0.1	QM
037	C	Door	-	-	I	Steel	grey	-0.2	QM
038	C	Door	-	Lft casing	I	Steel	grey	-0.3	QM
035	D	Wall	- -		I	Dry wall	white	-0.3	QM
Interior Room 005 1-05									
043	-	Floor	-		I	Ceramic	grey	1.9	QM
039	A	Wall	- -		I	Dry wall	Cream	-0.4	QM
040	B	Wall	- -		I	Dry wall	Cream	-0.4	QM
041	C	Wall	- -		I	Dry wall	Cream	-0.4	QM
044	C	Door	-	-	I	Steel	grey	-0.2	QM
045	C	Door	-	Lft casing	I	Steel	grey	-0.2	QM
042	D	Wall	- -		I	Dry wall	Cream	-0.5	QM
Interior Room 006 2-06									
050	-	Floor	-		I	Ceramic	grey	1.7	QM
053	A	Pipe	-		I	Steel	grey	-0.7	QM
054	A	Shower	-	Stall	I	Steel	grey	-0.2	QM
046	A	Wall	- -		I	Dry wall	grey	-0.6	QM
051	A	Column	-		I	Steel	grey	-0.3	QM
047	B	Wall	- -		I	Dry wall	grey	-0.5	QM
055	C	Locker	-		I	Steel	grey	-0.1	QM
048	C	Wall	- -		I	Dry wall	grey	-0.3	QM
056	C	Door	-	-	I	Steel	grey	-0.2	QM
057	C	Door	-	Lft casing	I	Steel	grey	-0.1	QM
049	D	Wall	- -		I	Dry wall	grey	-0.1	QM
052	D	Window	-	Rgt casing	I	Steel	black	-0.4	QM
Interior Room 007 2-07									
058	A	Wall	- -		I	Dry wall	white	-0.3	QM
059	B	Wall	- -		I	Dry wall	white	-0.2	QM
060	C	Wall	- -		I	Dry wall	white	-0.1	QM
061	D	Wall	- -		I	Dry wall	white	-0.2	QM
062	D	Door	-	-	I	Steel	grey	0.0	QM
063	D	Door	-	Lft casing	I	Steel	grey	-0.1	QM
Interior Room 008 2-08									
064	A	Wall	- -		I	Dry wall	white	-0.2	QM
065	B	Wall	- -		I	Dry wall	white	-0.4	QM
066	C	Wall	- -		I	Dry wall	white	-0.3	QM
068	C	Door	-	-	I	Steel	blue	-0.1	QM
069	C	Door	-	Rgt casing	I	Steel	blue	-0.2	QM

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
067	D	Wall	- -		I	Dry wall	white	-0.5	QM
Interior Room 009 2-09									
073	-	Floor	-		D	Concrete	grey	-0.3	QM
076	-	Ceiling	-	I Beam	I	Steel	red	-0.3	QM
070	A	Wall	- -		I	Dry wall	white	0.0	QM
071	B	Wall	- -		I	Dry wall	white	-0.6	QM
075	C	Railings	-		I	Steel	Yellow	-0.4	QM
074	D	Shelving	-	Support	I	Steel	green	-0.3	QM
072	D	Wall	- -		I	Dry wall	white	-0.2	QM
Interior Room 010 Number Only									
077	B	Wall	U -		I	Dry wall	white	-0.6	QM
078	C	Wall	U -		I	Dry wall	white	-0.4	QM
079	D	Window	-	Casing	I	Metal	black	-0.4	QM
Interior Room 011 Number Only									
082	A	Wall	U -		I	Dry wall	white	-0.6	QM
081	D	Wall	U -		I	Dry wall	white	-0.1	QM
080	D	Window	-	Casing	I	Metal	black	-0.4	QM
Interior Room 012 Number Only									
083	B	Wall	U -		I	Dry wall	white	-0.3	QM
084	B	Door	-	Lft casing	I	Metal	blue	-0.2	QM
085	C	Door	-	U Ctr	I	Metal	blue	-0.1	QM
086	D	Wall	L -		I	Dry wall	white	-0.3	QM
Interior Room 013 st-1									
088	-	Stairs	-	Stringers	I	Metal	blue	-0.3	QM
090	-	Stairs	-	Railing	I	Metal	blue	-0.2	QM
089	-	Stairs	-	Treads	I	Metal	blue	-0.2	QM
091	-	Stairs	-	Risers	I	Metal	blue	-0.5	QM
087	D	Wall	L -		I	Dry wall	white	-0.4	QM
Interior Room 014 st-2									
092	-	Floor	-		I	Concrete	blue	-0.3	QM
094	-	Stairs	-	Stringers	I	Concrete	blue	-0.6	QM
095	-	Stairs	-	Railing	I	Concrete	blue	-0.4	QM
098	-	Stairs	-	bull nose	I	Concrete	blue	-0.4	QM
096	-	Stairs	-	Treads	I	Concrete	blue	-0.6	QM
093	-	Stairs	-	Risers	I	Concrete	blue	-0.3	QM
097	-	Stairs	-	Balusters	I	Concrete	blue	-0.3	QM
Interior Room 015 JT-14									
121	-	Turbine	-	Casing	I	Steel	green	-0.3	QM
124	-	Generator	-	Casing	I	Steel	grey	-0.1	QM
122	B	Wall	- -		I	Steel	black	-0.1	QM
125	C	Turbine	-	Support	D	Steel	grey	-0.2	QM
119	C	Wall	- -		I	Steel	Silver	0.0	QM

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
123	C	Door	-	-	I	Steel	grey	-0.2	QM
120	C	Column	-		I	Steel	Silver	-0.3	QM
Interior Room 016 JTC-14									
127	A	Door	-	-	I	Steel	grey	-0.2	QM
128	A	Door	-	Rgt casing	I	Steel	grey	-0.3	QM
126	D	Wall	-	-	I	Steel	grey	0.4	QM
Interior Room 017 JTC-12									
152	-	Wall	-		I	Steel	grey	0.0	QM
153	C	Door	-	-	I	Steel	grey	-0.3	QM
154	C	Door	-	Lft casing	I	Steel	grey	-0.7	QM
Calibration Readings									
001								1.1	TC
002								1.1	TC
003								1.2	TC
116								1.1	TC
117								1.1	TC
118								1.1	TC
155								1.1	TC
156								1.1	TC
157								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/01/24 10:18

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities (NU) Building
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/01/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/2/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/01/24	MIRA
Report Date:	8/2/2024	Northeast Utilities (NU) Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/01/24 10:18	Hartford, CT
Total Readings:	105 Actionable: 35	
Job Started:	08/01/24 10:18	
Job Finished:	08/01/24 16:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-01									
009	C	Door	-	-	D	Steel	green	>9.9	QM
007	D	Stairs	-	Stringers	D	Steel	green	6.3	QM
008	D	Stairs	-	Railings	D	Steel	green	6.0	QM
Interior Room 002 00-02									
013	-	Stairs	-	Stringers	D	Steel	green	9.3	QM
014	-	Stairs	-	Risers	D	Steel	green	4.6	QM
015	C	Column	-		D	Steel	green	2.5	QM
010	D	Wall	-		D	Concrete	green	1.6	QM
Interior Room 004 00-04									
023	A	Wall	-		D	Wood	Yellow	9.6	QM
Interior Room 005 0-05									
028	D	Door	-	-	D	Steel	grey	3.5	QM
Interior Room 006 0-06									
035	C	Conduit	-	Casing	D	Steel	green	2.7	QM
Interior Room 007 0-07									
068	B	Stairs	-	Stringers	D	Steel	white	4.9	QM
069	B	Stairs	-	Railings	D	Steel	white	>9.9	QM
070	B	Stairs	-	Newel post	D	Steel	white	9.0	QM
038	C	Wall	-		D	Plaster	white	2.1	QM
039	D	Wall	-		D	Plaster	white	1.9	QM
Interior Room 008 0-09									
047	D	Pipe	-		D	Steel	black	3.0	QM
Interior Room 009 0-10									
048	A	Wall	-		D	Plaster	white	3.1	QM
050	C	Wall	-		D	Plaster	white	1.9	QM
Interior Room 011 0-11									
067	B	Pipe	-		D	Steel	white	3.3	QM
Interior Room 012 1-13									
071	A	Wall	Lower		I	Ceramic	white	>9.9	QM
074	B	Wall	Lower		I	Ceramic	white	>9.9	QM
079	B	Door	-	-	D	Steel	white	6.8	QM

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
080	B	Door	-	Lft casing	D	Steel	white	8.9	QM
081	B	Stairs	-	Stringers	D	Steel	white	7.2	QM
082	B	Stairs	-	Railings	D	Steel	white	3.2	QM
083	B	Stairs	-	Newel post	D	Steel	white	5.4	QM
076	C	Wall	Lower		I	Ceramic	white	>9.9	QM
078	D	Wall	Lower		I	Ceramic	white	>9.9	QM
Interior Room 015 1-17									
093	A	Wall	-		D	Plaster	Cream	4.5	QM
094	B	Wall	-		D	Plaster	Cream	5.3	QM
095	C	Wall	-		D	Plaster	Cream	3.6	QM
100	C	Door	Rgt	-	D	Steel	Cream	>9.9	QM
102	C	Door	Rgt	Window Case	D	Steel	Cream	>9.9	QM
101	C	Door	Rgt	Rgt casing	D	Steel	Cream	>9.9	QM
096	D	Wall	-		D	Plaster	Cream	6.4	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/01/24	MIRA
Report Date:	8/2/2024	Northeast Utilities (NU) Building
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/01/24 10:18	Hartford, CT
Total Readings:	105	
Job Started:	08/01/24 10:18	
Job Finished:	08/01/24 16:01	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 00-01									
005	A	Wall	-		D	Concrete	white	0.1	QM
004	B	Oil Tank	-		D	Steel	green	-0.2	QM
006	B	Wall	-		D	Concrete	white	0.0	QM
009	C	Door	-	-	D	Steel	green	>9.9	QM
007	D	Stairs	-	Stringers	D	Steel	green	6.3	QM
008	D	Stairs	-	Railings	D	Steel	green	6.0	QM
Interior Room 002 00-02									
013	-	Stairs	-	Stringers	D	Steel	green	9.3	QM
014	-	Stairs	-	Risers	D	Steel	green	4.6	QM
012	-	Column	Lft		D	Concrete	green	0.4	QM
016	A	Pipe	-		D	Steel	green	-0.1	QM
017	B	Door	-	-	I	Wood	Varnish	0.0	QM
018	B	Door	-	Lft casing	I	Wood	Varnish	-0.1	QM
011	C	Wall	-		D	Concrete	green	0.4	QM
015	C	Column	-		D	Steel	green	2.5	QM
010	D	Wall	-		D	Concrete	green	1.6	QM
Interior Room 003 00-03									
021	B	Wall	-		I	Concrete	Cream	0.0	QM
020	C	Wall	-		I	Concrete	Cream	-0.1	QM
019	D	Wall	-		I	Concrete	Cream	-0.2	QM
Interior Room 004 00-04									
023	A	Wall	-		D	Wood	Yellow	9.6	QM
022	B	Wall	-		D	Concrete	white	-0.2	QM
Interior Room 005 0-05									
029	A	Window	-	Lft casing	D	Steel	black	0.2	QM
026	B	Wall	Upper		D	Concrete	white	0.2	QM
024	B	Wall	Lower		D	Concrete	green	0.0	QM
027	C	Wall	Upper		D	Concrete	white	-0.2	QM
025	C	Wall	Lower		D	Concrete	green	0.0	QM
028	D	Door	-	-	D	Steel	grey	3.5	QM
Interior Room 006 0-06									
030	A	Wall	Lower		D	Concrete	green	0.4	QM
033	A	Door	-	-	D	Steel	grey	-0.1	QM
034	A	Door	-	Rgt casing	D	Steel	grey	-0.2	QM
031	B	Wall	Lower		D	Concrete	green	0.2	QM
035	C	Conduit	-	Casing	D	Steel	green	2.7	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
032	D	Stairs	-	Stringers	D	Steel	blue	-0.3	QM
Interior Room 007 0-07									
036	A	Wall	-		D	Plaster	white	0.2	QM
037	B	Wall	-		D	Plaster	white	-0.2	QM
068	B	Stairs	-	Stringers	D	Steel	white	4.9	QM
069	B	Stairs	-	Railings	D	Steel	white	>9.9	QM
070	B	Stairs	-	Newel post	D	Steel	white	9.0	QM
038	C	Wall	-		D	Plaster	white	2.1	QM
039	D	Wall	-		D	Plaster	white	1.9	QM
040	D	Door	-	-	D	Steel	grey	-0.1	QM
041	D	Door	-	Rgt casing	D	Steel	grey	-0.2	QM
Interior Room 008 0-09									
042	A	Wall	-		D	Plaster	white	-0.1	QM
043	B	Wall	-		D	Plaster	white	-0.1	QM
044	C	Wall	-		D	Plaster	white	0.1	QM
045	C	Door	-	-	D	Wood	white	-0.2	QM
046	C	Door	-	Lft casing	D	Wood	white	0.1	QM
047	D	Pipe	-		D	Steel	black	3.0	QM
Interior Room 009 0-10									
048	A	Wall	-		D	Plaster	white	3.1	QM
049	B	Wall	-		D	Plaster	white	0.1	QM
051	B	Window	-	Lft casing	D	Steel	black	-0.6	QM
050	C	Wall	-		D	Plaster	white	1.9	QM
052	C	Door	-	-	D	Steel	white	-0.2	QM
053	C	Door	-	Lft casing	D	Steel	white	-0.1	QM
Interior Room 010 0-12									
054	A	Wall	-		D	Plaster	white	-0.1	QM
055	B	Wall	-		D	Plaster	white	-0.1	QM
056	C	Wall	-		D	Plaster	white	-0.2	QM
057	D	Wall	-		D	Plaster	white	0.1	QM
058	D	Door	-	-	D	Steel	white	-0.3	QM
059	D	Door	-	Rgt casing	D	Steel	white	-0.2	QM
Interior Room 011 0-11									
060	A	Wall	-		D	Plaster	white	0.5	QM
067	B	Pipe	-		D	Steel	white	3.3	QM
061	B	Wall	-		D	Plaster	white	0.0	QM
066	B	Window	-	Lft casing	I	Steel	black	-0.6	QM
062	C	Wall	-		D	Plaster	white	-0.1	QM
063	D	Wall	-		D	Plaster	white	0.4	QM
064	D	Door	-	-	D	Steel	white	-0.3	QM
065	D	Door	-	Lft casing	D	Steel	white	-0.3	QM
Interior Room 012 1-13									
072	A	Wall	Upper		I	Plaster	white	0.3	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
071	A	Wall	Lower		I	Ceramic	white	>9.9	QM
073	B	Wall	Upper		I	Plaster	white	0.1	QM
074	B	Wall	Lower		I	Ceramic	white	>9.9	QM
079	B	Door	-	-	D	Steel	white	6.8	QM
080	B	Door	-	Lft casing	D	Steel	white	8.9	QM
081	B	Stairs	-	Stringers	D	Steel	white	7.2	QM
082	B	Stairs	-	Railings	D	Steel	white	3.2	QM
083	B	Stairs	-	Newel post	D	Steel	white	5.4	QM
075	C	Wall	Upper		I	Plaster	white	-0.1	QM
076	C	Wall	Lower		I	Ceramic	white	>9.9	QM
084	C	Door	-	-	D	Steel	white	-0.2	QM
085	C	Door	-	Lft casing	D	Steel	white	-0.3	QM
077	D	Wall	Upper		I	Plaster	white	0.3	QM
078	D	Wall	Lower		I	Ceramic	white	>9.9	QM
Interior Room 013 1-16									
086	A	Wall	-		D	Dry wall	white	-0.2	QM
087	B	Wall	-		D	Plaster	white	0.3	QM
088	C	Wall	-		D	Dry wall	white	-0.3	QM
090	C	Door	-	-	D	Wood	white	0.0	QM
091	C	Door	-	Rgt casing	D	Wood	white	0.2	QM
089	D	Wall	-		D	Dry wall	white	-0.7	QM
Interior Room 014 1-15									
092	-	Floor	-		D	Steel	blue	0.6	QM
Interior Room 015 1-17									
097	A	Radiator	-		D	Wood	Cream	-0.5	QM
098	A	Chair Rail	-		D	Wood	Cream	-0.1	QM
093	A	Wall	-		D	Plaster	Cream	4.5	QM
099	A	Window	-	Rgt casing	D	Steel	black	-0.2	QM
094	B	Wall	-		D	Plaster	Cream	5.3	QM
095	C	Wall	-		D	Plaster	Cream	3.6	QM
100	C	Door	Rgt	-	D	Steel	Cream	>9.9	QM
102	C	Door	Rgt	Window Case	D	Steel	Cream	>9.9	QM
101	C	Door	Rgt	Rgt casing	D	Steel	Cream	>9.9	QM
096	D	Wall	-		D	Plaster	Cream	6.4	QM
Calibration Readings									
001								1.1	TC
002								1.2	TC
003								1.1	TC
103								1.2	TC
104								1.1	TC
105								1.1	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/05/24 08:24

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities Building Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/05/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/9/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/05/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/05/24 08:24	Hartford, CT
Total Readings:	114 Actionable: 37	
Job Started:	08/05/24 08:24	
Job Finished:	08/05/24 16:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-18									
004	B	Door	-	-	D	Steel	green	8.9	QM
005	B	Door	-	Rgt casing	D	Steel	green	8.7	QM
Interior Room 002 1-19									
020	A	Door	-	Rgt casing	D	Steel	black	8.0	QM
013	B	Door	-	-	D	Steel	green	6.5	QM
Interior Room 004 1-20									
026	C	Wall	Lower		D	Concrete	green	3.3	QM
027	D	Wall	Lower		D	Concrete	green	1.8	QM
028	D	Door	-	-	D	Steel	green	>9.9	QM
Interior Room 007 1-24									
040	A	Wall	-		D	Brick	Cream	1.7	QM
044	A	Door	-	-	D	Steel	black	>9.9	QM
045	A	Door	-	Rgt casing	D	Steel	black	6.3	QM
041	B	Wall	-		D	Brick	Cream	3.7	QM
047	D	Door	-	Rgt casing	D	Steel	Cream	5.5	QM
Interior Room 009 1-27									
062	-	HVAC	-	Casing	D	Steel	Cream	3.4	QM
068	-	HVAC	-	Duct	D	Steel	Silver	2.6	QM
069	-	HVAC	-	Duct	D	Steel	Cream	3.6	QM
057	A	Wall	-		D	Plaster	Cream	2.7	QM
064	B	Door	-	Lft casing	D	Steel	green	5.1	QM
065	C	Cased Openin	-		D	Steel	Cream	3.5	QM
060	C	Wall	-		D	Concrete	Cream	1.8	QM
Interior Room 010 1-28									
087	A	HVAC	Upper	Duct	D	Steel	white	2.7	QM
086	A	HVAC	Lower	Duct	D	Steel	green	4.8	QM
070	B	Wall	Lower		D	Brick	green	1.8	QM
084	B	Door	Lft	-	D	Steel	green	>9.9	QM
085	B	Door	Lft	Rgt casing	D	Steel	green	3.3	QM
083	B	Door	Rgt	Rgt casing	D	Steel	green	3.5	QM
072	C	Wall	Lower		D	Brick	green	3.1	QM
074	D	Wall	Lower		D	Brick	green	2.0	QM
079	D	Door	Rgt	Lft casing	D	Steel	grey	6.4	QM
Interior Room 012 ST-03									

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
092	D	Stairs	-	Stringers	D	Steel	green	>9.9	QM
093	D	Stairs	-	Railings	D	Steel	green	4.0	QM
Interior Room 013 ST-02									
096	-	Stairs	-	Stringers	D	Steel	green	8.9	QM
098	-	Stairs	-	Railings	D	Steel	green	8.0	QM
097	-	Stairs	-	Risers	D	Steel	green	>9.9	QM
094	A	Wall	Lower		D	Brick	green	1.8	QM
104	C	Wall	Lower		D	Brick	green	2.4	QM
102	D	Wall	Lower		D	Brick	green	3.1	QM
Interior Room 014 3-34									
111	D	Wall	Under		I	Plaster	white	1.5	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/05/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/05/24 08:24	Hartford, CT
Total Readings:	114	
Job Started:	08/05/24 08:24	
Job Finished:	08/05/24 16:05	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 1-18									
006	A	Wall	Upper		D	Concrete	white	0.0	QM
007	A	Wall	Lower		D	Concrete	green	0.7	TC
008	B	Wall	-		D	Brick	green	0.2	QM
004	B	Door	-	-	D	Steel	green	8.9	QM
005	B	Door	-	Rgt casing	D	Steel	green	8.7	QM
009	D	Wall	Upper		D	Concrete	white	-0.5	QM
010	D	Wall	Lower		D	Concrete	green	0.2	QM
Interior Room 002 1-19									
021	-	Stall	-		I	Concrete	white	-0.5	QM
022	-	Door	-	-	D	Steel	blue	-0.1	QM
023	-	Door	-	Lft casing	D	Steel	blue	0.2	QM
011	A	Wall	-		D	Concrete	green	0.9	TC
019	A	Door	-	-	D	Steel	grey	0.2	QM
020	A	Door	-	Rgt casing	D	Steel	black	8.0	QM
012	B	Wall	-		D	Concrete	green	0.3	QM
013	B	Door	-	-	D	Steel	green	6.5	QM
014	B	Door	-	Lft casing	D	Steel	green	-0.1	QM
016	C	Wall	Upper		D	Brick	white	0.3	QM
015	C	Wall	Lower		D	Brick	green	0.3	QM
018	D	Wall	Upper		D	Brick	white	0.3	QM
017	D	Wall	Lower		D	Brick	green	0.5	QM
Interior Room 004 1-20									
024	A	Wall	Lower		D	Concrete	green	0.1	QM
025	B	Wall	Lower		D	Concrete	green	0.2	QM
026	C	Wall	Lower		D	Concrete	green	3.3	QM
030	D	Wall	Upper		D	Concrete	white	0.1	QM
027	D	Wall	Lower		D	Concrete	green	1.8	QM
028	D	Door	-	-	D	Steel	green	>9.9	QM
029	D	Door	-	Lft casing	D	Steel	green	-0.3	QM
Interior Room 005 1-21									
031	A	Wall	-		D	Concrete	green	0.1	QM
032	B	Wall	-		D	Concrete	green	0.0	QM
033	C	Wall	-		D	Concrete	green	-0.3	QM
034	D	Door	-	-	D	Steel	grey	0.5	QM
035	D	Door	-	Lft casing	D	Steel	grey	0.5	QM
Interior Room 006 1-23									
038	B	Door	-	-	D	Steel	grey	-0.1	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
039	B	Door	-	Lft casing	D	Steel	grey	-0.1	QM
036	C	Wall	-		D	Concrete	green	0.0	QM
037	D	Wall	-		D	Brick	green	-0.1	QM
Interior Room 007 1-24									
040	A	Wall	-		D	Brick	Cream	1.7	QM
044	A	Door	-	-	D	Steel	black	>9.9	QM
045	A	Door	-	Rgt casing	D	Steel	black	6.3	QM
041	B	Wall	-		D	Brick	Cream	3.7	QM
048	C	Stall	-		D	Concrete	Cream	-0.2	QM
042	C	Wall	-		D	Brick	Cream	0.2	QM
043	D	Wall	-		D	Brick	Cream	0.3	QM
046	D	Door	-	-	D	Steel	Cream	0.4	QM
047	D	Door	-	Rgt casing	D	Steel	Cream	5.5	QM
Interior Room 008 1-25									
053	-	Support	-	Leg	D	Steel	Yellow	0.2	QM
054	-	Railing	-	-	D	Steel	Yellow	-0.3	QM
052	C	Wall	-		I	Concrete	red	-0.3	QM
055	D	Door	-	-	D	Steel	grey	-0.2	QM
056	D	Door	-	Rgt casing	D	Steel	grey	-0.2	QM
Interior Room 009 1-27									
062	-	HVAC	-	Casing	D	Steel	Cream	3.4	QM
068	-	HVAC	-	Duct	D	Steel	Silver	2.6	QM
069	-	HVAC	-	Duct	D	Steel	Cream	3.6	QM
057	A	Wall	-		D	Plaster	Cream	2.7	QM
059	B	Wall	Upper		D	Concrete	white	-0.1	QM
058	B	Wall	Lower		D	Concrete	green	0.8	TC
063	B	Door	-	-	D	Steel	green	-0.2	QM
064	B	Door	-	Lft casing	D	Steel	green	5.1	QM
065	C	Cased Openin	-		D	Steel	Cream	3.5	QM
060	C	Wall	-		D	Concrete	Cream	1.8	QM
061	D	Wall	-		D	Brick	Cream	0.3	QM
066	D	Door	-	-	D	Steel	Cream	-0.1	QM
067	D	Door	-	Lft casing	D	Steel	Cream	0.2	QM
Interior Room 010 1-28									
087	A	HVAC	Upper	Duct	D	Steel	white	2.7	QM
086	A	HVAC	Lower	Duct	D	Steel	green	4.8	QM
071	B	Wall	Upper		D	Brick	white	0.3	QM
070	B	Wall	Lower		D	Brick	green	1.8	QM
084	B	Door	Lft	-	D	Steel	green	>9.9	QM
085	B	Door	Lft	Rgt casing	D	Steel	green	3.3	QM
082	B	Door	Rgt	-	D	Steel	green	0.1	QM
083	B	Door	Rgt	Rgt casing	D	Steel	green	3.5	QM
080	C	HVAC	Rgt	Duct	I	Steel	grey	-0.5	QM
081	C	HVAC	Rgt	Support	I	Steel	grey	-0.3	QM
073	C	Wall	Upper		D	Brick	white	0.2	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
072	C	Wall	Lower		D	Brick	green	3.1	QM
075	D	Wall	Upper		D	Brick	white	-0.1	QM
074	D	Wall	Lower		D	Brick	green	2.0	QM
076	D	Door	Lft	-	D	Steel	grey	-0.5	QM
077	D	Door	Lft	Lft casing	D	Steel	grey	-0.3	QM
078	D	Door	Rgt	-	D	Steel	red	0.1	QM
079	D	Door	Rgt	Lft casing	D	Steel	grey	6.4	QM
Interior Room 011 1-30									
090	B	Door	-	Header	I	Steel	Cream	0.0	QM
091	B	Door	-	Lft casing	I	Steel	grey	0.0	QM
089	C	Conduit	-	Casing	I	Steel	black	-0.2	QM
088	D	Door	-	Lft casing	D	Steel	green	0.0	QM
Interior Room 012 ST-03									
092	D	Stairs	-	Stringers	D	Steel	green	>9.9	QM
093	D	Stairs	-	Railings	D	Steel	green	4.0	QM
Interior Room 013 ST-02									
096	-	Stairs	-	Stringers	D	Steel	green	8.9	QM
098	-	Stairs	-	Railings	D	Steel	green	8.0	QM
097	-	Stairs	-	Risers	D	Steel	green	>9.9	QM
095	A	Wall	Upper		D	Brick	white	0.4	QM
094	A	Wall	Lower		D	Brick	green	1.8	QM
101	B	Radiator	-		D	Steel	Silver	-0.2	QM
105	C	Wall	Upper		D	Brick	white	0.5	QM
104	C	Wall	Lower		D	Brick	green	2.4	QM
099	C	Door	-	-	I	Steel	blue	-0.2	QM
100	C	Door	-	Rgt casing	I	Steel	blue	0.0	QM
103	D	Wall	Upper		D	Brick	white	0.1	QM
102	D	Wall	Lower		D	Brick	green	3.1	QM
Interior Room 014 3-34									
106	A	Wall	-		I	Dry wall	white	-0.1	QM
107	B	Wall	-		I	Dry wall	white	-0.2	QM
110	B	Window	-	Rgt casing	I	Steel	black	-0.6	QM
108	C	Wall	-		I	Dry wall	white	0.2	QM
109	D	Wall	-		I	Dry wall	white	-0.1	QM
111	D	Wall	Under		I	Plaster	white	1.5	QM
Calibration Readings									
001								1.0	TC
002								1.2	TC
003								1.1	TC
049								1.2	TC
050								1.2	TC
051								1.1	TC
112								1.3	TC
113								1.1	TC

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
114								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/06/24 08:40

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities Building Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/06/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/9/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/06/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/06/24 08:40	Hartford, CT
Total Readings:	137 Actionable: 35	
Job Started:	08/06/24 08:40	
Job Finished:	08/06/24 16:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 2-31									
008	-	Railing	Ctr	Balusters	D	Steel	white	6.9	QM
009	C	Stairs	-	Stringers	D	Steel	white	3.5	QM
012	C	Stairs	-	Railing	D	Steel	white	8.9	QM
010	C	Stairs	-	Risers	D	Steel	white	9.3	QM
011	C	Stairs	-	Balusters	D	Steel	white	9.4	QM
Interior Room 003 2-32									
024	A	Door	-	-	D	Steel	green	9.3	QM
027	B	Door	-	-	D	Steel	white	8.6	QM
028	B	Door	-	Lft casing	D	Steel	white	>9.9	QM
Interior Room 004 3-35									
033	B	Stairs	-	Stringers	D	Steel	white	5.3	QM
036	B	Stairs	-	Railings	D	Steel	white	4.1	QM
035	B	Stairs	-	Risers	D	Steel	black	8.1	QM
034	B	Stairs	-	Newel post	D	Steel	white	7.1	QM
Interior Room 007 3-36									
052	B	Wall	Lower		D	Brick	green	2.1	QM
062	B	Door	-	-	D	Steel	green	6.4	QM
063	B	Door	-	Lft casing	D	Steel	green	8.3	QM
057	D	Door	-	-	D	Steel	green	>9.9	QM
058	D	Door	-	Lft casing	D	Steel	green	8.8	QM
Interior Room 009 3-37									
065	A	Wall	Lower		D	Concrete	green	1.7	QM
074	D	Door	-	Lft casing	I	Steel	green	3.7	QM
Interior Room 010 2-39									
080	B	Wall	Lower		D	Brick	green	2.2	QM
082	B	Door	-	Lft casing	I	Steel	grey	4.8	QM
084	C	Wall	Lower		D	Brick	green	3.4	QM
Interior Room 012 4-41									
100	C	Stairs	-	Stringers	D	Steel	white	3.8	QM
102	C	Stairs	-	Railings	D	Steel	white	5.4	QM
101	C	Stairs	-	Risers	D	Steel	white	5.1	QM
099	C	Stairs	-	Balusters	D	Steel	white	7.9	QM
Interior Room 014 4-43									

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
111	D	Door	-	-	D	Steel	white	5.7	QM
112	D	Door	-	Rgt casing	D	Steel	white	>9.9	QM
Interior Room 015 4-44									
121	B	Fire Door	-		D	Steel	green	>9.9	QM
122	B	Door	-	-	D	Steel	green	6.9	QM
123	B	Door	-	Lft casing	D	Steel	green	8.1	QM
127	C	Closet	-	Door Casing	D	Steel	black	>9.9	QM
124	D	Fire Door	-		D	Steel	green	>9.9	QM
125	D	Door	-	-	D	Steel	green	>9.9	QM
126	D	Door	-	Lft casing	D	Steel	green	>9.9	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/06/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/06/24 08:40	Hartford, CT
Total Readings:	137	
Job Started:	08/06/24 08:40	
Job Finished:	08/06/24 16:13	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 2-31									
016	-	Ceiling	-		I	Plaster	white	0.3	QM
008	-	Railing	Ctr	Balusters	D	Steel	white	6.9	QM
004	A	Wall	-		I	Plaster	white	0.4	QM
005	B	Wall	-		I	Plaster	white	0.3	QM
014	B	Window	-	Sill	D	Wood	white	-0.2	QM
013	B	Window	-	Lft casing	I	Steel	black	-0.8	QM
006	C	Wall	-		I	Plaster	white	0.3	QM
009	C	Stairs	-	Stringers	D	Steel	white	3.5	QM
012	C	Stairs	-	Railing	D	Steel	white	8.9	QM
010	C	Stairs	-	Risers	D	Steel	white	9.3	QM
011	C	Stairs	-	Balusters	D	Steel	white	9.4	QM
015	D	Radiator	-		D	Steel	white	-0.5	QM
007	D	Wall	-		I	Plaster	white	0.3	QM
Interior Room 002 2-33									
017	A	Wall	-		D	Plaster	blue	-0.1	QM
018	B	Wall	-		D	Plaster	blue	0.3	QM
019	C	Wall	-		D	Plaster	blue	-0.1	QM
022	C	Door	-	-	D	Wood	Varnish	-0.4	QM
023	C	Door	-	Rgt casing	D	Wood	Varnish	-0.2	QM
020	D	Wall	-		D	Plaster	blue	0.0	QM
021	D	Ceiling	-		D	Plaster	blue	0.2	QM
Interior Room 003 2-32									
024	A	Door	-	-	D	Steel	green	9.3	QM
025	A	Door	-	Rgt casing	D	Steel	green	-0.3	QM
026	B	Wall	-		D	Steel	green	0.1	QM
027	B	Door	-	-	D	Steel	white	8.6	QM
028	B	Door	-	Lft casing	D	Steel	white	>9.9	QM
Interior Room 004 3-35									
029	A	Wall	-		D	Plaster	white	0.4	QM
030	B	Wall	-		D	Plaster	white	0.3	QM
033	B	Stairs	-	Stringers	D	Steel	white	5.3	QM
036	B	Stairs	-	Railings	D	Steel	white	4.1	QM
035	B	Stairs	-	Risers	D	Steel	black	8.1	QM
034	B	Stairs	-	Newel post	D	Steel	white	7.1	QM
031	C	Wall	-		D	Plaster	white	-0.1	QM
032	D	Wall	-		D	Plaster	white	0.2	QM
Interior Room 005 3-37									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
037	A	Wall	-		D	Plaster	Cream	0.1	QM
038	B	Wall	-		D	Dry wall	Cream	-0.4	QM
040	C	Door	-	-	I	Wood	Varnish	-0.2	QM
041	C	Door	-	Lft casing	I	Wood	Varnish	-0.3	QM
039	D	Wall	-		D	Dry wall	Cream	-0.1	QM
Interior Room 006 3-38									
042	A	Wall	-		I	Plaster	Cream	-0.1	QM
043	B	Wall	-		I	Plaster	Cream	-0.2	QM
046	B	Window	-	Rgt casing	I	Steel	black	0.4	QM
047	B	Window	-	Sill	I	Wood	Cream	-0.2	QM
044	C	Wall	-		I	Plaster	Cream	0.1	QM
045	D	Wall	-		I	Plaster	Cream	-0.1	QM
Interior Room 007 3-36									
055	-	Stall	Ctr		D	Concrete	white	-0.2	QM
056	-	Stall	Ctr		D	Concrete	green	0.4	QM
049	A	Wall	Upper		D	Brick	white	-0.1	QM
050	A	Wall	Lower		D	Brick	green	0.5	QM
051	B	Wall	Upper		D	Brick	white	0.2	QM
052	B	Wall	Lower		D	Brick	green	2.1	QM
062	B	Door	-	-	D	Steel	green	6.4	QM
063	B	Door	-	Lft casing	D	Steel	green	8.3	QM
053	C	Wall	Upper		D	Brick	white	-0.2	QM
054	C	Wall	Lower		D	Brick	green	0.5	QM
061	D	HVAC	-	Duct	I	Steel	Cream	0.0	QM
059	D	Wall	Upper		D	Brick	white	-0.1	QM
060	D	Wall	Lower		D	Brick	green	0.4	QM
057	D	Door	-	-	D	Steel	green	>9.9	QM
058	D	Door	-	Lft casing	D	Steel	green	8.8	QM
Interior Room 008 3-34									
048	-	Ceiling	-		D	Plaster	white	0.5	QM
Interior Room 009 3-37									
064	A	Wall	Upper		D	Concrete	white	0.0	QM
065	A	Wall	Lower		D	Concrete	green	1.7	QM
072	B	HVAC	-	Duct	D	Steel	Cream	-0.1	QM
066	B	Wall	Upper		D	Brick	white	0.4	QM
067	B	Wall	Lower		D	Brick	green	0.3	QM
070	B	Door	-	-	I	Steel	green	0.2	QM
071	B	Door	-	Rgt casing	I	Steel	green	-0.3	QM
068	C	Wall	Upper		D	Concrete	white	-0.1	QM
069	C	Wall	Lower		D	Concrete	green	0.1	QM
073	D	Door	-	-	I	Steel	green	0.4	QM
074	D	Door	-	Lft casing	I	Steel	green	3.7	QM
Interior Room 010 2-39									
078	A	Wall	Upper		D	Brick	white	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
079	B	Wall	Upper		D	Brick	white	0.1	QM
080	B	Wall	Lower		D	Brick	green	2.2	QM
081	B	Door	-	-	I	Steel	grey	0.1	QM
082	B	Door	-	Lft casing	I	Steel	grey	4.8	QM
083	C	Wall	Upper		D	Brick	white	0.3	QM
084	C	Wall	Lower		D	Brick	green	3.4	QM
087	D	Door	Lft	-	D	Steel	white	-0.5	QM
088	D	Door	Lft	Lft casing	D	Steel	Silver	-0.1	QM
085	D	Door	Rgt	-	I	Steel	Yellow	-0.3	QM
086	D	Door	Rgt	Lft casing	I	Steel	Yellow	-0.2	QM
Interior Room 011 4-40									
089	A	Wall	-		I	Dry wall	white	0.0	QM
090	B	Wall	-		I	Dry wall	white	-0.3	QM
091	C	Wall	-		I	Dry wall	white	-0.1	QM
092	D	Wall	-		I	Dry wall	white	-0.2	QM
093	D	Door	-	-	I	Wood	Varnish	-0.5	QM
094	D	Door	-	Lft casing	I	Wood	Varnish	-0.1	QM
Interior Room 012 4-41									
095	A	Wall	-		I	Plaster	white	0.4	QM
096	B	Wall	-		I	Plaster	white	0.5	QM
097	C	Wall	-		I	Plaster	white	0.1	QM
100	C	Stairs	-	Stringers	D	Steel	white	3.8	QM
102	C	Stairs	-	Railings	D	Steel	white	5.4	QM
101	C	Stairs	-	Risers	D	Steel	white	5.1	QM
099	C	Stairs	-	Balusters	D	Steel	white	7.9	QM
098	D	Wall	-		I	Plaster	white	0.5	QM
Interior Room 013 4-42									
103	A	Wall	-		I	Plaster	white	-0.2	QM
104	B	Wall	-		I	Plaster	white	-0.4	QM
105	C	Wall	-		I	Plaster	white	-0.1	QM
106	D	Wall	-		I	Plaster	white	0.0	QM
Interior Room 014 4-43									
107	A	Wall	-		I	Plaster	white	0.3	QM
108	B	Wall	-		I	Plaster	white	0.4	QM
109	C	Wall	-		I	Plaster	white	-0.1	QM
113	C	Door	-	-	I	Wood	Varnish	-0.5	QM
114	C	Door	-	Lft casing	I	Wood	Varnish	0.1	QM
110	D	Wall	-		I	Plaster	white	0.3	QM
111	D	Door	-	-	D	Steel	white	5.7	QM
112	D	Door	-	Rgt casing	D	Steel	white	>9.9	QM
Interior Room 015 4-44									
131	-	Stall	Ctr		I	Concrete	white	-0.2	QM
132	-	Stall	Ctr	Door	I	Wood	black	-0.2	QM
134	-	Switchgear	Ctr		I	Steel	black	-0.6	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
115	A	Wall	Upper		D	Brick	white	-0.1	QM
116	A	Wall	Lower		D	Brick	green	0.2	QM
133	A	Window	Ctr	Sash	D	Steel	black	-0.3	QM
121	B	Fire Door	-		D	Steel	green	>9.9	QM
117	B	Wall	Upper		D	Brick	white	0.0	QM
118	B	Wall	Lower		D	Brick	green	0.3	QM
122	B	Door	-	-	D	Steel	green	6.9	QM
123	B	Door	-	Lft casing	D	Steel	green	8.1	QM
119	C	Wall	Upper		D	Brick	white	0.1	QM
120	C	Wall	Lower		D	Brick	green	0.4	QM
127	C	Closet	-	Door Casing	D	Steel	black	>9.9	QM
130	C	Closet	-	Wall	D	Plaster	white	0.3	QM
129	C	Closet	-	Shelf Sup.	D	Wood	Varnish	-0.1	QM
128	C	Closet	-	Shelf	D	Wood	Varnish	-0.2	QM
124	D	Fire Door	-		D	Steel	green	>9.9	QM
125	D	Door	-	-	D	Steel	green	>9.9	QM
126	D	Door	-	Lft casing	D	Steel	green	>9.9	QM

Calibration Readings		
001	1.2	TC
002	1.1	TC
003	1.1	TC
075	1.1	TC
076	1.0	TC
077	1.1	TC
135	1.3	TC
136	1.2	TC
137	1.3	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/07/24 08:32

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities Building Interiors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/07/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ **Date:** 8/9/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/07/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/07/24 08:32	Hartford, CT
Total Readings:	148 Actionable: 41	
Job Started:	08/07/24 08:32	
Job Finished:	08/07/24 16:10	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 4-47									
011	D	Wall	Lower		D	Concrete	green	2.6	QM
013	D	Door	Lft	Rgt casing	I	Steel	green	3.8	QM
Interior Room 002 4-48									
027	A	Pipe	Ctr		D	Steel	green	7.4	QM
015	A	Wall	Lower		D	Brick	green	3.2	QM
026	A	Window	Ctr	Sash	D	Steel	black	6.2	QM
017	B	Wall	Lower		D	Brick	green	3.1	QM
029	B	Door	-	Lft casing	I	Steel	blue	5.6	QM
019	C	Wall	Lower		D	Brick	green	2.2	QM
021	D	Wall	Lower		D	Brick	green	2.1	QM
023	D	Door	Lft	Rgt casing	I	Steel	grey	8.2	QM
025	D	Door	Rgt	Lft casing	I	Steel	grey	6.1	QM
Interior Room 005 5-52									
046	C	Wall	Lower		D	Plaster	green	2.1	QM
Interior Room 009 5-56									
069	A	Window	-	Sill	D	Concrete	white	2.1	QM
073	C	Door	-	-	D	Steel	white	6.6	QM
074	C	Door	-	Lft casing	D	Steel	white	6.6	QM
Interior Room 010 5-57									
097	-	Control Pane	Lft	Rear Frame	I	Steel	black	3.6	QM
079	A	Wall	Upper		D	Plaster	white	2.1	QM
080	A	Wall	Lower		I	Ceramic	blue	>9.9	QM
089	A	Door	-	-	D	Steel	Cream	5.5	QM
090	A	Door	-	Rgt casing	D	Steel	Cream	7.9	QM
082	C	Wall	Upper		D	Plaster	white	1.5	QM
083	C	Wall	Lower		I	Ceramic	blue	>9.9	QM
092	C	Window	Rgt	Rgt casing	D	Steel	Cream	7.2	QM
086	D	Wall	Lower		I	Ceramic	blue	>9.9	QM
087	D	Door	-	-	D	Steel	Cream	8.3	QM
088	D	Door	-	Lft casing	D	Steel	Cream	9.7	QM
Interior Room 012 5-59									
127	-	HVAC	Ctr	Duct	D	Steel	white	3.9	QM
126	D	Door	Lft	Rgt casing	D	Steel	green	>9.9	QM
122	D	Stairs	-	Stringers	D	Steel	green	7.6	QM
124	D	Stairs	-	Railings	D	Steel	green	7.7	QM

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
123	D	Stairs	-	Risers	D	Steel	green	6.4	QM
Interior Room 013 ST-01									
133	-	Stairs	-	Stringers	D	Steel	white	4.1	QM
132	-	Stairs	-	Risers	D	Steel	white	3.4	QM
131	-	Stairs	-	Newel post	D	Steel	white	>9.9	QM
Interior Room 014 ST-02									
136	-	Stairs	-	Stringers	D	Steel	green	>9.9	QM
138	-	Stairs	-	Railings	D	Steel	green	>9.9	QM
137	-	Stairs	-	Risers	D	Steel	green	>9.9	QM
Interior Room 015 ST-03									
142	C	Wall	-		D	Brick	Tan	1.9	QM
143	C	Stairs	-	Stringers	D	Steel	green	9.6	QM
145	C	Stairs	-	Railings	D	Steel	green	4.2	QM
144	C	Stairs	-	Risers	D	Steel	green	6.7	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/07/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Interiors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/07/24 08:32	Hartford, CT
Total Readings:	148	
Job Started:	08/07/24 08:32	
Job Finished:	08/07/24 16:10	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Interior Room 001 4-47									
004	A	Wall	Upper		D	Brick	white	-0.1	QM
005	A	Wall	Lower		D	Brick	green	0.4	QM
006	B	Wall	Upper		D	Brick	white	0.2	QM
007	B	Wall	Lower		D	Brick	green	0.1	QM
008	C	Wall	Upper		D	Brick	white	0.1	QM
009	C	Wall	Lower		D	Brick	green	0.2	QM
010	D	Wall	Upper		D	Concrete	white	0.4	QM
011	D	Wall	Lower		D	Concrete	green	2.6	QM
012	D	Door	Lft	-	I	Steel	green	0.4	QM
013	D	Door	Lft	Rgt casing	I	Steel	green	3.8	QM
Interior Room 002 4-48									
027	A	Pipe	Ctr		D	Steel	green	7.4	QM
014	A	Wall	Upper		D	Brick	white	0.2	QM
015	A	Wall	Lower		D	Brick	green	3.2	QM
026	A	Window	Ctr	Sash	D	Steel	black	6.2	QM
016	B	Wall	Upper		D	Brick	white	0.0	QM
017	B	Wall	Lower		D	Brick	green	3.1	QM
028	B	Door	-	-	I	Steel	blue	0.0	QM
029	B	Door	-	Lft casing	I	Steel	blue	5.6	QM
018	C	Wall	Upper		D	Brick	white	0.1	QM
019	C	Wall	Lower		D	Brick	green	2.2	QM
020	D	Wall	Upper		D	Brick	white	0.3	QM
021	D	Wall	Lower		D	Brick	green	2.1	QM
022	D	Door	Lft	-	I	Steel	grey	-0.4	QM
023	D	Door	Lft	Rgt casing	I	Steel	grey	8.2	QM
024	D	Door	Rgt	-	I	Steel	grey	-0.1	QM
025	D	Door	Rgt	Lft casing	I	Steel	grey	6.1	QM
Interior Room 003 5-50									
030	A	Wall	-		D	Plaster	white	0.4	QM
031	B	Wall	-		D	Plaster	white	0.3	QM
032	C	Wall	-		D	Plaster	white	0.2	QM
034	C	Window	-	Casing	D	Wood	white	-0.3	QM
035	C	Door	-	-	D	Wood	white	-0.3	QM
036	C	Door	-	Lft casing	D	Wood	white	0.1	QM
033	D	Wall	-		D	Plaster	white	0.5	QM
Interior Room 004 5-51									
037	A	Wall	-		I	Wood	Varnish	-0.3	QM
038	B	Wall	-		D	Plaster	white	0.4	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
039	C	Wall	-		D	Plaster	white	0.2	QM
040	D	Wall	-		D	Plaster	white	0.0	QM
Interior Room 005 5-52									
041	A	Wall	Upper		D	Plaster	white	0.2	QM
042	A	Wall	Lower		D	Plaster	green	0.3	QM
043	B	Wall	Upper		D	Plaster	white	0.1	QM
044	B	Wall	Lower		D	Plaster	green	0.4	QM
045	C	Wall	Upper		D	Plaster	white	0.5	QM
046	C	Wall	Lower		D	Plaster	green	2.1	QM
049	D	Cased Openin	-		D	Wood	green	-0.7	QM
047	D	Wall	Upper		D	Plaster	white	-0.2	QM
048	D	Wall	Lower		D	Plaster	green	-0.8	QM
Interior Room 006 5-53									
050	B	Wall	-		I	Steel	tan	-0.1	QM
051	C	Wall	-		I	Steel	tan	0.1	QM
052	D	Wall	-		I	Steel	tan	-0.1	QM
053	D	Door	-	-	I	Steel	tan	0.2	QM
054	D	Door	-	Rgt casing	I	Steel	tan	0.1	QM
Interior Room 007 5-54									
058	-	Floor	-		I	Concrete	grey	-0.3	QM
059	A	Radiator	-		D	Steel	grey	-0.3	QM
055	A	Wall	-		D	Brick	white	0.0	QM
056	B	Wall	-		I	Wood	Varnish	-0.1	QM
057	C	Wall	-		I	Steel	tan	-0.2	QM
Interior Room 008 5-55									
061	-	Floor	-		D	Concrete	blue	-0.6	QM
060	B	Wall	-		D	Plaster	white	-0.2	QM
Interior Room 009 5-56									
066	-	Floor	-		D	Concrete	grey	-0.1	QM
062	A	Wall	-		D	Plaster	white	0.4	QM
065	A	Wall	-		D	Brick	white	-0.3	QM
070	A	Wall	-		D	Brick	white	0.1	QM
067	A	Window	-	Sash	D	Steel	black	0.2	QM
069	A	Window	-	Sill	D	Concrete	white	2.1	QM
068	C	Conduit	-		I	Steel	white	-0.9	QM
075	C	Electric Pan	-		D	Steel	tan	-0.3	QM
063	C	Wall	-		D	Plaster	white	-0.1	QM
073	C	Door	-	-	D	Steel	white	6.6	QM
074	C	Door	-	Lft casing	D	Steel	white	6.6	QM
064	D	Wall	-		D	Plaster	white	-0.2	QM
071	D	Door	-	-	I	Steel	white	-0.2	QM
072	D	Door	-	Lft casing	I	Steel	white	-0.1	QM
Interior Room 010 5-57									

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
099	-	Control Pane	-	Support	I	Steel	blue	0.1	QM
097	-	Control Pane	Lft	Rear Frame	I	Steel	black	3.6	QM
095	-	Control Pane	Ctr	Top	I	Ebony	black	-0.6	QM
096	-	Control Pane	Ctr	Frame	I	Steel	black	-0.3	QM
079	A	Wall	Upper		D	Plaster	white	2.1	QM
080	A	Wall	Lower		I	Ceramic	blue	>9.9	QM
089	A	Door	-	-	D	Steel	Cream	5.5	QM
090	A	Door	-	Rgt casing	D	Steel	Cream	7.9	QM
100	B	Control Pane	-	Door	D	Steel	black	-0.3	QM
081	B	Wall	-		D	Plaster	white	0.3	QM
093	B	Door	-	-	D	Steel	Cream	0.1	QM
094	B	Door	-	Lft casing	D	Steel	Cream	0.1	QM
098	C	Radiator	-		I	Steel	Cream	-0.1	QM
091	C	Panel	Rgt		D	Steel	Cream	-0.2	QM
082	C	Wall	Upper		D	Plaster	white	1.5	QM
084	C	Wall	-	Baseboard	I	Ceramic	black	-0.4	QM
083	C	Wall	Lower		I	Ceramic	blue	>9.9	QM
092	C	Window	Rgt	Rgt casing	D	Steel	Cream	7.2	QM
101	D	Control Pane	-	Door	D	Steel	black	-0.3	QM
085	D	Wall	Upper		D	Plaster	white	0.2	QM
086	D	Wall	Lower		I	Ceramic	blue	>9.9	QM
087	D	Door	-	-	D	Steel	Cream	8.3	QM
088	D	Door	-	Lft casing	D	Steel	Cream	9.7	QM
Interior Room 011 5-58									
113	-	Floor	-		D	Wood	red	-0.1	QM
110	A	Radiator	-		I	Steel	white	-0.2	QM
102	A	Wall	-		D	Brick	white	0.3	QM
111	A	Window	-	Rgt casing	D	Steel	Cream	0.1	QM
112	B	Conduit	-		I	Steel	white	-0.4	QM
103	B	Wall	-		D	Brick	white	0.1	QM
108	B	Door	-	-	I	Steel	white	-0.1	QM
109	B	Door	-	Rgt casing	I	Steel	white	-0.1	QM
104	C	Wall	-		I	Wood	Cream	-0.3	QM
105	D	Wall	-		I	Dry wall	Cream	-0.1	QM
106	D	Door	-	-	I	Steel	Cream	0.0	QM
107	D	Door	-	Rgt casing	I	Steel	Cream	-0.2	QM
Interior Room 012 5-59									
127	-	HVAC	Ctr	Duct	D	Steel	white	3.9	QM
114	A	Wall	Upper		D	Brick	white	0.3	QM
115	A	Wall	Lower		D	Brick	green	0.2	QM
116	A	Window	-	Rgt casing	D	Steel	black	0.1	QM
117	B	Wall	Upper		D	Panel	white	-0.3	QM
118	B	Wall	Lower		D	Panel	green	0.2	QM
128	B	Door	-	-	D	Wood	green	0.3	QM
129	B	Door	-	Rgt casing	D	Wood	green	0.2	QM
119	C	Wall	Upper		D	Brick	white	-0.2	QM
120	C	Wall	Lower		D	Brick	green	0.0	QM

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
121	D	Wall	Upper		D	Brick	white	0.2	QM
125	D	Door	Lft	-	I	Steel	grey	0.0	QM
126	D	Door	Lft	Rgt casing	D	Steel	green	>9.9	QM
122	D	Stairs	-	Stringers	D	Steel	green	7.6	QM
124	D	Stairs	-	Railings	D	Steel	green	7.7	QM
123	D	Stairs	-	Risers	D	Steel	green	6.4	QM
Interior Room 013 ST-01									
133	-	Stairs	-	Stringers	D	Steel	white	4.1	QM
132	-	Stairs	-	Risers	D	Steel	white	3.4	QM
131	-	Stairs	-	Newel post	D	Steel	white	>9.9	QM
130	B	Wall	-		I	Plaster	white	0.5	QM
Interior Room 014 ST-02									
136	-	Stairs	-	Stringers	D	Steel	green	>9.9	QM
138	-	Stairs	-	Railings	D	Steel	green	>9.9	QM
137	-	Stairs	-	Risers	D	Steel	green	>9.9	QM
139	A	Radiator	-		D	Steel	Silver	-0.1	QM
140	D	Pipe	-		D	Steel	green	-0.1	QM
134	D	Wall	Upper		D	Brick	white	0.5	QM
135	D	Wall	Lower		D	Brick	green	0.2	QM
Interior Room 015 ST-03									
141	A	Wall	-		I	Concrete	Tan	0.0	QM
142	C	Wall	-		D	Brick	Tan	1.9	QM
143	C	Stairs	-	Stringers	D	Steel	green	9.6	QM
145	C	Stairs	-	Railings	D	Steel	green	4.2	QM
144	C	Stairs	-	Risers	D	Steel	green	6.7	QM
Calibration Readings									
001								1.2	TC
002								1.1	TC
003								1.1	TC
076								1.3	TC
077								1.2	TC
078								1.2	TC
146								1.2	TC
147								1.2	TC
148								1.2	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/08/24 08:40

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities Building Exteriors
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/08/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm²

OPERATOR LICENSE: 002291

Lead-Based Paint Screen

SIGNED: _____ Date: 8/9/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/08/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/08/24 08:40	Hartford, CT
Total Readings:	15 Actionable: 2	
Job Started:	08/08/24 08:40	
Job Finished:	08/08/24 11:38	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm^2)	Mode
Exterior Room 002 Facade B									
011	-	Foundation	-		D	Concrete	white	6.7	QM
012	-	Belt Course	-		D	Concrete	white	>9.9	QM

Calibration Readings

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/08/24	MIRA
Report Date:	8/9/2024	Northeast Utilities Building Exteriors
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/08/24 08:40	Hartford, CT
Total Readings:	15	
Job Started:	08/08/24 08:40	
Job Finished:	08/08/24 11:38	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 Facade A									
004	-	Foundation	-		D	Concrete	white	0.0	QM
009	-	Window	Ctr	Rgt casing	D	Steel	grey	-0.4	QM
010	-	Window	Ctr	Sill	D	Concrete	white	0.2	QM
007	-	Door	Ctr	-	D	Steel	grey	0.0	QM
008	-	Door	Ctr	Lft casing	D	Steel	grey	-0.1	QM
005	-	Door	Rgt	-	D	Steel	Brown	-0.2	QM
006	-	Door	Rgt	Lft casing	D	Steel	Brown	0.0	QM
Exterior Room 002 Facade B									
011	-	Foundation	-		D	Concrete	white	6.7	QM
012	-	Belt Course	-		D	Concrete	white	>9.9	QM
Calibration Readings									
001								1.2	TC
002								1.1	TC
003								1.2	TC
013								1.1	TC
014								1.3	TC
015								0.8	TC

---- End of Readings ----

LEAD PAINT INSPECTION REPORT

REPORT NUMBER: S#02753 - 08/27/24 11:20

INSPECTION FOR: Mr. Robert J. Carr, PE, LEP
Weston & Sampson
712 Brook Street, Suite 103
Rocky Hill, CT 06067

PERFORMED AT: MIRA
Northeast Utilities Building Roofs
300 Maxim Road
Hartford, CT

INSPECTION DATE: 08/27/24

INSTRUMENT TYPE: R M D
MODEL LPA-1
XRF TYPE ANALYZER
Serial Number: 02753

ACTION LEVEL: 1.0 mg/cm^2

OPERATOR LICENSE: 002291

Lead-Based Paint Screen
Northeast Utilities Building Roofs 5-7

SIGNED: _____ **Date:** 8/28/24

Nicholas Mussen
Lead Inspector
Eagle Environmental, Inc.
8 South Main Street, Suite 3
Terryville, CT 06786

SUMMARY REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Northeast Utilities Building Roofs
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 11:20	Hartford, CT
Total Readings:	35 Actionable: 9	
Job Started:	08/27/24 11:20	
Job Finished:	08/27/24 14:11	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 NU RF-5									
007	A	Penthouse	-	Wall	D	Concrete	white	7.2	QM
020	A	Penthouse	-	Vent	D	Steel	grey	2.3	QM
023	A	Penthouse	Rgt	Door Casing	D	Steel	grey	4.0	QM
008	B	Penthouse	-	Wall	D	Concrete	white	5.9	QM
009	C	Penthouse	-	Wall	D	Concrete	white	4.8	QM
006	D	Penthouse	-	Wall	D	Concrete	white	1.6	QM
019	D	Penthouse	Rgt	Door Casing	D	Steel	grey	3.1	QM
Exterior Room 002 NU RF-7									
030	B	Door	Rgt	Rgt casing	D	Steel	grey	2.8	QM
027	C	Vent Stack	-		D	Steel	grey	7.0	QM
Calibration Readings									

---- End of Readings ----

DETAILED REPORT OF LEAD PAINT INSPECTION FOR: Mr. Robert J. Carr, PE, LEP

Inspection Date:	08/27/24	MIRA
Report Date:	8/28/2024	Northeast Utilities Building Roofs
Abatement Level:	1.0	300 Maxim Road
Report No.	S#02753 - 08/27/24 11:20	Hartford, CT
Total Readings:	35	
Job Started:	08/27/24 11:20	
Job Finished:	08/27/24 14:11	

Reading No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Color	Lead (mg/cm²)	Mode
Exterior Room 001 NU RF-5									
004	-	Sky Light	-	Casing	D	Steel	Gold	0.4	QM
005	-	Pipe	-		D	Steel	Yellow	-0.3	QM
014	-	Exhaust Vent	-		D	Steel	blue	-0.7	QM
015	-	Capped Vent	-		D	Steel	blue	-0.9	QM
016	-	Peaked Roof	-		D	Steel	Brown	-0.1	QM
007	A	Penthouse	-	Wall	D	Concrete	white	7.2	QM
020	A	Penthouse	-	Vent	D	Steel	grey	2.3	QM
021	A	A/C Condense	-	Casing	D	Steel	Brown	-0.2	QM
022	A	Penthouse	-	Door	D	Steel	grey	-0.3	QM
023	A	Penthouse	Rgt	Door Casing	D	Steel	grey	4.0	QM
010	A	Wall	P -		D	Concrete	green	-0.1	QM
024	A	Wall	P -	Flashing	D	Steel	Brown	0.0	QM
008	B	Penthouse	-	Wall	D	Concrete	white	5.9	QM
011	B	Wall	P -		D	Concrete	green	0.1	QM
009	C	Penthouse	-	Wall	D	Concrete	white	4.8	QM
006	D	Penthouse	-	Wall	D	Concrete	white	1.6	QM
017	D	Penthouse	-	Window	D	Steel	grey	-0.3	QM
018	D	Penthouse	-	Door	D	Steel	grey	-0.3	QM
019	D	Penthouse	Rgt	Door Casing	D	Steel	grey	3.1	QM
012	D	Wall	P -		D	Concrete	green	-0.1	QM
013	D	Wall	P -	Ladder	D	Steel	green	-0.1	QM
Exterior Room 002 NU RF-7									
025	A	Wall	P -		D	Concrete	white	0.1	QM
026	A	Wall	P -	Flashing	D	Steel	Brown	0.3	QM
028	B	Vent	-		D	Steel	grey	-0.2	QM
031	B	Door	Lft	-	D	Steel	grey	-0.2	QM
032	B	Door	Lft	Rgt casing	D	Steel	grey	-0.3	QM
029	B	Door	Rgt	-	D	Steel	grey	-0.1	QM
030	B	Door	Rgt	Rgt casing	D	Steel	grey	2.8	QM
027	C	Vent Stack	-		D	Steel	grey	7.0	QM
Calibration Readings									
001								1.2	TC
002								1.1	TC
003								1.2	TC
033								1.4	TC
034								1.2	TC
035								1.2	TC

---- End of Readings ----